Heritage at **Risk**



Midlands Register 2023

Contents

CriteriaIIIRutland (UA)82Key statisticsVIHerefordshire, County of (UA)83Key to the EntriesVIIShropshire (UA)93Entries on the Register by local planning authorityIXStaffordshire107Derby, City of (UA)ILichfield08Derbyshire2South Staffordshire110Amber Valley2Staffordshire111Bolsover4Staffordshire111Derbyshire2South Staffordshire111Dotsover4Staffordshire Moorlands112Chesterfield5Tamworth114Derbyshire Dales6Stoke on-Trent, City of (UA)117High Peak8Telford and Wrekin (UA)117North East Derbyshire11Nuneaton and Bedworth121Leicester, City of (UA)14Rugby121Leicester, City of (UA)14Rugby121Leicester, City of (UA)14Rugby121Leicestershire16Wearwickshire118Paktonugh19Wearwick126Charnwood16Wearwick126Charnwood16Wearwick138Lincolnshire25Dudley136Oadby and Wigston26Sandwell138Lincolnshire36Bromsgrove141East Lindsey28Worcesterrine141Baston26Walall140Boston<	The Register		Rushcliffe	81
Key tatistics VI Shropshire (UA) 93 Key to the Entries VI Shropshire (UA) 93 Entries on the Register by local planning authority X Staffordshire 107 Derby, City of (UA) I Lichfield 108 Derbyshire 2 South Staffordshire 111 Bolsover 4 Stafford 111 Bolsover 4 Staffordshire 111 Chesterfield 5 Tamworth 114 Derbyshire Dales 6 Stoke on-Trent, City of (UA) 117 High Peak 8 Telford and Wrekin (UA) 117 North East Derbyshire 11 Nuncaton and Bedworth 121 Leicester, City of (UA) 14 Rugby 121 Leicester, City of (UA) 14 Rugby 121 Leicester, City of (UA) 14 Rugby 121 Leicestershire 16 Warwickshire 118 North West Leicestershire 25 Dudley 134 North West Licestershire 26 Sandwell 138 <td< td=""><td>-</td><td>111</td><td>Rutland (UA)</td><td>82</td></td<>	-	111	Rutland (UA)	82
Key to the EntriesVIIShropshire (UA)93Entries on the Register by local planning authorityZStaffordshire107Derby, City of (UA)INewcastle-under-Lyme109Derbyshire2Stafford Shire110Amber Valley2Stafford Shire111Bolsover4Stafford Shire111Chesterfield5Tamworth114Derbyshire Dales6Stotke-on-Trent, City of (UA)117High Peak8Telford and Wrekin (UA)117North East Derbyshire9Warwickshire118Peak District (NP)10North Warwickshire118South Derbyshire11Nuneaton and Bedworth121Leicestershire16Warwick126Harborough19Warwick126Harborough19Birmingham129Hinckley and Bosworth21Birmingham129Hinckley and Bosworth21Birmingham129Hinckley and Bosworth21Birmingham129Hinckley and Wigston26Sandwell138Ducloshire26Solihull139Lincoln36Worcestershire14Lincoln36Worcestershire14Lincoln36South Holland14Kesteven38Bromsgrove141Lincoln36Morestershire152North Kesteven48Bromsgrove143North			Herefordshire, County of (UA)	83
Entries on the Register by local planning authorityXxStaffordshire107Derby, City of (UA)IEast Staffordshire107Derby, City of (UA)INewcastle-under-Lyme109Derbyshire2South Staffordshire111Bolsover4Staffordshire Moorlands112Chesterfield5Tarnworth114Derbyshire Dales6Stoke-on-Trent, City of (UA)114Derbyshire Dales6Stoke-on-Trent, City of (UA)117High Peak8Telford and Wrekin (UA)117North East Derbyshire9Warwickshire118Peak District (NP)10North Warwickshire118South Derbyshire11Nuneaton and Bedworth121Leicester, City of (UA)14Rugby121Leicestershire16Warwick126Charnwood16West Midlands129Harborough19Birmingham129Helton22Coventry134North West Leicestershire25Dudley136Oadby and Wigston26Sandwell138South Holland42Malvern Hills145South Kesteven44Redditch147West North Kesteven43Browsgrove143North Kesteven44Redditch147West Northamptonshire (UA)57North Lincolnshire (UA)57North Lincolnshire (UA)57Wyre Forest152		VII	Shropshire (UA)	93
Derbyshire2South StaffordShire109Amber Valley2Stafford111Bolsover4StaffordShire112Chesterfield5Tarmworth114Derbyshire Dales6Stoke-on-Trent, City of (UA)114Erewash7Telford and Wrekin (UA)117High Peak8Telford and Wrekin (UA)117North East Derbyshire9Warwickshire118Peak District (NP)10North Warwickshire118South Derbyshire11Nuneaton and Bedworth121Leicester, City of (UA)14Rugby121Leicestershire16Warwick126Charnwood16West Midlands129Hinckley and Bosworth21Birmingham129Helton22Coventry134North West Leicestershire25Dudley136Oadby and Wigston26Sandwell138Lincolnshire26Solihull139Juncoln36Wolverhampton, City of141East Lindsey28Worcestershire143North Kesteven38Bromsgrove143South Kesteven38Bromsgrove143South Kesteven44Redditch147West Lincolnshire (UA)52Wyre Forest152North Lest Lincolnshire (UA)53Wyre Forest152North Angtonshire69Bassetlaw69Broxtowe74 </td <td>Entries on the Register by local planning authority</td> <td>IX</td> <td>East Staffordshire</td> <td>107</td>	Entries on the Register by local planning authority	IX	East Staffordshire	107
Amber Valley2Stafford111Bolsover4StaffordShire Moorlands112Chesterfield5Tarworth114Derbyshire Dales6Stoke-on-Trent, City of (UA)114Erewash7Telford and Wrekin (UA)117High Peak8Telford and Wrekin (UA)117North East Derbyshire9Warwickshire118Peak District (NP)10North Warwickshire118South Derbyshire11Nuneaton and Bedworth121Leicester, City of (UA)14Rugby121Leicester, City of (UA)14Rugby121Leicestershire16Warwick126Charnwood16Warwick126Harborough19Birmingham129Hinckley and Bosworth21Birmingham129Metton22Coventry134North West Leicestershire25Dudley136Oadby and Wigston26Solihull139Lincolnshire26Wolverhampton, City of141East Lindsey38Bromsgrove143South Helland42Malvern Hills145South Kesteven38Bromsgrove143South Kesteven38Bromsgrove143North Kesteven48Bredditch147West Lincolnshire (UA)52Wychavon148North Last Lincolnshire (UA)53Wyre Forest152North Last Lincoln		1	1	
Bolsover4Staffordshire Moorlands112Chesterfield5Tarnworth114Derbyshire Dales6Stoke-on-Trent, City of (UA)117High Peak8Telford and Wrekin (UA)117North East Derbyshire9Warwickshire118Peak District (NP)10North Warwickshire118South Derbyshire11Nuneaton and Bedworth121Leicester, City of (UA)14Rugby121Leicestershire16Warwick126Charnwood16Warwick126Harborough19West Midlands129Hinckley and Bosworth21Birmingham129Hinckley and Bosworth21Birmingham129Melton22Coventry136Oadby and Wigston26Sandwell138Lincolnshire26Solihuil139Lincolnshire26Solihuil141Boston26Sonihuil140Boston26Solihuil141Lincoln36Bromsgrove143North Kesteven38Bromsgrove143North Kesteven44Redditch147West Lincolnshire (UA)52Wyre Forest152North Lincolnshire (UA)53Wyre Forest152North Northamptonshire (UA)63Nottingham, City of (UA)64North Incolnshire (UA)53Wyre Forest152North Intonhamptonshire (UA) <td>Derbyshire</td> <td></td> <td></td> <td></td>	Derbyshire			
Chesterfield5Tanworth114Derbyshire Dales6Stoke-on-Trent, City of (UA)114Erewash7Telford and Wrekin (UA)117High Peak8Telford and Wrekin (UA)117North East Derbyshire9Warwickshire118Peak District (NP)10North Warwickshire118South Derbyshire11Nuneaton and Bedworth121Leicester, City of (UA)14Rugby121Leicester, City of (UA)14Rugby121Leicestershire16Stratford-on-Avon123Charnwood16West Midlands129Hinckley and Bosworth21Birmingham129Hinckley and Bosworth21Birmingham129Melton22Coventry134North West Leicestershire25Dudley136Oadby and Wigston26Sandwell138Doston26Solihull139Lincolnshire26Solihull139Korth Kesteven38Bromsgrove143North Kesteven38Bromsgrove143North Kesteven44Redditch147West Lindsey47Worcester Mire147West Lindsey47Wychavon148North Kesteven44Redditch147West Lindsey53Wyre Forest152North Kesteven48Wyre Forest152North Northamptonshire (UA)53 <td>,</td> <td></td> <td></td> <td></td>	,			
Derbyshire Dales 6 Stoke-on-Trent, City of (UA) 114 Erewash 7 Telford and Wrekin (UA) 117 High Peak 8 Telford and Wrekin (UA) 117 North East Derbyshire 9 Warwickshire 118 South Derbyshire 11 Nuneaton and Bedworth 121 Leicester, City of (UA) 14 Rugby 121 Leicestershire 16 Stratford-on-Avon 123 Charnwood 16 Warwick 126 Charnwood 16 Warwick 126 Charnwood 16 West Midlands 129 Hinckley and Bosworth 21 Birmingham 129 Hinckley and Bosworth 21 Birmingham 129 Melton 22 Coventry 134 North West Leicestershire 25 Dudley 136 Oadby and Wigston 26 Solihull 139 Lincolnshire 26 Solihull 139 Lincolnshire 26 Wolverhampton, City of 141 East Lindsey 28 Worcestershire 143 North Kesteven 38 Bromsgrove 143 North Kesteven 44 Redditch 147 West Lincolnshire (UA) 52 Wyre Forest 152 North Last Lindsey 134 North Kesteven 44 Redditch 147 West Lincolnshire (UA) 53 West Northamptonshire (UA) 53 West Northamptonshire (UA) 63 Nottingham, City of (UA) 64 Nottingham, City of (UA) 64 Nottingham, City of (UA) 65 Nottingham, City of (UA) 66 Nottingham, City of (UA) 67 North Northamptonshire (UA) 63 Nottingham, City of (UA) 64 Nottingham, City of (UA) 64 Nottingham, City of (UA) 65 Nottingham, Stifeld 69 Bassetlaw 69 Broxtowe 74 Gedling 76 Mansfield 77				
Erewash7Telford and Wrekin (UA)117High Peak8Warwickshire118North East Derbyshire9Warwickshire118Peak District (NP)10North Warwickshire118South Derbyshire11Nuneaton and Bedworth121Leicester, City of (UA)14Rugby121Leicestershire16Warwick126Charnwood16Warwick126Harborough19West Midlands129Hinckley and Bosworth21Birmingham129Melton22Coventry134North West Leicestershire25Dudley136Oadby and Wigston26Sandwell138Lincolnshire26Solihull139Lincoln36Worcestershire143South Kesteven38Bromsgrove143South Kesteven38Bromsgrove143South Kesteven44Redditch147West Lindsey47Worcester147North East Lincolnshire (UA)53Wyre Forest152North Lincolnshire (UA)53Wyre Forest152North Anthanptonshire (UA)66Nottingham, City of (UA)66Nottingham, City of (UA)66Mansfield69Bassetlaw69Broxtowe74Gedling76Mansfied77				
High PeakabNorth East Derbyshire9Warwickshire118Peak District (NP)10North Warwickshire118South Derbyshire11Nuneaton and Bedworth121Leicester, City of (UA)14Rugby121Leicestershire16Warwick126Charnwood16Warwick126Harborough19Birmingham129Hinckley and Bosworth21Birmingham129Hinckley and Bosworth21Birmingham129Melton22Coventry134North West Leicestershire25Dudley138Oadby and Wigston26Sandwell138Lincolnshire26Solihull139Lincoln36Worcestershire143North Kesteven38Bromsgrove143South Holland42Malvern Hills145South Kesteven44Redditch147West Lindsey47Worcester147North East Lincolnshire (UA)52Wyre Forest152North Lincolnshire (UA)53West Northamptonshire (UA)53West Northamptonshire (UA)66Nottingham, City of (UA)66Nottingham, City of (UA)66Bassetlaw69Bassetlaw69Broxtowe74Gedling76Mansfield77	Erewash	7	, , ,	
Peak District (NP)10North Warwickshire118South Derbyshire11Nuneaton and Bedworth121Leicester, City of (UA)14Rugby121Leicestershire16Warwick126Charnwood16Warwick126Harborough19Birmingham129Hinckley and Bosworth21Birmingham129Melton22Coventry134North West Leicestershire25Dudley136Oadby and Wigston26Sandwell138Lincolnshire26Solihull139Lincoln26Worcestershire141Boston26Wolverhampton, City of141Lincoln36Worcestershire143South Holland42Malvern Hills145South Kesteven44Redditch147West Lindsey47Worcester143North Kesteven44Redditch147West Lindsey47Wyre Forest152North Lincolnshire (UA)53Wyre Forest152North Northamptonshire (UA)53Wyre Forest152Nottingham, City of (UA)66166166Nottinghamshire69Bassetlaw69Broxtowe74Gedling76Gedling7676141Gedling7677	5		Warwickshire	118
South Derbyshire11Nuneaton and Bedworth121Leicester, City of (UA)14Rugby121Leicestershire16Stratford-on-Avon123Charnwood16Warwick126Harborough19West Midlands129Melton21Birmingham129Melton22Coventry134North West Leicestershire25Dudley136Oadby and Wigston26Solihull139Lincolnshire26Wolverhampton, City of141Boston26Wolverhampton, City of141East Lindsey28Worcestershire143North Kesteven38Bromsgrove143South Holland42Malvern Hills145South Holland42Malvern Hills147West Lindsey47Worcester147West Lindsey47Worcester147North Kesteven44Redditch147West Lindsey47Wyre Forest152North Kesteven53Wyre Forest152North Northamptonshire (UA)57South Kesteven148North Northamptonshire (UA)63Nottingham, City of (UA)64Nottingham, City of (UA)64Forest152North Northamptonshire (UA)57Forest152North Northamptonshire (UA)69Forest152Nottinghamshire69Forest152Bassetlaw69	,		North Warwickshire	118
Leicestershire16Stratford-on-Avon123Leicestershire16Warwick126Charnwood16West Midlands129Harborough19Birmingham129Hinckley and Bosworth21Birmingham129Melton22Coventry134North West Leicestershire25Dudley136Oadby and Wigston26Sandwell138Lincolnshire26Walsall140Boston26Wolverhampton, City of141Lincoln36Worcestershire143Lincoln36Bromsgrove143South Kesteven38Bromsgrove143South Kesteven44Redditch147West Lindsey47Worcester147West Lindsey47Worcester147West Lindsey52Wychavon148North East Lincolnshire (UA)53Wyre Forest152North Lincolnshire (UA)57North Northamptonshire (UA)53West Northamptonshire (UA)66Mottingham, City of (UA)66Nottinghamshire69Ashfield69Bassetlaw69Bassetlaw69Broxtoowe74Gedling76Mansfield77Mansfield77	South Derbyshire	11		
Leicestershire16Warwick126Charnwood16West Midlands129Harborough19Birmingham129Melton22Coventry134North West Leicestershire25Dudley136Oadby and Wigston26Sandwell138Lincolnshire26Solihull139Lincolnshire26Walsall140Boston26Wolverhampton, City of141East Lindsey28Worcestershire143South Kesteven38Bromsgrove143South Kesteven38Bromsgrove143South Kesteven44Redditch147West Lindsey47Worcester147West Lindsey52Wychavon148North East Lincolnshire (UA)53152North Lincolnshire (UA)53152North Northamptonshire (UA)63Nottingham, City of (UA)64Nottingham, City of (UA)63Nottingham, City of (UA)64Nottinghamshire69Ashfield69Bassetlaw69Broxtowe74Gedling76Mansfield77	Leicester, City of (UA)	14	Rugby	2
Charnwood 16 Harborough 19 Hinckley and Bosworth 21 Birmingham 22 Coventry 34 North West Leicestershire 25 Dudley 36 Oadby and Wigston 26 Oadby and Wigston 26 Sandwell 38 Solihull 39 Lincolnshire 26 Boston 26 Walsall 140 Boston 26 Worcestershire 143 North Kesteven 38 Bromsgrove 143 North Kesteven 44 Redditch 147 West Lincolnshire (UA) 52 North East Lincolnshire (UA) 53 West Northamptonshire (UA) 53 West Northamptonshire (UA) 53 West Northamptonshire (UA) 57 North Northamptonshire (UA) 63 Nottingham, City of (UA) 64 Nottingham, City of (UA) 64 Nottingham, City of (UA) 65 Nottingham, City of (UA) 66 Nottingham, City of (UA) 77 North Northamptonshire (UA) 77	l eicestershire	16		
Harborough19West Pridands129Hinckley and Bosworth21Birrningham129Melton22Coventry134North West Leicestershire25Dudley136Oadby and Wigston26Sandwell138Lincolnshire26Solihull139Boston26Wolverhampton, City of141East Lindsey28Worcestershire143Lincoln36Boston26Wolverhampton, City ofNorth Kesteven38Bromsgrove143South Holland42Malvern Hills145South Kesteven44Redditch147West Lincolnshire (UA)52Wychavon148North East Lincolnshire (UA)53Verester152North Northamptonshire (UA)5357152North Northamptonshire (UA)64152152North Northamptonshire (UA)63152152Nottingham, City of (UA)6469153Nottingham, City of (UA)66164164Nottinghamshire69164164Bassetlaw69164164Broxtowe74164164Broxtowe74164164Broxtowe74164164Broxtowe74164164Broxtowe74164Broxtowe74164Broxtowe74164Broxtowe74164<				
Hinckley and Bosworth21Birrmingham129Melton22Coventry134North West Leicestershire25Dudley136Oadby and Wigston26Sandwell138Lincolnshire26Solihull139Boston26Wolverhampton, City of141East Lindsey28Worcestershire143Lincoln38Bromsgrove143South Holland42Malvern Hills145South Kesteven44Redditch147West Lindsey47Worcester147West Lindsey52Wychavon148North East Lincolnshire (UA)5353West Northamptonshire (UA)57152North Northamptonshire (UA)63152Nottingham, City of (UA)66152Nottingham, City of (UA)66152Nottinghamshire69152Bassetlaw69152Bassetlaw69154Bassetlaw69154Broxtowe7466Mansfield77			West Midlands	129
Intercon22Dudley136North West Leicestershire25Dudley138Cadby and Wigston26Sandwell138Lincolnshire26Walsall140Boston26Wolverhampton, City of141East Lindsey28Worcestershire143Lincoln36Bromsgrove143South Holland42Malvern Hills145South Holland42Malvern Hills147West Lindsey47Worcester147West Lindsey47Worcester147North East Lincolnshire (UA)52Wyre Forest152North Northamptonshire (UA)53West Northamptonshire (UA)57North Northamptonshire (UA)66147Nottingham, City of (UA)66148Nottingham, City of (UA)66148Mottinghamshire69148Mottinghamshire69148Mostinghamshire69148Mostinghamshire69148Mostinghamshire69148Mostinghamshire69148Masfield69148Mansfield77148	0	21	-	
North West Edecated shift C25Sandwell138Oadby and Wigston26Solihull139Lincolnshire26Walsall140Boston26Wolverhampton, City of141East Lindsey28Worcestershire143Lincoln36Bromsgrove143South Holland42Malvern Hills145South Kesteven44Redditch147West Lindsey47Worcester147West Lindsey47Worcester147North East Lincolnshire (UA)52Wychavon148North Lincolnshire (UA)53Wyre Forest152North Northamptonshire (UA)63148145Nottingham, City of (UA)66147Nottinghamshire69148Bassetlaw69148Broxtowe74148Gedling76141Mansfield77141		22	,	
Lincolnshire26Solihull139Lincolnshire26Walsall140Boston26Wolverhampton, City of141East Lindsey28Worcestershire143Lincoln36Bromsgrove143North Kesteven38Bromsgrove143South Holland42Malvern Hills145South Kesteven44Redditch147West Lindsey47Worcester147West Lindsey47Worcester147North East Lincolnshire (UA)52Wyre Forest152North Lincolnshire (UA)5357152North Northamptonshire (UA)634647Nottingham, City of (UA)664647Nottingham, City of (UA)695757South Sestelaw695757Ashfield695757Mottingham, Sitre695757Mottingham, Sitre695757Mathifeld695757Mathifeld695757Mathifeld695757Mathifeld695757Mansfield775757Mansfield775757Mansfield775757Mansfield775757Mansfield575757Mansfield575757Mathife Mathife575757<			,	
Lincolnshire26Walsall140Boston26Wolverhampton, City of141East Lindsey28Worcestershire143Lincoln36Bromsgrove143North Kesteven38Bromsgrove143South Holland42Malvern Hills145South Kesteven44Redditch147West Lindsey47Worcester147West Lindsey47Worcester147North East Lincolnshire (UA)52Wychavon148North Lincolnshire (UA)53152North Northamptonshire (UA)63152Nottingham, City of (UA)66147Ashfield69147Bassetlaw69147Broxtowe74147Gedling7674Mansfield7774	Oadby and Wigston	26		
Boston26Wolverhampton, City of141East Lindsey28Worcestershire143Lincoln36Bromsgrove143North Kesteven38Bromsgrove143South Holland42Malvern Hills145South Kesteven44Redditch147West Lindsey47Worcester147West Lindsey47Worcester147North East Lincolnshire (UA)52Wychavon148North Lincolnshire (UA)53Vest Northamptonshire (UA)53North Northamptonshire (UA)63Vest Northamptonshire (UA)63Nottingham, City of (UA)66Ashfield69Bassetlaw69Sassetlaw69Broxtowe74Gedling76Mansfield777777	Lincolnshire	26		
East Lindsey28 LincolnWorcestershire143 143 143 143 145 145 145 145 145 146North Kesteven38Bromsgrove143 143 145 145 145 145 147 147 147 148 147 148 147 148 147 148 147 148 149 148 149 148 149 149 149 149 149 140 140 140 141 141 141 141 141 142 141 145 145 145 145 145 146 147 147 148 148 147 148 149 148 149 148 149 148 149 148 149 148 149 149 149 149 149 149 149 140 140 140 140 141 141 141 141 141 141 141 141 141 141 141 141 141 141 141 141 141 141 141 141 141 141 141 141 141 141 141 141 141 141 141 141 141 142 143 143 143 143 143 143 143 143 143 143 143 143 144 144 144 147 144 147 147 148 143 143 143 145 144 145 145 145 145 146 147 147 148 143 145 143 145 145 145 145 146 147 147 148 147 148 147 148 147 148 148 149 149 149 149 149 149 149 149 149 149 149 149 149 149 149 149 149 149 149 149 149 149 149 149 149 149 149 149 149 149 149 149 149 149 149 149 149 149 149 149 149 149 149 149 149 149 	Boston			
Lincoin36Bromsgrove143North Kesteven38Bromsgrove143South Holland42Malvern Hills145South Kesteven44Redditch147West Lindsey47Worcester147North East Lincolnshire (UA)52Wychavon148North Lincolnshire (UA)53152North Northamptonshire (UA)57152North Northamptonshire (UA)63143Nottingham, City of (UA)66147Mottinghamshire69143Bassetlaw69147Broxtowe74147Gedling76147Mansfield77143				143
North Restevent30Malvern Hills145South Holland42Malvern Hills147South Kesteven44Redditch147West Lindsey47Worcester147North East Lincolnshire (UA)52Wychavon148North Lincolnshire (UA)53West Northamptonshire (UA)57North Northamptonshire (UA)63145Nottingham, City of (UA)66147Nottinghamshire69147Bassetlaw69147Broxtowe7464Gedling7677				
South Kesteven44Redditch147West Lindsey47Worcester147North East Lincolnshire (UA)52Wychavon148North Lincolnshire (UA)53152West Northamptonshire (UA)57152North Northamptonshire (UA)63147Nottingham, City of (UA)66147Ashfield69148Bassetlaw69148Broxtowe74148Gedling7677			5	
West Lindsey47Worcester147North East Lincolnshire (UA)52Wychavon148North Lincolnshire (UA)53152West Northamptonshire (UA)57147North Northamptonshire (UA)63147Nottingham, City of (UA)66147Nottinghamshire69147Ashfield69147Bassetlaw69147Gedling7474Gedling7677			Redditch	147
North East Lincolnshire (UA)52Wychavon148North Lincolnshire (UA)53152West Northamptonshire (UA)57152North Northamptonshire (UA)63148Nottingham, City of (UA)66148Nottinghamshire69148Ashfield69148Bassetlaw69141Broxtowe7474Gedling7677				147
North Lincolnshire (UA)53West Northamptonshire (UA)57North Northamptonshire (UA)63Nottingham, City of (UA)66Nottinghamshire69Ashfield69Bassetlaw69Broxtowe74Gedling76Mansfield77	-	52		
North Northamptonshire (UA)63Nottingham, City of (UA)66Nottinghamshire69Ashfield69Bassetlaw69Broxtowe74Gedling76Mansfield77	North Lincolnshire (UA)	53		
Nottingham, City of (UA)66Nottinghamshire69Ashfield69Bassetlaw69Broxtowe74Gedling76Mansfield77	West Northamptonshire (UA)	57		
Nottinghamshire69Ashfield69Bassetlaw69Broxtowe74Gedling76Mansfield77	North Northamptonshire (UA)	63		
Ashfield69Bassetlaw69Broxtowe74Gedling76Mansfield77	Nottingham, City of (UA)	66		
Bassetlaw69Broxtowe74Gedling76Mansfield77	Nottinghamshire	69		
Broxtowe74Gedling76Mansfield77				
Gedling 76 Mansfield 77				
Mansfield 77				
INEWARK ADD SDERWOOD 77	Manstield Newark and Sherwood	77		

THE REGISTER

The Heritage at Risk Register includes historic buildings and sites that are at risk of loss through neglect, decay or development, or are vulnerable to becoming so. It includes all types of designated heritage assets, including Conservation Areas, which are designated and assessed by Local Planning Authorities.

The aim of the Register is to focus attention on those places in greatest need. Historic England, in partnership with others, is able to help tackle heritage at risk. We work with owners, friends groups, developers and other stakeholders to find imaginative solutions for historic places and sites at risk across England.

More information about our role, the advice and funding available, and useful publications and guidance is available on our <u>website</u>.

Criteria for inclusion on the Register

RISK ASSESSMENTS

Heritage assets included on the Register are assessed according to the nature of the site. This can be through on-site checks and/or desk-based assessments. The risk assessment methodologies outlined below are based on the different factors which can threaten the different types of heritage assets and lead to them becoming at risk.

BUILDINGS AND STRUCTURES

To be considered for inclusion on the Register, buildings or structures must be listed on the National Heritage List for England; and in secular (non-worship) use. And be either:

- a grade I or II* listed building, or
- a grade II listed building in London, or
- a structural scheduled monument with upstanding remains.

Buildings or structures are assessed on the basis of condition and, where applicable, occupancy (or use) reflecting the fact that a building which is occupied is generally less vulnerable than one that is not.

Occupancy (or use) is assessed as 'vacant', 'partoccupied', 'occupied', 'not applicable', or occasionally, 'unknown'. Many structures fall into the 'not applicable' category, for example: ruins, walls, gates, headstones or boundary stones.

Condition is assessed as 'very bad', 'poor', 'fair' or 'good'. The condition of buildings or structures on the Register is typically very bad or poor, but can be fair or, very occasionally, good. This reflects the fact that some buildings or structures are vulnerable because they are empty, underused or face redundancy without a new use to secure their future.

A few buildings remain on the Register in good condition whilst solutions are being implemented as a reminder of the need for monitoring, and to ensure that repair and re-use are seen through to completion.

Buildings or structures are removed from the Register when they are fully repaired/consolidated, and their future secured either through occupation and use, or through the adoption of appropriate management.

PLACES OF WORSHIP

To be considered for inclusion on the Register, places of worship must be listed grade I, grade II* or grade II on the National Heritage List for England and be used as a public place of worship at least six times a year.

The method used to assess whether a place of worship is at risk is essentially the same as that used to assess other historic buildings or structures (as outlined above), with one important difference: the criterion as to whether a building is occupied is not used as by their nature, places of worship are in use. Places of worship will be assessed as at risk and added to the Register if their condition is assessed to be very bad or poor.

It is often the case that only part of a church building, e.g. the tower or one of the aisles, is in very bad or poor condition, and it then becomes a matter of professional judgement whether this puts the whole building at risk. Usually if a major or a very significant element of a church is considered to be at risk then the judgement is made that the whole building is at risk and it is included in the Register.

Once on the Register, places of worship can move through the condition categories (e.g. from very bad to poor, to fair, even to good) as repairs are implemented and the condition improves, until they are fully repaired and can be removed from the Register. This means that there are some places of worship in good condition on the Register but with outstanding issues still to be resolved at the time when they were assessed.

ARCHAEOLOGY

To be considered for inclusion on the Register, archaeological sites must be designated as scheduled monuments on the National Heritage List for England.

Archaeology assessments cover scheduled earthworks and buried archaeology.

The risk assessment is based on their condition and vulnerability, the trend in their condition, and their likely future vulnerability. A site's condition is expressed in terms of the scale and severity of adverse effects on it, ranging from 'extensive significant problems' to 'minor localised problems'. The trend will also be recorded as 'improving', 'stable', 'declining' or 'unknown'.

Archaeological entries are removed from the Register once sufficient progress has been made to address the identified issues, and a significant reduction in the level of risk has been demonstrated.

PARKS AND GARDENS

To be considered for inclusion on the Register, parks and gardens must be designated as grade I, grade II* or grade II on the National Heritage List for England. Parks and gardens are assessed in terms of their condition and vulnerability, the trend in their condition, and their likely future vulnerability. Steps being taken by owners to address problems are also taken into consideration.

Parks and gardens assessed as being at risk are typically affected by development and neglect. They have frequently been altered by development or are faced with major change. The original function of these landscapes has often changed and divided ownership leads to the loss of their cohesive historic design.

Park and garden entries are removed from the Register once steps have been taken to address issues and positive progress is being made.

BATTLEFIELDS

To be considered for inclusion on the Register, battlefields must be included on the National Heritage List for England. Battlefields deemed to be at risk of loss of cultural significance are included on the Register. Each battlefield is assessed against four key criteria:

- Landscape readability is it possible to understand the context of the battle?
- Landscape features are hedgerows, walls and trees which had a significant impact on the battle still in place?
- Archaeological integrity is the archaeology of the battle being disturbed?
- Ambiance are activities such as development having a negative impact on the setting of the site?

Current condition, future vulnerability and trend are all taken into account.

Battlefields are removed from the Register either when damaging activities cease/are managed, or when threats recede due to effective planning.

WRECK SITES

To be considered for inclusion on the Register, wrecks must be designated as protected wreck sites on the National Heritage List for England.

Wreck sites are assessed based on their condition and vulnerability, the trend in their condition, and their likely future vulnerability.

Wrecks are considered to be at risk if there is a significant likelihood of loss or further loss of historical, archaeological or artistic significance from it within the foreseeable future.

Wrecks are vulnerable to both environmental and human impacts. Risks that contribute to inclusion on the Register range from unauthorised access to erosion and fishing damage. The monitoring process ensures that the significance of the site is identified and maintained.

Wrecks are removed from the Register once an appropriate management and monitoring regime is operational.

CONSERVATION AREAS

Once a year Historic England asks every local authority in England to consider the state of its conservation areas and fill in (and update as appropriate) risk assessment questionnaires for those that cause concern or are believed to no longer be at risk.

Conservation areas that are deteriorating or are in very bad or poor condition and not expected to

change significantly in the next three years are defined as being at risk.

Categories for condition, vulnerability and trend are included for each conservation area on the Heritage at Risk Register.

The approach taken to assess conservation areas at risk has been refined since the first survey in 2008/2009. Conservation areas identified as at risk in 2009 but not reassessed since using the revised methodology are included on the Register but with limited information.

Conservation area entries are removed from the Register once issues have been identified, plans put in place to address them, and positive progress is being made.

Key Heritage at Risk Statistics for the Midlands 2023

There are 860 entries on the HAR Register for 2023 in the Midlands, 2 fewer than on the previous Register for 2022.

BUILDINGS AND STRUCTURES

- Of the 22,519 grade I and II* listed buildings and structures (excluding places of worship) in England, 765 (3.4%) are on the Register. Of the 3,681 grade I and II* listed secular buildings and structures in the Midlands 195 (5.3%) are on the Register.
- In addition to this, of the 3,013 scheduled monuments in the Midlands, 57 (1.9%) are on the Register assessed as structural scheduled monuments (i.e. using the buildings or structures methodology).
- 7 building or structure entries (including structural scheduled monuments) have been removed from the previous Midlands Register (2022) for positive reasons and 11 have been added.

PLACES OF WORSHIP

- Of the 14,797 listed places of worship (of all grades) in England, 943 (6.4%) are on the Register. Of the 3,368 listed places of worship in the Midlands 268 (8.0%) are on the Register.
- 13 places of worship entries have been removed from the previous Midlands Register (2022) for positive reasons and 15 have been added.

ARCHAEOLOGY

- Of the 19,954 scheduled monuments in England, 1,961 (9.6%) are on the Register assessed as archaeology. Of the 3,013 scheduled monuments in the Midlands, 199 (6.6%) are on the Register assessed as archaeology.
- 10 archaeology entries have been removed from the previous Midlands Register (2022) for positive reasons, and 5 have been added.

PARKS AND GARDENS

• Of the 1,701 registered parks and gardens in England 104 (6.1%) are on the Register. Of the 305 registered parks and gardens in the Midlands, 15 (4.9%) are on the Register. • No parks and gardens entries have been removed for positive reasons and none have been added to the previous Midlands Register (2022).

BATTLEFIELDS

• Of the 47 registered battlefields in England, 3 (6.4%) are on the Register. None of the 12 registered battlefields in the Midlands are on the Register.

WRECK SITES

• Of the 57 protected wreck sites around England's coast, 4 (7.0%) are on the Register. There are no protected wreck sites in the Midlands.

CONSERVATION AREAS

- Of the 9,907 conservation areas in England, 483 (4.9%) are on the Register. Of the 1,929 conservation areas in the Midlands 126 (6.5%) are on the Register.
- 3 conservation areas have been removed for positive reasons and one has been added to the previous Midlands Register (2022).

HISTORIC ENGLAND FUNDING

• £1.23 million in grant was spent on 24 entries (including conservation areas) on the Midlands Register during 2022/23. (This figure includes funding for Heritage Action Zones and for Partnership Schemes in Conservation Areas. It does not include regional capacity building grants or funding for High Street Heritage Action Zones.)

Risk assessments of heritage assets are based on the nature of the site. Buildings and structures include structural scheduled monuments and listed buildings (excluding listed places of worship); archaeology assessments include earthworks and buried archaeology. Please note that some sites may have more than one entry under different risk assessment methodologies, for example if a site has more than one listing for its different elements or if it consists of both buried and structural remains.

2023 HAR data as at 4pm 29 June 2023 2022 HAR data as at 11am 11 July 2022

Key to the entries

The Register includes the following risk assessment types:

- Building or structure (for grade I and II* listed Buildings, grade II listed buildings in London and structural scheduled monuments)
- Place of worship (for grade I, II* and II listed buildings)
- Archaeology (for scheduled monuments earthworks and buried archaeology)
- Park and garden (for Registered parks and gardens)
- Battlefield (for Registered battlefields)
- Wreck site (for Protected wreck sites)
- Conservation area (for conservation areas)

(Please note not all assessment types appear in each of the regional registers.)

ORDER OF ENTRIES

Please refer to the 'Contents' page to see the order that the Planning Authorities are presented in.

Please note that Unitary Authorities are ordered under their own names and may not appear in the same section as the other planning authorities in their ceremonial (or former) county.

Sites that straddle more than one local planning authority are included under the lead authority.

Within each planning authority, entries are grouped by risk assessment type in the following order:

- Buildings or structures
- Places of worship
- Archaeology
- Parks and gardens
- Battlefields
- Wreck sites
- Conservation areas

Within each risk assessment type, entries are ordered alphabetically by parish, locality and street/site name (except for conservation areas and protected wreck sites which are ordered by site name only).

DESIGNATION/LISTING

The principal designation/listing type is noted for each entry:

- Listed Building (LB) grade I, II* or II
- Scheduled Monument (SM)
- Registered Park and Garden (RPG) grade I, II*
 or II
- Registered Battlefield (RB)
- Protected Wreck Site (PWS)
- Conservation Area (CA)

Any other listing types that also apply to the site are also noted (e.g. location within a World Heritage Site (WHS); where a LB or SM is sited within a CA or RPG; or where a CA contains many LBs or SMs).

If an entry is dual designated on the National Heritage List for England (i.e. it is both a listed building and a scheduled monument) the two designations will be joined with an 'and' (e.g. 'Scheduled Monument and Listed Building grade I').

The National Heritage List Entry Number is included for all entries (except conservation areas). If a site has dual list entries, all relevant List Entry Numbers are noted.

CONDITION

For buildings (including places of worship), condition is graded as: 'very bad', 'poor', 'fair' and 'good'.

For sites that cover areas (scheduled monuments – archaeology assessments, parks and gardens, battlefields and wreck sites) one overall condition category is recorded. The category may relate only to the part of the site or monument that is at risk and not the whole site:

- extensive significant problems
- generally unsatisfactory with major localised problems
- generally satisfactory but with significant localised problems
- generally satisfactory but with minor localised problems
- optimal
- unknown (noted for a number of scheduled monuments that are below-ground and where their condition cannot be established)

For conservation areas, condition is categorised as: 'very bad', 'poor', 'fair' and 'optimal'.

If a site has suffered from heritage crime it is noted in the summary. Heritage crime is defined as any offence which harms the heritage asset or its setting and includes arson, graffiti, lead theft and vandalism.

OCCUPANCY/USE

For buildings (excluding places of worship) that can be occupied or have a use, the main vulnerability is vacancy or under-use.

Occupancy (or use) is noted as follows:

- vacant (or not in use)
- part occupied (part in use)
- occupied (in use)
- unknown
- not applicable (for structural scheduled monuments)

VULNERABILITY

Principal vulnerability is noted for archaeology assessments and may relate only to the part of the site that is at risk:

- animal burrowing
- arable ploughing
- coastal erosion
- collapse
- deterioration in need of management
- scrub/tree growth
- visitor erosion

For parks and gardens, battlefields, wreck sites and conservation areas, vulnerability is noted as 'high', 'medium' or 'low'.

PRIORITY CATEGORY

Priority for action is assessed on a scale of A to F, where 'A' is the highest priority for a site which is deteriorating rapidly with no solution to secure its future, and 'F' is the lowest priority.

For buildings and structures and places of worship the following priority categories are used as an indication of trend and as a means of prioritising action:

- A Immediate risk of further rapid deterioration or loss of fabric; no solution agreed
- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented
- C Slow decay; no solution agreed
- D Slow decay; solution agreed but not yet implemented
- E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use)
- F Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented

For battlefields and wreck sites the following priority categories are used as a means of prioritising action:

- A No action/strategy identified or agreed (where trend is declining or unknown)
- B Action/strategy agreed but not yet implemented (where trend is declining or unknown)
- C No action/strategy identified or agreed (where trend is stable or improving)
- D Action/strategy agreed but not yet implemented (where trend is stable or improving)
- E Monitoring as appropriate (any trend)
- F Action implemented/strategy underway/scheme in progress (any trend)

The priority category for the previous year for the entry is given in brackets, otherwise 'New entry' is noted.

'New entry – re-assessed' indicates an existing site on the Register that has been re-assessed using a different risk assessment methodology and is included on this year's Register under the new assessment type.

TREND

Trend for archaeology entries, parks and gardens, battlefields and wreck sites may relate only to the part of the site that is at risk and is categorised as:

- declining
- stable
- improving
- unknown

For conservation areas trend is categorised as:

- deteriorating
- deteriorating significantly
- no significant change
- improving
- improving significantly
- unknown

OWNERSHIP

A principal ownership category is given for each entry, and if sites are in divided ownership, a 'multiple' ownership category is noted.

CONTACT

This is the member of the Historic England local team who acts as a first point of contact for the case, and to whom enquiries should be addressed.

For conservation areas, the contact is the conservation/planning officer at the relevant local planning authority (indicated by 'LPA').

- CA Conservation Area
- HE Historic England
- NLHF National Lottery Heritage Fund
- LB Listed Building
- LPA Local Planning Authority
- NP National Park
- PWS Protected Wreck Site
- RB Registered Battlefield
- RPG Registered Park and Garden
- SM Scheduled Monument
- UA Unitary Authority
- WHS World Heritage Site

Entries on the Register by local planning authority

	entries		garden entries	entries	entries	area entries
4	I	0	0	0	0	I
			1			
8	3	I	0	0	0	0
2	0	I	0	0	0	2
3	I	0	0	0	0	0
2	3	I	0	0	0	0
1	2	0	0	0	0	3
3	2	I	0	0	0	0
I	0	I	0	0	0	3
0	0	3	0	0	0	0
10	4	2		0	0	0
6	4	0	0	0	0	4
6	2	1	I	0	0	2
1	8	1	0	0	0	0
I	I	0	0	0	0	3
I	14	0	0	0	0	I
2	5	0	0	0	0	0
0	I	0	0	0	0	0
			-			
2	4	1	0	0	0	4
10	19	14	0	0	0	6
2	4	I	0	0	0	6
3	9	4	I	0	0	2
3	3	4	0	0	0	2
6	7	5	I	0	0	
5	8	8	0	0	0	3
I	0	0	0	0	0	0
E (UA)			1	1		
3	I	2	0	0	0	6
.)						
3	4	12	0	0	0	2
E (UA)						
13	10	10	0	0	0	2
IIRE (UA)						
6	6	2	0	0	0	1
4)						
3	6	0	0	0	0	11
0	0	1		0	0	I
10	13	I		0	0	I
2	0	1	0	0	0	3
I	0	0	0	0	0	0
3	I	1	0	0	0	0
0	I	1	0	0	0	1
6	7	5	0	0	0	3
I	4			0	0	0
	2 3 3 2 1 3 3 1 3 1 0 10 6 10 6 1 1 1 1 1 2 0 10 2 10 2 1	2 0 3 1 2 3 1 2 3 2 1 0 0 0 10 4 6 4 10 4 6 2 1 14 2 5 0 1 1 14 2 5 0 1 1 14 2 5 0 1 1 14 2 4 10 19 2 4 10 19 2 4 3 9 3 3 6 7 5 8 1 0 3 4 4 6 6 6 7 3 3 4 4 0 1 0	2 0 1 3 1 0 1 2 0 3 2 1 1 0 1 0 0 3 10 4 2 6 4 0 1 14 0 1 14 0 2 5 0 0 1 0 1 14 0 2 5 0 0 1 0 2 4 1 10 19 14 2 4 1 3 9 4 3 3 4 6 7 5 5 8 8 1 0 0 13 10 10 14 0 0 15 8 8 1 0 0 13 10 10 14 0 0 <td>201031003210101000301010103014211810114002500010011400241011400241033403340334033404100100031203412041200331131111000311110003111100031101010311010003110100031101000110011</td> <td>20100310001210032100003001010003000101001100011000110001100025000241001140002500011400024100394103120058000580005100051000510006200013101000141000151100161100171000181100191100101311010</td> <td>20100031000000000000000000000000000000000000000000000000000000000000000000000000000000000000000000000000000000000000000000000000000000000000000000000000000000000000000000000000000000000000000000000000000</td>	201031003210101000301010103014211810114002500010011400241011400241033403340334033404100100031203412041200331131111000311110003111100031101010311010003110100031101000110011	20100310001210032100003001010003000101001100011000110001100025000241001140002500011400024100394103120058000580005100051000510006200013101000141000151100161100171000181100191100101311010	20100031000000000000000000000000000000000000000000000000000000000000000000000000000000000000000000000000000000000000000000000000000000000000000000000000000000000000000000000000000000000000000000000000000

Local planning authority	Building and structure entries	Place of worship entries	Archaeology entries	Park and garden entries	Battlefield entries	Wreck site entries	Conservation area entries
HEREFORDSHIRE, COUNTY	OF (UA)	-					
Herefordshire, County of (UA)	13	22	18	0	0	0	2
SHROPSHIRE (UA)		-		-		-	
Shropshire (UA)	26	23	35	0	0	0	0
STAFFORDSHIRE		-					
East Staffordshire	1	0	2	0	0	0	0
Lichfield	2	1	3	0	0	0	1
Newcastle-under-Lyme	2	0	0	0	0	0	0
Peak District (NP)	2	0	4	0	0	0	0
South Staffordshire	I	0	3	0	0	0	0
Stafford	3	0	2	0	0	0	2
Staffordshire Moorlands	5	0	2	0	0	0	2
Tamworth	I	0	0	0	0	0	0
STOKE-ON-TRENT, CITY O	F (UA)	1			1		
Stoke-on-Trent, City of (UA)	6	4	0	0	0	0	5
TELFORD AND WREKIN (U	A)	1			1		
Telford and Wrekin (UA)	4	2	3	0	0	0	0
WARWICKSHIRE		1			1		
North Warwickshire	10	I	3	0	0	0	0
Nuneaton and Bedworth	2	0	0	0	0	0	0
Rugby	0	0	8	I	0	0	0
Stratford-on-Avon	2	10	7	0	0	0	2
Warwick	3	3	7	2	0	0	0
WEST MIDLANDS		1					
Birmingham	9	10	I		0	0	8
Coventry	3	2	I	I	0	0	3
Dudley	4	3	I	0	0	0	4
Sandwell	3	1	I	0	0	0	2
Solihull	I	0	0	0	0	0	0
Walsall	0	2	0	0	0	0	6
Walsall / Sandwell [†]	0	0	0		0	0	0
Wolverhampton, City of	2	4	0	0	0	0	9
Dudley / Bromsgrove [†]	0	0	I	0	0	0	0
WORCESTERSHIRE							
Bromsgrove	2		0		0		
Malvern Hills	2		3	<u> </u>	0		0
Redditch	0	0	I	0	0		
Worcester	<u> </u>	1	I	0	0		
Wychavon	4		5	<u> </u>	0		0
Wyre Forest	3	I	0	0	0	0	3
TOTAL	252	268	199	15	0	0	126

[†] Sites that cross local planning authority boundaries

DERBY, CITY OF (UA)					
THE THE TAX	SITE NAME:	Darley Abbey Mills (North Complex) North Mill, engine house, boiler house, Old Lane, Darley Abbey, Derby	Former manufacturing cotton textile factory built by the Evans family of Darley Abbey. North Mill, thought to date from the mid-1820s, is a three-storey brick building with attic. Temporary high level repairs funded via a Historic		
VERILLE STATE	DESIGNATION:	Listed Building grade II*, CA, WHS	England grant in 2012, but the roof needs wholesale renewal. There is extensive decay of parapets indicating leaking gutters. Spalling to brickwork at high level. Much		
	CONDITION:	Fair	the building is now occupied with a mix of small office		
199	OCCUPANCY:	Occupied/in use	accommodation. The Council are still working with the owners to encourage comprehensive repair.		
Durley City Council	PRIORITY CATEGORY:	C (C)			
Derby City Council	OWNER TYPE:	Commercial company			
	LIST ENTRY NUMBER:	1067808	Contact: Ben Robinson 07823 327796		
	SITE NAME:	Darley Abbey Mills (North Complex) preparation building, cottage, workshop and cart sheds, Old Lane, Darley Abbey, Derby	Known as the proto-fireproof building, this range forms the northernmost part of the former manufacturing cotton textile factory built by the Evans family of Darley Abbey. Dating from c1790, the L shaped brick range is in poor condition with water ingress through the roof, poor		
	DESIGNATION:	Listed Building grade II*, CA, WHS	guttering, eroded brickwork and bowed east gable. The building is continuing to deteriorate.		
	CONDITION:	Poor			
	OCCUPANCY:	Occupied/in use			
Derby City Council	PRIORITY CATEGORY:	C (C)			
	OWNER TYPE:	Commercial company			
	LIST ENTRY NUMBER:	1067809	Contact: Ben Robinson 07823 327796		
0000 10000	SITE NAME:	Darley Abbey Mills (South Complex) East Mill and West Mill, Old Lane, Darley Abbey, Derby	Former manufacturing cotton textiles factory built by the Evans family of Darley Abbey. Long Mill was rebuilt and enlarged following fire damage in 1788. West Mill was added c1819-21. The exteriors of the buildings have		
	DESIGNATION:	Listed Building grade I, CA, WHS	decayed over time with significant loss of render to upper storeys, cavernous stone decay and localised evidence of faulty rainwater goods leading to water ingress. Significant		
The walk	CONDITION:	Poor	roof repairs are required to two mill buildings. The		
	OCCUPANCY:	Occupied/in use	conversion of Long Mill and West Mill is now complete. Repairs to Long Mill were completed in 2020 and it is no		
Historic England	PRIORITY CATEGORY:	D (D)	longer at risk.		
	OWNER TYPE:	Commercial company			
	LIST ENTRY NUMBER:	1279399	Contact: Ben Robinson 07823 327796		
	SITE NAME:	Allestree Hall, Allestree Park, Derby	House, 1802. Landscaped park now a golf course. The internal condition is poor, but the building is in fair		
	DESIGNATION:	Listed Building grade II*	condition overall. Following the production of a Heritage Assessment and Planning Brief, the City Council have		
	CONDITION:	Fair	successfully marketed Allestree Hall. The new owner has been granted listed building consent and planning		
	OCCUPANCY:	Part occupied/part in use	applications to repair and convert the hall and outbuildings		
	PRIORITY CATEGORY:	C (C)	to a wedding venue/hotel accommodation.		
	OWNER TYPE:	Local authority			

© Historic England Archive

Contact: Ben Robinson 07823 327796

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В
- implemented. C Slow decay; no solution agreed.

1215234

LIST ENTRY NUMBER:

 D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site
 - Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

HERITAGE AT RISK 2023 / MIDLANDS / DERBY, CITY OF (UA) / AMBER VALLEY

SITE NAME:	Church of St Thomas the Apostle, Pear Tree Road, Derby	Large urban parish church of rock faced masonry of c1881 by J Peacock. The National Lottery Heritage Fund has grant
DESIGNATION:	Listed Place of Worship grade II	aided two phases of repairs which addressed significant problems with roofs, high level masonry and internal
CONDITION:	Poor	plasterwork. The second phase, completed in 2018, included the careful dismantling and rebuilding of the east
PRIORITY CATEGORY:	D (D)	window. However, many other windows are in poor
OWNER TYPE:	Religious organisation	condition and require urgent repair. The Quinquennial Inspector has prepared costings to support any grant
LIST ENTRY NUMBER:	1230642	funding opportunities which may arise.
		Contact: Hanna Good 07825 318060

© Historic England

SITE NAME:	Green Lane and St Peter's, Arboretum Ward		
DESIGNATION:	Conservation Area	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	Deteriorating significantly
VULNERABILITY:	Low	CONTACT:	Chloe Oswald (LPA) 01332 640809

DERBYSHIRE

© Histor

AMBER VALLEY

	SITE NAME:	Codnor Castle remains, Castle Lane, Aldercar and Langley Mill	Castle ruins and earthworks dating to the early CI3 and later. Formerly affected by open-cast coal mining. A major
	DESIGNATION:	Scheduled Monument and Listed Building grade II, CA	repair programme was completed in 2008. The C16 farmhouse (grade II) remained abandoned, at risk and suffering from vandalism. The Lower Court east wall is in
The second	CONDITION:	Poor	danger of collapse and was temporarily supported. The property was sold in 2021. The new owner is progressing
	OCCUPANCY:	N/A	the refurbishment of the farmhouse as a dwelling. The
	PRIORITY CATEGORY:	C (C)	Codnor Castle Heritage Trust is no longer involved with the management and public presentation of the site.
	OWNER TYPE:	Commercial company	
oric England	LIST ENTRY NUMBER:	1007047 and 1109025	Contact: Ben Robinson 07823 327796

	SITE NAME:	Horseshoe Weir and Rock Weir, Bridge Foot, Belper	Massive gritstone weirs and sluices developed from 1796-7 to support the adjacent mill complex. Self-seeded woody
	DESIGNATION:	Listed Building grade II*, CA, WHS	growth is displacing masonry in Horseshoe Weir (to the east of the town bridge). Masonry has been lost from the centre of Rock Weir (to the west of the town bridge). The
	CONDITION:	Fair	weirs are in different ownerships and associated with adjacent property awaiting redevelopment. A condition
	OCCUPANCY:	N/A	survey of Rock Weir has been carried out. This identifies
	PRIORITY CATEGORY:	C (C)	repair and maintenance needs.
	OWNER TYPE:	Commercial company	
© Historic England	LIST ENTRY NUMBER:	1335702	Contact: Ben Robinson 07823 327796



	SITE NAME:	North Mill, Bridge Foot, Belper	Important example of early 'fireproof' mill, 1803-4. Amber
	DESIGNATION:	Listed Building grade I, CA, WHS	Valley Borough Council and Historic England are deeply concerned about the condition of the roof and occasional flooding in the basement. The owner has undertaken some
	CONDITION:	Poor	temporary repairs. These are failing and wholesale re- roofing is required. The adjoining grade II East Mill is also
	OCCUPANCY:	Part occupied/part in use	vacant and in poor condition. The owner has put forward
	PRIORITY CATEGORY:	A (A)	proposals for residential and mixed used conversion. Alternative proposals are also being investigated. The
	OWNER TYPE:	Commercial company	museum closed in October 2022.
-	LIST ENTRY NUMBER:	1186846	Contact: Ben Robinson 07823 327796

© Historic England

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В implemented.
- C Slow decay; no solution agreed.
- D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA LB
- LB LPA NP RPG SM
- Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument
- UA Unitary Authority WHS World Heritage Site

HERITAGE AT RISK 2023 / MIDLANDS / AMBER VALLEY

HERITAGE AT RISK 2023 / MIDLAN	NDS / AMBER VALLEY					
	SITE NAME:	Road archway and footbridge (including offices), Bridge Foot, Belper	Footbridge linking former mills. Late C18-early C19. The archway served a defensive role, with gun embrasures protecting the former Counting House in West Mill. Past			
	DESIGNATION:	Listed Building grade II*, CA, WHS	incidents of road traffic collisions appear to have been resolved by the installation of signage by Derbyshire County Council. However, roof coverings remain in a poor			
	CONDITION:	Poor	condition (turnerised and patched) and renewal is required. The building remains unoccupied. Proposals have			
	OCCUPANCY:	N/A	been submitted for the residential and mixed-use			
Tenter A and	PRIORITY CATEGORY:	C (C)	conversion of the mill complex. Alternative proposals are also being investigated.			
© Historic England	OWNER TYPE:	Commercial company				
	LIST ENTRY NUMBER:	1087395	Contact: Ben Robinson 07823 327796			
	SITE NAME:	Remains of Horsley Castle, Horsley	A military royal castle from C12-C14, which overlooks the strategically important Derwent valley. The base of the			
	DESIGNATION:	Scheduled Monument, CA	small Norman keep partially survives. The area was quarried extensively in CI9. Substantial masonry still			
Star and A	CONDITION:	Poor	remains, and walls are up to five metres high in places. The remains are in woodland under heavy scrub/ivy cover.			
	OCCUPANCY:	N/A	There is some loss of stonework to the base of the keep			
	PRIORITY CATEGORY:	C (C)	and vegetation is extensive and intrusive.			
	OWNER TYPE:	Unknown				
© Historic England	LIST ENTRY NUMBER:	1009293	Contact: Ben Robinson 07823 327796			
-						
	SITE NAME:	Heage Windmill, Dungley Hill, Ripley	Early C19. Part restored 1971-3 and restored again to working order 1997-2002. The ends of both sheers are			
	DESIGNATION:	Listed Building grade II*	suffering from historic wood rot. One sheer also displays signs of decay pockets and localised damage inside the cap.			
	CONDITION:	Poor	Emergency external sheer repairs were undertaken in 2018. The curb rollers and iron track require modifications.			
	OCCUPANCY:	Part occupied/part in use	The cap gutter has deteriorated, and there is rainwater			
	PRIORITY CATEGORY:	C (C)	ingress. There is adjacent high-level spalling of the stonework, alongside sporadic mortar loss. The Heage			
	OWNER TYPE:	Community interest group	Windmill Society and Derbyshire County Council are keen			
© Heage Windmill Society	LIST ENTRY NUMBER:	1109016	to effect repairs. Contact: Imogen Newcombe 07387 524030			
	SITE NAME:	South Wingfield Station Building, Holm Lane, South Wingfield	Built in 1839-40 to the designs of Francis Thompson for the North Midland Railway. It is one of the earliest railway stations in the world and is the sole survivor of			
	DESIGNATION:	Listed Building grade II*, CA	Thompson's picturesque stations on the Derby to Leeds line. IT was acquired by the Derbyshire Historic Buildings			
	CONDITION:	Poor	Trust in late 2019 following successful compulsory purchase proceedings by Amber Valley Borough Council,			
	OCCUPANCY:	Vacant/not in use	supported by Historic England. Historic England grant			
	PRIORITY CATEGORY:	F (F)	aided urgent work which complete in 2022. A second phase of National Lottery Heritage Funded work			
	OWNER TYPE:	Private	commenced in Spring 2023 and will complete later in 2023.			
© Historic England	LIST ENTRY NUMBER:	1045917	Contact: Amanda White 0121 625 6890			
	SITE NAME:	South Wingfield Manor Farmhouse, South Wingfield	Farmhouse east of the inner gateway of South Wingfield Manor, mid-C18, with stone slate and pantile roofs. Some slipped stone slates leaving holes in the roof and the			
	DESIGNATION:	Listed Building grade I and Scheduled Monument, CA	possibility of water ingress. There is also vegetation growth on parts of the property.			
	CONDITION:	Poor				
	OCCUPANCY:	Unknown				
	PRIORITY CATEGORY:	C (C)				
© Historic England	OWNER TYPE:	Private				
	LIST ENTRY NUMBER:	1109156 and 1014829	Contact: Ben Robinson 07823 327796			

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed.
 C Slow decay; no solution agreed.
- D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use)

use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument
- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site

HERITAGE AT RISK 2023 / MIDLANDS / AMBER VALLEY / BOLSOVER



SITE NAME:	Church of the Holy Trinity, Derby Road, Milford, Belper	Church, dating from 1848 by architect H Moffatt. Church room and vestry added in 1910. By 2014, rainwater goods
DESIGNATION:	Listed Place of Worship grade II, CA, WHS	required localised repairs and improvement failed joints and disposal of water at ground level was inadequate and or ineffective. There were numerous slipped slates from
CONDITION:	Poor	the north aisle roof. The church has been the subject of heritage crime.
PRIORITY CATEGORY:	C (C)	nentage crine.
OWNER TYPE:	Religious organisation	
LIST ENTRY NUMBER:	1087346	Contact: Hanna Good 07825 318060

© Historic England



© Mr Roy Millett, Source: Historic

England Archive

	SITE NAME:	Church of St James, Wirksworth Road, Idridgehay and Alton	Parish church of 1854-5, designed by H. I. Stevens in the Decorated style. Ashlar gritstone with nave, nave porch, chancel, north aisle and north east tower with broach spire
	DESIGNATION:	Listed Place of Worship grade II, CA	and lucarnes. The upper south and west corner of the tower is subject to increasing structural movement, with further movement evident at the basal stonework of the
	CONDITION:	Poor	spire. Re-pointing to the upper tower and spire is required, alongside the renewal of the bell chamber floor and further
	PRIORITY CATEGORY:	C (C)	roofing repairs. The Parochial Church Council are keen to
	OWNER TYPE:	Religious organisation	effect repairs and are investigating potential funding avenues.
ic	LIST ENTRY NUMBER:	5873	Contact: Imogen Newcombe 07387 524030

Parish church with fabric from early C14, late C14 and SITE NAME: Church of All Saints, Lower Road, Mackworth CI5. The church was restored in 1851. A fire tore through the building in early December 2020 which destroyed the interior and roofs. The shell of the building has been Listed Place of Worship grade I, DESIGNATION: CA secured. CONDITION: Very bad PRIORITY CATEGORY: A (A) OWNER TYPE: Religious organisation LIST ENTRY NUMBER: Contact: Tim Allen 07770 610214 1158642

© Historic England

SITE NAME:	Butterley Works blast furnaces, canal tunnel and underground wharf, Ripley			
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1404832	
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Deterioration - in need of management	NEW ENTRY?:	No	
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Tim Allen 07770 610214	

BOLSOVER

	SITE NAME:	Barlborough Hall, Ward Lane, Barlborough	Part rendered hall with impressive stone porch of c1583-4 attributed to Robert Smythson and built for Sir Francis Rodes. A second porch was added in 1825 after the hall was sold and converted for school use. The exterior was rendered with a cement gauged mix in mid C20. The render is cracked, the later porch suffers cramp damage and the original porch has suffered significant erosion. Historic England grant aided project development works were completed in 2017. A repair scheme has been discussed with the owners. No known progress with
	DESIGNATION:	Listed Building grade I, RPG grade II, CA	
	CONDITION:	Poor	
	OCCUPANCY:	Occupied/in use	
© Historic England Archive	PRIORITY CATEGORY:	A (C)	
	OWNER TYPE:	Religious organisation	repairs.
	LIST ENTRY NUMBER:	1108972	Contact: Amanda White 0121 625 6890

PRIORITY CATEGORIES

D

Е

- Immediate risk of further rapid deterioration or loss of fabric; no А
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; В solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.
- Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA
- LB LPA
- Conservation Area Listed Building Local Planning Authority National Park NP RPG
- Registered Park and Garden Scheduled Monument
- SM
- UA Unitary Authority WHS World Heritage Site

HERITAGE AT RISK 2023 / MIDLANDS / BOLSOVER / CHESTERFIELD

	SITE NAME:	Engine house, chimney and headstocks to the former Pleasley Colliery, Chesterfield Road, Pleasley	Disused colliery, late C19 with headstocks and winding engines. Owned by The Land Trust. The site includes a pit museum and recently improved visitor facilities. Restoration and maintenance led by a good local team of
Art	DESIGNATION:	Scheduled Monument and Listed Building grade II	volunteers from the Friends of Pleasley Pit/ Pleasley Pit Trust. A programme of repairs was completed in 2011 and much of the site is in a fair condition. However, major
	CONDITION:	Poor	repairs are required to address the deteriorating condition of the chimney and structural concerns adjacent to the southern headstock. Historic England has provided advice
	OCCUPANCY:	Part occupied/part in use	
© Historic England	PRIORITY CATEGORY:	B (B)	and offered a project development grant.
	OWNER TYPE:	Charity (non-heritage)	
	LIST ENTRY NUMBER:	1015641 and 1045855	Contact: John Tiernan 0121 625 6839

SITE NAME:	Pinxton Castle motte and fortified manor with moated site and five fishponds, South Normanton / Pinxton			
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1010025	
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Stable	
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No	
OWNER TYPE:	Commercial company	CONTACT:	Nick Carter 0121 625 6860	
SITE NAME:	Bolsover, Old Bolsover			
DESIGNATION:	Conservation Area, 51 LBs, RPG grade II*, 3 SMs	NEW ENTRY?:	No	
CONDITION:	Very bad	TREND:	Deteriorating	
VULNERABILITY:	Medium	CONTACT:	Kim Wyatt (LPA) 01246 242288	
SITE NAME:	Clowne, Clowne / Elmton with Creswell			
DESIGNATION:	Conservation Area, 5 LBs, SM	NEW ENTRY?:	No	
CONDITION:	Very bad	TREND:	Deteriorating	
VULNERABILITY:	Low	CONTACT:	Kim Wyatt (LPA) 01246 242288	

CHESTERFIELD

	SITE NAME:	Brampton Manor Barn, Old Hall Road	Late C16/early C17 barn with massive cruck trusses under a stone and slate roof. Multiple slate failures allowing water
	DESIGNATION:	Scheduled Monument and Listed Building grade II	to penetrate and significant cracking (historic) to gable elevation. The barn suffered vehicle damage in 2019. Planning permission granted in December 2021 for the
	CONDITION:	Very bad	residential conversion of the adjacent grade II pub/restaurant. This includes Conditions requiring the
EF	OCCUPANCY:	Part occupied/part in use	repair and consolidated of the Barn, which will be
	PRIORITY CATEGORY:	D (D)	sympathetically converted to garages. We anticipate works on site in 2023 / 2024
C. C. C. C. C.	OWNER TYPE:	Private	
	LIST ENTRY NUMBER:	1004600 and 1031926	Contact: Nick Carter 0121 625 6860

C.	a line	Ale.		
ter et		1944		1
(state)			and the second s	No.
		A	A.	調
in the		32	all in a	

	SITE NAME:	Gazebo at Brampton Manor, Old Hall Road, Brampton	Early C18 gazebo with stone slated 'fish scale' roof. The ground floor is used for storage. The upper floor has
	DESIGNATION:	Listed Building grade II*	suffered significant graffiti and some of the ceiling boarding is missing or otherwise defective. Slating appears to be in
	CONDITION:	Fair	fair condition, but the building is periodically infested with ivy. There appears to be no rainwater goods (by design).
	OCCUPANCY:	Part occupied/part in use	Planning proposals for residential conversion have been submitted for the wider site.
-	PRIORITY CATEGORY:	C (C)	submitted for the wider site.
	OWNER TYPE:	Commercial company	
	LIST ENTRY NUMBER:	1088267	Contact: Rosemary Thompson 07768 215540

© Historic England

© Historic England

PRIORITY CATEGORIES

- implemented. C Slow decay; no solution agreed.
- A Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
 B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
 C Slow decay; no solution agreed.
 D Slow decay; solution agreed but a provide the solution agreed but not yet implemented.
 C Slow decay; no solution agreed.
 D Slow decay; solution agreed but a provide the solution agreed but not yet implemented.
 D Slow decay; solution agreed but a provide the solution agreed but not yet implemented.
 D Slow decay; solution agreed but a provide the solu use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

HERITAGE AT RISK 2023 / MIDLANDS / CHESTERFIELD / DERBYSHIRE DALES

	SITE NAME:	Walton Works, Walton Fields Road, Brampton	Former cotton wick mill, late C18 and later; significant for its early and novel fireproof construction. Mainly three
	DESIGNATION:	Listed Building grade II*	storeys with two and four storey elements. Most of the building is vacant and in very poor condition despite some
	CONDITION:	Poor	temporary high level repairs. Proposals for conversion of the mill within a mixed use scheme have been submitted
	OCCUPANCY:	Vacant/not in use	for statutory consent. Buildings continue to deteriorate.
	PRIORITY CATEGORY:	C (C)	
and the second second	OWNER TYPE:	Private	
	LIST ENTRY NUMBER:	1391084	Contact: David Walsh 0121 625 6888

© Historic England

	SITE NAME:	Church of St Thomas, Chatsworth Road, Chesterfield	Parish church of 1830-31 by Woodhead & Hurst, with chancel 1888 by Naylor and Sale. Restored 1903 by
	DESIGNATION:	Listed Place of Worship grade II	Adams. The church historically suffered from water ingress, with repairs to the tower grant aided by the National
P al	CONDITION:	Fair	Lottery Heritage Fund and completed in 2017. The water ingress has caused subsequent damage to the highly ornate
	PRIORITY CATEGORY:	C (C)	nave ceiling panels, causing a loss of decoration and
	OWNER TYPE:	Religious organisation	plasterwork. Urgent repairs to the ceiling panels were undertaken in December 2021, alongside the safeguarding
	LIST ENTRY NUMBER:	1088299	of detaching banners and boss. The Parochial Church Council are keen to undertake a repair programme.
s			Contact: Imogen Newcombe 07387 524030

© Anthony Short & Partners

©

© Historic Er

DERBYSHIRE DALES

THE S	SITE NAME:	Cromford Mill, Buildings 1,18, 26 and Aqueduct, Mill Road, Cromford	Cotton mill factory complex from 1771. Building 18, the original mill, suffered significant fire damage in 1929. The building houses an introductory film on the ground floor,
	DESIGNATION:	Listed Building grade I, CA, WHS	but the upper storey is unoccupied and dilapidated. The lightweight roof structure and asbestos covering is failing. Drainage is problematic. Historic England awarded the
	CONDITION:	Very bad	Arkwright Society Covid 19 Emergency Response Fund grants to address loss of revenue and subsequently a
	OCCUPANCY:	Part occupied/part in use	project development grant to assess re-roofing options.
	PRIORITY CATEGORY:	A (A)	The Society has been encouraged to apply for further grant aid for 'interim' re-roofing.
D Historic England	OWNER TYPE:	Charity (heritage)	U U U U U U U U U U U U U U U U U U U
	LIST ENTRY NUMBER:	1248010	Contact: Amanda White 0121 625 6890

1 miles	SITE NAME:	Stable block and Coach House at Longford Hall Farm, Long Lane, Longford	Stable block circa 1760-65 attributed to the Derby architect Joseph Pickford. Red brickwork with stone dressings. Whitehurst of Derby clock on central pediment.
1 1 1	DESIGNATION:	Listed Building grade II*, CA	Fine interior with Tuscan columns. Suffering loss of historic fabric and water ingress. Temporary fencing to protect
ini ikini	CONDITION:	Very bad	public right of way was erected in 2014. Planning permission granted for conversion of adjacent farm
Mark.	OCCUPANCY:	Vacant/not in use	buildings to holiday accommodation requires some repairs
	PRIORITY CATEGORY:	A (A)	to the stable roof. A further planning application for business use of surrounding farm buildings has been
	OWNER TYPE:	Private	submitted. Repair work has not progressed.
England	LIST ENTRY NUMBER:	1281396	Contact: Ben Robinson 07823 327796



Early English to Perpendicular cruciform church with SITE NAME: Church of St Mary, Church central tower. Restored in 1870 by GG Scott and again in C20. By 2019, the aged roof coverings were defective and Yard, Wirksworth Listed Place of Worship grade I, actively leaking. A National Lottery Heritage Fund grant DESIGNATION was awarded in early 2020 for the replacement of nave CA roof coverings. Work was completed in summer 2020, CONDITION: Poor alongside the replacement of the north transept roof tiles. PRIORITY CATEGORY: The Parochial Church Council are maintaining other roofs. C (C) Below ground drainage is thought to be problematic. OWNER TYPE: Religious organisation Supporters are working hard to raise funds for ongoing maintenance and repairs. LIST ENTRY NUMBER: 1335090

Contact: Imogen Newcombe 07387 524030

© Peter Rogan, Peter Rogan Assoicates l td

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; В solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.

D

Е

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- Conservation Area Listed Building CA LB
- LPA
- Local Planning Authority National Park NP
- RPG Registered Park and Garden Scheduled Monument
- SM
- UA Unitary Authority WHS World Heritage Site

HERITAGE AT RISK 2023 / MIDLANDS / DERBYSHIRE DALES / EREWASH

OWNER TYPE:

	SITE NAME:	Church of St Peter, The Green, Edensor, Derbyshire Dales	Church of C12 and C15. Rebuilt in 1867 by GG Scott. T condition of the church is generally fair except for the	
	DESIGNATION:	Listed Place of Worship grade I, RPG grade I, CA	north nave wall which suffered from water ingress. Guttering, soakers and flashings has been repaired and stonework continues to dry out. Rainwater goods	
	CONDITION:	Fair	elsewhere have been repaired and renewed through an Historic England Covid-19 Emergency Heritage at Risk	
	PRIORITY CATEGORY:	F (F)	Response Fund grant. Aisle, chancel and chapel roof	
TANK .	OWNER TYPE:	Religious organisation	coverings are deteriorating, and failures are addressed they arise, but slate roofs need re-covering. General	
	LIST ENTRY NUMBER:	1088158	repointing is required, alongside repairs to C17 memorial.	
Historic England			Contact: Imogen Newcombe 07387 524030	
	SITE NAME:	Church of St Mary, Rakes Lane, Tissington and Lea Hall, Derbyshire Dales	Medieval C12 church with rebuilding in 1854, constructed of coursed limestone with gritstone dressings and slate roofs. Fabric appears to be in good condition generally and	
	DESIGNATION:	Listed Place of Worship grade II*, CA	the church is well-maintained. However, there is localised damp staining including to the tympanum over the south door and the nave roof covering is at the end of its	
	CONDITION:	Poor	economic lives. The shallow pitched slopes will require re- slating soon subject to potential fundraising avenues.	
	PRIORITY CATEGORY:	C (C)	situing soon subject to potential fundraising avenues.	

© Historic England

© Historic England	LIST ENTRY NUMBER:	1109271	Contact: Imogen	Newcombe 07387 524030
SITE NAME:	Lumsdale Mills an	d associated water management fe	atures, Matlock To	own / Tansley
DESIGNATION:	Scheduled Monur	nent, LB grade II, CA	LIST ENTRY NUMBER:	1417570
CONDITION:	Extensive significa	nt problems	TREND:	Improving
PRINCIPAL VULNERABILITY:	Collapse		NEW ENTRY?:	No
OWNER TYPE:	Charity (heritage)		CONTACT:	Nick Carter 0121 625 6860

Religious organisation

EREWASH

New York	
E as as	1
San San San San	
	ALL ?
	and the party

Wall footings and standing east wall of Dale Abbey, a SITE NAME: Dale Abbey, The Village, Dale house of Premonstratensian Canons founded in circa 1200. Abbey The mostly late CI3 remains were excavated in the late Scheduled Monument, LB grade C19 and left exposed. The east wall and footings were DESIGNATION: I, CA consolidated, and the museum was repaired and re-roofed in the early 2000s. However, the museum subsequently suffered from significant condensation. Historic England CONDITION: Fair OCCUPANCY: grant aided investigation work through a Section 17 Part occupied/part in use Management Agreement in 2015. Grant assistance to PRIORITY CATEGORY: C (C) address these issues was declined but the owner funded a partial scheme in 2020. OWNER TYPE: Private LIST ENTRY NUMBER: 1007061 Contact: Hanna Good 07825 318060

© Historic England



© Historic England

	SITE NAME:	United Reformed Church and attached parish rooms, Wharncliffe Road, Ilkeston	complicated rainwater goods were addressed in 2020. Th
	DESIGNATION:	Listed Place of Worship grade II, CA	
	CONDITION:	Poor	tower (pinnacles and walkway) and front steps have suffered structural movement. An application to the
	PRIORITY CATEGORY:	C (F)	National Lottery Heritage Fund in 2018 was unsuccessful.
UL.	OWNER TYPE:	Religious organisation	Covid-19 hampered fundraising efforts. Further progress with repairs is unknown.
	LIST ENTRY NUMBER:	1140446	Contact: Hanna Good 07825 318060

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; В solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.

D

Е

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use)

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA
- LB I PA
- NP
- Conservation Area Listed Building Local Planning Authority National Park RPG
- Registered Park and Garden Scheduled Monument SM
- ŬA
- Unitary Authority World Heritage Site WHS

HERITAGE AT RISK 2023 / MIDLANDS / EREWASH / HIGH PEAK



SITE NAME:	All Saints Church, Church Street, Ockbrook and Borrowash
DESIGNATION:	Listed Place of Worship grade II*, CA
CONDITION:	Poor
PRIORITY CATEGORY:	A (A)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1087941

Parish church from late C12 with some fabric from early CI4. Four stage tower with later broached stone spire. The church was rebuilt between 1800 -1835 and minor alterations took place in C20. The church was the subject of Heritage Crime in 2019. The chancel ceiling has been removed as a result of the water damage. The top most capstone of the spire and the base stone beneath it have split. The top section of the spire is also open jointed. Temporary strapping is in place but permanent repairs are required. The congregation is keen to effect repairs.

Contact: Hanna Good 07825 318060

© Peter Rogan Associates Ltd

SITE NAME:	Ilkeston Town Centre, Ilkeston		
DESIGNATION:	Conservation Area, 12 LBs	NEW ENTRY?:	No
CONDITION:	Poor	TREND:	Deteriorating
VULNERABILITY:	Low	CONTACT:	Erewash Borough Council (LPA) 0115 907 2244
SITE NAME:	Long Eaton Town Centre, Long Eaton		
DESIGNATION:	Conservation Area, 7 LBs	NEW ENTRY ?:	No
CONDITION:	Poor	TREND:	Deteriorating
VULNERABILITY:	Medium	CONTACT:	Erewash Borough Council (LPA) 0115 907 2244
SITE NAME:	Marlay		
DESIGNATION:	Morley	NFW ENTRY?:	NL
DESIGNATION:	Conservation Area, 9 LBs, SM	INEVV EINTRT:	No
CONDITION:	Poor	TREND:	Deteriorating
VULNERABILITY:	Medium	CONTACT:	Erewash Borough Council (LPA) 0115 907 2244

HIGH PEAK

DESIG CONE OCCL PRIOR OWN	SITE NAME:	Stodhart Tunnel, Hayfield Road, Chapel-en-le-Frith	Tramway tunnel entrance, 1796. Considered to be the oldest surviving rail-related tunnel in the world. Some
	DESIGNATION:	Listed Building grade II*	stones missing, repointing and vegetation removal needed. Water penetrating the tunnel roof and attached walls are
	CONDITION:	Poor	bowing due to tree roots. Concern over the distorted tunnel lining which requires propping. Later section in
	OCCUPANCY:	N/A	better condition but entrance blocked. Secure from public
	PRIORITY CATEGORY:	C (C)	access. Discussions are ongoing with one of the owners to determine how Historic England can encourage
	OWNER TYPE:	Private	development of a local trust to take forward repairs and presentation to the public.
	LIST ENTRY NUMBER:	1334843	Contact: Jez Bretherton 0121 625 6855

© Historic England



H	SITE NAME:	Cowdale quarry, limestone extraction and processing site, King Sterndale	Cowdale Quarry retains elements of the complete industrial process of lime quarrying and processing within their original setting. Some of the standing structures are in
	DESIGNATION:	Scheduled Monument	a very bad condition. Intrusive tree and scrub growth is widespread. Historic England gave advice to inform a
	CONDITION:	Very bad	planning application for a mineral water bottling plant, encouraging provisions to address the condition of the
A CARL	OCCUPANCY:	N/A	scheduled monument. The development has not
	PRIORITY CATEGORY:	A (A)	progressed. The site has various low key uses. Unauthorised access and damage has been reported.
	OWNER TYPE:	Private	
	LIST ENTRY NUMBER:	1399726	Contact: Ben Robinson 07823 327796

© Historic England

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; В solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.

D

Е

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.


NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA
- LB LPA
- Conservation Area Listed Building Local Planning Authority National Park NP RPG
- Registered Park and Garden Scheduled Monument
- SM
- UA Unitary Authority WHS World Heritage Site

HERITAGE AT RISK 2023 / MIDLANDS / HIGH PEAK / NORTH EAST DERBYSHIRE

A.	SITE NAME:	Torr Vale Mill, New Mills	Remarkable survival of a textile factory c1790. Long term
	DESIGNATION:	Listed Building grade II*, CA	tage at risk site with significant improvement in the last years. A manufacturing business, office space, events
	CONDITION:	Poor	venue, bar/restaurant, retail units and holiday accommodation have been created. Historic England
1 Van	OCCUPANCY:	Part occupied/part in use	provided a grant for the repair of the main mill building
	PRIORITY CATEGORY:	F (F)	roof. Further phases of repair work are required on other parts of the site and access difficulties need to be resolved
	OWNER TYPE:	Commercial company	in order to secure a fully viable future.
and the second se	LIST ENTRY NUMBER:	972	Contact: John Tiernan 0121 625 6839

© Historic England

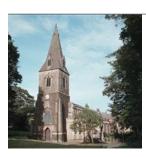

SITE NAME:	Church of All Saints, Church Street South, Glossop	Parish church, C14. Rebuilt 1837 by Matthew E Hadf and JG Weightman, nave remodelled 1913 by Charle
DESIGNATION:	Listed Place of Worship grade II, CA	Hadfield and chancel added 1924 by M Hadfield. There is cracking due to historic structural movement and water ingress within the spire and vestry, with the latter causing
CONDITION:	Poor	ongoing deterioration from penetrating moisture and a masonry joints. There are significant issues with the ch
PRIORITY CATEGORY:	C (New entry)	roof and masonry. Other roofs are approaching the end of
OWNER TYPE:	Religious organisation	their serviceable lives. Rainwater goods are in a poor condition. The parish are engaged with their Quinquennial
LIST ENTRY NUMBER:	1384237	Inspector and Diocese.
		Contact: Imogen Newcombe 07387 524030

© Mr Adrian Shaw. Source: Historic England Archive



SITE NAME: Church of St Edmund, Back Street, Castleton, High Peak CI2 parish church with later fabric. Rainwater dis problematic; there are large damp patches interna	
	ılly,
DESIGNATION: Listed Place of Worship grade II*, CA blocked drains and significant condensation. Histo England and the National Lottery Heritage Fund a grant to re-cover the nave roof in c1996. Further	warded a
CONDITION: Poor were awarded in 2010 for remedial work. The ch continues to suffer on account of defects in the ra	
PRIORITY CATEGORY: D (D) disposal system. An application to the National Le	ottery
OWNER TYPE: Religious organisation Heritage Fund was unsuccessful in 2013. The chur since raised funds, but progress has stalled.	ch had
LIST ENTRY NUMBER: 1087866 Contact: Amanda White 0121 625 6890	

© Historic England

SITE NAME:	Melandra Castle Roman fort		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004595
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Improving
PRINCIPAL VULNERABILITY:	Deterioration - in need of management	NEW ENTRY ?:	No
OWNER TYPE:	Local authority	CONTACT:	Nick Carter 0121 625 6860

NORTH EAST DERBYSHIRE



SITE NAME: Coke ovens, Dronfield / Unstone DESIGNATION: Scheduled Monument CONDITION: Very bad OCCUPANCY: N/A PRIORITY CATEGORY: D (D) OWNER TYPE: Private LIST ENTRY NUMBER: 1018379

Coke ovens, C19. Divided ownership and in gradual decline. Conservation plan and commissioned survey completed but future management remains unresolved.

Contact: Jane Holt 07425732881

© Historic England

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; В solution agreed but not yet implemented.
- C Slow decay; no solution agreed.

Slow decay; solution agreed but F not yet implemented.

D

Е

use).

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- Conservation Area Listed Building Local Planning Authority National Park CA
- LB LPA
- NP RPG Registered Park and Garden Scheduled Monument
- SM
- UA Unitary Authority WHS World Heritage Site

HERITAGE AT RISK 2023 / MIDLANDS / NORTH EAST DERBYSHIRE / PEAK DISTRICT (NP)

SITE NAME:	Ruins of Trinity Chapel, Brackenfield		
DESIGNATION:	Scheduled Monument, LB grade II	LIST ENTRY NUMBER:	1007037
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nick Carter 0121 625 6860
SITE NAME:	Clay Cross Town Centre, Clay Cross		
DESIGNATION:	Conservation Area, LB grade II	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	Improving
VULNERABILITY:	High	CONTACT:	Planning Department (LPA) 01246 217180
SITE NAME:	Eckington and Renishaw Park, Eckington, Eckingtor	ı / Killamarsh	
designation:	Conservation Area, 38 LBs, part in RPG grade II*, part in SM	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	Improving
VULNERABILITY:	P		
SITE NAME:	Morton		
DESIGNATION:	Conservation Area, 6 LBs	NEW ENTRY?:	No
CONDITION:	Poor	TREND:	No significant change
VULNERABILITY:			Planning Department (LPA) 01246 217180
PEAK DISTRICT (NP)			
SITE NAME:	Alport smelt mill, Harthill, Derbyshire Dales		
DESIGNATION:	Scheduled Monument, CA	LIST ENTRY NUMBER:	1009704
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners CONTACT:		Nick Carter 0121 625 6860
SITE NAME:	Callow prehistoric settlement and field system, Ca Derbyshire Dales	rr Head Moor, 300	m ENE of Toothill Farm, Hathersage
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1017506
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Improving
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	Yes
OWNER TYPE:	Local authority	CONTACT:	Tim Allen 07770 610214
SITE NAME:	Pin Dale lead side veins, Castleton, High Peak		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1017651
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Vehicle damage/erosion - extensive	NEW ENTRY?:	Yes

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no А

- Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В
- implemented. C Slow decay; no solution agreed.

 D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

PRIORITY CATEGORY:

LIST ENTRY NUMBER:

SITE NAME:

DESIGNATION:

CONDITION

OCCUPANCY:

OWNER TYPE:

D

Е

PRIORITY CATEGORY:

LIST ENTRY NUMBER:

OWNER TYPE:

C (C)

Private

1140125

SOUTH DERBYSHIRE

	SITE NAME:	Four bottle kilns at TG Greens Pottery, John Street, Church Gresley, Swadlincote	Four C19 bottle kilns and surrounding factory complex of the T G Green & Co pottery, which is particularly famous for its 'Cornish Ware'. The buildings are vacant and have
	DESIGNATION:	Listed Building grade II*	suffered from vandalism. Long standing defects to roof coverings, rainwater goods, and unsecured openings have
The search of the	CONDITION:	Very bad	not been addressed. Roof trusses have failed causing major
MARTIN PARTY	OCCUPANCY:	Vacant/not in use	collapses. The owner has applied to demolish selected buildings. Historic England has discussed a grant-aided
	PRIORITY CATEGORY:	A (A)	condition survey with the owner and Council. The Council instead intends to work on a feasibility study for the site,
© Historic England	OWNER TYPE:	Private	but no progress has been made.
	LIST ENTRY NUMBER:	1280950	Contact: Ben Robinson 07823 327796
	SITE NAME:	Brizlincote Hall Farmhouse, Brizlincote Lane, Bretby	Country house, now farmhouse. Built in 1707 for the Second Earl of Chesterfield in red brick and sandstone
	DESIGNATION:	Listed Building grade II*	ashlar. The building has been deteriorating for many years and stonework is heavily weathered. There are numerous
A1000	CONDITION:	Poor	defects, such as missing and broken masonry elements and eroded and spalling brickwork. The rainwater goods have
A THE SECTION	OCCUPANCY:	Part occupied/part in use	historically leaked, which is causing damage to the fine

© Historic England



LIST ENTRY NUMBER: 1096480 Contact: Hanna Good 07825 318060 SITE NAME: Footbridge, 1812. Cast-iron curved bridge. Bears the Coalbrookdale footbridge, (on inscription 'Coalbrookdale 1812'. Structurally unsound. former Egginton Estate), Sections of the ironwork are missing or corroded. The Egginton upstream flood arches have partially collapsed. The brick DESIGNATION: Listed Building grade II* abutment walls are in need of consolidation and repair. The sluice gate appears to be non-functional. Initial discussions CONDITION: Very bad were held with the landowner about options and funding. OCCUPANCY: N/A PRIORITY CATEGORY: A (A) OWNER TYPE: Private

panelled interior.

© Historic England

© Historic England



SITE NAME: Elvaston Castle, Borrowash Country house, 1633, altered C18 and early C19, has Road, Elvaston formal gardens to the south, south east, pleasure grounds to the north and north east, and a range of courtyards and Listed Building grade II*, RPG DESIGNATION: outbuildings to the west. Gardens were laid out 1830-1851 grade II* by William Barron. Permanent repairs to garden structures, survey and strategic options report all completed with CONDITION: Fair grants from Historic England. The Castle has been re-OCCUPANCY: Part occupied/part in use roofed and the orchid house has been re-glazed, with the entire roof now water-tight. An on-going programme of PRIORITY CATEGORY: D (D) repairs is being undertaken in accordance with the masterplan for the site. OWNER TYPE: Local authority LIST ENTRY NUMBER: 1334604 Contact: Ben Robinson 07823 327796

> Overseal House, 10-14, Acresford Road, Overseal

Listed Building grade II*

Part occupied/part in use

Poor

C (C)

Private

1311162

Four red brick houses, now one, of late C18 with early C19 additions. Believed to have been built for Joseph Wilkes, a local industrialist. The building and grounds had fallen into disrepair in recent years. Formerly a guest house, the current occupiers had planned to repair teh porperty. Progress with repairs is not known.

Contact: Ben Robinson 07823 327796

© Historic England

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric: solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.
- Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use)

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise. New Entry is noted).

Contact: Hanna Good 07825 318060

- Conservation Area Listed Building
- LB I PA
- Local Planning Authority National Park NP
- RPG Registered Park and Garden Scheduled Monument
- SM
- ΪA
- Unitary Authority World Heritage Site WHS

HERITAGE AT RISK 2023 / MIDLANDS / SOUTH DERBYSHIRE

1 0	SITE NAME:	Shardlow Hall, London Road, Shardlow and Great Wilne	Small country house built in 1684. Some remodelling was undertaken in 1726 by Francis Smith of Warwick, and again
	DESIGNATION:	Listed Building grade II*, CA	in 1768 by Joseph Pickford when Palladian flanking wings were added. Was in use as a Preparatory school in the
	CONDITION:	Poor	early C20 and used as offices of the Ministry of Agriculture, Fisheries and Food from 1946 to 1986. The hall is now
	OCCUPANCY:	Part occupied/part in use	surrounded by poor quality C20 buildings. Roofs are in
	PRIORITY CATEGORY:	C (C)	need of repair. The windows are in poor condition and the internal panelling is beginning to splinter. The building has
	OWNER TYPE:	Private	been the victim of heritage crime. Some patch repairs have been undertaken.
oric England	LIST ENTRY NUMBER:	1088368	Contact: Hanna Good 07825 318060

Remains of Swarkestone Old Hall, Derby Road, Swarkestone

Listed Building grade II*, RPG

grade II*, CA

Poor

N/A

C (C)

Private

1280604

© Histor



© South Derbyshire District Council

 SITE NAME:	Swarkestone Bridge, Stanton by Bridge / Swarkestone	River bridge and causeway combine to form the largest surviving stone bridge in England. Spans River Trent.
DESIGNATION:	Scheduled Monument and Listed Building grade I, 2 CAs	Medieval with alterations in C18. Bridge at risk from the volume of traffic. Unacceptable damage to parapets occurring from regular road traffic accidents. Further traffic
CONDITION:	Fair	calming measures and enforcement of weight restrictions are required. Repair and maintenance programme
OCCUPANCY:	N/A	underway within the terms of a management agreement.
PRIORITY CATEGORY:	F (F)	
OWNER TYPE:	Local authority	
LIST ENTRY NUMBER:	1007076 and 1088337	Contact: Nick Carter 0121 625 6860

Remains of Swarkestone Old Hall and complex of walls

relating to the gardens of the Old Hall, C16. All buildings are in a state of decay with dislodged bricks and stone

through a Countryside Stewardship Scheme in the past to

address these issues. Cows have now been replaced by sheep, thereby reducing attrition to the walls. The owners

wish to undertake further repairs.

Contact: Hanna Good 07825 318060

work particularly prevalent to the tops of walls and in openings. Owner has worked with Natural England



SITE NAME:

DESIGNATION:

CONDITION:

OCCUPANCY:

OWNER TYPE:

PRIORITY CATEGORY:

LIST ENTRY NUMBER:

© Historic	England



Small early C18 country house in red brick with stone SITE NAME: Walton Hall, attached stables detailing, effectively a symmetrical box. Grade II and garden wall, Main Street, Walton upon Trent outbuildings are in a poor condition. The hall is in new ownership, occupied and a phased programme of repair DESIGNATION: Listed Building grade II*, CA and refurbishment works is underway. CONDITION: Fair OCCUPANCY: Part occupied/part in use PRIORITY CATEGORY: F (C) OWNER TYPE: Private LIST ENTRY NUMBER: 1159300 Contact: Ben Robinson 07823 327796

© Historic England



	SITE NAME:	Weston Hall, Main Street, Weston upon Trent	A large ambitious country house c1625-30, only ever part built. Reputedly used as a barracks for soldiers when Civil
	DESIGNATION:	Listed Building grade II*	War fighting broke out in Weston in 1644. Lower floors have been in hospitality use since the 1990s; upper floors
-	CONDITION:	Poor	may always have been vacant. Kitchen and bar facilities were upgraded post 2011. By 2017 roof coverings were in
	OCCUPANCY:	Part occupied/part in use	poor condition and there were some significant structural
Π.	PRIORITY CATEGORY:	C (C)	issues. Historic England grant-aided urgent staircase repairs in 2017 and roof and other structural repairs in 2018. The
-	OWNER TYPE:	Commercial company	latter completed in late 2019. Modern additions were repaired in early 2020.
	LIST ENTRY NUMBER:	1088352	Contact: Hanna Good 07825 318060

© Historic England

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no А

- solution agreed. Immediate risk of further rapid В deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.

Slow decay; solution agreed but F not yet implemented.

D

Е

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use)

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA
- LB I PA
- Conservation Area Listed Building Local Planning Authority National Park NP
- RPG Registered Park and Garden Scheduled Monument
- SM UÁ
- Unitary Authority World Heritage Site WHS

HERITAGE AT RISK 2023 / MIDLANDS / SOUTH DERBYSHIRE

	SITE NAME:	Church of St George and St Mary, Church Street, Church Gresley	Largely CI4 church, incorporating part of a CI2 monastic church. The tower is CI5 and the remainder is CI8 and CI9. The church lies to the north of a former colliery site
	DESIGNATION:	Listed Place of Worship grade II*	and there is a history of structural movement, including to the stair turret. The National Lottery Heritage Fund Grants
	CONDITION:	Poor	for Places of Worship scheme grant aided localised tree management, drainage and turret structural repairs in 2015.
	PRIORITY CATEGORY:	D (D)	The nave and chancel slate roofs are in poor condition.
	OWNER TYPE:	Religious organisation	There is also a loss of fabric at parapet level. A 2020 National Lottery Heritage Fund grant for development
	LIST ENTRY NUMBER:	1204963	work has been completed.
ric England			Contact: Hanna Good 07825 318060

Church of St James, London

Listed Place of Worship grade II,

Road, Shardlow and Great

Religious organisation

Wilne

CA

Poor

A (A)

© Historic England



SITE NAME:	All Saints Church, Dalbury, Dalbury Lees	Parish church dating from C13 with minor C18 alterations. Restored in 1844 and north aisle added. A programme of
DESIGNATION:	Listed Place of Worship grade II*	repairs has been completed over several years. The south wall of the nave was particularly damp but is drying out
CONDITION:	Poor	following the installation of new drains in 2019. The marble pulpit and pews were badly affected by damp and their
PRIORITY CATEGORY:	C (C)	condition is being monitored. The Parochial Church
OWNER TYPE:	Religious organisation	Council were invited to apply for an Historic England Covid 19 Heritage at Risk Recovery Grant but were unable to
LIST ENTRY NUMBER:	1334550	pursue an application. Some re-pointing is planned for 2023.
		2023:

Contact: Hanna Good 07825 318060

fragment of stone has recently fallen.

Parish church, 1846, by H I Stevens. The tower has a

iron windows are in poor condition. A repair project supported by the National Lottery Heritage Fund

affordable. Recipient of an Historic England Covid 19 Emergency Heritage at Risk Response Fund grant in 2020

for further repairs. Further repairs are required; a large

history of structural movement and there is a long history

completed in late 2019 but not all necessary repairs were

of iron cramp damage generally with some previous repairs having failed. Rainwater disposal is problematic and cast-

© Historic England



SITE NAME:

DESIGNATION:

CONDITION:

OWNER TYPE:

PRIORITY CATEGORY:

© Historic England



LIST ENTRY NUMBER:	1088362	Contact: Hanna Good 07825 318060	
SITE NAME:	Church of St Stephen, Moira Road, Woodville	Parish church of 1846 by Stevens in the New Norman style. Ashlar with ashlar dressings, slate roofs, single tower	
DESIGNATION:	Listed Place of Worship grade II	to the south west. Apsidal end to the chancel whilst the west end has a full height gable where architectural	
CONDITION:	Poor	detailing is afforded greatest expression. Large areas of stonework are in a dangerous condition and require urgent	
PRIORITY CATEGORY:	C (New entry)	action. This is attributed to poor quality stone, exacerbated	
OWNER TYPE:	Religious organisation	by an amount of face bedding. Past repairs, cementitious patching and pointing has compounded the decay and is	
LIST ENTRY NUMBER:	1261993	now itself failing and falling away. Rainwater disposal is of concern.	
-		Contact: Hanna Good 07825 318060	

© Copyright Simon Headley, Church Support Officer

SITE NAME:	Swarkestone Lows round barrow cemetery and par Lowes Farm, Swarkestone	rt of an aggregate fi	eld system 300m north west of The
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1019060
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nick Carter 0121 625 6860
SITE NAME:	Twyford henge and Round Hill bowl barrow, Twyfo	ord and Stenson	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1011436
CONDITION:	Extensive significant problems	TREND:	Declining
CONDITION: PRINCIPAL VULNERABILITY:	Extensive significant problems Animal burrowing - moderate	TREND: NEW ENTRY?:	Declining No

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no А

D

Е

solution agreed. Immediate risk of further rapid deterioration or loss of fabric; В solution agreed but not yet implemented.

C Slow decay; no solution agreed.

Slow decay; solution agreed but $\ \ F$ not yet implemented.

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use)

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA

LB LPA

NP

Conservation Area Listed Building Local Planning Authority National Park RPG

Registered Park and Garden Scheduled Monument

SM ŬA

Unitary Authority World Heritage Site WHS

HERITAGE AT RISK 2023 / MIDLANDS / SOUTH DERBYSHIRE / LEICESTER, CITY OF (UA)

SITE NAME:

	SITE NAME:	Elvaston Castle, Elvaston	A unique Victorian fantasy, the work of designer William
ngland	DESIGNATION:	Registered Park and Garden grade II*, 19 LBs	Barron, which showcased the use of native and exotic evergreen trees as a winter garden. Later one of the country's earliest country parks. High use and lack of
	CONDITION:	Generally unsatisfactory with major localised problems	investment over many years has seen major decline in the condition of infrastructure, built and planted features. Historic England grant-aided repairs to listed structures
	VULNERABILITY:	High	within the garden and appraisals to help inform the future
	TREND:	Declining	direction of the site. In 2022, planning and listed building consent applications were submitted for works to
	NEW ENTRY?:	No	implement Phase I of the masterplan.
	OWNER TYPE:	Mixed, multiple owners	
	LIST ENTRY NUMBER:	1000404	Contact: Ben Robinson 07823 327796

Newarke Wall (Along north

LEICESTER, CITY OF (UA)




© Historic England

© Historic Eng



© Historic England Archive

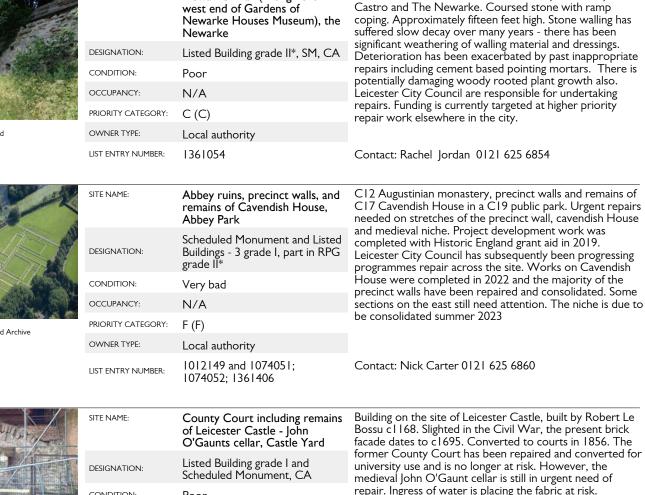

© Historic England

repair. Ingress of water is placing the fabric at risk. CONDITION: Poor Leicester City Council is exploring options with the OCCUPANCY: Vacant/not in use potential to stabilise the structure and improve access to it. PRIORITY CATEGORY: C (C) OWNER TYPE: Local authority LIST ENTRY NUMBER: 1200622 and 1012147 Contact: Rachel Jordan 0121 625 6854

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no

- solution agreed. Immediate risk of further rapid deterioration or loss of fabric: solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.

D

Е

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use)

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise. New Entry is noted).

ABBREVIATIONS

ΪA

Wall, c1423, which formed the boundary of St Mary-de-

- Conservation Area Listed Building
- LB I PA
- Local Planning Authority National Park NP
- RPG Registered Park and Garden Scheduled Monument
- SM
- Unitary Authority World Heritage Site WHS

HERITAGE AT RISK 2023 / MIDLANDS / LEICESTER, CITY OF (UA)

	, .	- (-)	
	SITE NAME:	Parish Church of St Peter, Church Road, Belgrave	The church has been closed as a place of worship since 2010. The building has since been vacant except for
	DESIGNATION:	Listed Building grade II*, CA	occasional use as a concert/recital venue by a local community group. Subject to heritage crime in 2011, a
	CONDITION:	Fair	temporary solution was put in place which is now reaching the end of its effective life. A permanent solution to the
	OCCUPANCY:	Vacant/not in use	long term vacancy and required repairs has not yet been
	PRIORITY CATEGORY:	C (E)	found, the building condition continues to deteriorate. The building is being marketed.
	OWNER TYPE:	Religious organisation	
	LIST ENTRY NUMBER:	1074029	Contact: Hanna Good 07825 318060



and the second se	SITE NAME:	HSBC Bank, 31, Granby Street, Leicester	Former HSBC bank, 1872-74 by Joseph Goddard in the French Gothic Revival style. Large banking hall with
	DESIGNATION:	Listed Building grade II*, CA	elaborate timber roof and stained glass. The main building is currently used for worship. Stained glass windows have
	CONDITION:	Poor	been repaired and the upper floors converted. Urgent repairs were completed on one roof in March 2018 with
	OCCUPANCY:	Part occupied/part in use	financial support from Leicester City Council. An Historic
	PRIORITY CATEGORY:	C (C)	England High Street Heritage Action Zone grant aided roof repair completed in early 2023 but post completion
	OWNER TYPE:	Commercial company	remedial work is required.
	LIST ENTRY NUMBER:	1074047	Contact: Amanda White 0121 625 6890

© Leicester City Council

© Historic England



© Historic England

© Historic England

© Historic England



CONDITION:

OWNER TYPE:

SITE NAME:

DESIGNATION:

CONDITION:

OWNER TYPE:

D

Е

PRIORITY CATEGORY:

LIST ENTRY NUMBER:

PRIORITY CATEGORY:

LIST ENTRY NUMBER:

Poor

C (D)

1074070

Very bad

1074072

D (C)

Gate, Leicester

Religious organisation

Religious organisation

St Margaret's Church, Church

Listed Place of Worship grade I

	SITE NAME:	St Saviour's Church, St Saviour's Road, Leicester	Former church built 1875-7 by Sir GG Scott. Brick in the Early English style with a broach spire, gable and rose		
1	DESIGNATION:	Listed Building grade II*	window which dominate the locality. No longer in ecclesiastical use and vacant. Significant repairs are required		
	CONDITION:	Poor	to the spire, roof and guttering. Planning and Listed Buildin Consent applications have been approved to enable new Christian worship in the church. Works have started on		
	OCCUPANCY:	Vacant/not in use			
	PRIORITY CATEGORY:	D (D)	site.		
	OWNER TYPE:	Religious organisation			
	LIST ENTRY NUMBER:	1074774	Contact: Rosemary Thompson 07768 215540		
6	SITE NAME:	Church of St Mary De Castro, Castle Yard, Leicester	A National Lottery Heritage Fund grant was awarded in 2011 for a detailed assessment of the spire. The condition		
	DESIGNATION:	Listed Place of Worship grade I, SM. CA	of masonry was such that urgent dismantling was necessary, this was completed in summer 2014. Much		

further repair work has been undertaken as part of a fouryear staged plan to tackle backlog repairs. The next phase will include masonry repairs to the south wall and south aisle gable. A small grant has been awarded by the National Lottery Heritage Fund for consultants to help develop proposals. Fundraising is underway. There are currently no plans to rebuild the spire.

Contact: Rosemary Thompson 07768 215540

Large, mainly C15, city centre church. By 2019 various sandstone walling had deteriorated and was shedding stone fragments. Scaffolding above the west door of the tower has now been removed. There were localised flashing defects, vegetation, rainwater disposal issues at high and low level and water penetration. An Historic England Covid-19 Emergency Heritage at Risk Response Fund award enabled repairs to the south porch and the tower has been repaired through a Heritage Stimulus Fund award. Ongoing funding is being sought for repairs to the chancel roof.

Contact: Hanna Good 07825 318060

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no А

- solution agreed. Immediate risk of further rapid В deterioration or loss of fabric; solution agreed but not yet implemented.
- С Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use)

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

- Conservation Area Listed Building CA
- LB I PA
- Local Planning Authority National Park NP
- RPG
- Registered Park and Garden Scheduled Monument SM

ÍΙΑ Unitary Authority World Heritage Site WHS

HERITAGE AT RISK 2023 / MIDLANDS / LEICESTER, CITY OF (UA) / CHARNWOOD

	SITE NAME:	Serbian Orthodox Church of St George, Rutland Street, Leicester	Built in 1823-7 by William Parsons; the chancel was added by Sir Arthur Blomfield in 1879. In use as a Serbian Orthodox place of worship in the centre of Leicester.
	DESIGNATION:	Listed Place of Worship grade II*, CA	Work to roof coverings and timber repairs, rainwater goods and drainage was funded in two phases under the joint Historic England/National Lottery Heritage Fund
446646	CONDITION:	Fair	repair grants scheme in 2014. Fabric remains at risk from water penetration due to blockages in high level rainwater
	PRIORITY CATEGORY:	F (C)	disposal system due to the proximity of churchyard trees.
	OWNER TYPE:	Religious organisation	Plans have been submitted to reduce tree cover and work may take place during 2023/4.
oric England	LIST ENTRY NUMBER:	1299776	Contact: Ben Robinson 07823 327796

	SITE NAME:	Church of St Peter, St Peter's Road, Leicester	Urban church of 1872-79 by GE Street in a Gothic style. By 2014, tower masonry and roof coverings were in poor
	DESIGNATION:	Listed Place of Worship grade II	condition. A first phase of repairs was completed with funding from the National Lottery Heritage Fund under the
	CONDITION:	Very bad	Grants for Places of Worship to address the deterioration of the tower. A second phase of roof repairs - to the
	PRIORITY CATEGORY:	C (A)	baptistery and south porch roof has now been completed.
	OWNER TYPE:	Religious organisation	Much further repair work is required.
Contraction The	LIST ENTRY NUMBER:	1361047	Contact: Imogen Newcombe 07387 524030

© Historic England

© Histor

SITE NAME:	All Saints, Leicester			
DESIGNATION:	Conservation Area, 2 LBs	NEW ENTRY?:	No	
CONDITION:	Very bad	TREND:	Improving	
VULNERABILITY:	Medium	CONTACT:	Justin Webber (LPA) 0116 454 4638	
SITE NAME:	Churchgate, Leicester			
DESIGNATION: Conservation Area, 6 LBs		NEW ENTRY ?:	No	
CONDITION:	Very bad	TREND:	Deteriorating	
VULNERABILITY: Low		CONTACT:	Justin Webber (LPA) 0116 454 4638	
SITE NAME: Granby Street, Leicester DESIGNATION: Conservation Area, 8 LBs CONDITION: Poor VULNERABILITY: Medium				
		NEW ENTRY ?:	Yes	
		TREND:	Deteriorating	
		CONTACT:	Justin Webber (LPA) 0116 454 4638	
SITE NAME:	Market Place, Leicester			
DESIGNATION:	Conservation Area, 30 LBs	NEW ENTRY ?:	No	
CONDITION:	Poor	TREND:	Improving significantly	
VULNERABILITY: Low		CONTACT:	Justin Webber (LPA) 0116 454 4638	

LEICESTERSHIRE

CHARNWOOD

	SITE NAME:	The Old Rectory, Rectory Place	Two bays of a medieval hall-house, now ruinous, dating
	DESIGNATION:	Listed Building grade II*, CA	from late C13. Lower bay rebuilt and used as a museum from the 1960s. Two arched doorways (one mutilated)
125	CONDITION:	Poor	have been propped since c 2019. Masonry requires attention to secure fabric and enable the removal of props.
	OCCUPANCY:	Part occupied/part in use	There is a history of antisocial behaviour and the removal
	PRIORITY CATEGORY:	C (New entry)	of some shrubs may be beneficial particularly in combination with security lighting. Historic England have
	OWNER TYPE:	Local authority	discussed a possible funding opportunity with council representatives.
	LIST ENTRY NUMBER:	1320404	Contact: Amanda White 0121 625 6890

© Historic England

PRIORITY CATEGORIES

- A Immediate risk of further rapid deterioration or loss of fabric; no
- Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В implemented.
- C Slow decay; no solution agreed.
- D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).
 - Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.
- NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA LB LPA NP RPG SM
- Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument
- UA Unitary Authority WHS World Heritage Site

a Historic England side of Construction a Historic England DESIGNATION: Listed Built cONDITION: Poor occupancy: Occupied/ PRIORITY CATEGORY: F (F) OWNER TYPE: Commerce LIST ENTRY NUMBER: 1236293 SITE NAME: Side of Construction DESIGNATION: Listed Built construction Proportion	ell Foundry (on east bbden Street), Street, Loughborough ding grade II* /in use ial company ell Foundry (on west bbden Street), Street, Loughborough ding grade II*	Bell foundry c1859 with late C19 and early C20 additions and alterations. The only historic purpose-built bell foundry in England in use. By 2011 buildings were in poor condition. Historic England grant aided much urgent work. The National Lottery Heritage Fund awarded a grant to develop a major repair and public access project in 2018 followed by a grant of c 3.5M in 2021 for works. Work commenced in February 2023 and is due to complete in March 2024. Funds are insufficient to tackle all repair needs. Further urgent work took place in 2020 with Historic England Heritage Stimulus Funds. Contact: Amanda White 0121 625 6890 Bell foundry c1859 with late C19 and early C20 additions and alterations. The only historic purpose-built bell foundry in England in use. By 2011 buildings were in poor condition. Historic England grant aided much urgent work. The
CONDITION: Poor OCCUPANCY: OCCUPIED PRIORITY CATEGORY: F (F) OWNER TYPE: Commerce LIST ENTRY NUMBER: 1236293 SITE NAME: Taylor's B side of Co Freehold S DESIGNATION: Listed Built CONDITION: Poor OCCUPANCY: OCCUPIED PRIORITY CATEGORY: F (F) OWNER TYPE: Charity (here)	/in use ial company ell Foundry (on west obden Street), Street, Loughborough	National Lottery Heritage Fund awarded a grant to develop a major repair and public access project in 2018 followed by a grant of c 3.5M in 2021 for works. Work commenced in February 2023 and is due to complete in March 2024. Funds are insufficient to tackle all repair needs. Further urgent work took place in 2020 with Historic England Heritage Stimulus Funds. Contact: Amanda White 0121 625 6890 Bell foundry c1859 with late C19 and early C20 additions and alterations. The only historic purpose-built bell foundry in England in use. By 2011 buildings were in poor condition. Historic England grant aided much urgent work. The
CONDITION: Poor OCCUPANCY: OCCUPIED PRIORITY CATEGORY: F (F) OWNER TYPE: Commerce LIST ENTRY NUMBER: 1236293 SITE NAME: Taylor's B side of Co Freehold S DESIGNATION: Listed Built CONDITION: Poor OCCUPANCY: OCCUPIED PRIORITY CATEGORY: F (F) OWNER TYPE: Charity (here)	ial company ell Foundry (on west obden Street), Street, Loughborough	develop a major repair and public access project in 2018 followed by a grant of c 3.5M in 2021 for works. Work commenced in February 2023 and is due to complete in March 2024. Funds are insufficient to tackle all repair needs. Further urgent work took place in 2020 with Historic England Heritage Stimulus Funds. Contact: Amanda White 0121 625 6890 Bell foundry c1859 with late C19 and early C20 additions and alterations. The only historic purpose-built bell foundry in England in use. By 2011 buildings were in poor condition. Historic England grant aided much urgent work. The
PRIORITY CATEGORY: F (F) OWNER TYPE: Commerce LIST ENTRY NUMBER: 1236293 SITE NAME: Taylor's B side of Co Freehold S DESIGNATION: Listed Buil CONDITION: Poor OCCUPANCY: OCcupied PRIORITY CATEGORY: F (F) OWNER TYPE: Charity (here)	ial company ell Foundry (on west obden Street), Street, Loughborough	 commenced in February 2023 and is due to complete in March 2024. Funds are insufficient to tackle all repair needs. Further urgent work took place in 2020 with Historic England Heritage Stimulus Funds. Contact: Amanda White 0121 625 6890 Bell foundry c1859 with late C19 and early C20 additions and alterations. The only historic purpose-built bell foundry in England in use. By 2011 buildings were in poor condition. Historic England grant aided much urgent work. The
OWNER TYPE: Commerce UST ENTRY NUMBER: 1236293 ISTE NAME: Taylor's B side of Co Freehold S DESIGNATION: Listed Buil CONDITION: Poor OCCUPANCY: Occupied/ PRIORITY CATEGORY: F (F) OWNER TYPE: Charity (here)	ell Foundry (on west obden Street), Street, Loughborough	needs. Further urgent work took place in 2020 with Historic England Heritage Stimulus Funds. Contact: Amanda White 0121 625 6890 Bell foundry c1859 with late C19 and early C20 additions and alterations. The only historic purpose-built bell foundry in England in use. By 2011 buildings were in poor condition. Historic England grant aided much urgent work. The
Ist ENTRY NUMBER: 1236293 Ist ENTRY NUMBER: Ist ENTRY NUMBER:	ell Foundry (on west obden Street), Street, Loughborough	Historic England Heritage Stimulus Funds. Contact: Amanda White 0121 625 6890 Bell foundry c1859 with late C19 and early C20 additions and alterations. The only historic purpose-built bell foundry in England in use. By 2011 buildings were in poor condition. Historic England grant aided much urgent work. The
UIST ENTRY NUMBER: 1236293 ISTE NAME: Taylor's B side of Co Freehold S DESIGNATION: Listed Buil CONDITION: Poor OCCUPANCY: Occupied, PRIORITY CATEGORY: F (F) OWNER TYPE: Charity (hr	bden Street), Street, Loughborough	Bell foundry c1859 with late C19 and early C20 additions and alterations. The only historic purpose-built bell foundry in England in use. By 2011 buildings were in poor condition. Historic England grant aided much urgent work. The
Image: Window Stress State Stress State Stress State Stress State Stress Str	bden Street), Street, Loughborough	and alterations. The only historic purpose-built bell foundry in England in use. By 2011 buildings were in poor condition. Historic England grant aided much urgent work. The
© Historic England	ding grade II*	
Image: Section of the sectio		National Lottery Heritage Fund awarded a grant to
PRIORITY CATEGORY: F (F) OWNER TYPE: Charity (here)		develop a major repair and public access project in 2018 followed by a grant of c 3.5M in 2021 for works. Work
OWNER TYPE: Charity (hr	/in use	commenced in February 2023 and is due to complete in
© Historic England		March 2024. Funds are insufficient to tackle all repair needs. Further urgent work took place in 2020 with
© Historic England	eritage)	Historic England Heritage Stimulus Funds.
LIST ENTRY NUMBER: 1264685		Contact: Amanda White 0121 625 6890
Garendon	ole of Venus, Park, Ashby Road, ough, Stonebow	Temple designed by Ambrose Phillipps, 1730s. Located in open parkland, one kilometre south/south west of the site of Garendon Hall. Aligned on the Triumphal Arch to the west along an avenue of alternating deciduous and
DESIGNATION: Listed Buil grade II	ding grade II*, RPG	coniferous trees. Temple not used, but in fair condition although not regularly maintained. The outline application for a Sustainable Urban Extension was approved in 2015,
CONDITION: Fair		subject to a Section 106 Agreement requiring repair and restoration of the park and its buildings. A reserved
OCCUPANCY: Vacant/nc	ot in use	matters planning application was submitted in 2020 that
© Historic England PRIORITY CATEGORY: D (D)		includes the restoration of the park.
OWNER TYPE: Private		
LIST ENTRY NUMBER: 6 09		



	SITE NAME:	The Triumphal Arch, Garendon Park, Ashby Road, Loughborough, Stonebow Village	Triumphal entrance archway designed by Ambrose Phillipps, 1730s. Located on the edge of pleasure grounds around White Lodge, 1100 metres south west of the site of Garendon Hall. Aligned on the Temple of Venus to the
-	DESIGNATION:	Listed Building grade I, RPG grade II	east along an avenue of trees. Arch and lodge in fair condition although not regularly maintained. The outline application for a Sustainable Urban Extension was
	CONDITION:	Fair	approved in 2015, subject to a Section 106 Agreement requiring repair and restoration of the park and its
	OCCUPANCY:	N/A	buildings. A reserved matters planning application was
	PRIORITY CATEGORY:	D (D)	submitted in 2020 that includes the restoration of the park.
	OWNER TYPE:	Private	
	LIST ENTRY NUMBER:	1361136	Contact: Ben Robinson 07823 327796

© Historic England

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed.
 C Slow decay; no solution agreed.

 D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

HERITAGE AT RISK 2023 / MIDLANDS / CHARNWOOD

	SITE NAME:	Ulverscroft Priory ruins, Priory Lane, Ulverscroft	The Priory of St Mary was founded in 1134 by Robert, E of Leicester, and was taken over by the Augustinian order
	DESIGNATION:	Scheduled Monument and Listed Building grade I	in 1174. Visible remains date to C13, C14 and C15. Parts of the outbuildings have been restored as two cottages. The Parlour/Prior's lodging is propped and has a
- n A4 A1	CONDITION:	Very bad	temporary roof. A schedule of repairs was prepared several years ago, but no further progress has been made.
	OCCUPANCY:	Part occupied/part in use	Historic England is seeking engagement with the owner to
	PRIORITY CATEGORY:	D (D)	update condition assessment and repair schedule.
	OWNER TYPE:	Private	
© Historic England	LIST ENTRY NUMBER:	1008554 and 1295073	Contact: Nick Carter 0121 625 6860

A. S. 198.16.9	SITE NAME:	Church of All Saints, Main Street, Cossington	Church of C13-C15 and C19 constructed of granite rubble stone with stone dressings. Awarded a grant from the
	DESIGNATION:	Listed Place of Worship grade II*, CA	Listed Places of Worship Roof Repair Fund in 2015. Roofs are in good condition but below ground drainage is defective. Chancel wall plaster has detached, and the south
STREAM TO BE	CONDITION:	Poor	aisle is damp. The Parochial Church Council applied to the National Lottery Heritage Fund in 2018 and to Historic
	PRIORITY CATEGORY:	C (C)	England's Covid 19 Emergency Heritage at Risk Response
	OWNER TYPE:	Religious organisation	Fund in 2020 but were unsuccessful.
	LIST ENTRY NUMBER:	1228032	Contact: Hanna Good 07825 318060
© Leicester DAC			

	SITE NAME:	Church of St John the Baptist, Main Street, South Croxton	Ironstone rubble church, with ashlar dressings throughout, dating mostly from C14. West tower with spire of large
	DESIGNATION:	Listed Place of Worship grade II*, CA	and squared rubble, three stages and buttressed, on an ashlar plinth. The tower masonry is weathered with some unstable high-level stonework. There are signs internally
	CONDITION:	Poor	that the nave roof and tower are leaking. The rainwater goods require overhauling and possible upgrading. The
	PRIORITY CATEGORY:	C (C)	below ground drainage may also be poor. Repairs to tower
	OWNER TYPE:	Religious organisation	louvres and floors completed in 2022 through grant support from Historic England's Covid 19 Emergency
	LIST ENTRY NUMBER:	1361188	Heritage at Risk Response Fund.
toric England			Contact: Hanna Good 07825 318060

SITE NAME:	Bradgate: house, chapel, garden and watermill, Newtown Linford			
DESIGNATION:	Scheduled Monu	ment, 3 LBs, RPG grade II	LIST ENTRY NUMBER:	1008831
CONDITION:	Generally satisfac problems	ctory but with significant localised	TREND:	Declining
PRINCIPAL VULNERABILITY:	Natural erosion - extensive		NEW ENTRY?:	No
OWNER TYPE:	Local authority		CONTACT:	Amanda White 0121 625 6890
Alter and	SITE NAME:	Garendon Park, Stonebow Village / Shepshed	A remnant Arcadian landscape c1730, complete with triumphal arch and temple (both buildings at risk), design	
	DESIGNATION:	Registered Park and Garden grade II, 13 LBs, SM	by Ambrose Phillipps, a member of the Society of Dilettanti. Now seriously degraded. An outline application for a Sustainable Urban Extension was approved in 2015	
	CONDITION:	Generally satisfactory but with significant localised problems	and restoration (ion 106 Agreement requiring the repair of the park and its buildings. Reserved

© Historic England

© Histo

matters applications for restoration of the park and other VULNERABILITY: High works have been submitted since 2020. TREND: Declining NEW ENTRY ?: No OWNER TYPE: Private LIST ENTRY NUMBER: 1000379 Contact: Ben Robinson 07823 327796

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В implemented.
- C Slow decay; no solution agreed.

 D Slow decay: solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA LB
- LPA NP RPG SM
- Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument
- UA Unitary Authority WHS World Heritage Site

HERITAGE AT RISK 2023 / MIDLANDS / CHARNWOOD / HARBOROUGH

SITE NAME:	Shelthorpe		
DESIGNATION:	Conservation Area	NEW ENTRY?:	No
CONDITION:	Poor	TREND:	Deteriorating
VULNERABILITY:	Low	CONTACT:	Martin Jones (LPA) 01509 634971
SITE NAME:	Shepshed		
SITE NAME: DESIGNATION:	Shepshed Conservation Area, 13 LBs	NEW ENTRY?:	No
		NEW ENTRY?: TREND:	No Deteriorating

HARBOROUGH

	SITE NAME:	Withcote Hall, Oakham Road, Withcote	Country house, early C18, incorporating Tudor building, outbuildings and walled garden. Detailed condition survey
	DESIGNATION:	Listed Building grade II*	carried out in 2002 part-funded by Historic England. The house had deteriorated to a very bad condition through
	CONDITION:	Poor	neglect and water ingress. The roof required repair and recovering; there was extensive rot, structural movement
	OCCUPANCY:	Vacant/not in use	and defective plasterwork. The repair of the main house
	PRIORITY CATEGORY:	E (E)	commenced in 2019 and has largely been completed externally. Historic England researched the building and
	OWNER TYPE:	Private	provided advice to the owner's agent and Harborough District Council. Further repairs are required.
: England	LIST ENTRY NUMBER:	1074844	Contact: Ben Robinson 07823 327796

© Historic E



Church of late C13 but restored and provided with a new SITE NAME Church of St Mary, Gilmorton chancel in 1861. The church comprises a four-stage Road, Ashby Magna embattled west tower, nave with north aisle and blind DESIGNATION: Listed Place of Worship grade II* clerestory and chancel with north vestry. Walls are of random granite rubble with field pebble galletting and CONDITION: Poor limestone dressings. The stonework to the tower is in need PRIORITY CATEGORY: A(A)of repair and the rainwater goods are in a poor condition with the downpipes displaced on the south side of the OWNER TYPE: Religious organisation nave. The church was the subject of heritage crime in 2018 and subsequent funding avenues were explored. LIST ENTRY NUMBER: 1061550 Contact: Hanna Good 07825 318060

© Historic England

indexed and	SITE NAME:	Church of St Peter, Horninghold, Horninghold	The earliest fabric of this small church dates to the C12 and C13, with later C15 work. Restored in 1844, 1904 and
	DESIGNATION:	Listed Place of Worship grade II*, CA	1936. Collyweston slates on the chancel and porch roofs are failing and require repair. Investigations are required to determine the extent of plaster failure to the chancel
	CONDITION:	Very bad	ceiling. The gutters and downpipes are inadequate and not sufficiently discharging water. Drainage works have been
	PRIORITY CATEGORY:	A (A)	undertaken and works to the nave and aisles has been
	OWNER TYPE:	Religious organisation	completed through grant support from Historic England's Covid-19 Emergency Heritage at Risk Response Fund.
	LIST ENTRY NUMBER:	1360671	Contact: Imogen Newcombe 07387 524030

© Historic England



SITE

DES

CO

PRIC

ow

LIST

D

Е

E NAME:	Church of St John the Baptist, King's Norton	Cł W
SIGNATION:	Listed Place of Worship grade I, CA	Sq Th en
NDITION:	Poor	ge his
ORITY CATEGORY:	C (C)	da
VNER TYPE:	Religious organisation	an pa
T ENTRY NUMBER:	1360627	pa als
		C.

hurch in the Gothic Revival style. Built 1757-75 by John Ving the Younger of Leicester for William Fortrey, the quire of King's Norton. Nave and chancel under one roof. he roof covering is in poor condition and is nearing the nd of its life. Renewal is required. Rainwater goods are enerally in fair condition but where there have been storic blockages to downpipes this has accelerated cramp amage in the stonework. Some repointing of stonework nd some minor stonework repairs are required. The arapet pinnacles are suffering from cramp damage and are so in need of repair.

Contact: Imogen Newcombe 07387 524030

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no

- solution agreed. Immediate risk of further rapid В deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but $\ \ F$ not yet implemented. Under repair or in fair to good

repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use)

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

- Conservation Area Listed Building LB
- I PA
- Local Planning Authority National Park NP
- RPG Registered Park and Garden Scheduled Monument
- SM
- ÍΙΑ Unitary Authority World Heritage Site WHS

19

HERITAGE AT RISK 2023 / MIDLANDS / HARBOROUGH

	SITE NAME:	Church of St John the Baptist, Little Stretton	Small parish church with fabric from C12, C13 and C15. Restored late C19 by H.L Goddard of Leicester. Tower
	DESIGNATION:	Listed Place of Worship grade II*	masonry is weathered but whilst there are localised areas of defects, it appears to be generally structurally sound.
ALL OLIVIER ALL AND AL	CONDITION:	Very bad	The tower roof is poorly detailed and has been leaking for some time. Internal floors and access are poor. Pointing
	PRIORITY CATEGORY:	C (C)	generally has eroded or is defective. Rainwater goods
	OWNER TYPE:	Religious organisation	serving the nave and the chancel require overhauling. Below ground drainage may also be poor. An application to
	LIST ENTRY NUMBER:	1294797	the National Lottery Heritáge Fund for repair programmes was unsuccessful in early 2019.
© Historic England			
O Thistoric England			Contact: Hanna Good 07825 318060

Contact: Hanna Good 07825 318060



ALC: N	SITE NAME:	Church of St Giles, Gartree Road, Great Stretton, Little Stretton	Church dating from C12 and rebuilt in 1838. Rubble stone, with coursed squared stone and largely C15 reconstructed ashlar tower. No longer an active place of worship having
3	DESIGNATION:	Listed Place of Worship grade II*	closed in 2022. Its future is uncertain and there is no known progress regarding disposal. Masonry in poor
	CONDITION:	Very bad	condition and there is damp internally. Guttering and downpipes need refurbishment and below ground drainage
	PRIORITY CATEGORY:	A (A)	requires improvement / repair. Tower base and parapet
	OWNER TYPE:	Religious organisation	repairs where undertaken in 2013. A quinquennial inspection was undertaken in January 2023. Further stone
12	LIST ENTRY NUMBER:	1074853	repairs are anticipated.
			Contact: Rosemary Thompson 07768 215540

© Historic England



	SITE NAME:	Church of St Michael, Loddington Lane, Loddington	Church of mainly CI3 and CI4 work with early CI5 nave roof structure. The nave roof leaks, some roof coverings
	DESIGNATION:	Listed Place of Worship grade II*, CA	are displaced and rainwater goods are in poor condition. Below ground drainage appears to be problematic. The nave roof structure and pew platforms have suffered from
	CONDITION:	Very bad	wood boring insect attack. Localised areas of wall plaster have failed and some floor tiles had been colonised by
	PRIORITY CATEGORY:	C (C)	algae. Applications to the National Lottery Heritage Fund
	OWNER TYPE:	Religious organisation	for grants in 2017 (Grants for Places of Worship) and 2019 were unsuccessful. The parish are keen to effect repairs.
	LIST ENTRY NUMBER:	1361009	Contact: Hanna Good 07825 318060

© Historic England

~	SITE NAME:	Church of St Leonard, Misterton with Walcote	
	DESIGNATION:	Listed Place of Worship grade II*	West towe north and
	CONDITION:	Poor	the subject Repairs we
	PRIORITY CATEGORY:	A (A)	goods are
	OWNER TYPE:	Religious organisation	requiring fu Council re
- in all	LIST ENTRY NUMBER:	1294954	Contact: Ir

urch of coursed limestone, sandstone with ashlar Built in CI4 and restored 1863 by William Smith. ver with octagonal spire, nave with clerestory, I south aisle, and chancel. The church has been ct of heritage crime in 2017, 2018 and 2019. vere recently undertaken in 2020. The rainwater inadequate and have caused subsequent damp, further investigation. The Parochial Church emain keen to effect repairs.

Imogen Newcombe 07387 524030

© Mr Ian Paterson. Source: Historic England Archive



D

Е

SITE NAME:	Church of St Andrew, Main Street, Owston and Newbold	Church including remains of the former Augustinian Priory. C13, C14 and later fabric. Restored 1861. Fair order
DESIGNATION:	Listed Place of Worship grade I, SM, CA	generally bar iron-jacking in the spire top. There is longstanding movement in a southern buttress and some masonry needs repairing. A specification is to be prepared
CONDITION:	Poor	to inform grant funding bids. Tower and spire works completed through an Historic England Covid-19
PRIORITY CATEGORY:	F (F)	Emergency Heritage at Risk Response Fund in 2021.
OWNER TYPE:	Religious organisation	Rainwater goods have been recently refurbished and repaired, alongside other masonry and tower repairs.
LIST ENTRY NUMBER:	1074871	Contact: Imogen Newcombe 07387 524030

© Historic England

- Immediate risk of further rapid deterioration or loss of fabric; no А
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; В solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.
- Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).


- CA LB
- LPA
- Conservation Area Listed Building Local Planning Authority National Park NP RPG
- Registered Park and Garden Scheduled Monument
- SM
- UA Unitary Authority WHS World Heritage Site

HERITAGE AT RISK 2023 / MIDLANDS / HARBOROUGH / HINCKLEY AND BOSWORTH

SITE NAME:	Moated site at Ingarsby, Hungarton		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1010839
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Vehicle damage/erosion - extensive	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Rachel Jordan 0121 625 6854

HINCKLEY AND BOSWORTH

	SITE NAME:	Stables and kennels to Bradgate House, Bradgate Hill, Groby	Complex of brick stables and kennels built 1856 to house the 7th Earl of Stamford's 47 horses. Largely ruinous by
4	DESIGNATION:	Listed Building grade II*	1988 and now derelict and in very bad condition having not been maintained for many years. The structure is actively
	CONDITION:	Very bad	deteriorating. There are multiple structural concerns; periodic masonry collapses; uncontrolled and significant ivy
and the state	OCCUPANCY:	Vacant/not in use	growth and self-seeded trees. The local authority has
	PRIORITY CATEGORY:	A (A)	exercised its statutory powers and this may prompt voluntary action in 2023. Historic England is providing grant
	OWNER TYPE:	Commercial company	aid and technical advice to the council. A feasibility study is to commence in 2023.
© Historic England	LIST ENTRY NUMBER:	1361383	Contact: Amanda White 0121 625 6890

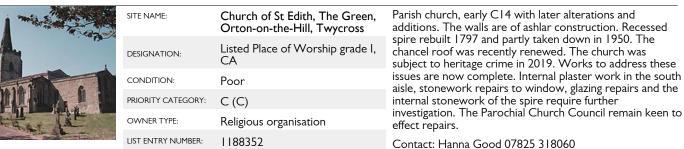

© IoE. Mr Peter J Ellis

SITE NAME:	Barwell B (Arthur Street), Barwell		
DESIGNATION:	Conservation Area	NEW ENTRY ?:	No
CONDITION:	Poor	TREND:	Deteriorating
VULNERABILITY:	Low	CONTACT:	Paul Grundy (LPA) 01455 255671
SITE NAME:	Hinckley Hollycroft, Hinckley		
DESIGNATION:	Conservation Area, LB grade II	NEW ENTRY ?:	No
CONDITION:	Very bad	TREND:	Improving
VULNERABILITY:	Low	CONTACT:	Paul Grundy (LPA) 01455 255671
SITE NAME:	Hinckley Town Centre		
DESIGNATION:	Conservation Area, 24 LBs, SM	NEW ENTRY?:	No
CONDITION:	Poor	TREND:	Deteriorating
VULNERABILITY:	Low	CONTACT:	Paul Grundy (LPA) 01455 255671

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no А

D

Е

- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; в solution agreed but not yet implemented.
- C Slow decay; no solution agreed.

Slow decay; solution agreed but F not yet implemented.

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA
- Conservation Area Listed Building Local Planning Authority National Park LB LPA
- NP RPG
 - Registered Park and Garden Scheduled Monument
- SM
- UA Unitary Authority WHS World Heritage Site

MELTON



SITE NAME:	Church of St Michael, Main Street, Edmondthorpe, Wymondham	Former church, mainly C14. The interior is notable for the fine series of C17 and C18 memorials. Now under the guardianship of the Churches Conservation Trust. The
DESIGNATION:	Listed Building grade I, CA	building was the subject of heritage crime in 2016. Storm damage in early 2020 left the interior vulnerable to water
CONDITION:	Fair	ingress, however recent works to the rainwater goods has resolved this. The interior is suffering from low level damp.
OCCUPANCY:	Part occupied/part in use The Churches Conse	The Churches Conservation Trust has undertaken a wide
PRIORITY CATEGORY:	C (F)	programme of repairs with grant support from Historic England's Covid-19 Emergency Heritage at Risk Response
OWNER TYPE: Charity (heritage)	Charity (heritage)	Fund.
LIST ENTRY NUMBER:	1075128	Contact: Imogen Newcombe 07387 524030

© Historic England



	SITE NAME:	Church of St Leonard, Church Lane, Holwell, Ab Kettleby	Single cell simply church dating occupying elevated position and dating from C13. Nave and chancel under a pitched
	DESIGNATION:	ATION: Listed Place of Worship grade ironstone and limestone. The c	roof with dripping eaves. Walls of coursed squared ironstone and limestone. The church was subject to heritage crime in 2019. The church has recovered roofs in
-	CONDITION:	Poor	2022 with the help of an Historic England Covid-19 Emergency Heritage at Risk Response Fund award in 2020.
	PRIORITY CATEGORY:	C (A)	Historic England additionally provided technical advice
	OWNER TYPE:	Religious organisation	regarding re-roofing. Re-ordering proposals are being prepared.
1	LIST ENTRY NUMBER:	1295131	Contact: Rosemary Thompson 07768 215540

Church Lane, Muston,

Religious organisation

Bottesford

Very bad

1360899

C (C)

© Leicester DAC



SITE NAME:

DESIGNATION:

CONDITION:

OWNER TYPE:

SITE NAME:

DESIGNATION:

CONDITION:

OWNER TYPE:

PRIORITY CATEGORY:

LIST ENTRY NUMBER:

PRIORITY CATEGORY:

LIST ENTRY NUMBER:

© Leicester DAC

Church of All Saints, Church Medieval ironstone church with CI3 tower and chancel and CI4 nave and north aisle; south aisle built and restored Hill, Knipton, Belvoir in C19. The condition of the exterior is fair, but there are Listed Place of Worship grade areas of weathering. Some localised repointing is required. II*, CA The chancel and north porch roof coverings require renewal. There is water ingress to the interior of the Poor church. Rainwater goods and disposal require maintenance C (C) and improvement. The church was subject to heritage crime in 2020. Some roof repairs completed with grant Religious organisation support from Historic England's Covid 19 Emergency Heritage at Risk Response Fund in 2021. 1075083 Contact: Hanna Good 07825 318060 Church of St John the Baptist,

Church, CI3 nave and aisles, CI4 tower and chancel. Restored 1875-6 by C Kirk. A Listed Places of Worship Roof Repair Fund grant was accepted in May 2015 and the nave, chancel, south aisle and south porch roofs have been Listed Place of Worship grade II* repaired. Rainwater goods have also been renewed, however there is no adequate drainage and there are issues of damp. Works to the south porch roof were completed in Spring 2020. Repointing is still required to the ironstone tower and there is poor cementitious pointing to walls elsewhere.

Contact: Hanna Good 07825 318060

© Historic England



SITE NAME:	Church of St James, Church	Parish church of coursed and squared ironstone rubble
	Lane, Little Dalby, Burton and Dalby	with limestone ashlar dressings. The tower was rebuilt, transepts added and the remainder remodelled by R.
DESIGNATION:	Listed Place of Worship grade II*	Brandon, 1851. A National Lottery Heritage Fund and Historic England Repair Grant for Places of Worship was
CONDITION:	Poor	awarded in 2009. The church was subject to heritage crime in 2019, with works to address these issues now complete
PRIORITY CATEGORY:	C (C)	Further repairs are required.
OWNER TYPE:	Religious organisation	
LIST ENTRY NUMBER:	1176630	Contact: Hanna Good 07825 318060

© Historic England

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed. Immediate risk of further rapid В deterioration or loss of fabric; solution agreed but not yet implemented.
- С Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.

D

Е

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use)

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise. New Entry is noted).

ABBREVIATIONS

WHS

- Conservation Area Listed Building CA
- LB I PA
- Local Planning Authority National Park NP
- Registered Park and Garden Scheduled Monument RPG
- SM ΪA
 - Unitary Authority World Heritage Site

HERITAGE AT RISK 2023 / MIDLANDS / MELTON

	SITE NAME:	Church of St Denis, Church Lane, Eaton	Ironstone church, CI3 west tower with short, recessed, ironstone spire. The weathering of the tower ironstone,
	DESIGNATION:	Listed Place of Worship grade I, CA	particularly to the buttresses and at high level is of concer On the north side the tracery to the belfry opening has eroded completely to one side requiring the central mulli to be restrained as a matter of urgency. The jamb stones all four belfry openings require some replacement with th north side being the worst. Elsewhere, the stonework has
	CONDITION:	Poor	
	PRIORITY CATEGORY:	A (New entry)	
200 Tel	OWNER TYPE:	Religious organisation	been adversely affected in a number of locations by historic, cement-based, pointing.
	LIST ENTRY NUMBER:	1075022	Contact: Imogen Newcombe 07387 524030
nort			

© Simon Headley, Church Support



A small parish church of C13 origin with C14 additions. Restored in 1869 and again in 1965. The church has suffered repeated occurrences of heritage crime. Recent repair works have been completed, however remaining temporary protective sheeting is in poor condition and is no longer waterproof. The Diocesan Historic Churches Support Officer is providing advice and fundraising is still underway.

Contact: Imogen Newcombe 07387 524030

© Historic England

	SITE NAME:	Church of St Luke, Church Lane, Gaddesby	Parish church of C12 origin with contributions of C13, C14 and late C18 porch. By 2022 north aisle roof coverings
	DESIGNATION:	Listed Place of Worship grade I, CA	were leaking and there was localised low level damp including adjacent to the south porch and in the vicinity of the fine monument at the east end of the north aisle. The rainwater disposal system required localised repairs and some self-seed vegetation needed to be tackled. Progress
AND DOOD	CONDITION:	Fair	
AL-	PRIORITY CATEGORY:	C (C)	with north aisle roof repairs, planned for 2022, is unknown.
	OWNER TYPE:	Religious organisation	
	LIST ENTRY NUMBER:	1307542	Contact: Hanna Good 07825 318060

© Historic England

SITE NAME: Church of St Peter, Church Lane, Saxelbye, Grimston Parish church of C13 origin, contributions of C14 and C15 and restored 1856-7. The church is constructed of ironstone with limestone dressings. The ironstone tower is topped with a limestone spire. Tower masonry is quite badly eroded and, whilst this is common for ironstone, some erosion is considerable and some sizeable masonry fragments had fallen to the ground. Pointing is in poor / very poor condition generally. There are very many open joints and several holes have formed. INSTEINTRY NUMBER: 1075032				
DESIGNATION:Listed Place of Worship grade II*, CAtopped with a limestone spire. Tower masonry is quite badly eroded and, whilst this is common for ironstone, some erosion is considerable and some sizeable masonry fragments had fallen to the ground. Pointing is in poor / very poor condition generally. There are very many open joints and several holes have formed.	-	Lane, Saxelbye, Grimston and restored 1856-7. T		
CONDITION:Poorsome erosion is considerable and some sizeable masonry fragments had fallen to the ground. Pointing is in poor / very poor condition generally. There are very many open joints and several holes have formed.PRIORITY CATEGORY:A (A)OWNER TYPE:Religious organisation		DESIGNATION:		topped with a limestone spire. Tower masonry is quite
PRIORITY CATEGORY: A (A) OWNER TYPE: Religious organisation		CONDITION:	Poor	some erosion is considerable and some sizeable masonry
OWNER TYPE: Religious organisation		PRIORITY CATEGORY:	A (A)	very poor condition generally. There are very many open
LIST ENTRY NUMBER: 1075032 Contact: Imogen Newcombe 07387 524030		OWNER TYPE:	Religious organisation	joints and several holes have formed.
		LIST ENTRY NUMBER:	1075032	Contact: Imogen Newcombe 07387 524030

© Historic England



SITE NAME:	Church of St Peter, Main Street, Kirby Bellars	A large C13 church, former priory, with C14, C15 and C16 work. Restored late C18, in 1820, and late C19. Ironstone
DESIGNATION:	Listed Place of Worship grade I	walling and a limestone spire. Spire repairs undertaken in 2013 following a National Lottery Heritage Fund Grants for
CONDITION:	Very bad	Places of Worship grant. An unsuccessful application to the National Lottery Heritage Fund in 2018. The church was
PRIORITY CATEGORY:	A (A)	the subject of heritage crime in 2017. Repairs to the tower
OWNER TYPE:	Religious organisation	masonry, roofs and drainage are urgently required; there are fruiting bodies. Historic England's Covid 19 Emergency
LIST ENTRY NUMBER:	1261717	Heritage at Risk Response Fund awarded funds to develop

© Historic England

Contact: Hanna Good 07825 318060

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- solution agreed. Immediate risk of further rapid В deterioration or loss of fabric; solution agreed but not yet implemented.
- С Slow decay; no solution agreed.
- Slow decay; solution agreed but $\ \ F$ not yet implemented.

D

Е

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use)

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- Conservation Area Listed Building CA LB
- I PA
- Local Planning Authority National Park NP
- RPG Registered Park and Garden Scheduled Monument SM
- UÁ
- UA Unitary Authority WHS World Heritage Site

HERITAGE AT RISK 2023 / MIDLANDS / MELTON



Parish church, C13 fabric with C14 tower and chancel. C15 Church of St Peter, Main Street, and C19 re-modelling. The south aisle roof was re-covered in felt during the 1980s but, by 2011, it had failed. A Redmile Listed Place of Worship grade National Lottery Heritage Fund grant was awarded in II*, CA December 201 l for urgent works. These were completed in summer 2013 but there are significant full height Fair movement cracks at the west end of the north nave and PRIORITY CATEGORY: C (C) south clerestory wall. Recipient of an Historic England Covid-19 Emergency Heritage at Risk Response Fund Religious organisation award to investigate movement. Investigations have taken place and repair needs have been identified. LIST ENTRY NUMBER: 1075013 Contact: Hanna Good 07825 318060

© Historic England



VIII - C	SITE NAME:	Church of St Helen, Barkerstone Lane, Plungar, Redmile	Parish church dating from C15 with an earlier C14 tower. The south aisle was rebuilt, and the chapel added in 1855- 56. Constructed from ironstone with limestone dressings.
11.4	DESIGNATION:	Listed Place of Worship grade II*	The church has been the subject of heritage crime in 2019. The tower roof and subsequent roof structure are in poor
100	CONDITION:	Very bad	condition and damp, with significant repairs required. The parish is keen to effect repairs and are investigating possible
	PRIORITY CATEGORY:	A (A)	funding avenues.
0.2	OWNER TYPE:	Religious organisation	
8	LIST ENTRY NUMBER:	1075010	Contact: Hanna Good 07825 318060

© Leicester DAC



SITE NAME:	Church of St Egelwin the Martyr, Church Street, Scalford	Large rural parish church of C13 origin with C15 contributions. Tower rebuilt 1639 and chancel rebuilt
DESIGNATION:	Listed Place of Worship grade II*, CA	1845. Restored 1858 by Millican and Smith. The church is built of local ironstone with limestone dressings. Some tower masonry blocks have eroded significantly,
CONDITION:	Poor	particularly at belfry and parapet levels where there are noticeable holes and gaps. Falling masonry fragments are a
PRIORITY CATEGO	DRY: E (E)	significant concern. Below ground drainage was also
OWNER TYPE: Religious organisation	Religious organisation	problematic. Recipient of Historic England's Covid-19 Emergency Heritage at Risk Response Fund award in 2020
LIST ENTRY NUMB	er: 1075018	to address drainage issues.
		Contact: Imogen Newcombe 07387 524030

© Historic England

S

Г

D

Е

2	
- U .	U
11	TL.

SITE NAME: Parish church of CI2 origin with CI3 additions. Repaired Church of St Mary, Chadwell, CI7 and restored 1865-6 by R W Johnson. There has been Scalford a long history of structural movement. A number of DESIGNATION: Listed Place of Worship grade II* structural ties are evident to the tower and there is extensive cracking to the chancel, of which widened during CONDITION: Poor 2018. It is thought that a lack of below ground drainage, PRIORITY CATEGORY: C (C) clay subsoil and the long dry summer of 2018 are contributing factors. The Parochial Church Council are in OWNER TYPE: Religious organisation receipt of professional structural engineering advice, alongside support from the Diocesan Historic Churches LIST ENTRY NUMBER: 1075015 Support Officer.

© Historic England



		Contact: Imogen Newcombe 07387 524030
SITE NAME:	Church of St Peter, Chapel Lane, Wymondham	Church of C13 origin with C14 and 15 contributions. Much restored in C19. Ironstone church with ashlar
DESIGNATION:	Listed Place of Worship grade I, CA	dressings comprising west tower with spire, nave with clerestory, north and south aisles, north and south transepts, chancel, vestry and south porch. By 2022, much
CONDITION:	Fair	of the ironstone is badly weathered; tower stonework was in particularly poor condition with many open joints,
PRIORITY CATEGORY:	C (C)	localised holes and notable cracking. North aisle roof
OWNER TYPE:	Religious organisation	coverings were in poor condition and required replacement. Repair proposals were prepared in 2022, but
LIST ENTRY NUMBER:	1177844	resources are limited, and funding opportunities are scarce.
		Contact: Amondo \A/bito 0121 (25 (000

© Historic England

Contact: Amanda White 0121 625 6890

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed. Immediate risk of further rapid В deterioration or loss of fabric; solution agreed but not yet implemented.
- С Slow decay; no solution agreed.
- Slow decay; solution agreed but $\ \ F$ not yet implemented.

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use)

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- Conservation Area Listed Building CA
- LB I PA
- Local Planning Authority National Park NP
- RPG Registered Park and Garden Scheduled Monument
- SM ΪA
- Unitary Authority World Heritage Site WHS

HERITAGE AT RISK 2023 / MIDLANDS / MELTON / NORTH WEST LEICESTERSHIRE

SITE NAME:	Melton Mowbray		
DESIGNATION:	Conservation Area, 95 LBs	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	Deteriorating
VULNERABILITY:	Medium	CONTACT:	Toby Ebbs (LPA) 07470 224 606

NORTH WEST LEICESTERSHIRE


	SITE NAME:	Snibston Colliery, Ashby Road	Buildings, structures, machinery and buried remains of
	DESIGNATION:	Scheduled Monument	former Snibston Colliery and adjoining railway, built 1832-4 by the engineers George and Robert Stephenson.
	CONDITION:	Fair	Leicestershire County Council completed a major scheme of repairs under SMC. Schemes for housing development are underway, and a revised offer to visitors. This include cafe facilities and bookable paid tours, alongside a free exhibition. Much progress has been made recently by the
	OCCUPANCY:	N/A	
	PRIORITY CATEGORY:	F (F)	
	OWNER TYPE:	Local authority	County Council and local partners, but conservation challenges remain. Historic England has provided advice
	LIST ENTRY NUMBER:	1018472	and has amended designations

© Historic England

©Ν Cou

	SITE NAME:	The Royal Hotel, Station Road, Ashby-de-la-Zouch	Hotel built c. 1826 and constructed of red brick and stone Large porch with Greek Doric columns where the fluting
	DESIGNATION:	Listed Building grade II*, CA	has been removed. Since the hotel closed in 2018 the building has been vacant and has suffered from heritage
	CONDITION:	Poor	crime. The roofs and rainwater disposal system require renewal. Delamination of stone 'slips' to elevations.
THE REAL	OCCUPANCY:	Vacant/not in use	Internally there is defective plaster work and failing ceilings
	PRIORITY CATEGORY:	C (C)	as a result of water ingress and stolen pipework. The building owners commissioned a condition report in 2020.
	OWNER TYPE:	Commercial company	There is a live planning application on the site for a large amount of new development.
North West Leicestershire District puncil	LIST ENTRY NUMBER:	1073594	Contact: Rosemary Thompson 07768 215540
1	SITE NAME:	Church of St Michael and All Angels, Church Street, Appleby Magna	Possibly C14 origin, west of former moated manor hous External drainage renewed and extended in 2016 with funds from the Listed Places of Worship Roof Repair Fun
	DESIGNATION:	Listed Place of Worship grade II*, CA	Low level plaster removed. Pews, platforms and boxes require sensitive repair once masonry has dried. Window tracery and glazing in poor condition. Specialist reports
AR	CONDITION:	Poor	were obtained for an application to the National Lottery Heritage Fund but the scheme was suspended in 2020 due
	PRIORITY CATEGORY:	A (A)	to Covid-19. Recipient of Historic England's Covid-19
	OWNER TYPE:	Religious organisation	Emergency Heritage at Risk Response Fund award in 2020

© Historic England

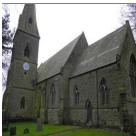

© Historic England

	SITE NAME:	Church of St Margaret of Antioch, Main Street, Blackfordby, Ashby-de-la-Zouch	A prominently sited church built 1856-8 by H I Stevens. It replaces an earlier church and includes a C18 monument and a fragment of medieval stained glass in the chancel. The
	DESIGNATION:	Listed Place of Worship grade II, CA	nave has a 5-bay hammerbeam roof. The church is suffering from blocked gutters, slipped slates, plant growth to the spire and undersized rainwater goods. Temporary covering
	CONDITION:	Very bad	of the west end gable after partial collapse of the external skin in 2020 was undertaken with grant support from
	PRIORITY CATEGORY:	B (B)	Historic England's Covid 19 Emergency Heritage at Risk
	OWNER TYPE:	Religious organisation	Response Fund. West end gable has now been repaired.
	LIST ENTRY NUMBER:	1073641	Contact: Hanna Good 07825 318060

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; В solution agreed but not yet implemented.
- C Slow decay; no solution agreed.

1177814

Religious organisation

LIST ENTRY NUMBER:

 D Slow decay: solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

Contact: Nick Carter 0121 625 6860

for repairs to chancel windows, now completed.

Contact: Imogen Newcombe 07387 524030

- CA LB
- LPA
- Conservation Area Listed Building Local Planning Authority National Park NP RPG SM
- Registered Park and Garden Scheduled Monument
- UA Unitary Authority WHS World Heritage Site

HERITAGE AT RISK 2023 / MIDLANDS / NORTH WEST LEICESTERSHIRE / OADBY AND WIGSTON / BOSTON

	SITE NAME:	Church of St Mary, Ashby Road,	Parish church with C14 and C15 work restored c1850 sitting adjacent to Coleorton Hall, Joints in the guttering
	LIST LINTRE NUMBER:	1361370	Contact: Hanna Good 07825 318060
© Historic England	LIST ENTRY NUMBER:	12/1270	Contract: Hanna Cood 0792E 2190/0
	OWNER TYPE:	Religious organisation	
	PRIORITY CATEGORY:	C (C)	
	CONDITION:	Poor	Repairs have been undertaken to address this. The roof the base of the tower spire is cracked and allowing water in. Rainwater goods are defective and drainage requires attention. The interior is suffering from low level damp.
	DESIGNATION:	Listed Place of Worship grade II*, CA	
	SITE NAME:	Church of St Edward King and Martyr, Clapgun Street, Castle Donington	An early CI3 parish church, with aisles widened CI4. Restored in 1876-77 by William Smith of the Adelphi, London. The church was subject to heritage crime in 2019.

	SITE NAME:	Church of St Mary, Ashby Road, Coleorton, Coleorton	sitting adjacent to Coleorton Hall. Joints in the guttering
1	DESIGNATION: Listed Place of Worship grade II*, CA		and downpipes have failed in places leading to saturation of surrounding stonework and the basal courses of the walls. There is also considerable moss growth at plinth level on
	CONDITION: Poor PRIORITY CATEGORY: C (C) OWNER TYPE: Religious organisation	Poor	the north side of the tower and the drainage channels are not working efficiently. The interior of the church is damp
)		C (C)	and the plaster work to the walls and ceiling has failed in
		places. The Parochial Church Council are considering options.	
LIST ENTRY NUN	LIST ENTRY NUMBER:	1073571	Contact: Imogen Newcombe 07387 524030

© Historic England

	SITE NAME:	Church of St Michael, Ravenstone with Snibstone	Parish church of early C14, restored C19. Stonework is in very poor condition, particularly to the octagonal broached
	DESIGNATION:	Listed Place of Worship grade II*, CA	spire and tower. The 2018 Quinquennial Inspection identified several movement cracks requiring urgent investigation. Further urgent repairs are needed to the
	CONDITION:	Poor	tower, the internal and external faces of the spire and masonry elsewhere. A defective rainwater disposal syste is causing significant damp issues. Major repairs have sinc
	PRIORITY CATEGORY:	D (C)	
	OWNER TYPE:	Religious organisation	been undertaken with support from Historic England's Covid-19 Emergency Heritage at Risk Response Fund.
	LIST ENTRY NUMBER:	1074380	Contact: Imogen Newcombe 07387 524030
ource Historic			

© Ms Elaine Allen. Source Historic England Archive

OADBY AND WIGSTON

	SITE NAME:	Church of St Wistan, Church Nook, Wigston	Early C14 tower remains of a church demolished C17. The rest was rebuilt in 1853 by Walker and Goodacre and
	DESIGNATION:	Listed Place of Worship grade II, CA	restored 1877 by R J & J Goodacre. Tower of limestone, otherwise uncoursed granite rubble and Welsh slate roof. The rainwater disposal system is undersized and ineffective Failing joints in gutters have caused long-term water ingress into earthen mortar core of walls, resulting in separation of external fabric. The failure of the external face is evident. The Parochial Church Council were previously keen to effect repairs and seek funding, however the process of
	CONDITION:	Poor	
	PRIORITY CATEGORY:	A (A)	
	OWNER TYPE:	Religious organisation	
	LIST ENTRY NUMBER:	1361576	closure is underway.
wart (Architect)			Contact: Imogen Newcombe 07387 524030

© Mark Stew

LINCOLNSHIRE

BOSTON			
	SITE NAME:	Shodfriars Hall, 2 and 4, South Street	Former Guild Hall, c1400. C17 additions. Restored and extended by John Oldrid Scott and George Gilbert Scott Jnr 1873-75 for Boston Conservative Club, adding theatrical hall to the rear. Following Historic England funded investigations, urgently necessary works at high level have been attended to. Further repairs are required to the roof and throughout the building. The new owner has undertaken some repairs, alterations and fit-out to accommodate new uses and the building is now partly in
	DESIGNATION:	Listed Building grade II*, CA	
	CONDITION:	Poor	
	OCCUPANCY:	Part occupied/part in use	
	PRIORITY CATEGORY:	B (A)	
	OWNER TYPE:	Commercial company	use.
© Historic England	LIST ENTRY NUMBER:	1388998	Contact: Ben Robinson 07823 327796

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В implemented.
- C Slow decay; no solution agreed.
- D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).
 - Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.
- NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA LB
- LPA NP RPG SM
- Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument
- UA Unitary Authority WHS World Heritage Site

HERITAGE AT R	ISK 2023 / MIDL	ANDS / BOSTON

HERITAGE AT RISK 2023 / MIDLAI	NDS / BOSTON		
(line and	SITE NAME:	Rochford Tower, Rochford Tower Lane, Fishtoft	Brick tower, c1460 with C17 and C19 alterations. There are vertical cracks in the brickwork on the north and west
West-	DESIGNATION:	Scheduled Monument and Listed Building grade I	elevations. The infill in the original west window is collapsing inwards. Brickwork on the parapet is unstable together with timber and floor remnants in the unroofed
	CONDITION:	Very bad	interior. Minimal repairs were carried out in 1988, includir repointing the south east turret. Nothing has been done
	OCCUPANCY:	N/A	since. The owner has not been able to take up an offer of
	PRIORITY CATEGORY:	A (A)	Historic England grant funding for a condition survey and options appraisal.
	OWNER TYPE:	Private	
© Historic England	LIST ENTRY NUMBER:	1016693 and 1062088	Contact: Ben Robinson 07823 327796
12 An	SITE NAME:	Church of St Peter and St Paul, Church Lane, Algarkirk	Parish church dating from the C12. Extensive roof repairs were completed in 2014 under a joint Historic England an
	DESIGNATION:	Listed Place of Worship grade I	National Lottery Heritage Fund Repair grant for Places of Worship. Improvement to the below-ground drainage
	CONDITION:	Poor	system is required; there has been a recent outbreak of d
	PRIORITY CATEGORY:	C (C)	rot at floor level. The church is experiencing structural movement, cracking to walling and damage to windows.
	OWNER TYPE:	Religious organisation	The church has been a victim of heritage crime. The National Lottery Heritage Fund Stage Two grant awarded
	LIST ENTRY NUMBER:	1164857	in 2018 was withdrawn in early 2020. The Parochial
© Historic England			Church Council is considering future options. Contact: Ben Robinson 07823 327796
	SITE NAME:	Church of All Saints, Old Main Road, Fosdyke	Church of 1871 in the Geometric style constructed from red brick with ashlar dressings and slate roof with covere
	DESIGNATION:	Listed Place of Worship grade II	spire. The building is in poor condition. Rainwater goods are defective and numerous downpipes and gutters leak.
	CONDITION:	Poor	There is evidence of movement between the tower and
	PRIORITY CATEGORY:	C (C)	aisle; defects in the valley gutter between the two have allowed water to penetrate inside. There is a large crack
	OWNER TYPE:	Religious organisation	the east window and signs of movement elsewhere. Som minor repairs have been completed and discussions have
	LIST ENTRY NUMBER:	1360494	taken place regarding a future repair project.
© Historic England			Contact: Ben Robinson 07823 327796
	SITE NAME:	Church of St James, Church End Road, Freiston	Large parish church of C12 and later date, with pre- Conquest origins, formerly the church of Freiston Priory.
C	DESIGNATION:	Listed Place of Worship grade I	The church forms one element of the wider Priory and
	CONDITION:	Poor	post-Dissolution complex. There is significant direct risk of damage to fabric and loss of associated archaeological
State I Links	PRIORITY CATEGORY:	A (A)	remains which comprise an important part of the setting the church. This is due to works immediately adjacent to
ALL PARTY	OWNER TYPE:	Religious organisation	the church, but latterly beyond the control of the church
	LIST ENTRY NUMBER:	1308415	authorities. Contact: Ben Robinson 07823 327796
© Historic England			Contact. Den Köbinson 07623 327776
	SITE NAME:	Church of St Mary and St Nicholas, Church Lane, Wrangle	Parish church of limestone ashlar with fabric from C13- C16. Restored 1875-8 by Ewan Christian. The church wa the subject of heritage crime in 2019 and a temporary
	DESIGNATION:	Listed Place of Worship grade I, CA	solution has been put in place. The Parochial Church Council are keen to effect repairs and are investigating possible funding sources.
	CONDITION:	Poor	

© Mr John Scarbro. Source: Historic England Archive

Contact: Imogen Newcombe 07387 524030

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В implemented.
- C Slow decay; no solution agreed.

PRIORITY CATEGORY:

LIST ENTRY NUMBER:

OWNER TYPE:

C (C)

1308367

Religious organisation

 D Slow decay: solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

SITE NAME:	Multon Hall moated site, Frampton		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1018584
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Ben Robinson 07823 327796
SITE NAME:	Bicker		
DESIGNATION:	Conservation Area, 7 LBs	NEW ENTRY?:	No
CONDITION:	Poor	TREND:	No significant change
VULNERABILITY:	High	CONTACT:	Matthew Bentley (LPA) 01529 414155
SITE NAME:	Boston, Boston Town Centre		
DESIGNATION:	Conservation Area, 225 LBs	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	Improving
VULNERABILITY:	Medium	CONTACT:	Matthew Bentley (LPA) 01529 414155
SITE NAME:	Kirton		
DESIGNATION:	Conservation Area, 11 LBs	NEW ENTRY ?:	No
CONDITION:	Poor	TREND:	Deteriorating
VULNERABILITY:	High	CONTACT:	Matthew Bentley (LPA) 01529 414155
SITE NAME:	Swineshead		
DESIGNATION:	Conservation Area, 7 LBs, SM	NEW ENTRY?:	No
CONDITION:	Poor	TREND:	Deteriorating
VULNERABILITY:	Medium	CONTACT:	Chris Holliday (LPA) 01205 314337

EAST LINDSEY

	SITE NAME:	Windmill, east Street, Alford	Windmill. Tower mill of 6 floors. 1837, restored 1979, built
	DESIGNATION:	Listed Building grade I, CA	by Alford millwright, Sam Oxley. Tarred brick. The wooden ogee cap and sails were removed for safety c.2020
	CONDITION:	Very bad	following rot within the structural elements. Sails now entirely lost, cap and fantail require substantial repair. A
	OCCUPANCY:	Vacant/not in use	temporary cap is in place over the top floor of the mill to
	PRIORITY CATEGORY:	B (B)	minimise further deterioration. Lincolnshire County Council is keen to effect repairs and working towards full
	OWNER TYPE:	Local authority	cap and sail reinstatement. Funding has been secured for proposed repairs.
	LIST ENTRY NUMBER:	1146936	Contact: Imogen Newcombe 07387 524030

© East Lindsey District Council



© Lincolnshire County Council

	SITE NAME:	Dobson's Windmill, High Street, Burgh Le Marsh	Windmill of five storeys. 1813 by Oxleys of Alford, restored 1947. Wooden ogee shaped cap with moulded brick eaves,
	DESIGNATION:	Listed Building grade I	ball finials, fantail and 5 left handed patent sails. The mill suffered storm damage in early 2020 which destroyed the
Ĺ	CONDITION:	Very bad	sails, cap and fantail. A temporary cap is in place over the top floor of the mill to minimise further deterioration. Initial
1	OCCUPANCY:	Part occupied/part in use	repairs have been undertaken and window repairs have
	PRIORITY CATEGORY:	B (B)	recently been completed. Lincolnshire County Council are engaged with key specialists and are exploring options for
	OWNER TYPE:	Local authority	the design of the mill cap, sails and associated new components.
	LIST ENTRY NUMBER:	1222732	Contact: Imogen Newcombe 07387 524030

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В implemented.
- C Slow decay; no solution agreed.
- D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user lidentified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA LB LPA NP RPG SM
- Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument
- UA Unitary Authority WHS World Heritage Site

HERITAGE AT	RISK 2023		FAST	
	10010 2025	, , ,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,	L) (0	

OCCUPANCY:

OWNER TYPE-

SITE NAME:

DESIGNATION:

CONDITION:

OCCUPANCY:

OWNER TYPE:

SITE NAME:

D

Е

DESIGNATION:

PRIORITY CATEGORY:

LIST ENTRY NUMBER:

PRIORITY CATEGORY:

LIST ENTRY NUMBER:

HERITAGE AT RISK 2023 / HIDLAI			
	SITE NAME:	Church Close (The Old Parsonage), High Street, Coningsby	Former rectory, now house. CI4 and CI5 with later additions and alterations. Rare domestic example of a CI4 cruck framed hall, with high status carvings. Only the CI9
	DESIGNATION:	Listed Building grade I	wing is occupied. Water ingress from roof, decaying timberwork, and cracks in brickwork. A condition survey
	CONDITION:	Poor	and development appraisal was carried out in 2014, funded by Historic England. Proposals have not progressed.
	OCCUPANCY:	Part occupied/part in use	by historic England. Proposais have not progressed.
© Historic England	PRIORITY CATEGORY:	C (C)	
	OWNER TYPE:	Private	
	LIST ENTRY NUMBER:	1215282	Contact: Jane Holt 07425732881
	SITE NAME:	Former Church of St Bartholomew, Village Street, Covenham St. Bartholomew	Former church, late C14 - early C15. St Bartholomew's is the earlier of two churches in the village and may have served as a pre-Conquest minster church. Restored 1854-5
	DESIGNATION:	Listed Building grade II*	and 1863-4, The fabric is chalk and greenstone with brick patching. Roofs leak and rainwater goods and drains are
	CONDITION:	Very bad	largely ineffective. There is damp, water ingress and structural movement. Trustees secured Historic England
	0.001/041/07/		Structural movement. Trustees secured Historic England

Vacant/not in use

Charity (heritage)

Friskney Methodist Chapel,

Chapel Lane, Friskney

Listed Building grade II*

Part occupied/part in use

A (A)

1063108

Fair

F (F)

Private

1267369

© Historic England



© East Lindsey District Council



Roman curtain wall, late C3 to mid C4, which survives as SITE NAME: Remains of Roman wall, both standing masonry and as buried remains in various Horncastle ownerships. One visible section has been incorporated into Scheduled Monument and Listed Horncastle Library. The condition of each section of the DESIGNATION: Buildings - 5 grade I, CA monument varies, but uncontrolled vegetation growth and weathering threatens several of the exposed sections. CONDITION: Fair Historic England grant-aided repairs of the southwest corner of the wall circuit completed in 2022. There have OCCUPANCY: N/A been some premature mortar failures and remedial work is PRIORITY CATEGORY: F (F) planned for summer 2023. OWNER TYPE: Other not for profit group Contact: Amanda White 0121 625 6890

1005034 and 1063769; LIST ENTRY NUMBER 1251668; 1262504; 1262720; 1262704

The Sycamores, Westgate,

Listed Building grade II*, CA

Louth

House, early C19, in Elizabethan style. Some repairs previously carried out, Further repairs are necessary and overall condition is deteriorating.

Covid 19 Emergency Heritage at Risk funds in 2020, covering urgent structural repairs, and the re-roofing of the

activities was awarded in 2022.

longer used for worship.

Contact: Amanda White 0121 625 6890

Contact: Ben Robinson 07823 327796

south transept. A Historic England grant for development

Typical Fenland chapel of 1839, with later alterations. No

- 317	CONDITION:	Poor	
I	OCCUPANCY:	Part occupied/part in use	
-	PRIORITY CATEGORY:	C (C)	
in de h	OWNER TYPE:	Private	
	LIST ENTRY NUMBER:	1063180	Contact: Jane Holt 07425732881

© Historic England

© Historic England

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no

- solution agreed. Immediate risk of further rapid В deterioration or loss of fabric: solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented. Under repair or in fair to good

repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use)

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise. New Entry is noted).

ABBREVIATIONS

- Conservation Area Listed Building
- LB I PA

ΪA

- Local Planning Authority National Park NP
- RPG
- Registered Park and Garden Scheduled Monument SM
- WHS
 - Unitary Authority World Heritage Site

1-1	SITE NAME:	Church of All Saints, Church Lane, Maltby Le Marsh	Former parish church, late C13 to early C14, tower rebuilt in 1700, chancel altered 1788. The building has been sold
- I STA	DESIGNATION:	Listed Building grade II*	and Planning Permission has been granted for change of use to an artist's studio. Some repairs have been carried out.
I the interior	CONDITION:	Fair	
1	OCCUPANCY:	Vacant/not in use	
	PRIORITY CATEGORY:	D (D)	
	OWNER TYPE:	Private	
Lindsey District Council	LIST ENTRY NUMBER:	1146990	Contact: Ben Robinson 07823 327796

storic England	SITE NAME:	Revesby Abbey and stable yard, Main Road, Revesby	Country house and stable block, 1845. Approached from the south by a 1km drive, set in a medieval deer park,
	DESIGNATION:	Listed Building grade I, RPG grade II, CA	landscaped in late C18. House, gardens and stable privately owned. Current owner has made progress with repairs to the stable block, but the main house is still at serious risk.
	CONDITION:	Very bad	
	OCCUPANCY:	Vacant/not in use	
	PRIORITY CATEGORY:	A (A)	
	OWNER TYPE:	Private	
	LIST ENTRY NUMBER:	1288157	Contact: David Walsh 0121 625 6888





© East Li

© Histo

		. 200107	
	site name:	Church of St Botolph, Church Lane, Skidbrooke with Saltfleet Haven	Parish church, now redundant. Early C13, C14, C15, 1854, 1871, C20. Subject to repeated heritage crime the building is now in ruinous state. Recent sudden movement to the
	DESIGNATION:	Listed Building grade I	north-east corner of the church has necessitated closure to the public while emergency stabilisation and holding repairs
	CONDITION:	Very bad	were undertaken. The owners are keen to undertake further investigations to establish the broader repair needs
	OCCUPANCY:	Vacant/not in use	and options to bring the building back into use, they are
	PRIORITY CATEGORY:	A (A)	seeking funding and local engagement to do so.
	OWNER TYPE:	Charity (heritage)	
	LIST ENTRY NUMBER:	1165864	Contact: Jane Holt 07425732881

	SITE NAME:	Church of St Swithin, Church Lane, Baumber	Parish church, coursed limestone rubble construction with fabric from CII, CI2 and CI3. Completely brick clad and
	DESIGNATION:	Listed Place of Worship grade I	refenestrated in 1758. Restored in 1892 by W. Scorer. The church was the subject of heritage crime in 2019. Repairs
1 mail	CONDITION:	Poor	are required to the roof. The Parochial Church Council are exploring funding options and are keen to effect repairs.
	PRIORITY CATEGORY:	C (C)	
	OWNER TYPE:	Religious organisation	
and as	LIST ENTRY NUMBER:	1063173	Contact: Imogen Newcombe 07387 524030

© Mr Roger H Mockford. Source: Historic England Archive



Parish church with mid-C12 fabric, rebuilt by James Fowler SITE NAME: Church of St Julian, Church in 1875. There is loose and fallen stonework in the north Lane, Benniworth parapet, with open and washed out mortar joints at high-DESIGNATION Listed Place of Worship grade II level on the tower and spire. There is historical structural movement within the tower, and cracking in the nave and CONDITION: Poor transepts. There are issues of long-term damp and PRIORITY CATEGORY: C (C) rainwater ingress, with dry-rot and decayed structural roof timbers, with loose and fallen high-level plasterwork. The OWNER TYPE: Religious organisation church suffers from poor ventilation. The Parochial Church Council are keen to undertake repairs and minor roofing LIST ENTRY NUMBER: 1063091 works are scheduled.

© Diocese of Lincoln

Contact: Imogen Newcombe 07387 524030

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; В solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented. Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no

D

Е


use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented. obvious new user (applicable only to buildings capable of beneficial

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA
- LB LPA
- Conservation Area Listed Building Local Planning Authority National Park NP
- RPG
- Registered Park and Garden Scheduled Monument SM
- UA WHS Unitary Authority World Heritage Site

	SITE NAME:	Church of St Peter and St Paul, Main Street, Bolingbroke, Bolingbroke	Parish church of 1360, possible built for John of Gaunt. Partly destroyed in the Civil War and restored 1866. The building has been poorly maintained but a local interest group has been formed and are actively seeking funding to undertake repairs. A Covid19 Emergency Heritage at Risk Response Fund Grant has enabled urgent holding repairs to be undertaken, however, a broader scope of repairs is required to address issues with roofs, rainwater goods, drainage and structural issues with boiler chimney. The
	DESIGNATION:	Listed Place of Worship grade II*, CA	
	CONDITION:	Poor	
	PRIORITY CATEGORY:	D (C)	
A State of the second second	OWNER TYPE:	Religious organisation	Friends Group have been successfully awarded funding for ongoing works.
© Historic England	LIST ENTRY NUMBER:	1359705	Contact: Imogen Newcombe 07387 524030

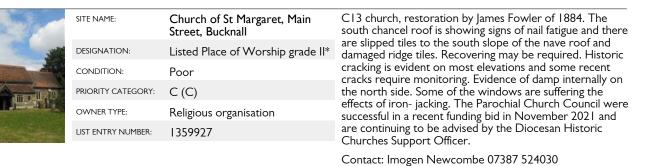

© Historic England

	SITE NAME:	Church of St Helen, Church Lane, East Keal	Parish church with fabric from CI3 and CI4. Restored and rebuilt externally with tower of 1853-4 by Stephen Lewin.
	DESIGNATION:	Listed Place of Worship grade II*	Repairs to the tower cladding are now complete, however the roofs are coming to the end of their lives and there are
	CONDITION:	Poor	numerous tingles and slipped slates. The rainwater goods are also in need of repair. The Parochial Church Council
	PRIORITY CATEGORY:	D (D)	were successful in a recent funding bid in November 2021
	OWNER TYPE:	Religious organisation	and are continuing to be advised by the Diocesan Historic Churches Support Officer on further fundraising avenues.
-	LIST ENTRY NUMBER:	1166170	Contact: Imogen Newcombe 07387 524030

© Mr John Scarbro. Source: Historic England Archive

SITE NAME:	Church of St Nicholas, Church Lane, East Kirkby	Parish church with CI3, CI4, CI6, extensively restored CI9 and 1904-6. The tower is unusually located to the
DESIGNATION:	Listed Place of Worship grade II*	south, and contains the entrance porch. The west wall heavily buttressed. The site has been subject to heritage crime. Rainwater goods need repairing, and the north sid of the church needs vegetation management in order to allow maintenance access. Greensand stonework walling
CONDITION:	Fair	
PRIORITY CATEGORY:	A (A)	
OWNER TYPE:	Religious organisation	heavily eroded, and suffers from previous cement pointing internally and externally.
LIST ENTRY NUMBER:	68096	Contact: Ben Robinson 07823 327796
	DESIGNATION: CONDITION: PRIORITY CATEGORY: OWNER TYPE:	Lane, East KirkbyDESIGNATION:Listed Place of Worship grade II*CONDITION:FairPRIORITY CATEGORY:A (A)OWNER TYPE:Religious organisation

© Historic England

SITE NAME:	Church of All Saints, Church Lane, Friskney	Parish church. Late C12, late C13, mid C14, mid C15, restored by W. Butterfield in 1879. Limestone rubble and
DESIGNATION:	Listed Place of Worship grade I	ashlar, some red sandstone, some red brick and some render. Stone coped gables and cross finials. The church
CONDITION:	Poor	has been subject to heritage crime and is at risk of water ingress. The PCC are keen to effect repairs, fundraising has
PRIORITY CATEGORY:	D (D)	been impeded by CoVID-19.
OWNER TYPE:	Religious organisation	
LIST ENTRY NUMBER:	1223280	Contact: Imogen Newcombe 07387 524030
	DESIGNATION: CONDITION: PRIORITY CATEGORY: OWNER TYPE:	Lane, FriskneyDESIGNATION:Listed Place of Worship grade ICONDITION:PoorPRIORITY CATEGORY:D (D)OWNER TYPE:Religious organisation

© Historic England

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; В solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.

D

Е

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA
- LB LPA
- Conservation Area Listed Building Local Planning Authority National Park
- NP RPG Registered Park and Garden Scheduled Monument
- SM
- UA WHS Unitary Authority World Heritage Site

	SITE NAME:	Church of St Helen, Biscathorpe, Gayton Le Wold	Small rural parish church of 1847 by WA Nicholson of Lincoln in a Gothic style. Lined stucco render with ashlar dressings and a slated roof. There is localised render failur and broken glass. Various slate roof defects are evident, and there is subsequent water ingress through the tower and nave roofs. Isolated iron cramp damage. The church is
	DESIGNATION:	Listed Place of Worship grade II*	
	CONDITION:	Very bad	
	PRIORITY CATEGORY:	A (A)	presently disused, and the process of closure is underway.
	OWNER TYPE:	Religious organisation	
	LIST ENTRY NUMBER:	1168152	Contact: Imogen Newcombe 07387 524030

© Historic England

	SITE NAME:	Church of St Clement, Church Lane, Grainthorpe	A spacious Marshland church, dating from the C12, with decorated and perpendicular phases. There is evidence of a
	DESIGNATION:	Listed Place of Worship grade I	restoration circa 1740 when the battlemented parapets and the ogee north door might have been constructed.
	CONDITION:	Poor	The chancel was restored and shortened in 1876 by Fowler. The north aisle roof is of considerable age, with graffiti, including hands and boots and three sailing ships
	PRIORITY CATEGORY:	C (C)	
	OWNER TYPE:	Religious organisation	one dated 1740. Roof coverings and stonework are in poor repair. National Lottery Heritage Fund Grants for Places of
	LIST ENTRY NUMBER:	1308429	Worship grant was offered in 2015. Works are now complete. A further phase of works is needed.
			Contact: Ben Robinson 07823 327796
			Contact. Den Robinson 07023 327770

© Historic England

	SITE NAME:	Church of All Saints, Church Lane, Greetham with Somersby	Parish church with C12 origins and heavily restored in 1903 with the chancel, vestry and porch rebuilt. Constructed
	DESIGNATION:	Listed Place of Worship grade II	from dressed stone with some red brick and render and half-timbering. The church was subject to heritage crime in
	CONDITION:	Poor	2019. A Faculty application for these repair works was approved in 2019, and the Parochial Church Council are keen to undertake these repairs. Support for investigating
	PRIORITY CATEGORY:	B (B)	
	OWNER TYPE:	Religious organisation	potential funding avenues is being provided by the Diocesan Historic Churches Support Officer.
	LIST ENTRY NUMBER:	1147285	Contact: Imogen Newcombe 07387 524030

© Historic England

	SITE NAME:	Church of St Edith, Tinkle Street, Grimoldby	A substantial church of Spilsby greensand with much eroded stone. Its C16 roof structure still survives, but this
	DESIGNATION:	Listed Place of Worship grade I	ancient timberwork has suffered from extensive dampness due to defective roof coverings and very bad high level
	CONDITION:	Poor	rainwater disposal arrangements. Recently re-roofed with National Lottery Heritage Fund Grant for Places of
	PRIORITY CATEGORY:	C (C)	Worship funding. Structural movement to the tower and
	OWNER TYPE:	Religious organisation	south aisle and the condition of stonework to the tower gives cause for concern. The church has been a victim of
	LIST ENTRY NUMBER:	1359986	heritage crime.
			Contact: Ben Robinson 07823 327796

© Historic England

© GMS Architecture



SITE NAME:	Church of St John the Baptist, Gravel Pit Lane, High Toynton	Parish church of gr limestone ashlar d
DESIGNATION:	Listed Place of Worship grade II	Christian, re-using south-west porch
CONDITION:	Very bad	roof has a number renewal, as do the
PRIORITY CATEGORY:	A (A)	suffered with struc
OWNER TYPE:	Religious organisation	have been attemp the tower collapse
LIST ENTRY NUMBER:	1062998	Heritage Fund Gra

green sandstone rubble blocks and dressings. Rebuilt in 1872 by Ewan ng some mid C12 fragments. Nave with h tower, chancel with vestry. The nave er of slipped slates and requires repair and e rainwater goods. The tower has uctural movement historically and there pts to underpin the structure, however ed in early 2020. A National Lottery rant was awarded in early 2022 for investigatory and repair works to the tower.

Contact: Imogen Newcombe 07387 524030

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no А

- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; В solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- D Slow decay; solution agreed but F not yet implemented.

Е

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA
- LB LPA
- Conservation Area Listed Building Local Planning Authority National Park NP RPG
- Registered Park and Garden Scheduled Monument SM
- UA Unitary Authority WHS World Heritage Site

Lane, Huttoft

Religious organisation

Poor

B (A)

1360009



Parish church from C13, with restorations in 1869, 1882 Church of St Margaret, Church and 1910. The tower is in poor condition and inaccessible, due to pigeon detritus and nesting. The chancel roof has Listed Place of Worship grade I missing and slipped slates, with failing tile battens. This has deteriorated to create holes in the roof, permitting water ingress into the building and onto the laths. The rainwater goods are defective and blocked with vegetation, with further damp and biological growth on most elevations. There is a hairline crack and void in the south porch. The parish are working with the Diocese to consider future repair schemes.

Contact: Imogen Newcombe 07387 524030



SITE NAME:	Church of St Lawrence, The Green, Revesby, Revesby	Parish church dating to 1891 by C. Hodgson Fowler in the Decorated style. Ashlar with plain tiled roofs. Western
DESIGNATION:	Listed Place of Worship grade II, CA	tower, nave, chancel, south porch, vestry. The church has suffered batten failure to north side of the nave roof. Rainwater goods appear undersized, are nearing the end of
CONDITION:	Poor	their lives and will require renewal. Masonry is saturated and vegetation is colonising as a result of defective gutters.
PRIORITY CATEGORY:	A (A)	Some slipped tiles are also visible on the south slope of the
OWNER TYPE:	Religious organisation	nave roof. The church is otherwise in fair condition and appears to be well cared for. The PCC are keen to effect
LIST ENTRY NUMBER:	1215306	repairs.

© Historic England



Contact: Hanna Good 07825 318060 Church of St Benedict, Church Situated in an open field. The church dates from C13 and SITE NAME: CI5, with chancel and nave and an arcaded Early English Lane, Scrivelsby north aisle. To the north west end is the tower and spire DESIGNATION: Listed Place of Worship grade II* built from Ancaster limestone in the 1860s. The building exterior was remodelled in the 1860s and 1870s. Nave and CONDITION: Poor north aisle roofs need re-slating. The church is damp. PRIORITY CATEGORY: F (D) Below ground drainage needs repair. A National Lottery Heritage Fund grant was awarded in December 2019 to OWNER TYPE: Religious organisation address the roof and rainwater goods. These works were completed in 2021. Monitoring of structural issues to the LIST ENTRY NUMBER: 1252195 chancel is ongoing.

© Historic England



D

Е

		Contact: Ben Robinson 07823 327796
SITE NAME:	Church of St Oswald, Church Lane, Strubby with Woodthorpe	This small parish church was largely rebuilt in 1857 by Maughan and Fowler, and the chancel by Ewan Christian in 1874. The construction is banded brickwork and
DESIGNATION:	Listed Place of Worship grade II*	greenstone, there is an open timber bellcote and facetted copper spirelet. The building suffers from seasonal ground
CONDITION:	Poor	movement. The north vestry is attached to the chancel but is inadequately founded and has suffered irreversible
PRIORITY CATEGORY:	C (C)	structural movement and needs to be rebuilt. The parish is
OWNER TYPE:		keen to effect repairs and may apply to the National Lottery Heritage Fund.
LIST ENTRY NUMBER:	1062988	Contact: Ben Robinson 07823 327796

© Historic England



SITE NAME:	Church of Holy Trinity, Sleaford Road, Tattershall	Former Norman church converted into a Collegiate church under license by King Henry VI in 1439. Constructed 1440-
DESIGNATION:	Listed Place of Worship grade I, CA	1500, undertaken by Ralph Cromwell, completed by William Waynflete. Glass removed to Stamford 1754. Restored 1893-97. Significant bat roost. Roof coverings are
CONDITION:	Poor	at the end of their working lives. There are issues with
PRIORITY CATEGORY:	D (C)	below ground drainage and various rainwater goods require maintenance. Some repairs are needed to fractured
OWNER TYPE:	Religious organisation	pinnacle bases. The Parochial Church Council are discussing repair options, with grant support from Historic
LIST ENTRY NUMBER:	1215320	England's Covid-19 Emergency Heritage at Risk Fund.
		Contact: Imogen Newcombe 07387 524030

© Historic England

RY:	D (C)	require maintenance. Some
	Religious organisation	pinnacle bases. The Paroch discussing repair options, w
ER:	1215320	England's Covid-19 Emerge
		Contact: Imogen Newcom

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no

- solution agreed. Immediate risk of further rapid В deterioration or loss of fabric; solution agreed but not yet implemented.
- С Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use)

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

- Conservation Area Listed Building
- LB I PA
- Local Planning Authority National Park NP
- Registered Park and Garden Scheduled Monument RPG

- SM ΪA
- Unitary Authority World Heritage Site WHS

	SITE NAME:	Church of St Helen, Main Road, Theddlethorpe St. Helen	This parish church dates from the CI4; CI5 tower constructed of squared green sandstone with limestone
	DESIGNATION:	Listed Place of Worship grade II*	bands, chancel and aisles were rebuilt by SS Teulon in 1866 using mixed stone rubble. Clerestory stonework is eroding
LA STATION	CONDITION:	Very bad	and render lumps are falling onto south aisle roof. East nave wall is holed; stone fall has damaged the chancel roof slating. Gutters and downpipes are in very bad condition
I THE PARTY OF	PRIORITY CATEGORY:	A (A)	
	OWNER TYPE:	Religious organisation	and are not discharging water away from the building. South nave rainwater is eroding south aisle buttress
	LIST ENTRY NUMBER:	1147259	stonework.
			Contact: Ben Robinson 07823 327796

© Historic England

Å	SITE NAME:	Church of St Margaret, Church Lane, Thimbleby	The church is a rebuilding by James Fowler of 1879, of Spilsby sandstone with Ancaster Limestone dressings. The
Til.	DESIGNATION:	Listed Place of Worship grade II, CA	spire and belfry turret stonework has been seriously eroded by migrating salts. The spire was considered unsafe and dismantled in 2014. The turret stonework was in very
	CONDITION:	Fair	poor condition. Ground drainage was not functioning and the rainwater disposal system was inadequate. Major
	PRIORITY CATEGORY:	C (C)	repairs, including rebuilding the spire, funded by the
	OWNER TYPE:	Religious organisation	National Lottery Heritage Fund Grants for Places of Worship scheme have been completed. Further repairs are
A STATE AND A DESCRIPTION	LIST ENTRY NUMBER:	1147090	needed.
indsey District Council			Contact: Ben Robinson 07823 327796

© East Lindsey District Council

SITE NAME:	Neolithic long barrow 350m south west of Sycamore Farm, Binbrook			
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1018893	
CONDITION:	Extensive significant problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No	
OWNER TYPE:	Private	CONTACT:	Ben Robinson 07823 327796	
site name:	Slight univallate hillfort on Swinhope Hill 430m r	Slight univallate hillfort on Swinhope Hill 430m north west of Glen Innes House, Binbrook		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1018839	
CONDITION:	Extensive significant problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No	
OWNER TYPE:	Private	CONTACT:	Ben Robinson 07823 327796	
SITE NAME:	Neolithic long barrow 280m south of Burgh Top	Farm, Burgh on Bain		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1013904	
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Arable clipping	NEW ENTRY?:	No	
OWNER TYPE:	Private	CONTACT:	Ben Robinson 07823 327796	
SITE NAME:	Neolithic long barrow 525m north east of Valley St. Andrew	House: one of a grou	up known as Deadmen's Graves, Claxb	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1017464	
CONDITION:	Extensive significant problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No	
OWNER TYPE:	Private	CONTACT:	Ben Robinson 07823 327796	
SITE NAME:	St Peter's Church, Low Toynton			
DESIGNATION:	Scheduled Monument, LB grade II*	LIST ENTRY NUMBER:	1004937	
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No	
OWNER TYPE:	Private	CONTACT:	Ben Robinson 07823 327796	
RIORITY CATEGORIES			ABBREVIATIONS	

PRIORITY CATEGORIES

А

В

C Slow decay; no solution agreed.

use).

Immediate risk of further rapid deterioration or loss of fabric; no solution agreed. Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented. Slow decay; solution agreed but F Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial user.

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site
- Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

SITE NAME:	Bowl barrow 100m south west of Gally Hill Farr	n, Ludford	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1013891
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Animal burrowing - moderate	NEW ENTRY ?:	No
OWNER TYPE:	Private	CONTACT:	Ben Robinson 07823 327796
SITE NAME:	Neolithic long barrow 680m west of Maidenwel	House, Maidenwell	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1018891
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY ?:	No
OWNER TYPE:	Private	CONTACT:	Ben Robinson 07823 327796
SITE NAME:	Neolithic long barrow 850m ENE of Ruckland H	ouse, Maidenwell	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1013913
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Ben Robinson 07823 327796
SITE NAME:	Neolithic long barrow 870m ENE of Ruckland H	ouse, Maidenwell	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1015203
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
WNER TYPE: Private CONTACT: Ben Robinson 078		Ben Robinson 07823 327796	
SITE NAME:	Neolithic long barrow 300m south east of Flint l	Hill House, Scamblesb	у
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1015196
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Ben Robinson 07823 327796
SITE NAME:	Small multivallate hillfort 340m south east of No	rth Road Farm, Tatte	rshall Thorpe
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1018353
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Ben Robinson 07823 327796
SITE NAME:	Neolithic long barrow 320m north west of Sken	dleby Psalter, Ulceby	with Fordington
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1013918
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Ben Robinson 07823 327796
SITE NAME:	Neolithic long barrow 575m WSW of Manor W	arren Farm, Welton I	∟e Wold
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1013908
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
PRINCIPAL VULNERABILITY:	Arable ploughing Private	NEW ENTRY?: CONTACT:	No Ben Robinson 07823 327796

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no А

B Immediate risk of further rapid deterioration or loss of fabric; solution agreed.
 C Slow decay; no solution agreed.

 D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site
 - Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

Convention Extensive significant problems TRUE Declining Memory Location Arable ploughing New ENTRY: No Memory Location Arable ploughing New ENTRY: No Memory Location Arable ploughing New ENTRY: No Memory Location Afford, town centre, Afford Entry No Destination: Conservation Area, 46 LBs New ENTRY: No Destination: Very bad TRND: Destinating MumRABILITY: Medium constract: Emile Vales (LPA) 01507 601111 en 3148 STE NAME Binbrook, village centre, Binbrook Emile Vales (LPA) 01507 601111 en 3148 STE NAME Conservation Area, 10 LBs, SM New ENTRY: No Destination: Poor IRRND: Destinating MumRABILITY: High constract: Emile Vales (LPA) 01507 601111 en 3148 Streame Conservation Area, 197 LBs New ENTRY: No Destination: Poor TRRD: Destinating Streame Spilsby, town centre, Spilsby Spilsby, t	SITE NAME:	Small multivallate hillfort 460m east of Old	Abbey Farm, Woodhall Spa	a
Presidence UNDERFARE Arable ploughing New ENTRY: No OWNERTYPE: Private CONTACT:: Bein Robinson 07823 327796 DEREMANDE: Alford, town centre, Alford CONTACT:: Bein Robinson 07823 327796 DEREMANDE: Conservation Area, 46 LBs NEW ENTRY: No DEREMANDE: Conservation Area, 46 LBs NEW ENTRY: No ULLINERMAILTY: Medium Contract:: Entitle Wales (LPA) 01507 601111 er ULLINERMAILTY: Binbrook, village centre, Binbrook Contract:: Entitle Wales (LPA) 01507 601111 er DEREMANDN: Conservation Area, 10 LBs, SM NEW ENTRY: No DEREMANDN: Conservation Area, 197 LBs NEW ENTRY: No RETERMARE: Louth, Town centre, contiguous residential areas & park, Elkington / Louth Deteriorating DEREMANDN: Conservation Area, 197 LBs New ENTRY: No RULINBARALTY: Medium Contract:: Emilie Wales (LPA) 01507 601111 er Splisby, town centre, Splisby Contract:: Emilie Wales (LPA) 01507 601111 er RULINBARALTY: High Contract::	DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1017880
DOWNER TYPE: Private CONTACT: Ben Robinson 07823 327796 STET NAME: Alford, town centre, Alford No DESIGNATION: Conservation Area, 46 LBs NEW ENTRY: No CONDITION: Very bad INEND: Deteriorating MULLERABLITY: Medium CONTACT: Emilie Wales (LPA) 01507 601111 esistem STET NAME: Binbrook, village centre, Binbrook Emilie Wales (LPA) 01507 601111 esistem DESIGNATION: Conservation Area, 10 LBs, SM NEW ENTRY: No CONTION: Poor TERNO: Emilie Wales (LPA) 01507 601111 esistem VILNERABILITY: High CONTACT: Emilie Wales (LPA) 01507 601111 esistem STET NAME: Louth, Town centre, contiguous residential areas & park, Elkington / Louth Emilie Wales (LPA) 01507 601111 esistem STET NAME: Conservation Area, 197 LBs NEW ENTRY: No OUNDRAME Conservation Area, 32 LBs, SM NEW ENTRY: No VILNERABILITY: Medium CONTACT: Emilie Wales (LPA) 01507 601111 esistem STET NAME: Splisby, town centre, Splisby Deteriorating VILNERABILITY: Medium CONTACT: Emilie Wales (LPA) 01507 601111 esistem Stetamation: Conservation Area, 24 LBs, 25Ms NEW ENTRY: No	CONDITION:	N: Extensive significant problems TREND: Declining		Declining
STERNAME: Alford, town centre, Alford SETENAME: Conservation Area, 46 LBs SETENAME: Very bad	PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
Designation Conservation Area, 46 LBs NEW ENTRY: No CONDITION: Very bad TREND: Deteriorating WUNERABLITY: Medium CONTACT: Emilie Wales (LPA) 01507 601111 exits STEENAME: Binbrook, village centre, Binbrook Contact: Emilie Wales (LPA) 01507 601111 exits DESIGNATION: Conservation Area, 10 LBs, SM New ENTRY: No CONTION: Poor TREND: Deteriorating CONTION: Poor TREND: Deteriorating STEENAME: Louth, Town centre, contiguous residential areas & park, Elkington / Louth Deteriorating DESIGNATION: Conservation Area, 197 LBs New ENTRY: No CONTION: Poor TREND: Deteriorating STEENAME: Spliby, town centre, Spliby Deteriorating CONTACT: Emilie Wales (LPA) 01507 601111 exits STEENAME: Spliby, town centre, Spliby Deteriorating CONTACT: Emilie Wales (LPA) 01507 601111 exits 3148 STEENAME: Conservation Area, 32 LBs, SM New ENTRY: No CONTACT: Emilie Wales (LPA) 01507 601111 exits 3148 STEENAME: Wainfleet, All Saints and St Marys, Wainfleet All Saints / Croft Deteriorating DESIGNATION: Con	OWNER TYPE:	Private	CONTACT:	Ben Robinson 07823 327796
CONDITION Very bad TREND: Deteriorating WULNERABULTY: Medium CONTACT: Emilie Wales (LPA) 01507 601111 exits (LPA) 01507 601	SITE NAME:	Alford, town centre, Alford		
WULD BRABULTY: Medium CONTACT: Emilie Wales (LPA) 01507 601111 est 3148 SITE NAME: Binbrook, village centre, Binbrook NEWENTRY: No DESIGNATION: Conservation Area, 10 LBs, SM NEWENTRY: No CONTACT: Emilie Wales (LPA) 01507 601111 est 3148 VILL BRABULTY: High CONTACT: Emilie Wales (LPA) 01507 601111 est 3148 STE NAME: Louth, Town centre, contiguous residential areas & park, Elkington / Louth Deteriorating DESIGNATION: Conservation Area, 197 LBs NEW ENTRY: No CONDITION: Poor TREND: Deteriorating VILINERABULTY: Medium CONTACT: Emilie Wales (LPA) 01507 601111 est 3148 STE NAME: Spilsby, town centre, Spilsby Deteriorating CONDITION: Very bad TREND: Deteriorating STE NAME: Spilsby, town centre, Spilsby Deteriorating CONDITION: Very bad TREND: Deteriorating STE NAME: Wainfleet, All Saints and St Marys, Wainfleet All Saints / Croft Sil48 STE NAME: Wainfleet, All Saints and St Marys, Wainfleet All Saints / Croft Deteriorating DISIGNATION: Conservation Area, 24 LBs, 2 SMs NIWEINTRY: No CONTACT: Emilie Wales (LPA) 01507 601111 est 3	DESIGNATION:	Conservation Area, 46 LBs	NEW ENTRY?:	No
Institution Preduction 3148 STEE NAME: Binbrook, village centre, Binbrook DESIGNATION: Conservation Area, 10 LBs, SM NEW ENTRY: No CONDITION: Poor TREND: Deteriorating VILINBRABILITY: High CONTACT: Emilie Wales (LPA) 01507 601111 exits STE NAME: Louth, Town centre, contiguous residential areas & park, Elkington / Louth Deteriorating DESIGNATION: Conservation Area, 197 LBs New ENTRY: No CONDITION: Poor TREND: Deteriorating ULINERABILITY: Medium CONTACT: Emilie Wales (LPA) 01507 601111 exits VILINERABILITY: Medium CONTACT: Emilie Wales (LPA) 01507 601111 exits STE NAME: Spilsby, town centre, Spilsby VILINERABILITY: No CONDITION: Very bad TREND: Deteriorating VILINERABILITY: High CONTACT: Emilie Wales (LPA) 01507 601111 exits STE NAME: Spilsby, town centre, Spilsby Deteriorating Steriorating VILINERABILITY: High CONTACT: Emilie Wales (LPA) 01507 601111 exits STE NAME: Spilsby, town centre, Spilsby No Steriorating VILINERABILITY: High CONTACT: Emilie Wales (LP	CONDITION:	Very bad	TREND:	Deteriorating
Designation: Conservation Area, 10 LBs, SM NEW ENTRY: No CONDITION: Poor TREND: Deteriorating WULNERABILITY: High CONTACT: Emilie Wales (LPA) 01507 601111 exits SITE NAME: Louth, Town centre, contiguous residential areas & park, Elkington / Louth No DESIGNATION: Conservation Area, 197 LBs NEW ENTRY: No CONTACT: Émilie Wales (LPA) 01507 601111 exits DESIGNATION: Conservation Area, 197 LBs NEW ENTRY: No CONTACT: Émilie Wales (LPA) 01507 601111 exits Site Name: Spilsby, town centre, Spilsby SUMERABILITY: Medium Conservation Area, 32 LBs, SM NEW ENTRY: No CONDITION: Very bad TREND: Deteriorating VULNERABILITY: High Contract: Emilie Wales (LPA) 01507 601111 exits STE NAME: Very bad TREND: Deteriorating VULNERABILITY: High Contract: Emilie Wales (LPA) 01507 601111 exits STE NAME: Very bad TREND: Deteriorating VULNERABILITY: High Contract: Emilie Wales (LPA) 01507 601111 exits </td <td>VULNERABILITY:</td> <td>Medium</td> <td>CONTACT:</td> <td>Emilie Wales (LPA) 01507 601111 ex 3148</td>	VULNERABILITY:	Medium	CONTACT:	Emilie Wales (LPA) 01507 601111 ex 3148
CONDITION: Poor TREND: Deteriorating WUNREARBUTY: High CONTACT: Emilie Wales (LPA) 01507 601111 er STENAME: Louth, Town centre, contiguous residential areas & park, Elkington / Louth No DESIGNATION: Conservation Area, 197 LBs NEW ENTRY: No CONDITION: Poor TREND: Deteriorating VULNERABUTY: Medium CONTACT: Emilie Wales (LPA) 01507 601111 er VULNERABUTY: Medium CONTACT: Emilie Wales (LPA) 01507 601111 er VULNERABUTY: Splisby, town centre, Splisby No Emilie Wales (LPA) 01507 601111 er VULNERABUTY: Splisby, town centre, Splisby NEW ENTRY: No CONDITION: Conservation Area, 32 LBs, SM NEW ENTRY: No CONDITION: Conservation Area, 32 LBs, SM NEW ENTRY: No VULNERABUTY: High Contact:: Emilie Wales (LPA) 01507 601111 er VULNERABUTY: Very bad TREND: No CONDITION: Conservation Area, 24 LBs, 2 SMs NEW ENTRY: No VULNERABUTY: High CONTACT: Emilie Wales (LPA) 01507 601111 er </td <td>SITE NAME:</td> <td>Binbrook, village centre, Binbrook</td> <td></td> <td></td>	SITE NAME:	Binbrook, village centre, Binbrook		
NUMBERABILITY: High CONTACT: Emilie Wales (LPA) 01507 601111 ex 3148 VULNERABILITY: High CONTACT: Emilie Wales (LPA) 01507 601111 ex 3148 VULNERABILITY: Louth, Town centre, contiguous residential areas & park, Elkington / Louth DESIGNATION: Conservation Area, 197 LBs NEW ENTRY: No VULNERABILITY: Medium Contact: Emilie Wales (LPA) 01507 601111 ex 3148 STE NAME: Spilsby, town centre, Spilsby Contact: Emilie Wales (LPA) 01507 601111 ex 3148 STE NAME: Spilsby, town centre, Spilsby Deteriorating STE NAME: Spilsby, town centre, Spilsby Deteriorating CONDITION: Very bad TREND: Deteriorating VULNERABILITY: High Contact: Emilie Wales (LPA) 01507 601111 ex 3148 STE NAME: Wainfleet, All Saints and St Marys, Wainfleet All Saints / Croft Deteriorating DEDEGIONATION: Conservation Area, 24 LBs, 2 SMs NEW ENTRY: No CONDITION: Very bad TEND: Deteriorating VULNERABILITY: High Contact: Emilie Wales (LPA) 01507 601111 ex 3148 STE NAME: Wragby, village centre, Wragby	DESIGNATION:	Conservation Area, 10 LBs, SM	NEW ENTRY?:	No
Notebookers High Contract: 3148 STEE NAME Louth, Town centre, contiguous residential areas & park, Elkington / Louth DesignATION: Conservation Area, 197 LBs New ENTRY: No CONDITION: Poor TREND: Deteriorating WULNERABILITY: Medium CONTACT: Emilie Wales (LPA) 01507 601111 epi 3148 STE NAME: Spilsby, town centre, Spilsby Emilie Wales (LPA) 01507 601111 epi 3148 STE NAME: Spilsby, town centre, Spilsby New ENTRY: No CONDITION: Very bad TREND: Deteriorating VULNERABILITY: High CONTACT: Emilie Wales (LPA) 01507 601111 epi 3148 STE NAME: Spilsby, town centre, Spilsby Deteriorating VULNERABILITY: High CONTACT: Emilie Wales (LPA) 01507 601111 epi 3148 STE NAME: Wainfleet, All Saints and St Marys, Wainfleet All Saints / Croft Emilie Wales (LPA) 01507 601111 epi 3148 VULNERABILITY: High CONTACT: Emilie Wales (LPA) 01507 601111 epi 3148 VULNERABILITY: High Contract: Emilie Wales (LPA) 01507 601111 epi 3148	CONDITION:	Poor	TREND:	Deteriorating
DESIGNATION: Conservation Area, 197 LBs NEW ENTRY?: No CONDITION: Poor TREND: Deteriorating VULNERABILITY: Medium conTACT: Emilie Wales (LPA) 01507 601111 exits STE NAME: Spilsby, town centre, Spilsby NEW ENTRY?: No DESIGNATION: Conservation Area, 32 LBs, SM NEW ENTRY?: No CONDITION: Very bad TREND: Deteriorating CONDITION: Very bad TREND: Deteriorating STE NAME: Wainfleet, All Saints and St Marys, Wainfleet All Saints / Croft Emilie Wales (LPA) 01507 601111 exits DESIGNATION: Conservation Area, 24 LBs, 2 SMs NEW ENTRY?: No CONDITION: Very bad TREND: Deteriorating UNLERABILITY: High conservation Area, 24 LBs, 2 SMs NEW ENTRY?: No STE NAME: Very bad TREND: Deteriorating ULINERABILITY: High conservation Area, 24 LBs, 2 SMs NEW ENTRY?: No STE NAME: Very bad TREND: Deteriorating STE NAME: Wragby, village centre, Wragby Ste Name: Ste Name: <td>VULNERABILITY:</td> <td>High</td> <td>CONTACT:</td> <td>Emilie Wales (LPA) 01507 601111 ex 3148</td>	VULNERABILITY:	High	CONTACT:	Emilie Wales (LPA) 01507 601111 ex 3148
CONDITION: Poor TREND: Deteriorating VULNERABILITY: Medium contract: Sile Vales (LPA) 01507 601111 ex 3148 STE NAME: Spilsby, town centre, Spilsby No CONDITION: Conservation Area, 32 LBs, SM NEW ENTRY: No CONDITION: Very bad TREND: Deteriorating VULNERABILITY: High contract: Emilie Vales (LPA) 01507 601111 ex 3148 STE NAME: Very bad TREND: Deteriorating VULNERABILITY: High contract: Emilie Vales (LPA) 01507 601111 ex 3148 STE NAME: Very bad TREND: Deteriorating DESIGNATION: Conservation Area, 24 LBs, 2 SMs NEW ENTRY: No CONDITION: Very bad TREND: Deteriorating VULNERABILITY: High contact: Sile Vales (LPA) 01507 601111 ex 3148 VULNERABILITY: Very bad REND: Deteriorating STE NAME: Very bad REND: No STE NAME: Conservation Area, 10 LBs NEW ENTRY: No CONDITION: Fair TREND: Deteriorating	SITE NAME:	Louth, Town centre, contiguous residential	areas & park, Elkington / L	outh
VULNERABILITY: Medium CONTACT: Emilie Wales (LPA) 01507 601111 exits and St Darson centre, Spilsby DESIGNATION: Conservation Area, 32 LBs, SM NEW ENTRY: No CONDITION: Very bad TREND: Deteriorating VULNERABILITY: High Contact: Emilie Wales (LPA) 01507 601111 exits and St Marys, Wainfleet All Saints / Croft: STRE NAME: Wainfleet, All Saints and St Marys, Wainfleet All Saints / Croft: Emilie Wales (LPA) 01507 601111 exits and St Marys, Wainfleet All Saints / Croft: DESIGNATION: Conservation Area, 24 LBs, 2 SMs NEW ENTRY: No CONDITION: Very bad TREND: Deteriorating VULNERABILITY: High Contact: Emilie Wales (LPA) 01507 601111 exits and St Marys, Wainfleet All Saints / Croft: STRE NAME: Very bad TREND: Deteriorating VULNERABILITY: High Contact: Emilie Wales (LPA) 01507 601111 exits and St Marys, Wainfleet All Saints / Croft: STRE NAME: Very bad TREND: Deteriorating VULNERABILITY: High Contact: Emilie Wales (LPA) 01507 601111 exits and St Marys, Wainfleet All Saints / Croft: STRE NAME: Very bad TREND: Deteriorating <td>DESIGNATION:</td> <td>Conservation Area, 197 LBs</td> <td>NEW ENTRY?:</td> <td>No</td>	DESIGNATION:	Conservation Area, 197 LBs	NEW ENTRY?:	No
Spillsbuiltin Spillsby, town centre, Spillsby 3148 DESIGNATION: Conservation Area, 32 LBs, SM NEW ENTRY?: No CONDITION: Very bad TREND: Deteriorating vulnerAbilitY: High contact: Emilie Wales (LPA) 01507 601111 ex SITE NAME: Wainfleet, All Saints and St Marys, Wainfleet All Saints / Croft Emilie Wales (LPA) 01507 601111 ex SITE NAME: Wainfleet, All Saints and St Marys, Wainfleet All Saints / Croft No DESIGNATION: Conservation Area, 24 LBs, 2 SMs NEW ENTRY?: No CONDITION: Very bad TREND: Deteriorating VulnerAbilitY: High contact: Emilie Wales (LPA) 01507 601111 ex SITE NAME: Wragby, village centre, Wragby contact: Emilie Wales (LPA) 01507 601111 ex SITE NAME: Wragby, village centre, Wragby contact: Emilie Wales (LPA) 01507 601111 ex SITE NAME: Wragby, village centre, Wragby contact: Emilie Wales (LPA) 01507 601111 ex SITE NAME: Conservation Area, 10 LBs NEW ENTRY?: No CONDITION: Fair TREND: Deteriorating VILLERABILITY: High contact: Emilie Wales (LPA) 01507 601111 ex	CONDITION:	Poor	TREND:	Deteriorating
DESIGNATION: Conservation Area, 32 LBs, SM NEW ENTRY?: No CONDITION: Very bad TREND: Deteriorating vulnerABILITY: High CONTACT: Emilie Wales (LPA) 01507 601111 exits and st Marys, Wainfleet All Saints and St Marys, Wainfleet All Saints / Croft DESIGNATION: Conservation Area, 24 LBs, 2 SMs NEW ENTRY?: No DESIGNATION: Conservation Area, 24 LBs, 2 SMs NEW ENTRY?: No CONDITION: Very bad TREND: Deteriorating VulnerABILITY: High Conservation Area, 24 LBs, 2 SMs NEW ENTRY?: No Condition: Very bad TREND: Deteriorating CONDITION: Very bad TREND: Emilie Wales (LPA) 01507 601111 exits and 3148 VulnerABILITY: High Contact: Emilie Wales (LPA) 01507 601111 exits and 3148 STE NAME: Wragby, village centre, Wragby Contact: Emilie Wales (LPA) 01507 601111 exits and 3148 DESIGNATION: Conservation Area, 10 LBs NEW ENTRY: No CONDITION: Fair TREND: Deteriorating UNINERABILITY: High CONTACT: Emilie Wales (LPA) 01507 601111 exits and and	VULNERABILITY:	Medium	CONTACT:	Emilie Wales (LPA) 01507 601111 ex 3148
CONDITION: Very bad TREND: Deteriorating VULNERABILITY: High CONTACT: Emilie Wales (LPA) 01507 601111 exits and St Marys, Wainfleet All Saints and St Marys, Wainfleet All Saint	SITE NAME:	Spilsby, town centre, Spilsby		
vulnerability: High CONTACT: Emilie Wales (LPA) 01507 601111 ex 3148 vulnerability: Wainfleet, All Saints and St Marys, Wainfleet All Saints / Croft Site Name: Designation: Conservation Area, 24 LBs, 2 SMs New ENTRY?: No condition: Very bad TREND: Deteriorating vulnerability: High contact: Emilie Wales (LPA) 01507 601111 ex 3148 stre name: Wragby, village centre, Wragby contact: Emilie Wales (LPA) 01507 601111 ex 3148 stre name: Wragby, village centre, Wragby No No Designation: Conservation Area, 10 LBs New ENTRY?: No condition: Fair TREND: Deteriorating will NERABILITY: High contact: Emilie Wales (LPA) 01507 601111 ex 3148	DESIGNATION:	Conservation Area, 32 LBs, SM	NEW ENTRY?:	No
Notest doct international and set with the set of	CONDITION:	Very bad	TREND:	Deteriorating
DESIGNATION: Conservation Area, 24 LBs, 2 SMs NEW ENTRY?: No CONDITION: Very bad TREND: Deteriorating vulnerability: High CONTACT: Emilie Wales (LPA) 01507 601111 existed SITE NAME: Wragby, village centre, Wragby Emilie Wales (LPA) 01507 601111 existed DESIGNATION: Conservation Area, 10 LBs NEW ENTRY?: No CONDITION: Fair TREND: Deteriorating VUINERABILITY: High CONTACT: Emilie Wales (LPA) 01507 601111 existed	VULNERABILITY:	High	CONTACT:	Emilie Wales (LPA) 01507 601111 ex 3148
CONDITION: Very bad TREND: Deteriorating VULNERABILITY: High CONTACT: Emilie Wales (LPA) 01507 601111 ex 3148 SITE NAME: Wragby, village centre, Wragby V DESIGNATION: Conservation Area, 10 LBs NEW ENTRY?: No CONDITION: Fair TREND: Deteriorating VULNERABILITY: High CONTACT: Emilie Wales (LPA) 01507 601111 ex	SITE NAME:	Wainfleet, All Saints and St Marys, Wainflee	et All Saints / Croft	
VULNERABILITY: High CONTACT: Emilie Wales (LPA) 01507 601111 ex 3148 SITE NAME: Wragby, village centre, Wragby DESIGNATION: Conservation Area, 10 LBs NEW ENTRY?: No CONDITION: Fair TREND: Deteriorating VILLINERABILITY: High CONTACT: Emilie Wales (LPA) 01507 601111 ex	DESIGNATION:	Conservation Area, 24 LBs, 2 SMs	NEW ENTRY?:	No
SITE NAME: Wragby, village centre, Wragby DESIGNATION: Conservation Area, 10 LBs CONDITION: Fair TREND: Deteriorating VILLINERABILITY: High	CONDITION:	Very bad	TREND:	Deteriorating
DESIGNATION: Conservation Area, 10 LBs NEW ENTRY?: No CONDITION: Fair TREND: Deteriorating WILINERABILITY: High CONTACT: Emilie Wales (LPA) 01507 601111 ex	VULNERABILITY:	High	CONTACT:	Emilie Wales (LPA) 01507 601111 ex 3148
CONDITION: Fair TREND: Deteriorating	SITE NAME:	Wragby, village centre, Wragby		
VIIINERABILITY: Emilie Wales (LPA) 01507 601111 ex	DESIGNATION:	Conservation Area, 10 LBs	NEW ENTRY?:	No
VULNERABILITY: High CONTACT: Emilie Wales (LPA) 01507 601111 ex 3148	CONDITION:	Fair	TREND:	Deteriorating
	VULNERABILITY:	High	CONTACT:	Emilie Wales (LPA) 01507 601111 ex 3148

LINCOLN



SITE NAME:	Greyfriars former monastic building, Broadgate	The chu
DESIGNATION:	Scheduled Monument, LB grade I, CA	lt w latte poc
CONDITION:	Poor	has Hov
OCCUPANCY:	Vacant/not in use	with
PRIORITY CATEGORY:	D (D)	Fun cen
OWNER TYPE:	Local authority	
LIST ENTRY NUMBER:	1005029	Cor

e building is believed to be one of the earliest Franciscan urches in Europe and the oldest friary building in England. vas remodelled for other uses, including a school and erly a museum. The main clay tile roof covering is in a or condition. The Welsh slate roof of the CI9 extension been repaired. The building is currently vacant. wever, City of Lincoln Council is working in partnership h Heritage Lincolnshire on a National Lottery Heritage nd project to undertake repairs and convert to a visitor ntre, venue and office.

ontact: Tim Allen 07770 610214

PRIORITY CATEGORIES

© Historic England

- Immediate risk of further rapid deterioration or loss of fabric; no А
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; В solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented. D Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no Е
 - obvious new user (applicable only to buildings capable of beneficial use).
- Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.
- NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA LB
- LPA
- Conservation Area Listed Building Local Planning Authority National Park NP RPG
- Registered Park and Garden Scheduled Monument SM
- UA Unitary Authority WHS World Heritage Site

	SITE NAME:	Colonia wall and lower west gate, The Park, Lincoln	The remains of the lower west gate of the Roman colonia and adjoining walls. The remains were excavated in the
	DESIGNATION:	Scheduled Monument and Listed Building grade I, CA	1970s and now serve as a thoroughfare. Weathering and vandalism have caused significant fabric loss. Vegetation is encroaching on the length of colonia wall north of the gate.
Strander of the	CONDITION:	Very bad	Historic England has provided management advice to City
ATT A	OCCUPANCY:	N/A	of Lincoln Council.
D' D	PRIORITY CATEGORY:	A (A)	
	OWNER TYPE:	Local authority	
Historic England	LIST ENTRY NUMBER:	1004986 and 1388731	Contact: Ben Robinson 07823 327796
	SITE NAME:	Church of St Swithin, Free School Lane, Lincoln	Built in the 1860s-70s by James Fowler of Louth and considered by Peysner to be 'without doubt his most
	DESIGNATION:	Listed Place of Worship grade II*, CA	important church'. In the Early English style. Repairs to the chancel roof and parapet gutters and high level stonework were completed in 2013 and a medieval sculpture on the
	CONDITION:	Poor	east gable was conserved. However, there is still extensive
1 CHILDREN CHILDREN	PRIORITY CATEGORY:	C (C)	wall stonework decay and the condition of the chancel windows is still a major concern.
1 A AL. 301	OWNER TYPE:	Religious organisation	
Historic England	LIST ENTRY NUMBER:	1388543	Contact: Ben Robinson 07823 327796
	SITE NAME:	Church of St Peter at Gowts, High Street, Lincoln	Ancient church with CII nave and tower. North aisle and porch dated 1852, by W A Nicholson. The chancel was
H	DESIGNATION:	Listed Place of Worship grade I, CA	enlarged in 1887 by C H Fowler. There is some general erosion of stonework and pointing. The west tower in particular has evidence of historical structural movement,
	CONDITION:	Poor	possibly related to issues of decay within the bell frame.
	PRIORITY CATEGORY:	C (C)	Further investigation of the cause is needed, alongside further monitoring.
FIRE A	OWNER TYPE:	Religious organisation	
Historic England	LIST ENTRY NUMBER:	1388599	Contact: Imogen Newcombe 07387 524030
	SITE NAME:	Cathedral Church of the Blessed Virgin Mary, Minster Yard, Lincoln	One of England's finest cathedrals and an iconic landmark, established 1072. Programmes of repair are addressing the decay of fabric, yet the condition of high-level masonry and
	DESIGNATION:	Listed Place of Worship grade I, CA	some roofs remain a concern. Historic England has funded repairs to the southwest and northwest turrets. A £16 million National Lottery Heritage Fund project; Lincoln
	CONDITION:	Fair	Cathedral Connected provided visitor facilities, repairs to the west front and conservation of the Romanesque Frieze
	PRIORITY CATEGORY:	F (F)	Historic England's Covid 19 Emergency Heritage at Risk
	TRIORITI CATEGORI.	I (I)	instone England's Covid 17 Enlergency rientage at hisk
22222222	OWNER TYPE:	Religious organisation	Response Fund supported further work. Further repairs
Historic England			Response Fund supported further work. Further repairs are required. Contact: Ben Robinson 07823 327796
Historic England	OWNER TYPE:	Religious organisation	Response Fund supported further work. Further repairs are required. Contact: Ben Robinson 07823 327796 City centre church of 1892-3 by Albert Vicars with a history of stone failure. By 2018, the condition of masonry,
Historic England	OWNER TYPE: LIST ENTRY NUMBER:	Religious organisation 1388680 Church of St Hugh and attached	Response Fund supported further work. Further repairs are required. Contact: Ben Robinson 07823 327796 City centre church of 1892-3 by Albert Vicars with a history of stone failure. By 2018, the condition of masonry, particularly the spire, tower and pinnacles at the base of the spire was poor. Past inappropriate render repairs were
Historic England	OWNER TYPE: LIST ENTRY NUMBER: SITE NAME:	Religious organisation 1388680 Church of St Hugh and attached vestry, Monks Road, Lincoln Listed Place of Worship grade II,	Response Fund supported further work. Further repairs are required. Contact: Ben Robinson 07823 327796 City centre church of 1892-3 by Albert Vicars with a history of stone failure. By 2018, the condition of masonry, particularly the spire, tower and pinnacles at the base of the spire was poor. Past inappropriate render repairs were failing and there has been several falls of masonry and render fragments. Repairs were tendered in early 2020 to
Historic England	OWNER TYPE: LIST ENTRY NUMBER: SITE NAME: DESIGNATION:	Religious organisation 1388680 Church of St Hugh and attached vestry, Monks Road, Lincoln Listed Place of Worship grade II, CA	Response Fund supported further work. Further repairs are required. Contact: Ben Robinson 07823 327796 City centre church of 1892-3 by Albert Vicars with a history of stone failure. By 2018, the condition of masonry, particularly the spire, tower and pinnacles at the base of the spire was poor. Past inappropriate render repairs were failing and there has been several falls of masonry and render fragments. Repairs were tendered in early 2020 to inform an application to the National Lottery Heritage func but the scheme was suspended in March due to Covid-19.
Historic England	OWNER TYPE: LIST ENTRY NUMBER: SITE NAME: DESIGNATION: CONDITION:	Religious organisation 1388680 Church of St Hugh and attached vestry, Monks Road, Lincoln Listed Place of Worship grade II, CA Very bad	Response Fund supported further work. Further repairs are required. Contact: Ben Robinson 07823 327796 City centre church of 1892-3 by Albert Vicars with a history of stone failure. By 2018, the condition of masonry, particularly the spire, tower and pinnacles at the base of the spire was poor. Past inappropriate render repairs were failing and there has been several falls of masonry and

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed.
 C Slow decay; no solution agreed.

 D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

HERITAGE AT RISK 2023 / MIDLANDS / LINCOLN / NORTH KESTEVEN

SITE NAME:	Lincoln Roman colonia wall at Cecil Street		
DESIGNATION:	Scheduled Monument, 5 LBs, part in CA	LIST ENTRY NUMBER:	1003569
CONDITION:	N: Extensive significant problems TREND: Declining		
PRINCIPAL VULNERABILITY:	Deterioration - in need of management	NEW ENTRY ?:	No
OWNER TYPE:	Local authority	CONTACT:	Ben Robinson 07823 327796
SITE NAME:	Carline, Lincoln		
DESIGNATION:	Conservation Area, LB grade II*	NEW ENTRY?:	No
CONDITION:	Poor	TREND:	Deteriorating
VULNERABILITY:	Medium	CONTACT:	Sarah Harrison (LPA) 01522 873760
SITE NAME:	Cathedral and City Centre, Lincoln		
DESIGNATION:	Conservation Area, 322 LBs, 21 SMs	NEW ENTRY?:	No
CONDITION: Poor TREND:		TREND:	Deteriorating significantly
VULNERABILITY:	Medium	CONTACT:	Sarah Harrison (LPA) 01522 87376
SITE NAME:	Gowts Bridge, Lincoln		
DESIGNATION:	Conservation Area, 2 LBs	NEW ENTRY ?:	No
CONDITION:	Poor	TREND:	Deteriorating
VULNERABILITY:	Medium	CONTACT:	Sarah Harrison (LPA) 01522 87376
SITE NAME:	Lindum and Arboretum, Lincoln		
DESIGNATION:	Conservation Area, 20 LBs, part in RPG grade II	NEW ENTRY ?:	No
CONDITION:	Poor	TREND:	Deteriorating
VULNERABILITY:	Medium	CONTACT:	Sarah Harrison (LPA) 01522 87376
SITE NAME:	Swanpool, Lincoln		
DESIGNATION:	Conservation Area	NEW ENTRY?:	No
CONDITION:	Poor	TREND:	Deteriorating
VULNERABILITY:	Medium	CONTACT:	Sarah Harrison (LPA) 01522 87376
SITE NAME:	West Parade and Brayford, Lincoln		
DESIGNATION:	Conservation Area, 9 LBs, SM	NEW ENTRY?:	No
	D	TREND:	
CONDITION:	Poor	INLIND.	Deteriorating significantly

NORTH KESTEVEN



SITE NAME:	Somerton Castle and outbuildings, Castle Lane, Boothby Graffoe	Early CI4 castle w outbuildings. The disrepair and the f	
DESIGNATION:	Scheduled Monument and Listed Buildings - 2 grade I	new owner is unde project. This has b archaeological inve	
CONDITION:	Fair	Local Planning Aut and refurbishment	
OCCUPANCY:	Vacant/not in use	Repairs and conv	
PRIORITY CATEGORY:	F (F)	southwest towers	
OWNER TYPE:	Private		
LIST ENTRY NUMBER:	1005015 and 1360511; 1061975	Contact: Tim Aller	

with C17 farmhouse and later extensive property had fallen into farm buildings were largely redundant. A dertaking a major repair and conversion been informed by thorough surveys and vestigations, and has been advised by the Ithority and Historic England. The repair t of the house has been completed. ersion of the ruined northeast and s and other buildings are nearly complete.

© Historic England

D

Е

use).

OWNER " LIST ENTF

en 07770 610214

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; В solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA LB
- LPA
- Conservation Area Listed Building Local Planning Authority National Park NP RPG
 - Registered Park and Garden Scheduled Monument
- SM
- UA Unitary Authority WHS World Heritage Site
- 38

HERITAGE AT RISK 2023 / MIDLANDS / NORTH KESTEVEN

	SITE NAME:	Manor Farmhouse, Helpringham, Helpringham	C15 origin, largely C17 with C18 and C19 alterations. An Urgent Works Notice, underwritten by Historic England,
	DESIGNATION:	Listed Building grade II*, CA	was served and implemented in 2008/2009. Proposals for repair and renovation which are tied to a larger housing
	CONDITION:	Very bad	development in the village were agreed by the Local Planning Authority in 2014/15. Work on the farmhouse
	OCCUPANCY:	Vacant/not in use	began in 2019. These works led to the demolition of a
	PRIORITY CATEGORY:	B (B)	large amount of the building. Historic England has advised the Local Authority and owner regarding remedial works.
	OWNER TYPE:	Private	Repairs and refurbishment are ongoing.
Ingland	LIST ENTRY NUMBER:	1061814	Contact: Jane Holt 07425732881

© Historic En



© Historic England Archive

	SITE NAME:	Former maltings of Bass Industrial Estate, Mareham Lane, Sleaford	Maltings, 1892-1905. A vast complex of buildings. Long disused and has suffered from fires and vandalism. A feasibility study was undertaken in collaboration with
6	DESIGNATION:	Listed Building grade II*	Phoenix Trust. The site was sold. Planning permission and Listed Building Consent was given for mixed use
	CONDITION:	Poor	development and conversion several years ago, but this has not been implemented. The buildings and site continue to
	OCCUPANCY:	Part occupied/part in use	deteriorate.
	PRIORITY CATEGORY:	D (D)	
Ste	OWNER TYPE:	Commercial company	
	LIST ENTRY NUMBER:	1062154	Contact: Ben Robinson 07823 327796



	SITE NAME:	Church of St Edith, Church Lane, Anwick	Parish church of limestone ashlar construction with some coursed rubble. Built late C13, C14, restored 1859. The
	DESIGNATION:	Listed Place of Worship grade I	chancel was restored 1900, and the south aisle in 1915. The church has been the subject of heritage crime in 2019
	CONDITION:	Poor	and a temporary solution has been put in place. The Parochial Church Council are keen to effect repairs and
	PRIORITY CATEGORY:	C (C)	have sought permissions for a programme of repair works.
	OWNER TYPE:	Religious organisation	Fundraising is underway, with support from the Diocesan Historic Churches Support Officer.
	LIST ENTRY NUMBER:	1061829	Contact: Imogen Newcombe 07387 524030

© Historic England

SITE NAME:	Parish Church of St Denys, Main Street, Aswarby and Swarby	Church of C12 origins with later C14 and C15 work. Restored in 1850 by Edward Blore. The stability of the
 DESIGNATION:	Listed Place of Worship grade I, CA	masonry spire is of concern and the top courses were taken down for safety reasons in 2015. Repair works under a National Lottery Heritage Fund grant-aided project was
CONDITION:	Poor	completed in 2019, but further repair works are required.
PRIORITY CATEGORY:	C (C)	
OWNER TYPE:	Religious organisation	
LIST ENTRY NUMBER:	1360619	Contact: Ben Robinson 07823 327796

© Historic England

Manager 1.1	SITE NAME:
1	DESIGNATION:
	CONDITION:
THEATHA	PRIORITY CATEGORY
	OWNER TYPE:
	LIST ENTRY NUMBER:

D

Е

© Historic England

Medieval church restored in 1888. Evidence of a painted Church of All Saints, Main scheme in the chancel dating to the mid-late C19 which has Street, Beckingham been severely damaged by modern paints used in the mid-Listed Place of Worship grade I C20. The chancel, organ chamber and vestry, nave and north aisle have all been re-roofed with Historic England Fair and National Lottery Heritage Fund repair fund grant aid. Y: C (C) Repairs to the south aisle and south porch roofs have been undertaken previously and repairs to the tower roof and Religious organisation associated timber work have recently been completed. Concerns remain over the chancel interior and condition of 1360525 pew platforms.

Contact: Hanna Good 07825 318060

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no А

- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; В solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA
- LB LPA
- Conservation Area Listed Building Local Planning Authority National Park NP
- RPG Registered Park and Garden Scheduled Monument
- SM
- UA Unitary Authority WHS World Heritage Site

HERITAGE AT RISK 2023 / MIDLANDS / NORTH KESTEVEN

	SITE NAME:	Church of St Michael, Church Street, Billinghay	A village centre parish church dating from CI2, CI4, and CI5. The tower and spire were rebuilt in 1787, the spire
	DESIGNATION:	Listed Place of Worship grade I, CA	rebuilt again in 1912. The north aisle was rebuilt in 1856. The roofs to the chancel, south porch and organ chamber are in poor condition and need re-slating. Funding is in
·	CONDITION:	Poor	place for repairs but Covid-19 has hindered progress.
No. of Street,	PRIORITY CATEGORY:	D (D)	
	OWNER TYPE:	Religious organisation	
and the second sec	LIST ENTRY NUMBER:	1204770	Contact: Ben Robinson 07823 327796
c England			

© Historic

© Historic England



₩.	SITE NAME:	Church of St Helen, Church Walk, Brant Broughton and Stragglethorpe	Parish church with fabric from C11, rebuilt and altered by GF Bodley in 1873-76. The church was the subject of heritage crime in 2010 and 2014. Rainwater goods and
ter.	DESIGNATION:	Listed Place of Worship grade I, CA	parapet gutters are impacted with detritus and vegetation at ground level, which is affecting disposal. All require review and clearing. The nave, north aisle and chancel
	CONDITION:	Poor	roofs require repairs and overhauling in places, alongside associated timber, rainwater goods and flashing repairs.
	PRIORITY CATEGORY:	C (C)	The south clerestory and north aisle require localised high-
	OWNER TYPE:	Religious organisation	level stonework repairs.
	LIST ENTRY NUMBER:	47497	Contact: Imogen Newcombe 07387 524030



SITE NAME:	Church of St Michael, Stragglethorpe Lane, Brant Broughton and Stragglethorpe	Parish church with fabric from C11 and late C12, restored c.1980. The church lacks rainwater goods, which is causing internal damp, efflorescence and epilithic growths on the
DESIGNATION:	Listed Place of Worship grade I	internal walls and floors. Drainage is ineffective, as it is full of gravel and detritus. There is moderate structural
CONDITION:	Poor	movement, causing external and internal cracking at wall junctions, soffits and reveals, with associated bulging of the
PRIORITY CATEGORY:	C (C)	north aisle wall. The roof requires tile replacement, and
OWNER TYPE:	Religious organisation	repointing is needed both externally and internally.
LIST ENTRY NUMBER:	1061900	Contact: Imogen Newcombe 07387 524030

© Historic England Archive

and the	SITE NAME:	Parish Church of St Andrew, Kelby, Culverthorpe and Kelby	Parish church, C12-C14 constructed of coursed limestone rubble and ashlar. The tower and spire were rebuilt in
and the second	DESIGNATION:	Listed Place of Worship grade I, CA	1850. There are a few slipped slates to the chancel roof and some localised repointing is required. The church interior is suffering from damp. The church has been
Jan BAR	CONDITION:	Poor	subject to heritage crime.
	PRIORITY CATEGORY:	A (A)	
	OWNER TYPE:	Religious organisation	
	LIST ENTRY NUMBER:	1360583	Contact: Imogen Newcombe 07387 524030

© Historic England



SITE NAME:	Church of St Peter, Church Lane, Navenby	Parish church from C13-C15, mid C18 and restored 1875- 6 with C20 additions. Constructed of limestone rubble and
DESIGNATION:	Listed Place of Worship grade I, CA	ashlar with ashlar dressings. The tower was rebuilt in the mid C18. The church has been subject to heritage crime. Support is being provided by the Diocesan Historic
CONDITION:	Poor	Churches Support Officer.
PRIORITY CATEGORY:	A (A)	
OWNER TYPE:	Religious organisation	
LIST ENTRY NUMBER:	1147458	Contact: Imogen Newcombe 07387 524030

© IoE. Mr James Brown

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В implemented.
- C Slow decay; no solution agreed.

use).

D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user latentified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use)

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

HERITAGE AT RISK 2023 / MIDLANDS / NORTH KESTEVEN



© Diocese of Lincoln

Parish Church of St Peter, Laundon Road, Threekingham DESIGNATION: Listed Place of Worship grade I CONDITION: Poor PRIORITY CATEGORY: C (C) OWNER TYPE: Religious organisation LIST ENTRY NUMBER: 1306911

Church with fabric from C12, C13 and C14. The spire was restored in 1872. At the west end of the nave are 2 large recumbent figures of a knight and his lady; reputed to be Sir Lambert de Trikyngham (d. 1280) and his wife. The church was subject to heritage crime in 2019 and requires repairs. Rainwater goods are in need of refurbishment and below ground drainage improvements are required. Some repointing and patch repairs are required to the tower and at high level. Sections of the interior are suffering from damp related issues. Potential funding avenues are being reviewed.

Contact: Imogen Newcombe 07387 524030

SITE NAME: DESIGNATION:		50yds (600m) east of Holme House	e, Heckington	
			-	
Design withork.	Scheduled Monun	Scheduled Monument		1004927
CONDITION:	Extensive significa	nt problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing		NEW ENTRY?:	No
OWNER TYPE:	Private		CONTACT:	Ben Robinson 07823 327796
SITE NAME:	Butt Mound bowl barrow, Butt Lees, Silk Willough		у	
DESIGNATION:	Scheduled Monun	nent	LIST ENTRY NUMBER:	1018899
CONDITION:	Generally unsatisf problems	actory with major localised	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable clipping		NEW ENTRY?:	No
OWNER TYPE:	Private	11 0		Ben Robinson 07823 327796
SITE NAME:	Folk Moot bowl barrow, Butt Lees, Silk Willoughb			
DESIGNATION:	Scheduled Monun	nent	LIST ENTRY NUMBER:	1018900
CONDITION:	Generally unsatisfactory with major localised problems		TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable clipping		NEW ENTRY?:	No
OWNER TYPE:	Private		CONTACT:	Ben Robinson 07823 327796
SITE NAME:	Silkby Chapel ren	nains, Butt Lees, Silk Willoughby		
DESIGNATION:	Scheduled Monun	nent	LIST ENTRY NUMBER:	1018901
CONDITION:	Generally unsatisf problems	actory with major localised	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing		NEW ENTRY?:	No
OWNER TYPE:	Private		CONTACT:	Ben Robinson 07823 327796
	SITE NAME:	Rauceby Hospital, Wilsford / Silk Willoughby / Sleaford	Rauceby Hospital was designed as the Kesteven Cour Lunatic Asylum by renowned asylum specialist G T H	
	DESIGNATION:	Registered Park and Garden grade II, part in CA	William Goldring's plan for the grounds was drawn u 1900 and implemented over the next few years with inmate labour. Rauceby served as an RAF hospital do	iented over the next few years with
	CONDITION:	Extensive significant problems	World War Two	b. It was here that pioneering plastic ed out for aircrew who had suffered
Transferrality states	VULNERABILITY:	High	severe burns. The hospital closed in the late 1990s a	
the stand of the party of the stand	TREND:	Declining	grounds have been extensively developed for housing, which continues. The central core of the complex rem	en extensively developed for housing, The central core of the complex remain
Y 1	NEW ENTRY?:	No	derelict and its future has yet to be secured.	
© Historic England	OWNER TYPE:	Commercial company, multiple owners		

Contact: Ben Robinson 07823 327796

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; В solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented. Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no

1001471

LIST ENTRY NUMBER:

D

Е

use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented. obvious new user (applicable only to buildings capable of beneficial

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA
- LB LPA
- Conservation Area Listed Building Local Planning Authority National Park NP
- RPG Registered Park and Garden Scheduled Monument SM
- UA WHS Unitary Authority World Heritage Site

HERITAGE AT RISK 2023 / MIDLANDS / NORTH KESTEVEN / SOUTH HOLLAND

SITE NAME:	Rauceby Hospital, Sleaford		
DESIGNATION:	Conservation Area, part in RPG grade II	NEW ENTRY ?:	No
CONDITION:	Very bad	TREND:	Deteriorating significantly
VULNERABILITY:	Medium	CONTACT:	Matthew Bentley (LPA) 01529 414155
SITE NAME:	Sleaford No. I, Sleaford No. 2 and Sleaford E	xtension, Sleaford	
DESIGNATION:	Conservation Area, 141 LBs, SM	NEW ENTRY ?:	No
CONDITION:	Very bad	TREND:	Deteriorating
	/		5
VULNERABILITY:	Low	CONTACT:	Matthew Bentley (LPA) 01529 414155

SOUTH HOLLAND



© Historic England

	SITE NAME:	Old office block of Land Settlement Association, Mallard Road, Low Fulney, Spalding	House, C17 re-fronted in the C18 and incorporating medieval monastic ruins. Stands within an area of intensive market gardens with limited curtilage. Suffering serious
	DESIGNATION:	Listed Building grade II*	structural damage. There is uncontrolled woody plant growth to one elevation. Urgent works were carried out in
	CONDITION:	Very bad	2004, underwritten by Historic England grant aid. In 2008, permission was granted to build glasshouses near to the
	OCCUPANCY:	Vacant/not in use	building, further restricting the curtilage. Historic England
	PRIORITY CATEGORY:	A (A)	has offered the Council support to prepare for further enforcement action.
	OWNER TYPE:	Private	
	LIST ENTRY NUMBER:	1359567	Contact: Hanna Good 07825 318060

	SITE NAME:	Crowland Manor, 5, East Street, Crowland	Former manor, 1690, with mid-C18 additions possibly by William Sands the younger of Spalding. Limestone ashlar
	DESIGNATION:	Listed Building grade II*, CA	north front and red brick south front with ashlar dressings. Some repair works undertaken previously but the property
	CONDITION:	Very bad	was in a very bad condition at the time of its sale. The current owner has cleared the grounds, carried out
	OCCUPANCY:	Occupied/in use	drainage improvements, installed temporary propping and
	PRIORITY CATEGORY:	C (C)	undertaken some repairs. The house is occupied. Replacement of failing stone slate roof coverings and
	OWNER TYPE: Private	Private	structural repairs are required.
toric England	LIST ENTRY NUMBER:	1359273	Contact: Ben Robinson 07823 327796

SITE NAME: Sneaths Mill, Lutton Gowts, Lutton DESIGNATION: Listed Building grade I CONDITION: Poor OCCUPANCY: Vacant/not in use PRIORITY CATEGORY: D (D) OWNER TYPE: Charity (heritage) England LIST ENTRY NUMBER: 1064530	SITE NAME:		Octagonal brick tower windmill, 1779, incorporating the remains of an earlier C18 mill. Unique in Lincolnshire and
	DESIGNATION:	Listed Building grade I	the oldest surviving tower mill in the county. Ceased to work in the 1930s and emergency repairs carried out in
	CONDITION:	Poor	1992. Historic England funded urgent repairs to make t building weather tight in 2011 and a comprehensive assessment of the timber machinery in 2018. Planning
	OCCUPANCY:	Vacant/not in use	
	PRIORITY CATEGORY:	D (D)	permission has been obtained to convert the outbuildings and piggery. A National Lottery Heritage Fund grant was
	OWNER TYPE:	Charity (heritage)	awarded to help the Sneaths Mill Trust to develop a comprehensive project and build capacity.
	Contact: Ben Robinson 07823 327796		

© Historic Er

© Histo

	SITE NAME:	Broad Street Methodist Church and attached Sunday School, Broad Street, Spalding	Methodist church, built by F Boreham in 1887. The attached Sunday School serves as a church hall and provides services to the wider community. Red brick
	DESIGNATION:	Listed Place of Worship grade II, CA	construction with ashlar dressings and decorative banding. The extensive slate roofs suffered widespread nail fatigue. Re-roofing of the church was completed in 2014 following
	CONDITION:	Fair	a joint Historic England and National Lottery Heritage Fu Repair Grants for Places of Worship grant. There are a
	PRIORITY CATEGORY:	C (C)	number of defects with the Sunday School and rear range
	OWNER TYPE:	Religious organisation	roofs. These buildings remain vulnerable. The church is well used by the local community.
	LIST ENTRY NUMBER:	1067614	Contact: Hanna Good 07825 318060

PRIORITY CATEGORIES

© Historic England

- Immediate risk of further rapid deterioration or loss of fabric; no А
- Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В implemented.
- C Slow decay; no solution agreed.

 D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA LB LPA NP RPG SM
- Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument
- UA Unitary Authority WHS World Heritage Site

HERITAGE AT RISK 2023 / MIDLANDS / SOUTH HOLLAND



SITE NAME:	Church of St Mary Magdalen, Hallgate, Fleet, Fleet	Parish church c.1180-1190, mid-C14, restored 1798, 1843 and 1860-2 by C Bennett of Lynn. Limestone rubble and
DESIGNATION:	Listed Place of Worship grade I, CA	ashlar. All the window tracery restored in C19. The church was subject to heritage crime in 2020. A Faculty application for subsequent repair works has been approved, and the
CONDITION:	Poor	Parochial Church Council are keen to undertake these repairs and investigate potential funding avenues.
PRIORITY CATEGORY:	C (C)	repairs and investigate potential funding avenues.
OWNER TYPE:	Religious organisation	
LIST ENTRY NUMBER:	1146568	Contact: Imogen Newcombe 07387 524030

© Mr David Brown. Source: Historic England Archive



	Gedney Hill resto		Parish church dating from the late-C14 and mid-C15, restored by James Fowler of Louth in the 1870s. The
	DESIGNATION:	Listed Place of Worship grade II*	church is unusual for Lincolnshire in its internal timber frame and fine timber nave arcades. There are deeply
	CONDITION:	Fair	eroded sections of pointing to the tower, decay to structural timbers to the tower roof and water ingress via
	PRIORITY CATEGORY:	C (C)	the tower roof covering. Re-covering of part of the south
	OWNER TYPE:	Religious organisation	aisle roof is also required. Ongoing support and advice is being provided by the Diocesan Historic Churches Suppo
	LIST ENTRY NUMBER:	4677	Officer.
			Contact: Imogen Newcombe 07387 524030

© Historic England

SITE NAME:	Settlement north east of Whitebread Farr	n, Crowland	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004978
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY ?:	No
OWNER TYPE:	Private	CONTACT:	Ben Robinson 07823 327796
site name:	Settlement north of The Parks, Deeping St. Nicholas		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004980
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY ?:	No
OWNER TYPE:	Private	CONTACT:	Ben Robinson 07823 327796
SITE NAME:	Settlement south west of The Parks, Deep	ping St. Nicholas	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004981
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Ben Robinson 07823 327796
SITE NAME:	Settlement south east of Lower Delgate F	arm, Weston	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002945
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Ben Robinson 07823 327796
SITE NAME:	Dawsmere, Gedney		
DESIGNATION:	Conservation Area, 3 LBs	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	Deteriorating significantly
VULNERABILITY:	High	CONTACT:	Gregory Watkinson (LPA) 01775 764560

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no А

- Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В implemented.
- C Slow decay; no solution agreed.

 D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user latentified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

HERITAGE AT RISK 2023 / MIDLANDS / SOUTH HOLLAND / SOUTH KESTEVEN

SITE NAME:

DESIGNATION:

CONDITION:

OCCUPANCY:

OWNER TYPE:

PRIORITY CATEGORY:

SITE NAME:	Long Sutton		
DESIGNATION:	Conservation Area, 29 LBs	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	No significant change
VULNERABILITY:	Medium	CONTACT:	Gregory Watkinson (LPA) 01775 764560

SOUTH KESTEVEN

	SITE NAME:	Angel and Royal Hotel, High Street, Grantham	One of the few remaining English medieval inns, dating from late C14 with substantial C18 additions at the rear.
	DESIGNATION:	Listed Building grade I, CA	Currently in use as a hotel. Much of the ornately decorated stone frontage has suffered severe erosion, and many of
	CONDITION:	Fair	the corniced figures are now unrecognisable or missing. Historic England has encouraged the owners to investigate
	OCCUPANCY:	Occupied/in use	the condition of the stone frontage further. The building is
	PRIORITY CATEGORY:	C (C)	otherwise in good condition.
	OWNER TYPE:	Commercial company	
nd	LIST ENTRY NUMBER:	1062486	Contact: Imogen Newcombe 07387 524030



0	SITE NAME:	Bridge over lake, Grantham Road, Harlaxton	Circa 1822-1838. Impressive stone bridge over lake: an important part of the historic landscape. Several balusters
C C	DESIGNATION:	Listed Building grade II*, RPG grade II*	missing and vegetation growing out of parapets. Evidence of severe frost shattering and crumbling stonework. A parkland management plan has been completed with grant
	CONDITION:	Poor	funding from Historic England.
	OCCUPANCY:	N/A	
Li de la	PRIORITY CATEGORY:	A (A)	
and the second second	OWNER TYPE:	Educational (independent)	
	LIST ENTRY NUMBER:	1187968	Contact: Ben Robinson 07823 327796

Ornamental garden steps 50

Listed Building grade II*, RPG

Educational (independent)

Manor, Grantham Road,

Harlaxton

grade II*

Poor

N/A

C (C)

metres south west of Harlaxton

© Historic England

© Historic England

© Historic England



LIST ENTRY NUMBER: Contact: Ben Robinson 07823 327796 1236717 Curved brick viaduct containing a narrow gauge railway for supplying the service courtyard, 1838-1844. Part repaired; SITE NAME: Railway tunnel attached to Harlaxton Manor, Grantham Road, Harlaxton screen wall and platform remain in derelict state. Further brickwork and masonry repair and repointing is needed. A Listed Building grade I, RPG parkland management plan has been completed with DESIGNATION grade II* Historic England grant funding. CONDITION: Poor OCCUPANCY: N/A PRIORITY CATEGORY: C (C) OWNER TYPE: Educational (independent) LIST ENTRY NUMBER: 1298440 Contact: Ben Robinson 07823 327796

PRIORITY CATEGORIES

© Historic England

- Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed. Immediate risk of further rapid В deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but $\ \ F$ not yet implemented. Under repair or in fair to good

D

Е

repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

Ornamental garden steps, 1838-1844, situated in the early

C19 formal gardens to the south west of the house. Retaining wall in poor condition. Steps are sound although

joints. Significant erosion of detail. Condition survey

funding from Historic England.

some re-bedding needed. Repointing needed for open

undertaken with Historic England grant aid. A parkland

management plan has also been completed with grant

- Conservation Area Listed Building
- LB LPA
- Local Planning Authority National Park NP
- RPG
- Registered Park and Garden Scheduled Monument SM
- UA Unitary Authority WHS World Heritage Site

HERITAGE AT RISK 2023 / MIDLANDS / SOUTH KESTEVEN

	SITE NAME:	Greyfriars Gate, Stamford	Part late CI4 or early CI5, restored with substantial late
	DESIGNATION:	Scheduled Monument, part in CA	C19 additions. The lodges and chamber are no longer used. Some evidence of historic structural movement is visible. The chamber over the arch and south lodge
	CONDITION:	Fair	suffered water ingress and the north lodge roof decayed beyond repair. Roofs have now been replaced and
	OCCUPANCY:	Vacant/not in use	repaired, masonry repairs have been carried out and the building is secure. The west part of the hospital complete
	PRIORITY CATEGORY:	E (E)	building is secure. The west part of the hospital complex, including the gatehouse, has been marketed.
	OWNER TYPE:	Health authority	
gland	LIST ENTRY NUMBER:	1005006	Contact: Ben Robinson 07823 327796

© Historic Engla

© Historic England



SITE NAME: Seats, balustrades and terraces to the east of Stoke Seats, balustrades and terraces to east of Stoke Rochford Hall, Rochford Hall. 1841-45, by William Burn. Acquired by the previous owner in 2016 by which time the terrace walls Stoke Rochford were in very poor condition as a result of rusting iron Listed Building grade I, RPG cramps and poor original detailing. Damage was DESIGNATION: grade II* progressive and accelerating. Some balusters were loose and at risk of falling. Historic England had been in CONDITION: Poor communication with a former leaseholder about repairs. The building was sold in late 2019. The new owner has OCCUPANCY: N/A been contacted. PRIORITY CATEGORY: A (A) OWNER TYPE: Commercial company LIST ENTRY NUMBER: Contact: Amanda White 0121 625 6890 1360353

SITE NAME: Church of St Peter, Town Street, Claypole	Parish church c.1300, with various phasing from C14 through to 1631 and the C19, of ashlar construction. Som rendering with ashlar dressings. Cruciform plan with west tower with spire. The church was the recipient of a Roof
DESIGNATION: Listed Place of Worship grade I	
CONDITION: Poor	Repair Fund grant in 2015 to re-roof the chancel and vestry. The church has been the subject of heritage crime.
PRIORITY CATEGORY: A (A)	A Faculty was approved in June 2021, and the Parochial Church Council are keen to undertake these repairs.
OWNER TYPE: Religious organisation	Potential funding avenues are being investigated.
LIST ENTRY NUMBER: 1062912	Contact: Imogen Newcombe 07387 524030

© Diocese of Lincoln

	SITE NAME:	Church of St Michael and All Angels, Main Street, Edenham	Parish church with C8, C12, C13, C15 and early C16 fabric, plus C19 work. The chancel and south aisle roof
	DESIGNATION:	Listed Place of Worship grade I	coverings have been renewed and parapet stone work secured in 2014-15, funded by a National Lottery Heritage
	CONDITION:	Poor	Fund Repair Grants for Places of Worship scheme grant The nave roof is leaking and the significant monuments in the chancel require conservation due to continued dam
	PRIORITY CATEGORY:	C (C)	
	OWNER TYPE:	Religious organisation	by damp conditions over many years. The porch barrel- vaulted plaster ceiling is damaged from water ingress
	LIST ENTRY NUMBER:	1146587	although the porch roof slating has now been renewed. The below-ground drainage has also been renewed.
			The below-ground drainage has also been renewed.

© Historic England



	SITE NAME:	Church of St Andrew, Church Lane, Haconby	Late CI2 parish church with early CI3, c.1300, and CI5 additions. Restored CI9. Coursed ironstone rubble,
	DESIGNATION:	Listed Place of Worship grade I	limestone ashlar with some render. The church has been subject to heritage crime and is suffering from water
	CONDITION:	Poor	ingress. A Faculty application for repair works has been approved, and the Parochial Church Council are keen to
1	PRIORITY CATEGORY:	D (D)	undertake these repairs.
1111	OWNER TYPE:	Religious organisation	
	LIST ENTRY NUMBER:	1360134	Contact: Imogen Newcombe 07387 524030

© Diocese of Lincoln

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; В solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.

D

Е

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

Contact: Ben Robinson 07823 327796

- CA
- LB LPA
- Conservation Area Listed Building Local Planning Authority National Park NP
- RPG Registered Park and Garden Scheduled Monument
- SM
- UA Unitary Authority WHS World Heritage Site

HERITAGE AT RISK 2023 / MIDLANDS / SOUTH KESTEVEN

	SITE NAME:	Church of St Swithun, Church Street, Long Bennington	Located on the site of the former priory, a large parish church dating from early CI3, with CI4, (aisles
	DESIGNATION:	Listed Place of Worship grade I	constructed) C15, and C19 work, restored 1902-3 by Scorer and Gamble Architects, (ceilings in nave and aisles
	CONDITION:	Poor	assumed from this date). The church north aisle has suffered from structural movement related to poor
	PRIORITY CATEGORY:	C (C)	rainwater disposal arrangements and ground drainage
	OWNER TYPE:	Religious organisation	affecting the bearing strata. A National Lottery Heritage Fund Grant for Places of Worship grant, to address the
	LIST ENTRY NUMBER:	1062891	chancel roof and drainage, was completed in 2019. The church is drying out but a further phase of repairs is
© Historic England			required.
			Contact: Ben Robinson 07823 327796

1.00	SITE NAME:	Church of St Mary, Church Lane, North Witham	Parish church. Late C11, C13-C15 and restored in 1887. Constructed of ashlar and coursed limestone rubble. Two
	DESIGNATION:	Listed Place of Worship grade I	stage C14 ashlar tower. The church was subject to heritage crime in 2019 and is suffering from water ingress due to the
	CONDITION:	Poor	failing of the temporary cover. Potential funding avenues are being explored and engagement with the Diocesan
	PRIORITY CATEGORY:	A (A)	Historic Churches Support Officer is ongoing.
	OWNER TYPE:	Religious organisation	
- Labor	LIST ENTRY NUMBER:	1360327	Contact: Imogen Newcombe 07387 524030

© Historic England

SITE NAME:	Church of St James, Church Street, Skillington	C11 fabric. Problems with rising damp, the below-ground drainage system and water dispersal from the building
 DESIGNATION:	Listed Place of Worship grade I, CA	needs to be addressed. It is possible that part of the nave requires re-roofing, and the north aisle and south transept/chapel and porch roof coverings require repair.
CONDITION:	Poor	There is water ingress to several roofs. Ivy growth has taken hold externally to the tower and vestry. The church
PRIORITY CATEGORY:	D (D)	has been the subject of heritage crime. Repairs completed
OWNER TYPE:	Religious organisation	with grant support from Historic England's Covid 19 Emergency Heritage at Risk Response Fund. Further
LIST ENTRY NUMBER:	1168300	repairs required. Funds are being sought.
		Contact: Hanna Good 07825 318060

© Historic England



		Coi	
SITE NAME:	Church of St James, Village Street, Woolsthorpe By Belvoir	Chu Cl4	
DESIGNATION:	Listed Place of Worship grade II, CA	Eas stru Lot	
CONDITION:	Poor	fun ext	
PRIORITY CATEGORY:	C (C)	15.	
OWNER TYPE:	Religious organisation	mai nee	
LIST ENTRY NUMBER:	1168645	ingr	

urch, 1847 by GG Place of Nottingham. Built in the early 4 style on the site of the former St Mary's Chapel of se. The church has suffered problems associated with uctural movement and roofing defects. A National ttery Heritage Fund Repair Grant for Places of Worship ded the renewal of nave and south aisle roofing and ensive roof timber repairs and structural works in 2014-The condition of the stonework to the tower and the in body of the church is of concern and the interior eds repair following many years of damage from water ress.

© Historic England

SITE NAME: Settlement site at Greatford, Barholm and Stowe / Greatford			
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004957
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Ben Robinson 07823 327796
SITE NAME:	Settlement site east of Greatford village, Barholm	and Stowe / Greatf	ord
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004934
CONDITION:	Extensive significant problems	TREND:	Declining
	0 1		5
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no А

solution agreed. Immediate risk of further rapid deterioration or loss of fabric; В solution agreed but not yet implemented.

C Slow decay; no solution agreed.

Slow decay; solution agreed but F not yet implemented.

D

Е

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA LB

LPA

- Conservation Area Listed Building Local Planning Authority National Park NP RPG
- Registered Park and Garden Scheduled Monument SM

UA Unitary Authority WHS World Heritage Site

HERITAGE AT RISK 2023 / MIDLANDS / SOUTH KESTEVEN / WEST LINDSEY

SITE NAME:	Bronze Age salte	ern, Billingborough		
DESIGNATION:	Scheduled Monument		LIST ENTRY NUMBER:	1004961
CONDITION:	Generally unsatisfactory with major localised problems		TREND:	Declining
PRINCIPAL VULNERABILITY:	Animal burrowin	g - moderate	NEW ENTRY?:	No
OWNER TYPE:	Private		CONTACT:	Ben Robinson 07823 327796
SITE NAME:	Five barrows no	rth west of Heath Farm, Great Po	nton	
DESIGNATION:	Scheduled Monu	ment	LIST ENTRY NUMBER:	1004998
CONDITION:	Extensive significa	ant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing		NEW ENTRY?:	No
OWNER TYPE:	Private		CONTACT:	Ben Robinson 07823 327796
SITE NAME:	Causewayed cam	ıp, Uffington		
DESIGNATION:	Scheduled Monument		LIST ENTRY NUMBER:	1004938
CONDITION:	Extensive significa	ant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing		NEW ENTRY?:	No
OWNER TYPE:	Private		CONTACT:	Ben Robinson 07823 327796
and the second	SITE NAME:	Harlaxton Manor, Harlaxton	A mid-C19 park and gardens with contemporary Jacobean/Baroque garden buildings, walled kitchen gard and house. Historic split management of landscape and conversion of house and gardens to institutional use, deterioration of built features (buildings at risk) and decli of wider parkland due to arable agriculture. Several gard buildings and structures have been repaired, and a parkla plan prepared, with Historic England grants and other	
	DESIGNATION:	Registered Park and Garden grade II*, 17 LBs, part in CA		
a 74	CONDITION:	Generally satisfactory but with significant localised problems		
A COL	VULNERABILITY:	Medium		
	TREND:	Improving		College is progressing plans for tensive parkland formerly in separate
	NEW ENTRY?:	No	ownership.	. , , ,
© Historic England	OWNER TYPE:	Educational (independent)		
	LIST ENTRY NUMBER:	1000982	Contact: Ben Ro	binson 07823 327796
SITE NAME:	Grantham			
DESIGNATION:	Conservation Ar	ea, 156 LBs, 2 SMs	NEW ENTRY?:	No

DESIGNATION:	Conservation Area, 156 LBs, 2 SMs	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	Improving
VULNERABILITY:	Low	CONTACT:	Planning and Building Control (LPA) 01476 406080

WEST LINDSEY



	SITE NAME:	Bridge over lakes at Norton Place, Norton Place, Glentham	Bridge, 1776 by John Carr. Parapet has collapsed and damage is occurring from tree roots; the sluice gate and
	DESIGNATION:	Listed Building grade II*, RPG grade II	weirs are blocked. Some trees have been removed in the past but the area around the bridge has since become overgrown with self-set vegetation, and the bridge
State of the	CONDITION:	Very bad	continues to deteriorate.
	OCCUPANCY:	N/A	
A.M.	PRIORITY CATEGORY:	A (A)	
8).	OWNER TYPE:	Private	
	LIST ENTRY NUMBER:	1165038	Contact: Ben Robinson 07823 327796

© Historic England

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В implemented.
- C Slow decay; no solution agreed.
- D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use)

use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA LB
- LB LPA NP RPG SM
- Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument
- UA Unitary Authority WHS World Heritage Site

	SITE NAME:	Church of St George, Goltho Road, Goltho	This enigmatic small brick church is in the care of the Churches Conservation Trust. It has a C16 nave and late
	DESIGNATION:	Listed Building grade II*	CI7 or early CI8 chancel and is surrounded by the buried remains of the settlement it once served. Its simply
	CONDITION:	Very bad	furnished interior and roof were destroyed by fire on 21st October 2013. The shell of the building has been secured,
	OCCUPANCY:	Vacant/not in use	stabilised and covered. It is regularly monitored, however
	PRIORITY CATEGORY:	C (C)	there are no immediate plans for repair and rebuilding.
The second	OWNER TYPE:	Charity (heritage)	
c England	LIST ENTRY NUMBER:	1308371	Contact: Imogen Newcombe 07387 524030

© Historic I

© Historic England

© Historic England



	OWNER THE.	Charity (heritage)	
	LIST ENTRY NUMBER:	1308371	Contact: Imogen Newcombe 07387 524030
	SITE NAME:	Gate, mounting block and wall, Kettlethorpe Hall, Hall Lane, Kettlethorpe	Gateway, C14 with C18 alterations. Eroded brickwork, repointing and repair required.
	DESIGNATION:	Listed Building grade II*	
	CONDITION:	Fair	
in the second	OCCUPANCY:	N/A	
	PRIORITY CATEGORY:	C (C)	
	OWNER TYPE:	Private	
	LIST ENTRY NUMBER:	47 72	Contact: Ben Robinson 07823 327796

Gate and gate piers, circa 1720. Attributed to Francis or SITE NAME: Gates and piers to Nettleham Hall, Hall Lane, Nettleham William Smith of Warwick. Relocated from the demolished St Peter at Arches Church in Lincoln and once led to DESIGNATION: Listed Building grade I Nettleham Hall. Ironwork is in very poor condition and some stonework is displaced. Some of the Victorian railings Very bad have been stolen from the side walls and stonework has OCCUPANCY: N/A been damaged. Condition survey completed and consent applied for to repair the gates and restore the driveway to PRIORITY CATEGORY: A (A) a principal dwelling incorporating the ruined hall. OWNER TYPE: Private LIST ENTRY NUMBER: 1165868 Contact: David Walsh 0121 625 6888

Remains of country house of 1560 slighted in the Civil SITE NAME: Torksey Castle, Trent Side, War. The west wall and part of south wall remain. Major Torksey structural repairs were carried out in 1991 and a watching Scheduled Monument and Listed brief was maintained. The main structure appears stable DESIGNATION: Building grade I but repairs to exposed brickwork required. Fabric and buried remains under threat from vegetation growth. A CONDITION: Poor condition survey was carried out several years ago and OCCUPANCY: N/A options for repairs, access and interpretation have been investigated. No further progress has been made. PRIORITY CATEGORY: C (C) OWNER TYPE: Private © Historic England LIST ENTRY NUMBER: 1005056 and 1064079 Contact: Ben Robinson 07823 327796

	SITE NAME:	Church of St Martin, Church Lane, Blyton	Parish church with fabric dating from C11, C13 to C16 and c.1860. Constructed of coursed limestone rubble and rock
	DESIGNATION:	Listed Place of Worship grade I	faced ashlar. The north aisle was rebuilt in C19. The church was subject to heritage crime in 2019. The Parochial
	CONDITION:	Poor	Church Council are keen to undertake repairs and investigate potential funding avenues. Support is being given
IN I	PRIORITY CATEGORY:	C (C)	by the Diocese, alongside advice from the Diocesan
	OWNER TYPE:	Religious organisation	Historic Churches Support Officer.
	LIST ENTRY NUMBER:	1064159	Contact: Imogen Newcombe 07387 524030

© Diocese of Lincoln

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- solution agreed. Immediate risk of further rapid В deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but $\ \ F$ not yet implemented.

D

Е

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use)

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- Conservation Area Listed Building CA
- LB I PA
- Local Planning Authority National Park NP
- RPG Registered Park and Garden Scheduled Monument
- SM ŬA
- Unitary Authority World Heritage Site WHS

Ma	SITE NAME:	Church of All Saints, Lincoln Road, Holton cum Beckering	Rural parish church of C13 origin with contributions of C14 and C15. Later C19 restorations by GG Scott. South slope
	DESIGNATION:	Listed Place of Worship grade I	of nave roof is tingled, with some slipped slates. The church was the subject of heritage crime in 2017 and a temporary
1	CONDITION:	Fair	solution has been put in place. Some urgent repairs have been undertaken.
A STATE AND	PRIORITY CATEGORY:	C (C)	
APPENDA	OWNER TYPE:	Religious organisation	
	LIST ENTRY NUMBER:	1064035	Contact: Imogen Newcombe 07387 524030

© Historic England

	SITE NAME:	Church of St Michael, East Torrington, Legsby	Victorian church of 1848-50 by SS Teulon. Widespread roof defects to all slated roofs, with nave requiring re-
DESIGNATION:	DESIGNATION:	Listed Place of Worship grade II	roofing. The west elevation has widespread open joints. Some missing eaves stones to north of nave. Evidence of
	CONDITION:	Very bad	water ingress internally. Some gutters to the nave south slope have become detached.
1 11,1	PRIORITY CATEGORY:	A (A)	siope have become detached.
I To Labor	OWNER TYPE:	Religious organisation	
-	LIST ENTRY NUMBER:	1359514	Contact: Ben Robinson 07823 327796

© Historic England

	SITE NAME:	Church of St Cornelius, Church Lane, Linwood	Church with fabric from C12 to C15. Restorations took place in 1854 and 1868. The church has been subject to
Ke !!	DESIGNATION:	Listed Place of Worship grade I	heritage crime. There are concerns over the asbestos cement sheet covering on the north and south aisles which
Aller Aller	CONDITION:	Poor	is trapping moisture and is evident by the water staining in the interior. The nave roof covering is failing and there is a
	PRIORITY CATEGORY:	C (C)	particular concern over water damage to the south west
	OWNER TYPE:	Religious organisation	corner. Water staining also visible on the underside of the Vestry roof. Isolated repointing is also required. The church is continuing to work with the Diocese to develop
	LIST ENTRY NUMBER:	1166212	church is continuing to work with the Diocese to develop repair schemes.
			repair schemes.

Church of St Thomas, Main

Listed Place of Worship grade II

Road, North Willingham

Religious organisation

Very bad

1064043

A (A)

© Diocese of Lincoln

Contact: Imogen Newcombe 07387 524030

Parish church with CI4 fabric. The is evidence of high-level structural movement in the nave, with associated internal cracking. The tower suffers from damp, and there is significant loss of plasterwork. Sarking boards within the nave and chancel have rotted and further are decaying, with signs of wet-rot and water ingress. The bell chamber shows signs of beetle and worm attack. The church suffers from poor ventilation, with the walls and stone floors damp and slippery underfoot, with signs of efflorescence. The Parochial Church Council are currently reviewing potential funding avenues.

Contact: Imogen Newcombe 07387 524030

	SITE NAME:
金融 制 相望	DESIGNATION:
	CONDITION:
	PRIORITY CATEGO
	OWNER TYPE:
	LIST ENTRY NUMB

SITE NAME:

DESIGNATION:

CONDITION:

OWNER TYPE:

PRIORITY CATEGORY:

LIST ENTRY NUMBER:

	SITE NAME:	Church of St Andrew, Main Street, Kirkby cum Osgodby, Osgodby	Parish church with fabric from early C13, early C14, C15 and 1790, undergoing restoration in 1891, 1900 and 1923. Roughly coursed ironstone rubble, squared coursed
	DESIGNATION:	Listed Place of Worship grade II*	limestone and ironstone. The church was the subject of heritage crime in 2019. Roof repairs have been undertaken.
	CONDITION:	Poor	The Nave roof appears to be nearing its serviceable life. There are some isolate areas of deep pocket erosion to
	PRIORITY CATEGORY:	C (C)	the tower, friable stone and previous cementitious
	OWNER TYPE:	Religious organisation	pointing. Considerable vegetation growth to the chancel. The parish are keen to effect repairs.
	LIST ENTRY NUMBER:	1166092	Contact: Imogen Newcombe 07387 524030

© Historic England

© Historic England

PR	ITY	C	ATE	GOR	IES	

- Immediate risk of further rapid deterioration or loss of fabric; no А
- solution agreed. Immediate risk of further rapid В deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.

D

Е

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA
- LB LPA
- Conservation Area Listed Building Local Planning Authority National Park NP RPG
- Registered Park and Garden Scheduled Monument
- SM
- UA Unitary Authority WHS World Heritage Site

ALA	SITE NAME:	Church of St Margaret, Usselby, Osgodby	Two cell CI4 church, restored CI8 and CI9. Nave, chancel and west bellcote. Random rubble ironstone with
	DESIGNATION:	Listed Place of Worship grade II	gauged brick window arches, roofs are diminished random slate. Timber window frames, cast iron casements and
4	CONDITION:	Poor	plain leaded glazing. Numerous issues including ivy growth, blocked and slipped downpipes, localised defects and
	PRIORITY CATEGORY:	A (A)	cracks and broken glass. Roofs appear to be in good order
	OWNER TYPE:	Religious organisation	but bellcote at risk of immediate loss. The closure process has started.
	LIST ENTRY NUMBER:	1166119	Contact: Ben Robinson 07823 327796

© Historic England

SITE NAME:	Church of St Mary, Church Lane, Stow	A parish church of lofty proportions which includes the transepts and crossing of an early collegiate church, dating
DESIGNATION:	Listed Place of Worship grade I, SM	from C11. The nave and chancel are C12. There was a major restoration by JL Pearson in 1850-67 when the chancel vaulting was reconstructed. Several re-roofing
CONDITION:	Poor	projects have recently been completed. The church is damp having suffered water ingress through defective roof
PRIORITY CATEGORY:	C (C)	coverings and underground drainage for many years.
OWNER TYPE:	Religious organisation	
LIST ENTRY NUMBER:	1146624	Contact: Ben Robinson 07823 327796
-	DESIGNATION: CONDITION: PRIORITY CATEGORY: OWNER TYPE:	Lane, StowDESIGNATION:Listed Place of Worship grade I, SMCONDITION:PoorPRIORITY CATEGORY:C (C)OWNER TYPE:Religious organisation

© Historic England

SITE NAME:	ME: Owmby Roman settlement, Fillingham / Owmby-by-Spital			
DESIGNATION:	Scheduled Monument, part in RPG grade II	LIST ENTRY NUMBER:	1004922	
CONDITION:	CONDITION: Extensive significant problems		Declining	
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY ?:	No	
OWNER TYPE:	Private	CONTACT:	Ben Robinson 07823 327796	
SITE NAME: Hengiform monument 260m north west of Honeypot			oy-by-Spital	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1017020	
CONDITION:	Extensive significant problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No	
OWNER TYPE:	Private	CONTACT:	Ben Robinson 07823 327796	
SITE NAME: SITE NAME: Round barrows and ring ditches 530m south east of Barlings Abbey: part of Barling cemetery, Stainfield			art of Barlings-Stainfield barrow	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1009989	
CONDITION:	Extensive significant problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	Yes	
OWNER TYPE: Private		CONTACT:	Ben Robinson 07823 327796	
SITE NAME:	Ash Hill long barrow in Swinhope Park, Swinhop	be		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1013886	
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Animal burrowing - moderate	NEW ENTRY?:	No	
OWNER TYPE:	Private	CONTACT:	Ben Robinson 07823 327796	
SITE NAME:	Cromwell's Grave, a Neolithic long barrow 300	m west of Hoe Hill Fa	rm, Swinhope	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1013885	
CONDITION:	Extensive significant problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Animal burrowing - moderate	NEW ENTRY?:	No	
OWNER TYPE:	Private	CONTACT:	Ben Robinson 07823 327796	

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no А

Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В implemented.

C Slow decay; no solution agreed.

 D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user lidentified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

- Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site

SITE NAME:			
DESIGNATION:	SIGNATION: Scheduled Monument LIST ENTRY NUMBER		1013901
CONDITION: Extensive significant problems TREND: Dec		Declining	
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE: Private		CONTACT:	Ben Robinson 07823 327796
SITE NAME:	Neolithic long barrow 380m south west of	f Thorganby House, Thorga	nby
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1020359
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Ben Robinson 07823 327796
SITE NAME:	Neolithic long barrow 300m ESE of Wales	by Top Farm, Walesby	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1013914
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Ben Robinson 07823 327796
SITE NAME:	Gainsborough Riverside, Saundby / Becking	gham / Gainsborough	
DESIGNATION:	Conservation Area, 14 LBs	NEW ENTRY?:	No
CONDITION:	Poor	TREND:	Improving
VULNERABILITY:	High	CONTACT:	Chris Bradley (LPA) 01427 676676
SITE NAME:	Gainsborough Town, Gainsborough		
DESIGNATION:	Conservation Area, 39 LBs	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	Improving
VULNERABILITY:	High	CONTACT:	Chris Bradley (LPA) 01427 676676
SITE NAME:	Market Rasen		
DESIGNATION:	Conservation Area, 45 LBs	NEW ENTRY?:	No
CONDITION:	Poor	TREND:	Improving
VULNERABILITY:	High	CONTACT:	Chris Bradley (LPA) 01427 676676

LINCOLNSHIRE / NOTTINGHAMSHIRE

WEST LINDSEY / BASSETLAW



	SITE NAME:	Torksey Viaduct over River Trent, Trent Side, Torksey / Rampton and Woodbeck	T D ir
	DESIGNATION:	Listed Building grade II*	d e
	CONDITION:	Fair	0
	OCCUPANCY:	N/A	0
	PRIORITY CATEGORY:	D (D)	
	OWNER TYPE:	Private	
	LIST ENTRY NUMBER:	1359456	C

Tubular iron girder railway bridge and viaduct, 1849. Designed by John Fowler. The main span was strengthened n 1897. Disused since the closure of the line in 1959 and decayed slowly thereafter. Repairs carried out in 2015 to enable a public footpath to be constructed along one side of the viaduct. The footpath opened in April 2016. The other side is unused and some further repairs are required.

Contact: Rosemary Thompson 07768 215540

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; В solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- D Slow decay; solution agreed but F not yet implemented.

Е

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA
- LB LPA
- Conservation Area Listed Building Local Planning Authority National Park NP RPG
- Registered Park and Garden Scheduled Monument
- SM
- UA Unitary Authority WHS World Heritage Site

NORTH EAST LINCOLNSHIRE (UA)



SI	TE NAME:	Grimsby Haven Lock and Dock Wall 58 metres Long adjoining to West, Lock Hill	Lock basin and quayside wall by John Rennie, built 1798/1799. This lock separated the tidal haven from the Humber estuary, creating the first dock at Grimsby.
DI	esignation:	Listed Building grade II*	Vaulted dock walls were employed here; an innovative form of dock construction later replicated at Hull and
C	ONDITION:	Poor	Grimsby on a much larger scale. The lock and dock walls are now partly covered by spoil. Localised collapse, open
0	CCUPANCY:	Vacant/not in use	joints, missing and broken bollards and railings signal the
PF	RIORITY CATEGORY:	C (C)	neglect suffered by this historic structure.
0	WNER TYPE:	Commercial company	
LIS	ST ENTRY NUMBER:	1379856	Contact: Ben Robinson 07823 327796

© E.Ravenscroft/ENGIE/NELC



SITE NAME:	The Grimsby Ice Factory, Gorton Street, Grimsby	Ice production works dating from 1900-1910 that served the Grimsby fishing fleet, facilitating its development and
DESIGNATION:	Listed Building grade II*	international renown during the C20. The factory closed in 1990. It is thought that this is the earliest surviving ice
CONDITION:	Very bad	factory in Britain, and the sole survivor from this period to retain its machinery. The loss of roof coverings and non-
OCCUPANCY:	Y: Vacant/not in use	secure openings has exposed the interior, including
PRIORITY CATEGORY:	A (A)	extensive wooden floors, to increasing levels of weather damage and bird infestation. Sold early in 2022. Proposals
OWNER TYPE:	Commercial company	for stabilisation and roofing works consented and new uses discussed.
LIST ENTRY NUMBER:	1379842	Contact: Bon Bobinson 07022 227704

© Historic England



© E.Ravenscroft/ENGIE/NELC

			Contact: Ben Robinson 0/823 32/796
	SITE NAME:	Former Heavy Anti-Aircraft Gun Site, Keelby Road, Stallingborough	Second World War and early post-War Heavy Anti- Aircraft gun site. One of only six of the surviving 5.25 in HAA sites known nationally. The site is overgrown and
	DESIGNATION:	Listed Building grade II*	suffers from vandalism. The concrete structures are deteriorating.
	CONDITION:	Very bad	
	OCCUPANCY:	Vacant/not in use	
	PRIORITY CATEGORY:	C (C)	
	OWNER TYPE:	Private	
	LIST ENTRY NUMBER:	1403222	Contact: Ben Robinson 07823 327796



© Historic England

	SITE NAME:	Sir Moses Montefiore Synagogue, Holme Hill, Heneage Road, Grimsby	Synagogue 1885-8. C19 entrance arch adjoining to right; ark extension to east end and secondary synagogue and schoolroom addition to rear (now meeting hall). The only
	DESIGNATION:	Listed Place of Worship grade II, CA	Victorian synagogue in Lincolnshire and South Humberside, one of few of this period in the country to survive so intact. Together with its accompanying bath-house (qv) this
1	CONDITION:	Poor	synagogue reflects the former significance of Grimsby's Jewish community and the town's prominence in the
a	PRIORITY CATEGORY:	C (New entry)	movement of Jews from Eastern Europe to Britain and
	OWNER TYPE:	Religious organisation	America. Suffering water ingress, vegetation growth and structural movement requiring investigation.
	LIST ENTRY NUMBER:	1379853	Contact: David Walsh 0121 625 6888

SITE NAME:	TE NAME: Civil War earthwork fort 350m north east of Walk Farm, Irby		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1007735
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Ben Robinson 07823 327796

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no А

D

Е

- Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В implemented.
- C Slow decay; no solution agreed.

Slow decay: solution agreed but F not yet implemented. Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site
 - Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

HERITAGE AT RISK 2023 / MIDLANDS / NORTH EAST LINCOLNSHIRE (UA) / NORTH LINCOLNSHIRE (UA)

SITE NAME:	est Ravendale			
DESIGNATION:	Scheduled Monument, LB grade II	LIST ENTRY NUMBER:	1019867	
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Arable clipping	NEW ENTRY?:	No	
OWNER TYPE:	Private	CONTACT:	Ben Robinson 07823 327796	
ITE NAME:	Central Area, Grimsby			
DESIGNATION:	Conservation Area, 25 LBs	NEW ENTRY?:	No	
CONDITION:	Very bad	TREND:	No significant change	
ULNERABILITY:	Low	CONTACT:	Louise Jennings (LPA) 01472 32426	
ITE NAME:	Central Sea Front, Cleethorpes			
DESIGNATION:	Conservation Area, 12 LBs	NEW ENTRY?:	No	
CONDITION:	Very bad	TREND:	Improving	
/ULNERABILITY:	Low CONTACT:		Louise Jennings (LPA) 01472 32426	
SITE NAME:	Holme Hill, Grimsby			
DESIGNATION: Conservation Area, 8 LBs		NEW ENTRY?:	No	
CONDITION:	Very bad	TREND:	Deteriorating significantly	
/ULNERABILITY:	Medium	CONTACT:	Louise Jennings (LPA) 01472 32426	
SITE NAME:	The Kasbah			
DESIGNATION:	Conservation Area, 8 LBs	NEW ENTRY?:	No	
CONDITION:	Very bad	TREND:	No significant change	
/ULNERABILITY:	Medium	CONTACT:	Louise Jennings (LPA) 01472 32426	
ITE NAME:	Victoria Mills, Grimsby			
DESIGNATION:	Conservation Area, 3 LBs	NEW ENTRY ?:	No	
CONDITION:	Very bad	TREND:	Improving	
/ULNERABILITY:	Medium	CONTACT:	Louise Jennings (LPA) 01472 32426	
ITE NAME:	Wellow, Grimsby			
DESIGNATION:	Conservation Area, 27 LBs, RPG grade II	NEW ENTRY?:	No	
CONDITION: Very bad TR				
CONDITION:	Very bad	TREND:	Deteriorating	

NORTH LINCOLNSHIRE (UA)

	· · /		
	SITE NAME:	United Reformed Church, Chapel Lane, Barton	Chapel and adjoining manse erected by the Barton Independent congregation in 1806. It is the oldest surviving
A P	DESIGNATION:	Listed Building grade II*, CA	Barton Independent chapel in Lincolnshire, with its original seating still intact. Constructed of locally-made red brick
	CONDITION:	Very bad	with rubbed brick and stone dressings. The roof of the chapel is clad in Welsh slate. The manse is occupied and
	OCCUPANCY:	Vacant/not in use	being repaired. The chapel is in very bad condition and is
	PRIORITY CATEGORY:	A (A)	currently without a use. A condition survey has been produced.
	OWNER TYPE:	Private	
ngland	LIST ENTRY NUMBER:	1051598	Contact: Imogen Newcombe 07387 524030

© Historic Eng

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В implemented.
- C Slow decay; no solution agreed.

 D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA LB LPA NP RPG SM
- Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument
- UA Unitary Authority WHS World Heritage Site

HERITAGE AT RISK 2023 / MIDLANDS / NORTH LINCOLNSHIRE (UA)

	SITE NAME:	Hibaldstow Mill and walls to mill pond and wheel race, Ings Lane, Hibaldstow	Combined wind and watermill, 1802, by James Middleton of Hibaldstow. Some repairs undertaken, but further work required to both exterior and interior.
	DESIGNATION:	Scheduled Monument and Listed Buildings - I grade II*; I grade II	
i i i	CONDITION:	Fair	
	OCCUPANCY:	Part occupied/part in use	
	PRIORITY CATEGORY:	C (C)	
© Historic England Archive	OWNER TYPE:	Private	
	LIST ENTRY NUMBER:	1008528 and 1083709; 1162093	Contact: Ben Robinson 07823 327796
	SITE NAME:	Manor Farmhouse, East Halton Road, North Killingholme	Medieval, C17 to C19 manor house on a scheduled moated site. Exceptional multi-period survival for this
	DESIGNATION:	Listed Building grade II*, SM	region. The roof was repaired in 1980, but little has been done since and the interior is propped with scaffolding. A
	CONDITION:	Very bad	feasibility study has been completed.
	OCCUPANCY:	Vacant/not in use	
	PRIORITY CATEGORY:	A (A)	
	OWNER TYPE:	Private	
© Historic England Archive	LIST ENTRY NUMBER:	1346854	Contact: Ben Robinson 07823 327796

State of the	SITE NAME:	Church of St Mary, High Street, Broughton	Parish church with spacious west tower of four stages. The lower section of tower and circular stair turret date from
	DESIGNATION:	Listed Place of Worship grade I	CII, when it was the main body of the church with a chancel to the east. Walls contain large squared ashlars,
	CONDITION:	Very bad	herringbone rubble and reused Roman gritstone. C14-C15 top stage to the tower. Some urgent repairs have been
and the formation of the	PRIORITY CATEGORY:	C (C)	undertaken but work to the tower and roofs is still
	OWNER TYPE:	Religious organisation	required.
	LIST ENTRY NUMBER:	1161801	Contact: Ben Robinson 07823 327796

© Historic England

State of the second

	SITE NAME:	Church of All Saints, Vicarage Lane, Cadney	Parish church, with a mid C12 arcade, C13 tower and chancel, early C14 south aisle and a C15 porch. Restored
	DESIGNATION:	Listed Place of Worship grade I	in 1912-13 by Sir Charles Nicholson, with further general restorations c.1960. The church suffered repeated
	CONDITION:	Poor	occurrences of heritage crime in 2022, and temporary
The start	PRIORITY CATEGORY:	C (New entry)	protective sheeting is now in place. The Historic Churches Support Officer for the Diocese is providing ongoing advice
	OWNER TYPE:	Religious organisation	and support.
	LIST ENTRY NUMBER:	1083706	Contact: Imogen Newcombe 07387 524030

© Diocese of Lincoln



	SITE NAME:	Church of All Saints, Church Lane, Saxby All Saints	Late C13 church rebuilt between 1845 and 1849 by George Gilbert Scott in the Decorated style, with tower
	DESIGNATION:	Listed Place of Worship grade II, CA	rebuilt by Neville in 1873. The National Lottery Heritage Fund Grants for Places of Worship scheme funded roof repairs in 2013, of which have since been completed. A
	CONDITION:	Fair	further phase of works is still needed in order to repair the
	PRIORITY CATEGORY:	C (C)	tower masonry.
	OWNER TYPE:	Religious organisation	
	LIST ENTRY NUMBER:	1103702	Contact: Imogen Newcombe 07387 524030

© Historic England

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В implemented.
- C Slow decay; no solution agreed.

 D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

HERITAGE AT RISK 2023 / MIDLANDS / NORTH LINCOLNSHIRE (UA)

	SITE NAME:	Church of St Nicholas, Church Lane, Ulceby	Large church with tall C13 spire. C15 nave roof and clerestory. Restorations in C19. Previous roof leaks had left
	DESIGNATION:	Listed Place of Worship grade I	the interior damp. The tower masonry is eroded and the is some loose high-level stonework. The church has bee subject to heritage crime. National Lottery Heritage Fun Grants for Places of Worship grant-aided repairs were completed in early 2020. Urgent tower repairs are still
	CONDITION:	Poor	
	PRIORITY CATEGORY:	D (D)	
	OWNER TYPE:	Religious organisation	required, and the Parochial Čhurch Council are in receipt of structural engineering advice for this, alongside added
	LIST ENTRY NUMBER:	1227927	support from the Diocesan Historic Churches Support Officer.
			Onicei.

© Historic England

Contact: Imogen Newcombe 07387 524030

SITE NAME:	Money Field Roman site, Dragonby		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1005224
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY ?:	No
OWNER TYPE:	Private	CONTACT:	Ben Robinson 07823 327796
SITE NAME:	Heavy Anti-aircraft gunsite 220m east of West N	1arsh Cottage, Barrov	w upon Humber
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1020024
CONDITION:	Generally satisfactory but with minor localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Deterioration - in need of management	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Ben Robinson 07823 327796
SITE NAME:	Yarborough Camp large univallate hillfort, Croxt	on	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1016427
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY ?:	No
OWNER TYPE:	Private	CONTACT:	Ben Robinson 07823 327796
SITE NAME:	Romano-British settlement near Staniwells Farm	, Hibaldstow	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1005221
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY ?:	No
OWNER TYPE:	Private	CONTACT:	Ben Robinson 07823 327796
SITE NAME:	Roman settlement, Kirmington		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1005206
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Metal detecting - unlicensed	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Ben Robinson 07823 327796
SITE NAME:	Romano-British villa at Mount Pleasant Farm, Kir	ton in Lindsey	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1013627
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY ?:	No
OWNER TYPE:	Private	CONTACT:	Ben Robinson 07823 327796

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no А

- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В
- implemented. C Slow decay; no solution agreed.

 D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site

 - Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

HERITAGE AT RISK 2023 / MIDLANDS / NORTH LINCOLNSHIRE (UA)

SITE NAME:	North Garth moated site and associated enclosure	s, North Killingholr	ne
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1007815
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Drainage/dewatering	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Ben Robinson 07823 327796
SITE NAME:	Axholme Carthusian Priory and post-Dissolution g	arden earthworks,	Melwood Park, Owston Ferry
DESIGNATION:	Scheduled Monument, LB grade II	LIST ENTRY NUMBER:	1017487
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Collapse	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Tim Allen 07770 610214
SITE NAME:	Kinaird motte and bailey castle, Owston Ferry		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1017556
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Ben Robinson 07823 327796
SITE NAME:	Old Winteringham Roman settlement, Winteringh	am	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1005243
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Ben Robinson 07823 327796
SITE NAME:	Howe Hill bowl barrow, Wootton		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1009346
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable clipping	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Ben Robinson 07823 327796
SITE NAME:	Roman site 400yds (370m) north east of Worlaby	Church, Worlaby	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1005233
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Ben Robinson 07823 327796
SITE NAME:	Crowle, Crowle and Ealand		
DESIGNATION:	Conservation Area, 14 LBs	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	Improving
VULNERABILITY:	Low	CONTACT:	Duty Planner (LPA) 01724 297000
SITE NAME:	Winterton		
DESIGNATION:	Conservation Area, 25 LBs	NEW ENTRY?:	No
CONDITION:	Poor	TREND:	Deteriorating
VULNERABILITY:	Medium	CONTACT:	Duty Planner (LPA) 01724 297000

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no А

Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В

implemented. C Slow decay; no solution agreed.

 D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

WEST NORTHAMPTONSHIRE (UA) Ruined church of Norman origin with CI4 and CI5 SITE NAME Old Church of St John the Baptist, Matton Lane, Boughton material. Nave, chancel and aisles partially survive but have suffered as a result of extensive, deep rooted ivy growth in DESIGNATION: Scheduled Monument the past and suffer, more generally, from antisocial behaviour. Historic England grant aided vegetation removal CONDITION Poor and stone consolidation in 2017-18. St John's was subsequently removed from the register. There have been OCCUPANCY: N/A some localised mortar failures. Vandalism in May 2019 PRIORITY CATEGORY: C (C) prompted re-addition to the register. Historic England has worked with church representatives to consider the OWNER TYPE: Religious organisation problems. LIST ENTRY NUMBER: 1003894 Contact: Jane Holt 07425732881 of Castle Ashby

© Historic England

© Historic England



	SITE NAME:	Terrace gardens, Castle Ashby Park, Castle Ashby	Terraced gardens, 1864, to north and east of Castle Ashby House. Designed by WB Thomas with decorated Blashfield
	DESIGNATION:	Listed Building grade II*, RPG grade I, part in CA	terracotta balustrading and other features. Balustrade in very poor state and has largely been dismantled or lost. Large sections of replacement with Jesmonite artificial
	CONDITION:	Very bad	replica. End bastion section and fountains still intact. Condition survey and structural investigation have been
	OCCUPANCY:	N/A	undertaken to inform management actions. LBC application
	PRIORITY CATEGORY:	A (A)	ongoing to regularise and continue Jesmonite replacement while conserving surviving terracotta where possible.
	OWNER TYPE:	Private	
	LIST ENTRY NUMBER:	189676	Contact: Dale Dishon 07889 808148



Church of St Mary, Horton, SITE NAME: Former church, CI3 and CI4 fabric, repaired and altered c1720 at the expense of the Earl of Halifax. There is a Hackleton known history of seasonal structural movement, and DESIGNATION: Listed Building grade II* internal plasterwork has fallen as a result. Rainwater goods are in very bad condition. There are areas of poor CONDITION: Poor stonework, such as to the tower and areas affected by leaking gutters. The chancel roof covering is in poor OCCUPANCY: Vacant/not in use condition, with slipped and missing slates. The Church PRIORITY CATEGORY: C (C) Commissioners have approved a pastoral scheme for sale of the building and part of the churchyard. OWNER TYPE: Religious organisation LIST ENTRY NUMBER: 1190174 Contact: Dale Dishon 07889 808148

© Historic England



The three-storey gatehouse tower with stair and SITE NAME Astwell Castle Farm (Gatehouse Tower), Helmdon garderobe turrets. Originally formed the east range of a moated courtyard house and now represents the sole DESIGNATION: Scheduled Monument standing remains of the CI5 house incorporated into an early C17 manor house. A condition survey, CONDITION: Poor commissioned by the owner, has identified repair needs. OCCUPANCY: The partially collapsed north store roof has been Vacant/not in use temporarily covered. The historic buildings, together with PRIORITY CATEGORY: B (B) farmyard and surrounding land has been sold. The new owner is undertaking consultation with Historic England. OWNER TYPE: Private LIST ENTRY NUMBER: 1003902 Contact: Ben Robinson 07823 327796

© Historic England



SITE NAME:	8, 8a, 9 and 9a, George Row, Northampton	The Northampton & County Club occupies one of the town's most important buildings. Its medieval vaulted
DESIGNATION:	Listed Building grade II*, CA	cellars survived the Great Fire of Northampton in 1675. The building later became Northampton's first Infirmary.
CONDITION:	Poor	There is a notable C17 staircase and ceiling and a C19 billiards room. The building suffers from cumulative
OCCUPANCY:	Occupied/in use	alterations, under-use and lack of repair. A condition
PRIORITY CATEGORY:	C (C)	survey and options appraisal were completed with Historic England funding in 2014. A grant for priority repairs was
OWNER TYPE:	Private	discussed, but this was not progressed by the owner. Consent given to replace a leaking roof light.
LIST ENTRY NUMBER:	1039667	Contact: Ben Robinson 07823 327796

© Historic England

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no

- solution agreed. Immediate risk of further rapid В deterioration or loss of fabric; solution agreed but not yet implemented.
- Slow decay; no solution agreed. С

Slow decay; solution agreed but F not yet implemented.

D

Е

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use)

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise. New Entry is noted).

ABBREVIATIONS

- Conservation Area Listed Building
- LB I PA
- Local Planning Authority National Park NP
- RPG
- Registered Park and Garden Scheduled Monument SM

ΪA ŴĤS

Unitary Authority World Heritage Site




SITE NAME:	Stable block and outbuildings at Wakefield Lodge, Potterspury	Stable block, outbuildings and attached walls and gate piers. Mid C18. Outbuildings now dwelling. Stable block has been
DESIGNATION:	Listed Building grade II*, RPG grade II	re-roofed and is watertight. Interior finishes in poor condition. Repair works been carried out to the exterior, including replacement of eroded stone window cills and
CONDITION:	Fair	repair/redecoration of some of the timber windows. Further repairs anticipated.
OCCUPANCY:	Part occupied/part in use	
PRIORITY CATEGORY:	F (F)	
OWNER TYPE:	Private	
LIST ENTRY NUMBER:	1190683	Contact: Amanda White 0121 625 6890

© Historic England



	SITE NAME:	Former Weedon Barracks, Outer Walls to Magazine Enclosure, Bridge Street, Weedon Bec	Defensive walls with lean-to structures at east and west end of enclosure, early C19. Red brick in Flemish style with intermediate piers. Part of an extraordinary Napoleonic military complex. Brickwork is in poor condition; both
	DESIGNATION:	Listed Building grade II*	lean-to structures have suffered partial collapse. Vegetation is damaging the brickwork further. The site has been
	CONDITION:	Poor	underused for many years and was left in a poor condition The magazine enclosure is now in the same ownership as the adjacent depot enclosure. Historic England is grant
	OCCUPANCY:	N/A	
	PRIORITY CATEGORY:	A (A)	aiding the repair of the Depot's north east bastion; work is due to complete in 2023.
	OWNER TYPE:	Private	
	LIST ENTRY NUMBER:	1342983	Contact: Amanda White 0121 625 6890

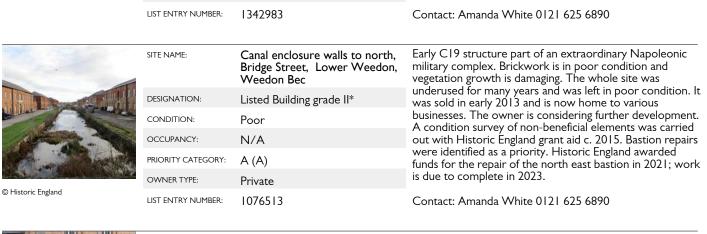

	SITE NAME:	Canal enclosure walls to south, Weedon Bec	Early C19 structure part of an extraordinary Napoleonic military complex. Brickwork is in poor condition and
	DESIGNATION:	Listed Building grade II*	vegetation growth is damaging. The whole site was underused for many years and was left in poor condition. It
	CONDITION:	Poor	was sold in early 2013 and is now home to various businesses. The owner is considering further development.
2 Co Marine	OCCUPANCY:	N/A	A condition survey of non-beneficial elements was carried
材料的利用工作的工作	PRIORITY CATEGORY:	A (A)	out with Historic England grant aid c. 2015. Bastion repairs were identified as a priority. Historic England awarded
	OWNER TYPE:	Private	funds for the repair of the north east bastion in 2021; work is due to complete in 2023.
gland	LIST ENTRY NUMBER:	1281680	Contact: Amanda White 0121 625 6890

© Historic Engla



D

Е

SITE NAME:	Outer wall and north west bastion, Weedon Bec
DESIGNATION:	Listed Building grade II*
CONDITION:	Very bad
OCCUPANCY:	N/A
PRIORITY CATEGORY:	A (A)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	1076512

Early C19 structure part of an extraordinary Napoleonic military complex. Brickwork is in poor condition and vegetation growth is damaging. The whole site was underused for many years and was left in poor condition. It was sold in early 2013 and is now home to various businesses. The owner is considering further development. A condition survey of non-beneficial elements was carried out with Historic Éngland grant aid c. 2015. Bastion repairs were identified as a priority. Historic England awarded funds for the repair of the north east bastion in 2021; work is due to complete in 2023.

Contact: Amanda White 0121 625 6890

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed. Immediate risk of further rapid В deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use)

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise. New Entry is noted).

- Conservation Area Listed Building LB
- I PA
- Local Planning Authority National Park NP
- Registered Park and Garden Scheduled Monument RPG
- SM UÁ
- Unitary Authority World Heritage Site WHS



	SITE NAME:	Outer wall and south east bastion, Bridge Street, Lower Weedon, Weedon Bec	Early C19 structure part of an extraordinary Napoleonic military complex. Brickwork is in poor condition and vegetation growth is damaging. The whole site was
A STATE OF A	DESIGNATION:	Listed Building grade II*	underused for many years and was left in poor condition. It was sold in early 2013 and is now home to various
	CONDITION:	Poor	businesses. The owner is considering further development. A condition survey of non-beneficial elements was carried
	OCCUPANCY:	N/A	out with Historic Éngland grant aid c. 2015. Bastion repa
	PRIORITY CATEGORY:	A (A)	were identified as a priority. Historic England awarded funds for the repair of the north east bastion in 2021; work
	OWNER TYPE:	Private	is due to complete in 2023.
	LIST ENTRY NUMBER:	1342980	Contact: Amanda White 0121 625 6890

© Historic England

© Historic England

© Historic England



	SITE NAME:	West lodge, Weedon Depot, Bridge Street, Lower Weedon, Weedon Bec	Lodge/gatehouse, early C19, to an extraordinary Napoleonic military complex. The whole site was underused for many years and was left in poor condition.
17	DESIGNATION:	Listed Building grade II*	Sold in early 2013 and now home to various businesses. All structural repairs completed, and external steps reinstated.
	CONDITION:	Fair	Building fully weathertight and in partial use. A change of use has been applied for to return the lodge to lodgings.
	OCCUPANCY:	Part occupied/part in use	
	PRIORITY CATEGORY:	C (C)	
	OWNER TYPE:	Private	
	LIST ENTRY NUMBER:	1203443	Contact: Amanda White 0121 625 6890



	SITE NAME:	Gate arch south of south front of Manor House, Winwick Manor, Winwick	Gate arch, early C17, constructed of limestone ashlar. Some open joints and stonework decay. There is a gradual loss of decorative details from natural erosion. Repairs
	DESIGNATION:	Listed Building grade II*	were planned but have not been implemented.
	CONDITION:	Fair	
	OCCUPANCY:	N/A	
	PRIORITY CATEGORY:	D (D)	
	OWNER TYPE:	Private	
	LIST ENTRY NUMBER:	1278961	Contact: Ben Robinson 07823 327796

C13, C14 and C17 church, comprising aisled nave, chancel, Church of St John the Baptist, SITE NAME: Church Road, Boddington south transept and CI4 three-stage west tower, all of squared coursed ironstone. The nave roof of CI9 has CI4 DESIGNATION: Listed Place of Worship grade I corbels. Ground drainage is poor, church is damp internally. A condition survey has been produced. Window CONDITION: Poor masonry repairs were completed 2020 but repairs to PRIORITY CATEGORY: drainage channel and stonework elsewhere are required. C (C) OWNER TYPE: Religious organisation LIST ENTRY NUMBER: 1041214 Contact: Jane Holt 07425732881

© Historic England



	SITE NAME:	Church of St Peter and St Paul, Church Lane, Chacombe	C14 church. Probably all one build but some later windows. C14 wall painting depicting Crucifixion of St
	DESIGNATION:	Listed Place of Worship grade I, CA	Peter; possibly more undiscovered. Generally well maintained but the building has been subject to heritage crime. Several roofs require permanent repair solutions
	CONDITION:	Very bad	and rainwater goods require attention. On-going structura issues to the south aisle require urgent repairs, chancel
K	PRIORITY CATEGORY:	A (A)	movement is being monitored. PCC keen to effect repairs
1	OWNER TYPE:	Religious organisation	and is working with the Diocesan Historic Church Support Officer to explore funding options.
. 0	LIST ENTRY NUMBER: 1041190	1041190	Contact: Jane Holt 07425732881

© Historic England

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no А

- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; В solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.

D

Е

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA
- LB LPA
- Conservation Area Listed Building Local Planning Authority National Park NP
- RPG Registered Park and Garden Scheduled Monument
- SM UA WHS
 - Unitary Authority World Heritage Site

	SITE NAME:	Church of All Saints, Church Lane, Clipston	Early CI3 church with monuments to the Buswells. The tower was rebuilt in the restoration of 1884-85. Aisled
	DESIGNATION:	Listed Place of Worship grade I	nave, south aisle and vestry have tall three-light windows and plain glass. A C20 extension provides chapel, kitcher
Stand Stand	CONDITION:	Poor	and toilets. The church is damp internally. Listed Places of Worship Roof Repair Fund grant repairs were completed
	PRIORITY CATEGORY:	C (C)	in 2018. The external drainage is defective, and repairs a
	OWNER TYPE:	Religious organisation	required to the rainwater goods. A recent steeplejack survey revealed concerns about spire stonework. The
	LIST ENTRY NUMBER:	1067033	parish is continuing to work with the Diocesan Historic Churches Support Officer.
			Churches Support Onicer.

© Historic England



	SITE NAME:	Lane, Cold Higham church with C13 tower, a saddleback st	A small mixed ironstone/ limestone/ brownstone parish church with CI3 tower, a saddleback stage added in the
-	DESIGNATION:	Listed Place of Worship grade II*	C14, with stone slate roof. Chancel rebuilt 1880-82. Structural movement to the east end has occurred leaving
PRIOF	CONDITION:	Poor	the masonry vulnerable to water ingress and there is erosion of all ironstone; this is a particular concern at high
	PRIORITY CATEGORY:	C (C)	level on the tower. PCC is keen to effect repairs and
	OWNER TYPE:	Religious organisation	exploring funding options with Diocesan Historic Church Support Officer.
	LIST ENTRY NUMBER:	1190319	Contact: Jane Holt 07425732881

Contact: Imogen Newcombe 07387 524030

© Historic England

	SITE NAME:	Church of All Saints, Church Lane, Croughton	Parish church of coursed limestone rubble built C12 to C14. The interior contains an important series of C14 wall
11	DESIGNATION:	Listed Place of Worship grade I, CA	paintings; scenes form 'Life of Christ' in the aisles and fragments of a 'Last Judgement' at east end of the nave. T church has been subject to heritage crime. Roof repairs
Par in	CONDITION:	Poor	completed 2021 but wall paintings need conservation and porch roof suffers slipped slates. The congregation is keen
	PRIORITY CATEGORY:	C (C)	to effect repairs and is fundraising.
	OWNER TYPE:	Religious organisation	
	LIST ENTRY NUMBER:	1192503	Contact: Jane Holt 07425732881
Peterborough			

© J. Brecon/Diocese ofPeterborough

1A	Ĵ₽ [™]	
	V	
- Ale	and the	1 AV

SITE NAME:	Church of St Denys, Clipston Road, Kelmarsh	C14 Church with C19 work by JK Colling. There is extensive cracking to the east end of the chancel, the east
DESIGNATION:	Listed Place of Worship grade II*	window and to the east and north elevations of the north aisle, however various repairs were undertaken in 2020.
CONDITION:	Very bad	The interior shows further signs of movement with the Sir John Hanbury wall monument now open jointed. A few
PRIORITY CATEGORY:	A (A)	rainwater goods require maintenance, yet gutters have
OWNER TYPE:	Religious organisation	recently been repaired. The Parochial Church Council are keen to effect further repairs, with funding required for the
LIST ENTRY NUMBER:	1370062	reinstatement of the east window and works to the

© J. Breckon, Diocese of Peterborough



SITE NAME:	Church of All Saints, Daventry Road, Norton	A large ironstone church, with C13 tower. Its C16 and C17 history is connected with the demolished Norton Hall.
DESIGNATION:	Listed Place of Worship grade I	Internally a fine C18 three-storey west screen with various monuments. South aisle stained glass by Willement c1850.
CONDITION:	Poor	The condition of high-level stonework is very bad, and below ground rainwater disposal is not functional and
PRIORITY CATEGORY:	D (C)	requires repair. The condition of the windows is poor with
OWNER TYPE:	Religious organisation	broken glass and deteriorating stonework. The interior is damp and roofing works are required. Repairs are
LIST ENTRY NUMBER:	1076507	proposed to be completed by late autumn 2023.

Contact: Imogen Newcombe 07387 524030

Contact: Imogen Newcombe 07387 524030

© J. Brecon/Diocese ofPeterborough

D

Е

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; В solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay: solution agreed but F not yet implemented. Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

- CA
- LB LPA
- Conservation Area Listed Building Local Planning Authority National Park NP RPG
- Registered Park and Garden Scheduled Monument

- SM
- UA Unitary Authority WHS World Heritage Site

	SITE NAME:	Church of St Mary, Thenford	Parish church of late C12, early C14 and Perpendicular.		
	DESIGNATION:	Listed Place of Worship grade I, CA	There is C15 stained glass in the north aisle. The north porch was rebuilt 1885. The church has been subject to heritage crime in 2016, 2018 and 2019. The interior		
	CONDITION:	Very bad	suffered severe water ingress prior to a temporary felt r being fitted. There are issues relating to the below grou		
-	PRIORITY CATEGORY:	C (A)	drainage and the interior is suffering from damp. The		
	OWNER TYPE:	Religious organisation	congregation is keen to effect repairs and is working with the Historic Churches Support Officer at the Diocese to		
The second second	LIST ENTRY NUMBER:	1371503	source funding do so.		
			Contact: Jane Holt 07425732881		

© Historic England

4	SITE NAME:	Church of St John the Baptist, High Street South, Tiffield	Church. C13 and C14. Restored, south aisle and porch added 1859 by EF Law; further restoration and rebuilding
	DESIGNATION:	Listed Place of Worship grade II*, CA	1873 by HC Vernon. High level stonework repairs are needed to the tower. Repairs are required to the nave and chancel roof; drainage channel and the rainwater goods are
	CONDITION:	Poor	largely inadequate. Works to address roof repairs, rainwater goods and drainage completed, but further
A ALL HE	PRIORITY CATEGORY:	C (C)	repairs to the tower roof tiles and some high level tower
STE-	OWNER TYPE:	Religious organisation	stonework are still needed.
	LIST ENTRY NUMBER:	1040916	Contact: Jane Holt 07425732881

© Historic England

AN AN	SITE NAME:	Church of St Peter and St Paul, Church Lane, Watford	Church, CI4 origin with CI5 and CI8 work. Restored CI9. Tower and drainage repairs, jointly funded by
- A	DESIGNATION:	Listed Place of Worship grade I	Historic England and the National Lottery Heritage Fund, completed late 2013. Nave and Chancel roof and
1	CONDITION:	Poor	rainwater goods repairs completed in 2019. Further drainage and low level masonry repairs are required. There
	PRIORITY CATEGORY:	C (C)	is some damp internally and some areas of flooring may
	OWNER TYPE:	Religious organisation	require specialist cleaning. The church has been the victim of heritage crime. Fundraising continues for final phase of
	LIST ENTRY NUMBER:	1077018	repairs.
			Contact: Jane Holt 07425732881

© Historic England

DesignationFormal villa, Chipping vira derians EdgebeeDesignation:Scheduled MonumentList ENTRY NUMBER:1006616condition:Generally satisfactory but with significant localised problemsTREND:StablePRINCIPAL VULNERABILITY:Development requiring planning permissionNEW ENTRY:Noowner type:PrivateCONTACT:Tim Allen 07770 610214SITE NAME:Roman villa south east of Cosgrove Hall, CosgroveIUST ENTRY NUMBER:1003874CONDITION:Scheduled Monument, 2 CAsLIST ENTRY NUMBER:1003874CONDITION:Extensive significant problemsTREND:DecliningPRINCIPAL VULNERABILITY:Arable ploughingNEW ENTRY:Noowner type:Univallate hillfort 250m south and a bowl barrow 30-wrater:Sathel Jordan 0121 625 6854DESIGNATION:Scheduled MonumentUIST ENTRY NUMBER:1018857ONDITION:Scheduled MonumentIUST ENTRY NUMBER:1018857STIE NAME:Univallate hillfort 250m south and a bowl barrow 30-wrater:IUST ENTRY NUMBER:1018857DESIGNATION:Scheduled MonumentIUST ENTRY NUMBER:1018857CONDITION:Extensive significant problemsTREND:DecliningDESIGNATION:Scheduled MonumentIUST ENTRY NUMBER:1018857CONDITION:Extensive significant problemsTREND:DecliningPRINCIPAL VULNERABILITY:Arable ploughingNEW ENTRY:No				
CONDITION:Generally satisfactory but with significant localised problemsTREND:StablePRINCIPAL VULNERABILITY:Development requiring planning permissionNEW ENTRY?:NoOWNER TYPE:PrivateCONTACT:Tim Allen 07770 610214SITE NAME:Roman villa south east of Cosgrove Hall, CosgroveUST ENTRY NUMBER:1003874DESIGNATION:Scheduled Monument, 2 CAsLIST ENTRY NUMBER:1003874CONDITION:Extensive significant problemsTREND:DecliningPRINCIPAL VULNERABILITY:Arable ploughingNEW ENTRY?:NoOWNER TYPE:Univallate hillfort 250m south and a bowl barrow WE ENTRYNoDESIGNATION:Scheduled MonumentUST ENTRY NUMBER:1018857CONTACT:Extensive significant problemsISTE NAME:1018857CONDITION:Extensive significant problemsISTE NAME:1018857CONDITION:Extensive significant problemsIREND:DecliningPRINCIPAL VULNERABILITY:Arable ploughingNEW ENTRY?NoSTE NAME:Univallate hillfort 250m south and a bowl barrow West of Stele Dykes Farm, FarthingstoneDESIGNATION:Scheduled MonumentLIST ENTRY NUMBER:1018857CONDITION:Extensive significant problemsREND:DecliningPRINCIPAL VULNERABILITY:Arable ploughingNEW ENTRY?No	SITE NAME:	Roman villa, Chipping Warden and Edgcote		
Condition:problemsPrivateStablePRINCIPAL VULNERABILITY:Development requiring planning permissionNEW ENTRY?:NoOWNER TYPE:PrivateCONTACT:Tim Allen 07770 610214SITE NAME:Roman villa south east of Cosgrove Hall, CosgroveIJST ENTRY NUMBER:1003874DESIGNATION:Scheduled Monument, 2 CAsLIST ENTRY NUMBER:1003874CONDITION:Extensive significant problemsTREND:DecliningPRINCIPAL VULNERABILITY:Arable ploughingNEW ENTRY?:NoOWNER TYPE:Univallate hillfort 250m south and a bowl barrow 30m south east of CosgroveStelee Dykes Farm, FarthingstoneDESIGNATION:Scheduled MonumentLIST ENTRY NUMBER:1018857CONTACT:Rachel Jordan 0121 625 6854Stelee Dykes Farm, FarthingstoneDESIGNATION:Scheduled MonumentLIST ENTRY NUMBER:1018857CONDITION:Extensive significant problemsTREND:DecliningPRINCIPAL VULNERABILITY:Arable ploughingNEW ENTRY?:NoPRINCIPAL VULNERABILITY:Arable ploughingNEW ENTRY?:No	DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1006616
OWNER TYPE:PrivateCONTACT:Tim Allen 07770 610214SITE NAME:Roman villa south east of Cosgrove Hall, CosgroveUIST ENTRY NUMBER:1003874DESIGNATION:Scheduled Monument, 2 CAsLIST ENTRY NUMBER:1003874CONDITION:Extensive significant problemsTREND:DecliningPRINCIPAL VULNERABILITY:Arable ploughingNEW ENTRY?:NoOWNER TYPE:Univallate hillfort 250m south and a bowl barrow JUNACT:Rachel Jordan 0121 625 6854SITE NAME:Univallate hillfort 250m south and a bowl barrow JUNACT:1018857DESIGNATION:Scheduled MonumentILST ENTRY NUMBER:1018857CONDITION:Extensive significant problemsTREND:DecliningCONDITION:Kensive significant problemsTREND:DecliningRINCIPAL VULNERABILITY:Arable ploughingNEW ENTRY?:No	CONDITION:		TREND:	Stable
sitte NAME: Roman villa south east of Cosgrove Hall, Cosgrove designation: Scheduled Monument, 2 CAs LIST ENTRY NUMBER: 1003874 cONDITION: Extensive significant problems TREND: Declining PRINCIPAL VULNERABILITY: Arable ploughing NEW ENTRY?: No OWNER TYPE: Private Univallate hillfort 250m south and a bowl barrow 3000000000000000000000000000000000000	PRINCIPAL VULNERABILITY:	Development requiring planning permission	NEW ENTRY?:	No
DESIGNATION:Scheduled Monument, 2 CAsLIST ENTRY NUMBER:1003874CONDITION:Extensive significant problemsTREND:DecliningPRINCIPAL VULNERABILITY:Arable ploughingNEW ENTRY?:NoOWNER TYPE:PrivateCONTACT:Rachel Jordan 0121 625 6854SITE NAME:Univallate hillfort 250m south and a bowl barrow 3000 south east of Univallate hillfort 25000 south and a bowl barrow 3000 south east of Univallate hillfort 25000 south and a bowl barrow 3000 south east of Univallate hillfort 25000 south and a bowl barrow 3000 south east of Univallate hillfort 25000 south and a bowl barrow 3000 south east of Univallate hillfort 25000 south and a bowl barrow 3000 south east of Univallate hillfort 25000 south and a bowl barrow 3000 south east of Univallate hillfort 25000 south and a bowl barrow 30000 south east of Univallate hillfort 25000 south and a bowl barrow 3000 south east of Univallate hillfort 25000 south and a bowl barrow 30000 south east of Univallate hillfort 25000 south and a bowl barrow 30000 south east of Univallate 1018857DESIGNATION:Scheduled MonumentLIST ENTRY NUMBER:1018857CONDITION:Extensive significant problemsTREND:DecliningPRINCIPAL VULNERABILITY:Arable ploughingNEW ENTRY?:No	OWNER TYPE:	Private	CONTACT:	Tim Allen 07770 610214
CONDITION:Extensive significant problemsTREND:DecliningPRINCIPAL VULNERABILITY:Arable ploughingNEW ENTRY?:NoOWNER TYPE:PrivateCONTACT:Rachel Jordan 0121 625 6854SITE NAME:Univallate hillfort 250m south and a bowl barrow 3000 more south east of 25stle Dykes Farm, FarthingstoneDESIGNATION:Scheduled MonumentLIST ENTRY NUMBER:1018857CONDITION:Extensive significant problemsTREND:DecliningPRINCIPAL VULNERABILITY:Arable ploughingNEW ENTRY?:No	SITE NAME:	Roman villa south east of Cosgrove Hall, Cosgrove		
PRINCIPAL VULNERABILITY: Arable ploughing NEW ENTRY?: No OWNER TYPE: Private CONTACT: Rachel Jordan 0121 625 6854 SITE NAME: Univallate hillfort 250m south and a bowl barrow 300m south east of Extensive Significant problems LIST ENTRY NUMBER: 1018857 CONDITION: Extensive significant problems TREND: Declining PRINCIPAL VULNERABILITY: Arable ploughing NEW ENTRY?: No	DESIGNATION:	Scheduled Monument, 2 CAs	LIST ENTRY NUMBER:	1003874
OWNER TYPE:PrivateCONTACT:Rachel Jordan 0121 625 6854SITE NAME:Univallate hillfort 250m south and a bowl barrow 300m south east of Castle Dykes Farm, FarthingstoneDESIGNATION:Scheduled MonumentLIST ENTRY NUMBER:CONDITION:Extensive significant problemsTREND:DecliningPRINCIPAL VULNERABILITY:Arable ploughingNEW ENTRY?:No	CONDITION:	Extensive significant problems	TREND:	Declining
SITE NAME: Univallate hillfort 250m south and a bowl barrow 300m south east of Castle Dykes Farm, Farthingstone DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1018857 CONDITION: Extensive significant problems TREND: Declining PRINCIPAL VULNERABILITY: Arable ploughing NEW ENTRY?: No	PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1018857 CONDITION: Extensive significant problems TREND: Declining PRINCIPAL VULNERABILITY: Arable ploughing NEW ENTRY?: No	OWNER TYPE:	Private	CONTACT:	Rachel Jordan 0121 625 6854
CONDITION: Extensive significant problems TREND: Declining PRINCIPAL VULNERABILITY: Arable ploughing NEW ENTRY?: No	SITE NAME:	Univallate hillfort 250m south and a bowl barrow 3	00m south east of	Castle Dykes Farm, Farthingstone
PRINCIPAL VULNERABILITY: Arable ploughing NEW ENTRY?: No	DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1018857
	CONDITION:	Extensive significant problems	TREND:	Declining
OWNER TYPE: Private CONTACT: Ben Robinson 07823 327796	PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
	OWNER TYPE:	Private	CONTACT:	Ben Robinson 07823 327796

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В
- implemented. C Slow decay; no solution agreed.

 D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user lidentified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

- CA LB LPA NP RPG SM
- Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

UA Unitary Authority WHS World Heritage Site

TERITAGE AT RISK 2023 7 THE			
SITE NAME:	Roman villa north of Road Hill Farm, Harpole		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1003901
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Ben Robinson 07823 327796
SITE NAME:	Site of Bannaventa, Long Buckby / Norton / Whi	lton	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1003879
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Ben Robinson 07823 327796
SITE NAME:	Two bowl barrows and a henge 600m east of Mi	ll Hill Farm, Naseby	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1012148
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Ben Robinson 07823 327796
SITE NAME:	Roman villa south east of Stokegap Lodge, Stoke	Bruerne	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1003878
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Ben Robinson 07823 327796
SITE NAME:	Former World War I National Filling Factory, Ba	nbury, Warkworth	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	4098
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Ben Robinson 07823 327796
SITE NAME:	Multivallate hillfort at Hunsbury Hill, West Huns	bury	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1012150
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY ?:	No
OWNER TYPE:	Local authority	CONTACT:	Ben Robinson 07823 327796
SITE NAME:	Castle Hill ringwork, Weedon Lois, Weston and	Weedon	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1010252
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Improving
		NEW ENTRY?:	No
PRINCIPAL VULNERABILITY:	Deterioration - in need of management		
	Deterioration - in need of management Local authority	CONTACT:	Rachel Jordan 0121 625 6854
PRINCIPAL VULNERABILITY: OWNER TYPE: SITE NAME:	-		
OWNER TYPE:	Local authority		
OWNER TYPE:	Local authority Old Stratford	CONTACT:	Rachel Jordan 0121 625 6854

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no А

Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В

implemented. C Slow decay; no solution agreed.

 D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

62

HERITAGE AT RISK 2023 / MIDLANDS / WEST NORTHAMPTONSHIRE (UA) / NORTH NORTHAMPTONSHIRE (UA)

SITE NAME:	St Crispin Hospital, Upton, Upton / Duston		
DESIGNATION:	Conservation Area, 2 LBs	NEW ENTRY ?:	No
CONDITION:	Very bad	TREND:	Deteriorating significantly
VULNERABILITY:	Medium	CONTACT:	Jenny Ballinger (LPA) 01604 837637

NORTH NORTHAMPTONSHIRE (UA)

	· · ·		
	SITE NAME:	Apethorpe Palace, Apethorpe	Country house, late C15/early C17. Following a
marter and marting	DESIGNATION:	Listed Building grade I, RPG grade II	Compulsory Purchase Order in 2004 by the Secretary of State, Historic England took possession of the site and carried out a programme of repairs over the following
	CONDITION:	Fair	decade. The building was sold on to private buyers in 2015 and they have been carrying out a comprehensive
	OCCUPANCY:	Part occupied/part in use	programme of further repairs and renovations, including
	PRIORITY CATEGORY:	F (F)	reversal of harmful mid-C20 alterations by the school. Phase I of the repair programme has been completed and
	OWNER TYPE:	Private	Phase II will complete in summer 2023. Public access for 50 days a year is managed by English Heritage.
© Historic England	LIST ENTRY NUMBER:	1040083	Contact: Dale Dishon 07889 808148

	SITE NAME:	Ashton Mill, Oundle Road, Ashton	Former C18 -C19 water-powered corn mill, adapted circa 1900 to form electricity-generating and water-pumping
	DESIGNATION:	Listed Building grade II*, CA	station for the Rothschild estate at Ashton village and Ashton Wold. Housed the Dragonfly Museum until 2001,
II II CARL	CONDITION:	Poor	since unoccupied. Historic England grant aided localised urgent repairs of building fabric in 2014/15 and urgent mill
	OCCUPANCY:	Vacant/not in use	machinery repairs in early 2016. The building remains
	PRIORITY CATEGORY:	C (C)	unused and continues to deteriorate. Discussions are ongoing regarding urgent works.
	OWNER TYPE:	Commercial company	
gland	LIST ENTRY NUMBER:	1040278	Contact: Dale Dishon 07889 808148

Barnwell Castle, Barnwell

Listed Building grade I, RPG

grade II, SM, ČĂ

Poor

N/A

E (E)

Private

1294426

© Historic Engla



SITE NAME:

DESIGNATION:

CONDITION:

OCCUPANCY:

OWNER TYPE:

PRIORITY CATEGORY:

LIST ENTRY NUMBER:

© Historic England



© Historic England

2	SITE NAME:	Lilford Hall, Lilford-cum- Wigsthorpe	Country house, 1635 and 1656, extended and altered in C18 by Henry Flitcroft and in C19 and early C20. The roof
- PU	DESIGNATION:	Listed Building grade I	covering is in poor condition leading to water ingress and distress to the upper storeys. The front bays require
THI	CONDITION:	Poor	structural attention. Some repairs were carried out by the previous owners but significant further works are required.
DIN	OCCUPANCY:	Part occupied/part in use	The property was acquired by new owners in 2022 and
Ly.	PRIORITY CATEGORY:	C (C)	they have embarked on a programme of major repairs and restoration as a family residence. Good progress has been
	OWNER TYPE:	Private	made on the works especially to the roofs.
	LIST ENTRY NUMBER:	1189554	Contact: Dale Dishon 07889 808148

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- solution agreed. Immediate risk of further rapid В deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.

D

Е

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

The ruins of a fortified residence dating to the mid CI3,

gatehouse entrance. Despite the demolition of its internal

growth and deterioration of the local limestone, especially

of repair work commenced in 2021, completing repairs to

where wall cores are exposed, has led to fabric loss and vulnerability to localised collapse. A five-year programme

southeast tower and gatehouse in 2021.

Contact: Tim Allen 07770 610214

built on a quadrangular plan with corner towers and a

buildings in the late C17, Barnwell Castle survives in a remarkably complete form. In recent years vegetation

- CA LB
- LPA
- Conservation Area Listed Building Local Planning Authority National Park NP
- RPG Registered Park and Garden Scheduled Monument
- SM
- UA WHS Unitary Authority World Heritage Site

HERITAGE AT RISK 2023 / MIDLANDS / NORTH NORTHAMPTONSHIRE (UA)

Manually and all	SITE NAME:	Dovecote, circa 160 metres	An exceptionally large late C16/early C17 dovecote of
Marter V		north east of Newton Field Centre, Newton and Little Oakley	squared coursed limestone, closely laid in tight courses, with stone slate roof and hipped lanterns. Central coping ornamented with Tresham trefoils. Interior has around
	DESIGNATION:	Listed Building grade I, SM	2000 nesting boxes in two lofty chambers. Masonry is generally in fair order albeit there are a few isolated missing
	CONDITION:	Poor	stones. However, roof slates and lanterns are in poor condition. Some patch roof repairs were undertaken in
Contraction of street	OCCUPANCY:	Vacant/not in use	2015 but the building is now in new ownership. It is
	PRIORITY CATEGORY:	C (C)	 deteriorating once more and re-roofing is required. Subject to occasional vandalism.
Historic England	OWNER TYPE:	Private	
	LIST ENTRY NUMBER:	1192042	Contact: Rachel Jordan 0121 625 6854
200	SITE NAME:	Dovecote on site of manor house and gardens, Wakerley	Roofless ruin of rectangular stone dovecote, C16-C18. Stone nesting boxes with alighting steps inside. Partial
TRANSFE 1	DESIGNATION:	Scheduled Monument, part in CA	collapse of the internal east wall nesting boxes has occurred and the wall to the north has collapsed to a few courses above ground level. There is evidence of structural
	CONDITION:	Poor	instability to the south and east elevations. It is likely that livestock is contributing to the displacement of stonework.
	OCCUPANCY:	N/A	ivestock is contributing to the displacement of stonework.
- 4 -	PRIORITY CATEGORY:	A (A)	
	OWNER TYPE:	Other not for profit group	
∋ Historic England	LIST ENTRY NUMBER:	1003626	Contact: Ben Robinson 07823 327796
	SITE NAME:	Church of St Nicholas, Main Street, Bulwick	Mainly C13 and C14 church, restored 1870 by Slater & Carpenter. Rainwater goods are in poor condition and many leak badly, with some sections broken. Maintenance
	DESIGNATION:	Listed Place of Worship grade I, CA	or repair is urgently needed. Some gutters are blocked with grass and vegetation. External drainage and water dispersal
	CONDITION:	Poor	in general is poor, with ineffective drainage channels contributing to dampness internally. Some evidence of leaks to the nave and south aisle roofs, and the chance ridge is also letting in water. Sources of grant funding f
L m 1 1.	PRIORITY CATEGORY:	C (C)	
A A A A	OWNER TYPE:	Religious organisation	repairs are being explored,
J. Brecon/Diocese ofPeterborough	LIST ENTRY NUMBER:	1191576	Contact: Jane Holt 07425732881
NHN1	SITE NAME:	Church of St Peter, Main Road, Lowick	Church with fabric from early CI4, late CI4 and CI5 for the Greene family of Drayton House. There are a number
	DESIGNATION:	Listed Place of Worship grade I, CA	of monuments within the church, the earliest to Sir Rolf Greene who died in 1417. The building was restored 1869 and 1887. Repointing required, particularly to the western
	CONDITION:	Poor	elevation of the south transept. The church was subject to heritage crime in 2020. The Historic Churches Support
AF 1 Jann	PRIORITY CATEGORY:	A (A)	Officer at Peterborough Diocese is supporting the Parish
	OWNER TYPE:	Religious organisation	to find sources of funding for repairs.
). Brecon/Diocese ofPeterborough	LIST ENTRY NUMBER:	1040265	Contact: Jane Holt 07425732881
J. Diecon Diocese on eterborough			
A CAR	SITE NAME:	Church of St Mary the Virgin and All Saints, Church Street, Nassington	Church CII, restored CI9. There are issues of rainwater dispersal at high, ground and below-ground levels, with blocked drains and inadequate drainage. Roof coverings of
	DESIGNATION:	Listed Place of Worship grade I, CA	the north aisle and the tower south chamber are at the end of their serviceable lives. There is accelerated weathering of masonry, with open masonry joints. General repointing
ALA LA LA	CONDITION:	Poor	is required. Further issues are general vegetation and detritus. Internally, low-level cement strap-pointing has
	PRIORITY CATEGORY:	C (New entry)	detached, alongside the detachment of wall painting
	OWNER TYPE:	Religious organisation	fragments. The Historic Churches Support Officer is

C BRID © Diocese of Peterborough

	i vassiligi Oli	biocited di uno uno inadequate di unager ricori corre
DESIGNATION:	Listed Place of Worship grade I, CA	the north aisle and the tower south chamber are a of their serviceable lives. There is accelerated weat of masonry, with open masonry joints. General rep
CONDITION:	Poor	is required. Further issues are general vegetation a detritus. Internally, low-level cement strap-pointing
PRIORITY CATEGORY:	C (New entry)	detached, alongside the detachment of wall paintin
OWNER TYPE:	Religious organisation	fragments. The Historic Churches Support Officer providing ongoing support.
LIST ENTRY NUMBER:	1065930	Contact: Imogen Newcombe 07387 524030

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented. В
- C Slow decay; no solution agreed.

 D Slow decay: solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site
 - Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

HERITAGE AT RISK 2023 / MIDLANDS / NORTH NORTHAMPTONSHIRE (UA)


Di CC PF	SITE NAME:	Church of St Peter, Berrister Place, Raunds	Large urban church of C12-C14, with wall paintings. There is history of movement at the west end, with the northwest
	DESIGNATION:	Listed Place of Worship grade I	corner of the north aisle settling and the south aisle requiring tying by 2013. Stained-glass panels had been
	CONDITION:	Fair	temporarily removed, with the wall paintings now conserved. A National Lottery Heritage Fund Grants for
	PRIORITY CATEGORY:	D (D)	Places of Worship grant was awarded mid-2017 for
	OWNER TYPE:	Religious organisation	localised underpinning and repairs. A structural roof timber in the nave is at high-risk of failure, yet a solution for its
	LIST ENTRY NUMBER:	1192206	repair has been identified. The Diocesan Historic Churches Support Officer is providing advice.
Peterborough			Contact: Imogen Newcombe 07387 524030



SITE NAME: Church of St Leonard, Church of C13 origin. Rebuilt in 1660-70 after it was Rockingham, Rockingham destroyed in the Civil War. Restored in C19. The church has a history of structural movement with notable Listed Place of Worship grade movement occurring in 2014 and continuing through 2018 DESIGNATION: II*, SM, CA and 2019. By 2020 the east wall and south wall of the chapel were invested with ivy and chapel roof coverings CONDITION: Poor were in poor condition. Historic England Covid 19 PRIORITY CATEGORY: Emergency HAR funds were awarded in 2020 to C (C) investigate movement, remove ivy and undertake roof OWNER TYPE: Religious organisation repairs. This work has been completed. Post repair monitoring continues in 2023. LIST ENTRY NUMBER: 1286197

© Historic England

© Diocese of Pe

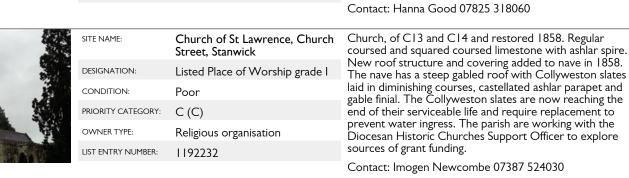

© Historic England

SITE NAME:	Site revealed by aerial photography north of Easton Lodge, Easton Maudit			
DESIGNATION:	Scheduled Monument LIST ENTRY NUMBER: 1003876			
CONDITION:	Extensive significant problems	Extensive significant problems TREND: Declining		
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No	
OWNER TYPE:	Private	CONTACT:	Ben Robinson 07823 327796	
SITE NAME:	Roman villa, Little Addington			
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1003630	
CONDITION:	Extensive significant problems TREND: Declining			
PRINCIPAL VULNERABILITY:	Arable ploughing NEW ENTRY?: No		No	
OWNER TYPE:	Private	CONTACT:	Ben Robinson 07823 327796	
SITE NAME:	Wellingborough Town Centre, Wellingborough			
DESIGNATION:	Conservation Area, 93 LBs, SM	Conservation Area, 93 LBs, SM NEW ENTRY?: No		
CONDITION:	Poor	TREND:	Deteriorating	
VULNERABILITY:	Low	CONTACT:	Samantha Pace (LPA) 0333 0137156	

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no

- solution agreed. Immediate risk of further rapid В deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.

Slow decay; solution agreed but $\ \ F$ not yet implemented.

D

Е

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use)

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- Conservation Area Listed Building CA
- LB I PA
- Local Planning Authority National Park NP
- RPG Registered Park and Garden Scheduled Monument
- SM UÁ
- Unitary Authority World Heritage Site WHS

SITE NAME

DESIGNATION:

CONDITION:

OCCUPANCY:

OWNER TYPE:

PRIORITY CATEGORY:

LIST ENTRY NUMBER:

NOTTINGHAM, CITY OF (UA)



(0) ()		
SITE NAME:	County House, 23, High Pavement	Townhouse, with possible C15 or C16 origins, rebuilt between 1728 and 1733, remodelled and extended in 1833
DESIGNATION:	Listed Building grade II*, CA	to form judges' lodgings, subsequently converted to offices in 1922, and further extended in 1930 and 1949. The
CONDITION:	Very bad	building is in a very bad condition. The bressumer beam in the north west wing has failed and there is defective
OCCUPANCY:	Vacant/not in use	plasterwork throughout. One of the staircases has failed.
PRIORITY CATEGORY:	B (B)	Listed Building consent for a new use has been granted. The owner is working with Nottingham City Council on
OWNER TYPE:	Commercial company	future plans. The building is unoccupied.
LIST ENTRY NUMBER:	1270805	Contact: Clive Fletcher 07771502052

© For use in HAR register



© Mr David Kennedy. Source: Historic

England Archive

Early C18, restored c1970. There are issues of widespread SITE NAME: Dovecote 600m east of Home spalling to overall brickwork, notably the gables. The west Farm gable's parapet and kneeler shows vertical cracking. The Scheduled Monument and Listed parapet is in poor condition, with cement repointing and DESIGNATION: Building grade II, CA loss of the original copings. The roof shingles are deteriorating, creating holes in the roof and the possibility CONDITION: Poor of water ingress. The basal courses on the north elevation OCCUPANCY: N/A are in poor condition, with biological growths and heavily eroded mortar joints. Nottingham City Council PRIORITY CATEGORY: F (F) commissioned a condition survey to inform future repairs and are keen to undertake these OWNER TYPE: Local authority LIST ENTRY NUMBER: 1016950 and 1270435 Contact: Imogen Newcombe 07387 524030

Wollaton Hall, Wollaton Park

Listed Building grade I, RPG

grade II*, CA

Occupied/in use

A (New entry)

Local authority

Very bad

1255269

Country house, now a museum, 1580-88, by Robert

Converted to a museum in 1925. Of square plan with

By 2022, there was significant water ingress through the towers and terrace. An Arts Council England MEND grant

Smythson. Altered late C17 and again early C19.


symmetrical fronts. The central hall is topped by a prospect room and there are projecting towers to corners.

was awarded for repairs in early 2023.

Contact: Amanda White 0121 625 6890



© Historic England

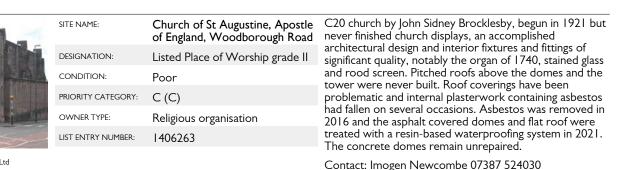

© Peter Rogan Associates Ltd



SITE NAME:	Woodborough Road Islamic Social Centre	Baptist church 1893, by Watson Fothergill of Nottingham. Internally the building is in a poor condition, with damp,
DESIGNATION:	Listed Place of Worship grade II	mould and active dry rot throughout the building. The ceiling has large holes, and there are signs of structural
CONDITION:	Poor	movement above the central archway and of the mezzanine joists. The tower roof has missing slates and
PRIORITY CATEGORY:	A (A)	deteriorated coverings, which is permitting water ingress.
OWNER TYPE:	Mixed, multiple owners	The Pakistan Centre and the Nottingham School of Boxing are eager to undertake a repair programme. Further advice
LIST ENTRY NUMBER:	1255289	on repairs and grant funding is being sought.
		Contact: Imogen Newcombe 07387 524030

© © Mrs Mollie Toy. Source Historic England Archive

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no

- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- С Slow decay; no solution agreed.
- Slow decay; solution agreed but $\ \ F$ not yet implemented.

D

Е

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use)

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise. New Entry is noted).

- Conservation Area Listed Building LB
- I PA
- Local Planning Authority National Park NP
- Registered Park and Garden Scheduled Monument RPG
- SM
- ΪA Unitary Authority World Heritage Site WHS

HERITAGE AT RISK 2023 / MIDLANDS / NOTTINGHAM, CITY OF (UA)

	SITE NAME:	Capitol Bingo and Social Club, Churchfield Lane	Cinema, now Zionist Church. 1936-37 by Reginald Cooper. Red brick and reconstituted stone construction.
	DESIGNATION:	Listed Place of Worship grade II	Auditorium retains most of its original features. The roof is in poor condition and needs recovering, rainwater dispersal
	CONDITION:	Poor	also needs to be addressed. Some emergency repairs to stabilise the buildings condition were completed with an Historic England Repair Grant. Water continues to penetrate the interior is causing damage to the remarkab fibrous plasterwork. A National Lottery Heritage Fund
	PRIORITY CATEGORY:	A (A)	
	OWNER TYPE:	Religious organisation	
	LIST ENTRY NUMBER:	1246786	Development Phase project has commenced, it is hoped a Delievery Phase project will follow.

© Historic England



SITE NAME:	Church of St Mary, High Pavement, Nottingham	Grand urban parish church. C15 with later C19 restoration by George Gilbert Scott. Several areas require urgent
DESIGNATION:	Listed Place of Worship grade I, CA	masonry repair. In addition, several roofs require repair and rainwater goods need attention to prevent water ingress and decay. A Grant for Places of Worship was
CONDITION:	Poor	awarded in 2014 by the National Lottery Heritage Fund, enabling nave roof repairs. The tower roof has recently
PRIORITY CATEGORY:	C (C)	been repaired and works to the south transept have
OWNER TYPE:	Religious organisation	commenced. The Parochial Church Council continue to effect repairs with grant support from Historic England's
LIST ENTRY NUMBER:	342 8	Covid-19 Emergency Heritage at Risk Response Fund.

Contact: Jane Holt 07425732881

© Historic England



		Contact: Imogen Newcombe 07387 524030
SITE NAME:	Church of St Peter, St Peter's Gate, Nottingham	A large church in the heart of the city of Nottingham. C12 origins though mainly C15 in date with some C13 and C14
DESIGNATION:	Listed Place of Worship grade I, CA	work. Later C19 and C20 additions. A National Lottery Heritage Fund award enabled the nave and south aisle roofs to be recovered in 2020. The north aisle slated roof
CONDITION:	Poor	leaks and requires urgent repair. The chancel slate roof is suffering from nail fatigue. The Parochial Church Council
PRIORITY CATEGORY:	C (C)	are keen to explore potential funding avenues for repair
OWNER TYPE:	Religious organisation	programmes.
LIST ENTRY NUMBER:	1255013	Contact: Hanna Good 07825 318060

© Historic England

	SITE NAME:	Church of St Peter, Hartley Road, Nottingham	Church, 1812 by Henry Moses Wood in the Early English and Decorated styles. The present building replaced an
	DESIGNATION:	Listed Place of Worship grade II	earlier building, of which little survives. The chancel is later and dates to 1872. The roof coverings generally are in poor
	CONDITION:	Poor	condition and water ingress has caused damage to the interior decoration. Broken and leaking rainwater goods
	PRIORITY CATEGORY:	C (C)	have saturated the stonework. The church has been the
	OWNER TYPE:	Religious organisation	subject of antisocial behaviour. Grant funding being sought.
	LIST ENTRY NUMBER:	1270769	Contact: Hanna Good 07825 318060

© Historic England

SITE NAME:	Alfreton Road/Gamble Street, Nottinghan	n	
DESIGNATION:	Conservation Area, 3 LBs	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	Improving
VULNERABILITY:	Medium	CONTACT:	Toby Ebbs (LPA) 0115 8764149
SITE NAME:	Bulwell, Nottingham		
	Buiweii, Nottinghain		
DESIGNATION:	Conservation Area, 9 LBs	NEW ENTRY?:	No
		NEW ENTRY?: TREND:	No Improving

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no А

- Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В implemented.
- C Slow decay; no solution agreed.

 D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA LB LPA NP RPG SM
- Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument
- UA Unitary Authority WHS World Heritage Site

HERITAGE AT RISK 2023 / MIDLANDS / NOTTINGHAM, CITY OF (UA)

SITE NAME:	Canning Circus, Nottingham		
DESIGNATION:	Conservation Area, 25 LBs, RPG grade II	NEW ENTRY?:	No
	-	TREND:	
VULNERABILITY:	Very bad Low	CONTACT:	Deteriorating Toby Ebbs (LPA) 0115 8764149
VOLINEIVABIETTI.	Low	CONTACT.	1009 EDDS (LFA) 0115 8764149
SITE NAME:	Hine Hall, Nottingham		
DESIGNATION:	Conservation Area	NEW ENTRY ?:	No
CONDITION:	Poor	TREND:	Deteriorating
VULNERABILITY:	Low	CONTACT:	Toby Ebbs (LPA) 0115 8764149
SITE NAME:	Mapperley Hospital, Nottingham		
DESIGNATION:	Conservation Area, LB grade II	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	Improving
VULNERABILITY:	Low	CONTACT:	Toby Ebbs (LPA) 0115 8764149
SITE NAME:	New Lenton, Nottingham		
DESIGNATION:	Conservation Area, 8 LBs	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	Deteriorating
VULNERABILITY:	Low	CONTACT:	Toby Ebbs (LPA) 0115 8764149
GITE NAME:	Nottingham Canal, Nottingham		
DESIGNATION:	Conservation Area, 8 LBs	NEW ENTRY ?:	No
CONDITION:	Very bad	TREND:	Improving significantly
VULNERABILITY:	Low	CONTACT:	Toby Ebbs (LPA) 0115 8764149
SITE NAME:	Old Sneinton, Nottingham		
DESIGNATION:	Conservation Area, 7 LBs	NEW ENTRY ?:	No
CONDITION:	Very bad	TREND:	Improving
/ULNERABILITY:	Low	CONTACT:	Toby Ebbs (LPA) 0115 8764149
SITE NAME:	Star Buildings, Nottingham		
DESIGNATION:	Conservation Area	NEW ENTRY ?:	No
CONDITION:	Very bad	TREND:	Deteriorating
VULNERABILITY:	Low	CONTACT:	Toby Ebbs (LPA) 0115 8764149
SITE NAME:	The Arboretum, Nottingham		
DESIGNATION:	Conservation Area, 39 LBs, 2 RPGs	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	No significant change
VULNERABILITY:	Low	CONTACT:	Toby Ebbs (LPA) 0115 8764149
SITE NAME:	The Lace Market, Nottingham		
DESIGNATION:	Conservation Area, 119 LBs, SM	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	Improving
VULNERABILITY: Medium		CONTACT:	Toby Ebbs (LPA) 0115 8764149

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no А

- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed.
 C Slow decay; no solution agreed.

 D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site
 - Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

HERITAGE AT RISK 2023 / MIDLANDS / ASHFIELD / BASSETLAW

Very bad

Medium

NOTTINGHAMSHIRE **ASHFIELD** SITE NAME Wansley Hall manorial site, Selston LIST ENTRY NUMBER: 1019869 DESIGNATION: Scheduled Monument, LB grade II, part in CA Generally satisfactory but with significant localised CONDITION: TREND: Declining problems PRINCIPAL VULNERABILITY: NEW ENTRY? Collapse No OWNER TYPE: CONTACT: Private Ben Robinson 07823 327796 C13 park with remains of C13 motte and bailey castle. C17 terraces around the Hall with late C19 garden, pleasure SITE NAME: Annesley Hall, Annesley Registered Park and Garden grounds and walled garden. Site at risk due to lack of DESIGNATION: grade II*, 5 LBs, 2 SMs cohesive management, condition of key listed buildings and internal and external development pressures. The Hall Generally satisfactory but with CONDITION: (Grade II) suffered a serious fire in May 2015. An options significant localised problems appraisal and parkland management plan have been High VULNERABILITY: completed to help inform a sustainable future for the site and secure its conservation. Potentially harmful TREND: Stable development proposals have been submitted for land to the west. Historic England has provided advice. NEW ENTRY ?: No © Historic England OWNER TYPE: Mixed, multiple owners LIST ENTRY NUMBER: Contact: Ben Robinson 07823 327796 1001077 SITE NAME: Sutton in Ashfield Church and Market Place DESIGNATION: Conservation Area, 3 LBs NEW ENTRY ?: No

BASSETL	AW.
---------	-----

CONDITION:

VULNERABILITY

	SITE NAME:	Worksop Priory gatehouse, Cheapside, Worksop	Gatehouse, early CI4, with a slightly later south porch containing what is believed to be the only surviving English
	DESIGNATION:	Listed Building grade I, CA	medieval 'walk through' shrine. The gatehouse requires comprehensive repair, as demonstrated by a condition
	CONDITION:	Poor	survey funded by grant aid from Historic Éngland. An initial body of repairs focusing on the shrine, funded by a Repair
	OCCUPANCY:	Vacant/not in use	Grant for Places of Worship, was completed summer
	PRIORITY CATEGORY:	C (C)	2016. Further repairs are needed to the interior, exterior stonework, rainwater goods and statues. Options for
	OWNER TYPE:	Religious organisation	future uses and funding possibilities are being explored and engagement is positive.
oric England	LIST ENTRY NUMBER:	1045028	Contact: Imogen Newcombe 07387 524030

© Histo



© Historic England

			Contact: Imogen Newcombe 07387 524030
1	SITE NAME:	Church of St Giles, Main Street, Darlton	Former church, probably early C13. The church was largely rebuilt in 1855 by Hine and Evans, with the chancel rebuilt
DESIGNATION:	Listed Building grade II*	in 1863. The building has suffered from widespread structural movement with vertical cracks to several	
	CONDITION: Very bad	Very bad	elevations. The tiled roofs have numerous defects and t junction between nave and chancel is open to the
OCCUPANCY:	Vacant/not in use	elements, allowing water to penetrate the building.	
	PRIORITY CATEGORY:		Rainwater goods are defective, Self-set trees in the valley gutter between the north vestry and chancel. There are
	OWNER TYPE: Religious organisation	blocked hoppers elsewhere, and smashed windows. Residentiall conversion under discussion.	
	LIST ENTRY NUMBER:	1212465	Contact: David Walsh 0121 625 6888

TREND:

CONTACT:

Improving

Duty Planner (LPA) 01623 457388

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no

D

Е

- solution agreed. Immediate risk of further rapid В deterioration or loss of fabric; solution agreed but not yet implemented.
- С Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.
- Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use)

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- Conservation Area Listed Building CA
- LB I PA
- Local Planning Authority National Park NP
- RPG Registered Park and Garden Scheduled Monument
- SM
- ÍΙΑ Unitary Authority World Heritage Site WHS

HERITAGE AT RISK 2023 / MIDLANDS / BASSETLAW

	SITE NAME:	Church of St Oswald, Main Street, Dunham-on-Trent	Former church, C15 in origin, but with the exception of the tower all rebuilt in 1862 by TC Hine. There are serious
	DESIGNATION:	Listed Building grade I	concerns about the tracery work to the very large belfry openings, and the structural integrity is severely
	CONDITION:	Very bad	compromised in several places. There are localised stonework defects elsewhere. The slated roofs, gutters and
	OCCUPANCY:	Vacant/not in use	downpipes are all in very poor condition. Water ingress is
	PRIORITY CATEGORY:	B (B)	evident in numerous places. Conversion to a two bed dwelling has been approved. Roof repairs are underway.
	OWNER TYPE:	Private	
	LIST ENTRY NUMBER:	1370101	Contact: Ben Robinson 07823 327796

© Historic England

© Historic England



	SITE NAME:	Hodsock Priory Gatehouse, Hodsock	Early C16 gatehouse and bridge. Imposing entrance to later house with gardens. Whilst the house is occupied and used
	DESIGNATION:	Listed Building grade I	as a wedding venue, the gatehouse is unused and requires comprehensive maintenance. Historic England has
	CONDITION:	Fair	encouraged the development of options for reuse of the gatehouse combined with full repair of the structure.
	OCCUPANCY:	Vacant/not in use	Following the commissioning of a condition survey,
	PRIORITY CATEGORY:	C (C)	essential repairs have now been carried out. A bid to the National Lottery Heritage Fund for an educational and
	OWNER TYPE:	Private	restoration project has been considered.
	LIST ENTRY NUMBER:	87689	Contact: Ben Robinson 07823 327796

© Historic England

Limestone gateway and brick walls, mid C16. Stonework SITE NAME: Gateway and walls from Manor on the south face is very eroded, particularly on the Farm to churchyard, Torksey Street, Rampton and decorative plaques and lintel above the gateway, all which requires repair. The north face (including the plaques) is Woodbeck less eroded, but subsequent repointing is still required. The mortar joints to the brick wall are now deeply recessed DESIGNATION: Listed Building grade I and in need of repointing. The ivy growth on the walls is CONDITION: Poor extensive and is displacing the stone copings. OCCUPANCY: N/A PRIORITY CATEGORY: C (C) OWNER TYPE: Private LIST ENTRY NUMBER: 1276407 Contact: Hanna Good 07825 318060

- 1	SITE NAME:	East stable and outbuildings at Shireoaks Hall, Thorpe Lane, Shireoaks	Early C18 stable and outbuildings, possibly by Sir Thomas Hewitt, located to north west of the Hall, and set in C17 and early C18 formal landscape. A pair to the West Stable There are many slipped, broken and displaced roof slates. Masonry is open jointed. There are crack and displaced blocks. The building is shrouded in vegetation and a significant self-set sapling is growing through the roof. The outbuildings are in a ruinous state. Historic England has encouraged the local authority to consider options to
	DESIGNATION:	Listed Building grade II*, RPG grade II*, SM, 2 CAs	
	CONDITION:	Very bad	
© Historic England	OCCUPANCY:	Vacant/not in use	
	PRIORITY CATEGORY:	A (A)	secure this site in recent years but we are not aware of any action having been taken.
	OWNER TYPE:	Private	5
	LIST ENTRY NUMBER:	1045054	Contact: Amanda White 0121 625 6890



SITE NAME:	Shireoaks Hall, Thorpe Lane, Shireoaks	Country house, circa 1600 with later alterations, set in remains of C17 and early C18 gardens. The hall has been
DESIGNATION:	Listed Building grade II*, RPG grade II*, SM, 2 CAs	much altered historically. There is some significant cracking and loose masonry at high level; roofs are evidently in poor condition; some ceiling plaster has failed and rainwater
CONDITION:	Very bad	goods appear to be ineffective and undersized. The building has been neglected for many years; the north elevation is
OCCUPANCY:	Part occupied/part in use	shrouded in vegetation. Historic England has encouraged
PRIORITY CATEGORY:	A (A)	the local authority to consider options to secure this site in recent years but we are not aware of any action having
OWNER TYPE:	Private	been taken.
LIST ENTRY NUMBER:	1370408	Contact: Amanda White 0121 625 6890
	DESIGNATION: CONDITION: OCCUPANCY: PRIORITY CATEGORY: OWNER TYPE:	ShireoaksDESIGNATION:Listed Building grade II*, RPG grade II*, SM, 2 CAsCONDITION:Very badOCCUPANCY:Part occupied/part in usePRIORITY CATEGORY:A (A)OWNER TYPE:Private

© Historic England

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; В solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.

D

Е

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA LB
- LPA
- Conservation Area Listed Building Local Planning Authority National Park NP RPG
- Registered Park and Garden Scheduled Monument
- SM
- UA Unitary Authority WHS World Heritage Site

HERITAGE AT RISK 2023 / N	MIDLANDS / BASSETLAW

, Store	SITE NAME:	West stable at Shireoaks Hall, Thorpe Lane, Shireoaks	Early C18 stable and outbuildings, possibly by Sir Thomas Hewitt, located to north west of the Hall, and set in C17	
	DESIGNATION:	Listed Building grade II*, RPG grade II*, SM, 2 CAs	and early C18 formal landscape. A pair to the East Stable. There are many slipped, broken and displaced roof slates. Past slate repairs are now failing; the north ridge is missing	
	CONDITION:	Very bad	rainwater disposal is problematic, and the building is shrouded in vegetation. Historic England has encouraged	
	OCCUPANCY:	Vacant/not in use	the local authority to consider options to secure this site i	
the start shall	PRIORITY CATEGORY:	A (A)	recent years, but we are not aware of any action having been taken.	
	OWNER TYPE:	Private		
D Historic England	LIST ENTRY NUMBER:	1045055	Contact: Amanda White 0121 625 6890	
	SITE NAME:	Arch at Serlby Park, Serlby Road, Serlby, Styrrup with Oldcotes	arly C18 archway which lies on an axis of Serlby Hall. Dressed coursed rubble stone and brick. The stonework leavily eroded in places, particularly to the southern	
常國是自己	DESIGNATION:	Listed Building grade II*	elevation and the voussoirs. There is extensive open mortar jointing across most elevations. Self-seeded trees	
	CONDITION:	Poor	require removal. Some vegetation clearance has been	
「「「人」の「	OCCUPANCY:	N/A	undertaken.	
1993年4月第4日第1日	PRIORITY CATEGORY:	C (C)		
	OWNER TYPE:	Private		
D Historic England	LIST ENTRY NUMBER:	1224495	Contact: Ben Robinson 07823 327796	
		1227775	Contact. Ben Robinson 07625 527776	
	SITE NAME:	The Old Grammar School, Number 4, and attached Wall, Gate and Steps, Lincoln Road, Tuxford	Former school dating to 1669, with late C18 reorganisation. The building has not been maintained and actively deteriorating, with considerable structural issues within both the timbers and brickwork. Rainwater goods	
	DESIGNATION:	Listed Building grade II*, CA	are corroded, defective and blocked with detritus. The	
	CONDITION:	Poor	window timbers and dormer cheeks are failing, with potential detachment. Internal and boundary brickwork h	
	OCCUPANCY:	Vacant/not in use	partially collapsed in places, creating significant voids, with some areas of masonry unsupported and at risk of further	
	PRIORITY CATEGORY:		collapse. There are ongoing issues of asbestos, damp,	
Mr Derek E Godson, Source: Historic		A (A)	mould and beetle infestation.	
) Mr Derek E Godson. Source: Historic Ingland Archive	OWNER TYPE:	Community interest group		
			mould and beetle infestation. Contact: Imogen Newcombe 07387 524030	
	OWNER TYPE:	Community interest group	Contact: Imogen Newcombe 07387 524030 Church and meeting rooms of 1880 by Bellamy and Harc Localised ceiling plaster failures in 2014 lead to the closur	
	OWNER TYPE:	Community interest group 1224333 Methodist Church, Grove	Contact: Imogen Newcombe 07387 524030 Church and meeting rooms of 1880 by Bellamy and Hard Localised ceiling plaster failures in 2014 lead to the closur of the main part of the building. Investigations took place 2015 and repairs followed in 2020 with grant support fro	
	OWNER TYPE: LIST ENTRY NUMBER: SITE NAME:	Community interest group 1224333 Methodist Church, Grove Street Listed Place of Worship grade II,	Contact: Imogen Newcombe 07387 524030 Church and meeting rooms of 1880 by Bellamy and Hard Localised ceiling plaster failures in 2014 lead to the closur of the main part of the building. Investigations took place 2015 and repairs followed in 2020 with grant support fro Historic England's Covid-19 Emergency Heritage at Risk Response Fund. Loose plaster was secured and fallen	
	OWNER TYPE: LIST ENTRY NUMBER: SITE NAME: DESIGNATION:	Community interest group 1224333 Methodist Church, Grove Street Listed Place of Worship grade II, CA Fair	Contact: Imogen Newcombe 07387 524030 Church and meeting rooms of 1880 by Bellamy and Hard Localised ceiling plaster failures in 2014 lead to the closur of the main part of the building. Investigations took place 2015 and repairs followed in 2020 with grant support fro Historic England's Covid-19 Emergency Heritage at Risk Response Fund. Loose plaster was secured and fallen elements reinstated. Below ground drainage in the vicinity	
	OWNER TYPE: LIST ENTRY NUMBER: SITE NAME: DESIGNATION: CONDITION:	Community interest group 1224333 Methodist Church, Grove Street Listed Place of Worship grade II, CA Fair C (F)	Contact: Imogen Newcombe 07387 524030 Church and meeting rooms of 1880 by Bellamy and Hard Localised ceiling plaster failures in 2014 lead to the closur of the main part of the building. Investigations took place 2015 and repairs followed in 2020 with grant support fro Historic England's Covid-19 Emergency Heritage at Risk Response Fund. Loose plaster was secured and fallen elements reinstated. Below ground drainage in the vicinity of the stair tower was renewed in 2020. Funds were separately raised for internal redecorations in 2021. The	
	OWNER TYPE: LIST ENTRY NUMBER: SITE NAME: DESIGNATION: CONDITION: PRIORITY CATEGORY:	Community interest group 1224333 Methodist Church, Grove Street Listed Place of Worship grade II, CA Fair C (F) Religious organisation	Contact: Imogen Newcombe 07387 524030 Church and meeting rooms of 1880 by Bellamy and Hard Localised ceiling plaster failures in 2014 lead to the closur of the main part of the building. Investigations took place 2015 and repairs followed in 2020 with grant support fro Historic England's Covid-19 Emergency Heritage at Risk Response Fund. Loose plaster was secured and fallen elements reinstated. Below ground drainage in the vicinity of the stair tower was renewed in 2020. Funds were	
	OWNER TYPE: LIST ENTRY NUMBER: SITE NAME: DESIGNATION: CONDITION: PRIORITY CATEGORY: OWNER TYPE:	Community interest group 1224333 Methodist Church, Grove Street Listed Place of Worship grade II, CA Fair C (F)	Contact: Imogen Newcombe 07387 524030 Church and meeting rooms of 1880 by Bellamy and Harc Localised ceiling plaster failures in 2014 lead to the closur of the main part of the building. Investigations took place 2015 and repairs followed in 2020 with grant support fro Historic England's Covid-19 Emergency Heritage at Risk Response Fund. Loose plaster was secured and fallen elements reinstated. Below ground drainage in the vicinit of the stair tower was renewed in 2020. Funds were separately raised for internal redecorations in 2021. The first service in over five years occurred in summer 2021.	
ingland Archive	OWNER TYPE: LIST ENTRY NUMBER: SITE NAME: DESIGNATION: CONDITION: PRIORITY CATEGORY: OWNER TYPE:	Community interest group 1224333 Methodist Church, Grove Street Listed Place of Worship grade II, CA Fair C (F) Religious organisation	Contact: Imogen Newcombe 07387 524030 Church and meeting rooms of 1880 by Bellamy and Harc Localised ceiling plaster failures in 2014 lead to the closur of the main part of the building. Investigations took place 2015 and repairs followed in 2020 with grant support fro Historic England's Covid-19 Emergency Heritage at Risk Response Fund. Loose plaster was secured and fallen elements reinstated. Below ground drainage in the vicinity of the stair tower was renewed in 2020. Funds were separately raised for internal redecorations in 2021. The first service in over five years occurred in summer 2021. Monitoring is ongoing. Contact: Imogen Newcombe 07387 524030 Large urban church with tall decorative tower and spire. Earliest sections date to C14 but church extensively restored C19 and extended C20. Masonry is generally in	
ingland Archive	OWNER TYPE: LIST ENTRY NUMBER: SITE NAME: DESIGNATION: CONDITION: PRIORITY CATEGORY: OWNER TYPE: LIST ENTRY NUMBER:	Community interest group 1224333 Methodist Church, Grove Street Listed Place of Worship grade II, CA Fair C (F) Religious organisation 1393069 Parish Church of St Michael the Archangel, Bridgegate, West	Contact: Imogen Newcombe 07387 524030 Church and meeting rooms of 1880 by Bellamy and Hard Localised ceiling plaster failures in 2014 lead to the closur of the main part of the building. Investigations took place 2015 and repairs followed in 2020 with grant support fro Historic England's Covid-19 Emergency Heritage at Risk Response Fund. Loose plaster was secured and fallen elements reinstated. Below ground drainage in the vicinity of the stair tower was renewed in 2020. Funds were separately raised for internal redecorations in 2021. The first service in over five years occurred in summer 2021. Monitoring is ongoing. Contact: Imogen Newcombe 07387 524030 Large urban church with tall decorative tower and spire. Earliest sections date to C14 but church extensively restored C19 and extended C20. Masonry is generally in fair condition but there are poor parapet abutment detail and various localised repairs are evident. There is significa erosion of jamb stones and jointing to south porch arch	
ingland Archive	OWNER TYPE: LIST ENTRY NUMBER: SITE NAME: DESIGNATION: CONDITION: PRIORITY CATEGORY: OWNER TYPE: LIST ENTRY NUMBER: SITE NAME:	Community interest group 1224333 Methodist Church, Grove Street Listed Place of Worship grade II, CA Fair C (F) Religious organisation 1393069 Parish Church of St Michael the Archangel, Bridgegate, West Retford Listed Place of Worship grade	Contact: Imogen Newcombe 07387 524030 Church and meeting rooms of 1880 by Bellamy and Hard Localised ceiling plaster failures in 2014 lead to the closur of the main part of the building. Investigations took place 2015 and repairs followed in 2020 with grant support fro Historic England's Covid-19 Emergency Heritage at Risk Response Fund. Loose plaster was secured and fallen elements reinstated. Below ground drainage in the vicinity of the stair tower was renewed in 2020. Funds were separately raised for internal redecorations in 2021. The first service in over five years occurred in summer 2021. Monitoring is ongoing. Contact: Imogen Newcombe 07387 524030 Large urban church with tall decorative tower and spire. Earliest sections date to C14 but church extensively restored C19 and extended C20. Masonry is generally in fair condition but there are poor parapet abutment detail and various localised repairs are evident. There is significal erosion of jamb stones and jointing to south porch arch and gable. There is potential water ingress and damp	
ingland Archive	OWNER TYPE: LIST ENTRY NUMBER: SITE NAME: DESIGNATION: CONDITION: PRIORITY CATEGORY: OWNER TYPE: UIST ENTRY NUMBER: SITE NAME: DESIGNATION:	Community interest group 1224333 Methodist Church, Grove Street Listed Place of Worship grade II, CA Fair C (F) Religious organisation 1393069 Parish Church of St Michael the Archangel, Bridgegate, West Retford	Contact: Imogen Newcombe 07387 524030 Church and meeting rooms of 1880 by Bellamy and Hard Localised ceiling plaster failures in 2014 lead to the closur of the main part of the building. Investigations took place 2015 and repairs followed in 2020 with grant support fro Historic England's Covid-19 Emergency Heritage at Risk Response Fund. Loose plaster was secured and fallen elements reinstated. Below ground drainage in the vicinity of the stair tower was renewed in 2020. Funds were separately raised for internal redecorations in 2021. The first service in over five years occurred in summer 2021. Monitoring is ongoing. Contact: Imogen Newcombe 07387 524030 Large urban church with tall decorative tower and spire. Earliest sections date to C14 but church extensively restored C19 and extended C20. Masonry is generally in fair condition but there are poor parapet abutment detail and various localised repairs are evident. There is significa erosion of jamb stones and jointing to south porch arch and gable. There is potential water ingress and damp internally. A Listed Places of Worship Roof Repair Fund grant enabled roofs and rainwater goods to be repaired in	
ingland Archive	OWNER TYPE: LIST ENTRY NUMBER: SITE NAME: DESIGNATION: CONDITION: PRIORITY CATEGORY: OWNER TYPE: LIST ENTRY NUMBER: SITE NAME: DESIGNATION:	Community interest group 1224333 Methodist Church, Grove Street Listed Place of Worship grade II, CA Fair C (F) Religious organisation 1393069 Parish Church of St Michael the Archangel, Bridgegate, West Retford Listed Place of Worship grade II*, CA	Contact: Imogen Newcombe 07387 524030 Church and meeting rooms of 1880 by Bellamy and Hard Localised ceiling plaster failures in 2014 lead to the closur of the main part of the building. Investigations took place 2015 and repairs followed in 2020 with grant support fro Historic England's Covid-19 Emergency Heritage at Risk Response Fund. Loose plaster was secured and fallen elements reinstated. Below ground drainage in the vicinity of the stair tower was renewed in 2020. Funds were separately raised for internal redecorations in 2021. The first service in over five years occurred in summer 2021. Monitoring is ongoing. Contact: Imogen Newcombe 07387 524030 Large urban church with tall decorative tower and spire. Earliest sections date to C14 but church extensively restored C19 and extended C20. Masonry is generally in fair condition but there are poor parapet abutment detail and various localised repairs are evident. There is significa erosion of jamb stones and jointing to south porch arch and gable. There is potential water ingress and damp internally. A Listed Places of Worship Roof Repair Fund	

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed.
 C Slow decay; no solution agreed.

 D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site
 - Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

HERITAGE AT RISK 2023 / MIDLANDS / BASSETLAW

	SITE NAME:	Church of St Swithun, Churchgate, East Retford	Church, CI3 origins, with major rebuilding work in the I650s following the collapse of the central tower. The
	DESIGNATION:	Listed Place of Worship grade II*, CA	church has been suffering from many leaks and was subject to heritage crime in 2018. Nave and aisle roof coverings were repaired with a National Lottery Heritage Fund grant
	CONDITION:	Poor	in 2010 and a second phase of repairs to the transept roofs and tower was completed in 2014. Overhauling works to
	PRIORITY CATEGORY:	A (A)	the chancel roof has recently been undertaken. Furthe
	OWNER TYPE:	Religious organisation	masonry repairs, interior works and bell repairs are still required, and these will be carried out as funding avenues
	LIST ENTRY NUMBER:	1370346	allow.
ngland			Contact: Imogen Newcombe 07387 524030

© Historic Eng



SITE NAME:	Church of St John, Gateford Road, Worksop	Church, 1868, by RC Clarke & Son. Built in the Decor Revival style. Large west tower and spire. Steeply pitc
DESIGNATION:	Listed Place of Worship grade II	slate roofs over coursed walling stone with gable parapets. Stone erosion at high level. A steeplejack inspection in
CONDITION:	Poor	2021 revealed a range of defects including some movement at an estimated cost of $\pounds170,000$. Repairs to the spire were
PRIORITY CATEGORY:	A (A)	undertaken in 2021 and completed 2022. The church is
OWNER TYPE:	Religious organisation	keen to undertake further repairs and are engaging positively with the local community, heritage groups, and
LIST ENTRY NUMBER:	1370402	wider charities.
		Contact: Imogen Newcombe 07387 524030

© Historic England



© Carl Andrews, Sou



	SITE NAME:	Church of St Cuthbert and St Mary, Worksop Priory, Priorswell Road, Worksop	Augustinian priory, now Parish church. CI1, CI2, CI3, CI4, restored 1845-49 by R. Nicholson. C20 additions including Crossing Tower, sanctuary and east end by
	DESIGNATION:	Listed Place of Worship grade I, CA	Laurence King 1966-74. Regular and irregularly coursed ashlar and squared rubble; slate and flat roofs. The church building has suffered from Heritage Crime. Roof to the
	CONDITION:	Poor	crossing tower has dislodged panels to spire skirt and damage has occurred to timber substrate. Glazed panels
	PRIORITY CATEGORY:	A (A)	are letting water in. Structural concerns over condition of
	OWNER TYPE:	Religious organisation	tower. Various open joints. Issues identified with drainage. The PCC are seeking funding for repairs.
oul Architects Ltd	LIST ENTRY NUMBER:	1156758	Contact: Hanna Good 07825 318060

Church of St Giles, Piper Lane,

Listed Place of Worship grade II*

Religious organisation

Carburton

Poor

C (C)

1370105

Simple church of C12 and C13 origins now consisting principally of a combined nave and chancel with bellcote to the west and mono-pitch vestry to the north side of the chancel. Externally the church has a cementitious render coat and there is evidence of structural movement to the east end gable. Nave roof covering appears functional. Vestry roof and rainwater goods are in need of repair. Water ingress internally has caused damage to the plasterwork and ceiling panels. The church was formally closed in October 2018.

SITE NAME:

DESIGNATION:

CONDITION:

OWNER TYPE:

D

Е

PRIORITY CATEGORY:

LIST ENTRY NUMBER:

Contact: Imogen Newcombe 07387 524030



SITE NAME:	Church of St Peter and St Paul, North Green, East Drayton	A parish church of late C12 origins with C13 and C15 work. Restored in 1857 by the Ecclesiastical
DESIGNATION:	Listed Place of Worship grade I, CA	Commissioners. Heavily embattled and described by Pevsner as a 'very complete' late medieval church externally. Extensive works recently completed to nave
CONDITION:	Fair	roof and medieval timber structure under a National Lottery Heritage Fund Grant for Places of Worship grant.
PRIORITY CATEGORY:	F (F)	South aisle also repaired in 2015 with grant from the Listed
OWNER TYPE:	Religious organisation	Places of Worship Roof Repair Fund. Repairs to north aisle roof carried out under Covid-19 recovery scheme HAR
LIST ENTRY NUMBER:	1212946	grant.

© Historic England

© Historic England

Contact: Ben Robinson 07823 327796

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no А

- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; В solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use)

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA
- LB LPA
- Conservation Area Listed Building Local Planning Authority National Park NP
- RPG Registered Park and Garden Scheduled Monument
- SM
- UA Unitary Authority WHS World Heritage Site

HERITAGE AT RISK 2023 / MIDLANDS / BASSETLAW



SITE NAME:	Church of St John the Baptist, Church Street, East Markham	Parish church of C14 and C15. The church was restored, and the north and south aisles built 1883-7 by Oldrid Scott.
DESIGNATION:	Listed Place of Worship grade I, CA	The tower was restored in 1981. The east window of the south aisle contains some fragments of C15 glass. The east window is by Sir John Ninian Comper. The church was
CONDITION:	Poor	subject to héritage crime in 2019. The parish is keen to effect repairs as a result and have sought the advice of the
PRIORITY CATEGORY:	A (A)	Diocese, the conservation officer at the local authority and
OWNER TYPE:	Religious organisation	Historic England, with further grant support from Historic England's Covid-19 Emergency Heritage at Risk Response
LIST ENTRY NUMBER:	1223679	Fund.
		Contact: Imogen Newcombe 07387 524030

© Historic England



SITE NAME:	Church of St Peter, Church Lane, Headon cum Upton	Parish church of C13 origin with C15 and C19 fabric, restored 1885 by G. Somers Clarke Junior. Dressed
DESIGNATION:	Listed Place of Worship grade I	coursed rubble and ashlar, with angle buttresses, tower, nave, aisles, north vestry, south porch and chancel. The
CONDITION:	Poor	nave and chancel roofs require extensive repair due to signs of nail fatigue. The rainwater goods require repair,
PRIORITY CATEGORY:	C (C)	redecoration and clearing of detritus. As a result, the
OWNER TYPE:	Religious organisation	interior is suffering from high levels of damp. The Parochial Church Council are keen to effect repairs and are
LIST ENTRY NUMBER:	1224198	investigating potential funding avenues.
		Contact: Imogen Newcombe 07387 524030

© Mr Gerard Sheridan, Source: Historic England Archive

	SITE NAME:	Church of All Saints, Church Street, Misterton	Church, with fabric dating from the C13 but with C14, C15, C17, C19 and C20 contributions. The tower and
DESIGNATION: CONDITION: PRIORITY CATEGORY: OWNER TYPE: LIST ENTRY NUMBER:	DESIGNATION:	Listed Place of Worship grade I	spire was rebuilt in 1847-8 and there was a partial restoration elsewhere. The north aisle has suffered from
	Poor	structural movement and defective ground drainage is suspected. Further investigation into the cause of the	
	PRIORITY CATEGORY:	C (C)	movement is needed before repairs are implemented.
	OWNER TYPE:	Religious organisation	North aisle buttresses are unstable in places and there is a need for repointing once movement has stabilised. The
	LIST ENTRY NUMBER:	1302717	tower stonework at belfry stage is open jointed and localised repair is needed.
			localised repair is needed.

© Historic England

Contact: Ben Robinson 07823 327796

Contact: Hanna Good 07825 318060

Parish church C13-C15 constructed of coursed rubble and ashlar. Restored C19 and C20. The church was subject to heritage crime in 2019 and the interior suffered from subsequent water ingress. The interior remains damp. The tower roof is nearing the end of its life. Some pointing and isolated masonry repairs are required. The church undertook a programme of repairs in early 2020 and is keen to undertake further repairs once potential funding avenues are available.

1233792

Church of St Matthew, Main

Street, Normanton on Trent

Religious organisation

Poor

D (D)

Listed Place of Worship grade II*

© Historic England



SITE NAME:	Church of All Saints, Torksey Street, Rampton and Woodbeck	Parish church. C10, early C13, c.1300, C14, C15, C16, C17, restored 1894, nave roof restored 1902. Possible on- going movement of aisles away from nave, requires
DESIGNATION:	Listed Place of Worship grade I	structural investigation/monitoring. North aisle west window has been removed for safety and repair; south
CONDITION:	Poor	aisle west window vulnerable due to movement. Roof finishes are coming to the end of their serviceable life,
PRIORITY CATEGORY:	C (C)	water ingress threatens structural timbers. Rainwater
OWNER TYPE:	Religious organisation	goods and drainage require attention. Isolated pockets of deep stone erriosion. The Parish and 'Friends' Group are
LIST ENTRY NUMBER:	1233879	keen to effect repairs and are seeking funding.
		C

© Historic Englar

	LIST ENTRY NUMBER:	Т
nd		

D

Е

SITE NAME:

DESIGNATION:

CONDITION:

OWNER TYPE:

PRIORITY CATEGORY:

LIST ENTRY NUMBER:

Contact: Imogen Newcombe 07387 524030

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no А

- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; В solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but $\ \ F$ not yet implemented.

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- LB
- LPA
- Conservation Area Listed Building Local Planning Authority National Park NP RPG
- Registered Park and Garden Scheduled Monument
- SM UA WHS
 - Unitary Authority World Heritage Site

HERITAGE AT RISK 2023 / MIDLANDS / BASSETLAW / BROXTOWE

	SITE NAME:	Church of All Saints, Church Street, South Leverton	Parish church. C12, C13, C14, C15. Chancel restored by Ewan Christian, 1868; remainder restored by C.
	DESIGNATION:	Listed Place of Worship grade II*	Scholefield, 1897. Subject to heritage crime. Roofs requermanent repairs. Possible on-going movement of the
	CONDITION:	Poor	east end of the chancel away from nave and within the tower, which require structural investigation/ monitoring.
	PRIORITY CATEGORY:	C (C)	The rainwater goods and drainage also require attention sections are failing or missing, low-level damp and most internally, Isolated pockets of deep stone and pointing
	OWNER TYPE:	Religious organisation	
	LIST ENTRY NUMBER:	1275880	erosion. Parish are keen to effect repairs.
			Contact: Imogen Newcombe 07387 524030


© Historic England

一一一三四十四

SITE NAME:	Roman fort and a section of Roman road 350m north west of Holly House Farm, Scaftworth			
DESIGNATION:	Scheduled Monument		LIST ENTRY NUMBER:	1018529
CONDITION:	Extensive significa	ant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Drainage/dewate	ering	NEW ENTRY?:	No
OWNER TYPE:	Private		CONTACT:	Ben Robinson 07823 327796
	SITE NAME:	Shireoaks Hall, Shireoaks / Thorpe Salvin	The core of an extensive late C17 and early C18 landsca park with early C17 gardens and a grand late C17 water feature. The site is deteriorating, in multiple ownership with buildings at risk and a lack of strategic management. External development has had an impact upon its setting and appreciation.	
	DESIGNATION:	Registered Park and Garden grade II*, 4 LBs, part in SM, 2 CAs		
HE SHUMMER ()	CONDITION:	Extensive significant problems		
	VULNERABILITY:	High		
	TREND:	Declining		
© Historic England	NEW ENTRY?:	No		
	OWNER TYPE:	Private, multiple owners		
	LIST ENTRY NUMBER:	1000367	Contact: Ben Ro	binson 07823 327796

SITE NAME:	Worksop		
DESIGNATION:	Conservation Area, 60 LBs, SM	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	No significant change
VULNERABILITY:	Low	CONTACT:	Michael Tagg (LPA) 01909 533427

BROXTOWE

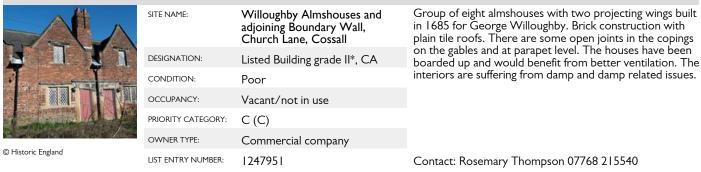

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no А

D

Е

- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; В solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.
- Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA
- LB LPA
- Conservation Area Listed Building Local Planning Authority National Park
- NP RPG Registered Park and Garden Scheduled Monument
- SM
- UA Unitary Authority WHS World Heritage Site

HERITAGE AT RISK 2023 / MIDLANDS / BROXTOWE

	SITE NAME:	Summerhouse at the Yews, Kimberly Road, Nuthall	A Gothic summerhouse, circa 1759, probably by Thomas Wright and formerly in the garden of Nuthall Temple.
	DESIGNATION:	Listed Building grade II*, CA	Coursed and square rubble and brick with ashlar dressings and pantile roof. Significant vegetation growth around and
	CONDITION:	Poor	over the roofs into the upper gutters. Loss of roof covering has permitted structural timber decay and localised
	OCCUPANCY:	Vacant/not in use	instability in the decayed masonry, particularly in the rear
	PRIORITY CATEGORY:	C (C)	gable masonry which is at risk of collapse if continued water ingress is not prevented.
	OWNER TYPE:	Private	
© Historic England	LIST ENTRY NUMBER:	1248177	Contact: Hanna Good 07825 318060

SITE NAME:	Greasley Castle, Greasley		
DESIGNATION:	Scheduled Monument, 3 LBs	LIST ENTRY NUMBER:	1020943
CONDITION:	DITION: DITION: DITION:		Declining
PRINCIPAL VULNERABILITY:	Deterioration - in need of management	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Ben Robinson 07823 327796
SITE NAME:	Eastwood		
DESIGNATION:	Conservation Area, 4 LBs	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	No significant change
VULNERABILITY:	High	CONTACT:	Planning Policy (LPA) 0115 917 7777
SITE NAME:	Kimberley		
DESIGNATION:	Conservation Area, LB grade II	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	Unknown
VULNERABILITY:	Medium	CONTACT:	Planning Policy (LPA) 0115 917 7777
SITE NAME:	Nuthall		
DESIGNATION:	Conservation Area, 12 LBs	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	No significant change
VULNERABILITY:	High	CONTACT:	Planning Policy (LPA) 0115 917 7777

NOTTINGHAMSHIRE / DERBYSHIRE

BROXTOWE / EREWASH

© Historic England	SITE NAME:	Bennerley Viaduct, Awsworth Road (part located in Erewash Borough), Awsworth	An exceptional iron railway viaduct, 1878-9 c.500m long. Disused and unmaintained for decades. An application to the National Heritage Lottery Fund in 2017 for repairs and
	DESIGNATION:	Listed Building grade II*	a pathway across the viaduct was unsuccessful. Historic England awarded a grant in early 2019; development work
	CONDITION:	Poor	and essential repairs followed in 2019 and 2020. Work
	OCCUPANCY:	N/A	temporarily stopped due to Covid-19. Historic England Heritage Stimulus funding enabled the reinstatement of
	PRIORITY CATEGORY:	F (F)	parapets. Remedial re-pointing is to be undertaken in summer 2023. The western approach has been reinstated
	OWNER TYPE:	Charity (non-heritage)	and the viaduct has been decked.
	LIST ENTRY NUMBER:	1140437	Contact: Amanda White 0121 625 6890

PRIORITY CATEGORIES

- C Slow decay; no solution agreed.
- A Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
 B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
 C Slow decay: no solution agreed.
 D Slow decay; solution agreed but F not yet implemented.
 C Slow decay: no solution agreed.
 D Slow decay; solution agreed but F not yet implemented.
 D Slow decay; solution agreed but not yet implemented.
 D Slow decay; solution agreed but F not yet implemented.
 D Slow decay; solution agreed but not yet implemented.
 D Slow decay; solution agreed but not yet implemented.
 D Slow decay; solution agreed but not yet implemented. use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site

 - Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument
- 75

NOTTINGHAMSHIRE

GEDLING			
	SITE NAME:	Newstead Abbey and adjoining boundary wall, Newstead Park, Newstead	Priory c1165, post-Dissolution country house, now a visitor attraction and museum, set in formal gardens and parkland. Home of the poet Lord Byron. By 2018, stone
	DESIGNATION:	Listed Building grade I, RPG grade II*	fragments were falling from the adjoining priory church ruin and the area was cordoned off. Historic England awarded a two-stage grant in 2018 and repairs were completed in
A DISTANDAR SHARE I	CONDITION:	Poor	2020. Roof coverings of the main house are at the end of their effective lives. Leaks are addressed as they occur, but
and the second second	OCCUPANCY:	Occupied/in use	re-slating is now required. Repairs have been scheduled
	PRIORITY CATEGORY:	C (C)	(2023) and funding opportunities are being explored.
© Historic England	OWNER TYPE:	Local authority	
	LIST ENTRY NUMBER:	1265325	Contact: Amanda White 0121 625 6890
	SITE NAME:	Porch to Engine House, Papplewick Pumping Station, Papplewick	Engine house built in 1881 by M.O. Tarbotton for Nottingham Corporation Water Department. The timber porch is sited on the east elevation and is approached via
	DESIGNATION:	Listed Building grade II*, RPG grade II, SM	balustraded steps. Mansard roof carried on balusters. Renovated in 2004. Significant scarf joints evident to principle posts. Several structural timbers have suffered
	CONDITION:	Poor	significant deterioration with some having suffered a considerable loss of section. Modern paint finishes are
	OCCUPANCY:	N/A	trapping moisture. Rainwater goods are failing and allowing
	PRIORITY CATEGORY:	A (A)	water to penetrate the structure. A Historic England Development grant was awarded in Spring 2022.
© Historic England	OWNER TYPE:	Charity (heritage)	
	LIST ENTRY NUMBER:	1265301	Contact: Hanna Good 07825 318060
	SITE NAME:	Engine house, boiler house and workshop, Papplewick Pumping Station, Longdale Lane, Ravenshead, Ravenshead / Papplewick	Pumping Station was laid out 1881-84 by the Nottingham Corporation Water Department to the designs by the Corporation engineer, M Ogle Tarbotton in a Gothic Revival style. The chimney is generally sound, but brickwork and stone dressings require repair. Brickwork
	DESIGNATION:	Scheduled Monument, 5 LBs, part in RPG grade II	suffers from significant efflorescence. The brick boundary wall and the significant timber framed Boiler House porch are in very poor condition. The whole site is vulnerable
	CONDITION:	Very bad	given the significant repair needs of key buildings. Historic

© Historic England

		Station, Longdale Lane, Ravenshead, Ravenshead / Papplewick	Corporation engineer, M Ogle Tarbotton in a Gothic Revival style. The chimney is generally sound, but brickwork and stone dressings require repair. Brickwork
A Cat	DESIGNATION:	Scheduled Monument, 5 LBs, part in RPG grade II	suffers from significant efflorescence. The brick boundary wall and the significant timber framed Boiler House porch are in very poor condition. The whole site is vulnerable
10	CONDITION: Very	Very bad	given the significant repair needs of key buildings. Historic England funded 2022 development work and Arts Council
OCCUPANCY:	Occupied/in use	England awarded a repair grant in early 2023.	
	PRIORITY CATEGORY:	A (New entry - re-assessed)	
	OWNER TYPE:	Trust	
	LIST ENTRY NUMBER:	1006373	Contact: Amanda White 0121 625 6890



© Historic England

SITE NAME: Church of the Good Shepherd, Thackery's Lane, Woodthorpe DESIGNATION: Listed Place of Worship grade II* CONDITION: Poor PRIORITY CATEGORY: A (A) OWNER TYPE: Religious organisation LIST ENTRY NUMBER: 1376603

Significant modern concrete church designed on Liturgical Movement principles with stained glass windows by Patrick Reyntiens. The church is suffering severe concrete decay requiring urgent specialist attention to avoid loss of historic fabric. An extensive programme of grant-assisted repairs, jointly funded by Historic England and National Lottery Heritage Fund, successfully renewed complex roofing and ensured concrete facing panels were safe and weather tight but mullions and glazing require further extensive repairs, Historic England technical staff visited in late 2021. Progress unknown.

Contact: Hanna Good 07825 318060

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; В solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.

D

Е

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA
- LB LPA
- Conservation Area Listed Building Local Planning Authority National Park
- NP RPG
- Registered Park and Garden Scheduled Monument SM
- UA Unitary Authority WHS World Heritage Site

HERITAGE AT RISK 2023 / MIDLANDS / GEDLING / MANSFIELD / NEWARK AND SHERWOOD

SITE NAME:	Round Hill, Lambley		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1006379
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable clipping	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Ben Robinson 07823 327796

MANSFIELD

	SITE NAME:	Church of St John the Evangelist, St John Street, Mansfield	Large urban church in central Mansfield of 1855-56 and later north porch c1906. Following completion of development work the nave roof was repaired with funds
	DESIGNATION:	Listed Place of Worship grade II, CA	from the National Heritage Lottery Fund in 2016. The chancel and organ chamber and vestry roofs are suffering from nail fatigue and are leaking. The structural integrity of
	CONDITION:	Very bad	the spire - currently strapped - is of particular concern and is being monitored. A Historic England Covid 19 Recovery
	PRIORITY CATEGORY:	B (B)	Fund award in 2020 investigated issues with the internal
	OWNER TYPE:	Religious organisation	ceiling plaster. A drone survey of the spire was also undertaken. Further works are required.
© Historic England	LIST ENTRY NUMBER:	1215129	Contact: Hanna Good 07825 318060

SITE NAME:	Roman villa ESE of Northfield House		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1006387
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Ben Robinson 07823 327796
SITE NAME:	Bridge Street, Mansfield		
DESIGNATION:	Conservation Area, 27 LBs	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	Deteriorating
VULNERABILITY:	Low	CONTACT:	Denise Varley (LPA) 01623 463806

NEWARK AND SHERWOOD

	SITE NAME:	Church of St Nicholas, Church Lane, Hockerton	Former C12 to C14 church, with a restoration by Hodgson Fowler in 1876. The building is in very bad condition.
	DESIGNATION:	Listed Building grade II*	Previous historic movement is evident in the stonework, and it is possible this is still ongoing. Rainwater goods are
	CONDITION:	Poor	defective and choked with vegetation and detritus. There are numerous slipped and missing slates to pitched roofs
	OCCUPANCY:	Part occupied/part in use	and some ridge tiles are loose. Some vegetation has been
	PRIORITY CATEGORY:	F (F)	cleared from the north side of the building. Archaeological works have been undertaken, and a new use has been
	OWNER TYPE:	Religious organisation	approved which includes various repair schemes and renovations.
	LIST ENTRY NUMBER:	1045486	Contact: Imogen Newcombe 07387 524030

© Historic England



SITE NAME:	Former White Hart Hotel, 34, Market Place, Newark	Former hotel and latterly building society. C14th with C15th, C16th extensions, C17th and C19th additions and
DESIGNATION:	Listed Building grade II*, CA	remodelling. Restored 1983 and 1990. Lower floors have been vacant for c.2 years, upper floors vacant c.10 years.
CONDITION:	Poor	No on-going cyclical maintenance and gutter clearing programme has led to numerous isolated areas of severe
OCCUPANCY:	Vacant/not in use	water ingress, which threaten the important historic timber
PRIORITY CATEGORY:	C (C)	frame. High internal moisture levels exacerbated by long- term vacancy. No solution or future use agreed. Historic
OWNER TYPE:	Commercial company	England and Local Authority working with owner to address issues and find a viable new use.
LIST ENTRY NUMBER:	1196426	Contact: Jane Holt 07425732881

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no А

- Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В implemented.
- C Slow decay; no solution agreed.

 D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA LB
- LB LPA NP RPG SM
- Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument
- UA Unitary Authority WHS World Heritage Site

H

HERITAGE AT RISK 2023 / MIDLA	NDS / NEWARK AND S	SHERWOOD	
	SITE NAME:	Ollerton Hall, Main Street, Ollerton and Boughton	Country House, c.1700. Sold by Newark and Sherwood District Council to a developer in 2008. The developer
	DESIGNATION:	Listed Building grade II*, CA	commenced a care home development, but this work was not completed. The District Council re-acquired the
	CONDITION:	Poor	property in 2016. Some repairs to the envelope of the
	OCCUPANCY:	Vacant/not in use	building have been carried out and incomplete development works have been removed from the grounds.
	PRIORITY CATEGORY:	C (C)	Historic England contributed to the costs of a condition survey. The District Council has entered into an agreement
i i i	OWNER TYPE:	Local authority	with another developer to progress repairs and conversion
© Historic England	LIST ENTRY NUMBER:	1045598	to apartments. Contact: Ben Robinson 07823 327796
1 BA	SITE NAME:	Sundial 50 metres east of Church of Holy Rood, Church Lane, Ossington	An early C17 sundial. Tuscan column with chamfered square base and four dials. It stands in a wooded churchyard in what was previously the gardens of nearby
	DESIGNATION:	Listed Building grade II*	Ossington Hall, now demolished. The stones forming the stepped base have slipped and open joints will allow
	CONDITION:	Poor	rainwater to penetrate. The stone column and cubic top has lost some detail and there are localised pockets of
	OCCUPANCY:	N/A	decay.
	PRIORITY CATEGORY:	C (C)	
	OWNER TYPE:	Unknown	
© Historic England	LIST ENTRY NUMBER:	1301995	Contact: Imogen Newcombe 07387 524030
	SITE NAME:	North range at The Saracen's Head, Market Place, Southwell	Unoccupied wing of the hotel. The north range (and hotel) has been dated to circa 1460 with early and late C19 and
	DESIGNATION:	Listed Building grade II*, CA	C20 alterations and additions. The north range is a two storey six bay range of timber-framed close studding with
	CONDITION:	Poor	brick underbuild and nogging. Irregular fenestration with late C19 casements. Some decay, collapse of the lime ash
	OCCUPANCY:	Vacant/not in use	floor and limited penetration by vegetation. Listed Building
	PRIORITY CATEGORY:	D (D)	Consent for repairs has been granted, alongside grant support from Historic England's Covid 19 Emergency
	OWNER TYPE:	Commercial company	Heritage at Risk Response Fund. Surveys and a repair schedule have been completed.
© Alan Joyce, Architects	LIST ENTRY NUMBER:	1369925	Contact: Ben Robinson 07823 327796
	SITE NAME:	Upton Hall, Main Road, Upton	Country house, 1832, by WJ Donthorn. Now used by the
	DESIGNATION:	Listed Building grade II*, CA	British Horological Institute as offices, education and a clock museum. Roof coverings, copings and rainwater
	CONDITION:	Poor	goodsis in poor condition, with corresponding internal
TTT	OCCUPANCY:	Occupied/in use	dampness and signs of active dry rot. The adjacent stables and courtyard structures contribute to the setting of the
			hall they are in very poor condition and at significant risk of

	DESIGNATION:	Listed Building grade II*, CA	clock museum. Roof coverings, copings and rainwater
	CONDITION:	Poor	goodsis in poor condition, with corresponding internal dampness and signs of active dry rot. The adjacent stables
	OCCUPANCY:	Occupied/in use	and courtyard structures contribute to the setting of the
	PRIORITY CATEGORY:	C (C)	hall, they are in very poor condition and at significant risk of loss. Previous proposals for works to the hall and repair of
	OWNER TYPE:	Educational (independent)	the stables for educational use have fallen through. Further advice on repair need and grant funding is being sought.
	LIST ENTRY NUMBER:	1179760	Contact: Jane Holt 07425732881

© Historic England



SITE NAME:	Church of St Margaret, Church Hill, Bilsthorpe	Small parish church centrally located in an elevated churchyard. Tower, nave, chancel, south porch and chapel,
DESIGNATION:	Listed Place of Worship grade I, CA	north vestry. There is general masonry decay in several areas and deep open jointing to walling which is becoming unstable. A temporary fix has been undertaken to the high-
CONDITION:	Very bad	level rainwater goods, however a long-term solution is needed. The provision for managing rainwater drainage
PRIORITY CATEGORY:	A (A)	away from the building and on-going maintenance is still
OWNER TYPE:	Religious organisation	required.
LIST ENTRY NUMBER:	1045616	Contact: Imogen Newcombe 07387 524030

© Historic England

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В implemented.
- C Slow decay; no solution agreed.

D

Е

use).

Slow decay: solution agreed but F not yet implemented. Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use)

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA LB
- LPA NP RPG SM

- Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument
- UA Unitary Authority WHS World Heritage Site

HERITAGE AT RISK 2023 / MIDLANDS / NEWARK AND SHERWOOD

- MIL	SITE NAME:	Church of All Saints, Newark Road, Hawton	Church, CI3, with CI4 and CI5 additions. Restored in 1880 by CH Fowler, with a further restoration in the
1	DESIGNATION:	Listed Place of Worship grade I	1960s. The chancel contains a C14 Easter Sepulchre. The tower is considered unsafe. High level stonework to the
m m ·	CONDITION:	Poor	tower needs repairing. A National Lottery Heritage Fund grant awarded in 2018 to address the urgent repairs to the
The state	PRIORITY CATEGORY:	C (C)	bell frame, flooring and belfry is complete. Repairs to the
	OWNER TYPE:	Religious organisation	parapets of the south aisle are also complete. However, further repairs to tower masonry are still required, and
Contraction of the second	LIST ENTRY NUMBER:	1046031	investigations are needed into possible movement of the south aisle.
			oous, aco,

© Historic England



SITE NAME:	Church of St Giles, Langford Lane, Holme	Substantial rural church with west tower and spire, double plan nave and chancel, south porch and turret stair. Steeply
DESIGNATION:	Listed Place of Worship grade I	pitched clay pantiled roofs. Internally in good order and generally well maintained. Some recent repair work has
CONDITION:	Fair	been completed to the tower masonry, valley gutters, external rendering, and south porch roof.
PRIORITY CATEGORY:	F (F)	external rendering, and south porchroot.
OWNER TYPE:	Religious organisation	
LIST ENTRY NUMBER:	1302380	Contact: Ben Robinson 07823 327796

Contact: Imogen Newcombe 07387 524030

© Historic England

No 18	SITE NAME:	Church of St Mary, Church Lane, Kilvington	Small church rebuilt in 1852 on the site of the earlier church. Built in lias walling, there is consequent widespread
	DESIGNATION:	Listed Place of Worship grade II	stone erosion throughout and the south porch has a significant structural fault resulting in a displaced gable and
	CONDITION:	Poor	arch masonry. There is an associated accumulation of general maintenance requirements and subsequent low-
	PRIORITY CATEGORY:	A (A)	level damp-related decay, however gutter and drainage
	OWNER TYPE:	Religious organisation	works were recently completed.
Linke	LIST ENTRY NUMBER:	1178578	Contact: Imogen Newcombe 07387 524030

© Historic England

	SITE NAME:	Church of St Mary Magdalene and attached railing, Church Walk, Newark	Parish church dating from c1180. South aisle and four-stage spire constructed in early C14; the main nave mid-C15. The church was restored in 1853 by GG Scott. Nave roof,
	DESIGNATION:	Listed Place of Worship grade I, CA	south porch and spire restored 1913. The church has been the victim of heritage crime. Several roofs are leaking and require renewal. The rainwater goods are generally in fair
	CONDITION:	Poor	order but require overhauling and clearing of detritus. Some areas of stonework are open jointed. Several
	PRIORITY CATEGORY:	A (A)	windows have broken panes and loss to hood moulds.
	OWNER TYPE:	Religious organisation	Drainage channels require attention. The Parochial Church Council are keen to effect repairs.
© Mark Goodwill-Hodgson (Architect)	LIST ENTRY NUMBER:	1279450	Contact: Hanna Good 07825 318060

the seaso	SITE NAME:	Church of St Wilfrid, Main Street, North Muskham	Church, C12 origin of Blue Lias stone. A Listed Places of Worship Roof Repair Fund grant in 2016 enabled the
	DESIGNATION:	Listed Place of Worship grade I	repair of rainwater goods and the tower's parapet gutter. The lower stages of tower are heavily weathered; a
	CONDITION:	Very bad	considerable masonry repairs are needed. The buildin rendered historically. The church has been subject to
	PRIORITY CATEGORY:	A (A)	heritage crime. Recipient of an Historic England Covid-19
- I I prove	OWNER TYPE:	Religious organisation	Emergency Heritage at Risk Response Fund grant in 2020 for roof repairs. Historic England commenced a research
	LIST ENTRY NUMBER:	1178997	project in 2022 looking at the performance of Blue Lias repairs to inform future repair guidance.
Alline and Frederick			repairs to inform luture repair guidance.

© Historic England

Contact: Hanna Good 07825 318060

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В implemented.
- C Slow decay; no solution agreed.

 D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA LB
- LB LPA NP RPG SM
- Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

- UA Unitary Authority WHS World Heritage Site

HERITAGE AT RISK 2023 / MIDLANDS / NEWARK AND SHERWOOD

	SITE NAME:	Church of St John, Church Lane, Perlethorpe cum Budby	Church, built in 1876 to the designs of Anthony Salvin for the 3rd Earl Manvers. In the C14 Decorated style.
4	DESIGNATION:	Listed Place of Worship grade II*	mature landscape of Thoresby Park. The building is
	CONDITION:	Very bad	suffering from extensive and severe salt damage to internal
	PRIORITY CATEGORY:	A (A)	Numerous areas of external stone are also affected. The
PART OF THE OWNER	OWNER TYPE:	Religious organisation	necessary, but some downpipes leak, there is extensive
	LIST ENTRY NUMBER:	1045471	cement repointing and gutters are susceptible to blockage
	CONDITION: PRIORITY CATEGORY: OWNER TYPE:	Listed Place of Worship grade II* Very bad A (A) Religious organisation	Restored in 1904. The church sits within the rural and mature landscape of Thoresby Park. The building is suffering from extensive and severe salt damage to intern stonework, with significant and widespread stone decay.

© Historic England

Contact: Ben Robinson 07823 327796

SITE NAME:	Settlement 3/4 mile (1198m) W of Cromwell Villa	ge, Cromwell	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1003490
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Tim Allen 07770 610214
SITE NAME:	Site discovered by aerial photography NNE of villa	ge, Cromwell	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1003487
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Ben Robinson 07823 327796
SITE NAME:	Roman camp 470m south of Carr Banks Farm, Far	nsfield	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1018121
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Ben Robinson 07823 327796
SITE NAME:	Iron Age settlement, South Muskham		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1003494
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY: Arable ploughing		NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Ben Robinson 07823 327796
SITE NAME:	Bowl barrow 160m south east of Wharf Farm, The	orpe	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1017563
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Ben Robinson 07823 327796
SITE NAME:	Newark		
DESIGNATION:	Conservation Area, 351 LBs, RPG grade I, 5 SMs	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	Unknown
VULNERABILITY:	Medium	CONTACT:	Oliver Scott (LPA) 01636 655847
SITE NAME:	Ollerton, Ollerton and Boughton		
DESIGNATION:	Conservation Area, 11 LBs	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	Unknown
VULNERABILITY:	Medium	CONTACT:	Oliver Scott (LPA) 01636 655847

PRIORITY CATEGORIES

А

В

C Slow decay; no solution agreed.

Immediate risk of further rapid deterioration or loss of fabric; no solution agreed. Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented. Slow decay; solution agreed but F Under repair or in fair to good repair, but no user identified; or obvious new user (applicable only to buildings capable of beneficial use use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

80

HERITAGE AT RISK 2023 / MIDLANDS / NEWARK AND SHERWOOD / RUSHCLIFFE

SITE NAME:	Upton		
DESIGNATION:	Conservation Area, 22 LBs	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	Unknown
VULNERABILITY:	Low	CONTACT:	Oliver Scott (LPA) 01636 655847

RUSHCLIFFE

I ©

	SITE NAME:	Conservatory at Flintham Hall, Flintham	Conservatory, 1853-59, integral to house. Cast iron superstructure with high percentage of original glass,
	DESIGNATION:	Listed Building grade I, RPG grade II, CA	deteriorating and failing due in part to ventilation problems and water ingress leading to loss of historic fabric. Water damage to interior stonework. Some repair work has been
	CONDITION:	Poor	carried out.
TTPOLA MAL	OCCUPANCY:	Occupied/in use	
TTER KILL	PRIORITY CATEGORY:	F (F)	
	OWNER TYPE:	Private	
© Historic England	LIST ENTRY NUMBER:	1272727	Contact: Ben Robinson 07823 327796



	SITE NAME:	Church of St Giles, Fern Road, Cropwell Bishop	Church dating back to C13. Numerous problems. There are signs that extensive structural movement is causing
	DESIGNATION:	Listed Place of Worship grade I	damage to the historic fabric. It is not clear if this movement is ongoing. Repairs to the rainwater goods,
	CONDITION:	Poor	drainage and roofs were completed in 2015. A period of monitoring should follow to establish the effect of ground
	PRIORITY CATEGORY:	C (C)	movement and any corresponding cracks in masonry.
	OWNER TYPE:	Religious organisation	
	LIST ENTRY NUMBER:	1045650	Contact: Ben Robinson 07823 327796

© Historic England



4	SITE NAME:	Parish Church of St Andrew, Church Lane, Langar, Langar cum Barnstone	A large village church. Heavily restored in the 1860s. Prominent crossing tower with crenellated parapets. Structural repairs to the north transept were completed in
	DESIGNATION:	Listed Place of Worship grade I, CA	2013 via a National Lottery Heritage Fund and Historic England Repair Grant for Places of Worship. There remain a number of rainwater management issues and dampness in
	CONDITION:	NDITION: Poor	low level masonry still threatens several important monuments within the church. Repairs to the vestry roof
	PRIORITY CATEGORY:	C (C)	have been undertaken.
	OWNER TYPE:	Religious organisation	
	LIST ENTRY NUMBER:	1264793	Contact: Ben Robinson 07823 327796

© Historic England



Parish church, C13, C14, C15 with the tower dating back to 1766 and restored in 1889. The nave and north aisle Church of St Mary, Church SITE NAME: Street, Orston were restored 1914. The nave clerestory dates from C15. Listed Place of Worship grade I, The church tower is suffering from movement and requires DESIGNATION: CA investigation. Fabric appears to be in good condition except for the tower and the associated cracking in the CONDITION: Poor interior of the church. Urgent works to the stonework of PRIORITY CATEGORY: the north west arcade were undertaken in late 2021. A(A)Potential funding avenues are being explored by the Parochial Church Council for outstanding repair works. OWNER TYPE: Religious organisation LIST ENTRY NUMBER: 1272710 Contact: Imogen Newcombe 07387 524030

© Historic England

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- solution agreed. Immediate risk of further rapid В deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.

D

Е

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA
- LB I PA
- Conservation Area Listed Building Local Planning Authority National Park NP
- RPG
- Registered Park and Garden Scheduled Monument SM
- UA WHS Unitary Authority World Heritage Site

HERITAGE AT RISK 2023 / MIDLANDS / RUSHCLIFFE / RUTLAND (UA)

sh church of ashlar construction dating from C14 but ally rebuilt between 1888-95. The church was subject
eritage crime in 2019. The Parochial Church Council undertaken repairs, with recent repairs to the roofs
the north aisle's plasterwork. Further repairs are tanding.
narrang.
tact: Imogen Newcombe 07387 524030
ial er un th

© Historic England

SITE NAME:	JAME: Margidunum Roman Station, Bingham / Car Colston		Newton
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1006395
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Ben Robinson 07823 327796
SITE NAME:	Succession of rectilinear enclosures south west of S	Shelford Manor, Sh	elford
SITE NAME: DESIGNATION:	Succession of rectilinear enclosures south west of S Scheduled Monument	Shelford Manor, Sh LIST ENTRY NUMBER:	elford 1006372
		,	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1006372

RUTLAND (UA)

-	SITE NAME:	Old Hall ruins, Exton Park, Exton and Horn	Remains of a hall, late C16/early C17, located in C19 pleasure grounds, around 150 metres south of current
	DESIGNATION:	Scheduled Monument and Listed Building grade II, RPG grade II	house, with remains of C17 terraces to south east. Vegetation growth is being managed, but the ruins are decaying steadily. Parts are well preserved, particularly the
THE STATE	CONDITION:	Fair	south elevation and chimneys. The west gable is vulnerable with cracks, open joints and unsupported masonry.
	OCCUPANCY:	N/A	with cracks, open joints and unsupported masonry.
	PRIORITY CATEGORY:	C (C)	
	OWNER TYPE:	Private	
listoric England	LIST ENTRY NUMBER:	1005477 and 1073771	Contact: Ben Robinson 07823 327796



© Historic England

© His

SITE NAME:	Church of St Edmund, Church Road, Egleton	Small parish church of largely Norman, albeit altered, origin comprising nave with clerestory, chancel and west tower
DESIGNATION:	Listed Place of Worship grade I, CA	with short spire. Notable richly carved tympanum over the C12 south door. Chancel roof coverings are at the end of their life and need replacement. Dampness inside church is
CONDITION:	Poor	much improved following modest drainage works and low level repointing.
PRIORITY CATEGORY:	D (C)	level repointing.
OWNER TYPE:	Religious organisation	
LIST ENTRY NUMBER:	1073761	Contact: Hanna Good 07825 318060
LIST EINTKT NUMBER:	10/3/61	Contact: Hanna Good 07825 318060

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no А

Е

- Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В implemented.
- C Slow decay; no solution agreed.
- D Slow decay; solution agreed but F not yet implemented.

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA LB
- LPA NP RPG SM
- Conservation Area Listed Building Local Planning Authority National Park
- Registered Park and Garden Scheduled Monument
- UA Unitary Authority WHS World Heritage Site

HERITAGE AT RISK 2023 / MIDLANDS / RUTLAND (UA) / HEREFORDSHIRE, COUNTY OF (UA)

	SITE NAME:	Church of St Andrew, Stoke Dry	Small parish church of early C12 origin. Largely re-built early C13 and C14 with C15 additions. Restored in 1898.
	DESIGNATION:	Listed Place of Worship grade I	The church was the subject of heritage crime in 2018, however repairs were undertaken in early 2022. Previous
A Provide	CONDITION:	Fair	water ingress has damaged plasterwork, alongside causing sections of a historic painting scheme to become detached.
	PRIORITY CATEGORY:	D (D)	The Parochial Church Council are keen to undertake a
Adda the	OWNER TYPE:	Religious organisation	repair scheme and remove associated cementitious plaster.
A DAMAGE	LIST ENTRY NUMBER:	1237061	Contact: Imogen Newcombe 07387 524030

© Historic England

HEREFORDSHIRE, COUNTY OF (UA)

HEREFORDSHIRE, COUL	NTY OF (UA)		
	SITE NAME:	Eastern half of the Outer Gatehouse to Wigmore Abbey, Adforton	Associated with the remains of a late C12 and C14 abbey. The Outer Gatehouse comprises two buildings, of which this is the eastern building. It is without a roof and in very
	DESIGNATION:	Listed Building grade I	poor condition with extensive tree growth penetrating parts of the structure. Survey work to inform conservation
	CONDITION:	Very bad	is required. Discussions commenced regarding emergency works and scheme being developed by Herefordshire
	OCCUPANCY:	N/A	Council
	PRIORITY CATEGORY:	A (A)	
	OWNER TYPE:	Private	
) Historic England	LIST ENTRY NUMBER:	1082061	Contact: Neil Rimmington 07775 550 674
100	SITE NAME:	Walsopthorne Farmhouse, Walsopthorne, Ashperton	A c.1600 timber framed house built on a C plan to give an impression of size and stature. It is of two storeys built on a
	DESIGNATION:	Listed Building grade II*	stone plinth with stone mullioned windows to the cellar and has a plain clay tile roof. The east range was historically
	CONDITION:	Poor	the 'high' end, the west range was converted to farm use in
	OCCUPANCY:	Part occupied/part in use	the CI9 with the addition of two brick hop kilns. The roof, rainwater goods, infill panels, doors and windows are in
T STATE & CALL IN CALL	PRIORITY CATEGORY:	C (C)	poor condition and there is evidence of movement in the east and west ranges.
a stand to be	OWNER TYPE:	Private	
) Historic England	LIST ENTRY NUMBER:	1302708	Contact: Steven McLeish 0121 625 6884
All and a second	SITE NAME:	Ruined Church of St Mary, Avenbury	A ruined C12 church. The tower stands to full height, to roof survived to the mid C20 but has fallen in. The wal the nave and chancel are half collapsed and survive only a few feet in places. Fragments of decorated interior pl survive. Vegetation clearance has been carried out by t
	DESIGNATION:	Scheduled Monument and Listed Building grade II*	
and a state	CONDITION:	Very bad	owners under an Historic England Management Agreement. The walls are generally stable but are highly
	OCCUPANCY:	Vacant/not in use	exposed.
A Company of the second	PRIORITY CATEGORY:	A (A)	
A Contraction of the second second	OWNER TYPE:	Private	
) Historic England	LIST ENTRY NUMBER:	1005356 and 1349633	Contact: Neil Rimmington 07775 550 674
-	SITE NAME:	Belmont House, Belmont Rural	A late C18 country house by James Wyatt, extended and
an an an	DESIGNATION:	Listed Building grade II*	remodelled by E.W. Pugin c. 1860. The property has been unused since 2014 and is deteriorating through
	CONDITION:	Poor	longstanding lack of regular maintenance. Holes in the roof and broken windows allow rain entry and increased risk of
	OCCUPANCY:	Vacant/not in use	rot and decay. Delamination and erosion of stonework
	PRIORITY CATEGORY:	A (A)	problem. A new use for the building is critical to its future

© Historic England

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; В solution agreed but not yet implemented.
- C Slow decay; no solution agreed.

1167079

Commercial company

LIST ENTRY NUMBER:

OWNER TYPE:

 D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).


Contact: Steven McLeish 0121 625 6884

ABBREVIATIONS

and should be encouraged through the planning process.

- CA LB
- LPA
- NP RPG SM
- Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument
- UA Unitary Authority WHS World Heritage Site

		(),	
	SITE NAME:	Huntington Castle, Huntington / Gladestry Community	Castle remains C13 or earlier. The motte and inner bailey are surrounded by a ditch and outer bailey. Traces of a
	DESIGNATION:	Scheduled Monument and Listed Building grade II	curtain wall and CI3 semi circular tower have survived in a fair condition although they were very overgrown. Work to control vegetation is being carried out by the owner and
	CONDITION:	Poor	a new access track has been created. Unstable stonework
	OCCUPANCY:	N/A	needs consolidating following unsuccessful attempts to secure funding for the site via Natural England Stewardship
	PRIORITY CATEGORY:	C (C)	schemes.
A A A A A A A A A A A A A A A A A A A	OWNER TYPE:	Private	
ric England	LIST ENTRY NUMBER:	1002939 and 1157544	Contact: Jez Bretherton 0121 625 6855

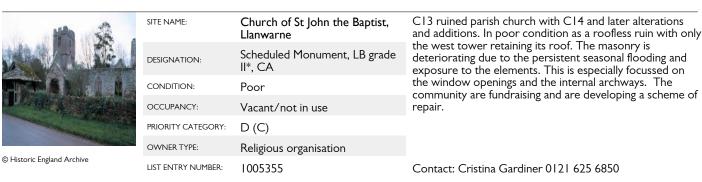

Outbuilding east of Marstow

Court (formerly listed as the

Listed Building grade II*

Part occupied/part in use

Barn and attached cowhouse

Poor

D (D)

Private

1214715

Granary at Marstow), Marstow

© Historic England

© Historia



built onto Glibes Farmhouse, Michaelchurch Escley DESIGNATION: Listed Building grade II* CONDITION: Very bad OCCUPANCY: Vacant/not in use PRIORITY CATEGORY: A (A) OWNER TYPE: Private LIST ENTRY NUMBER 1223446

SITE NAME:

DESIGNATION:

CONDITION:

OCCUPANCY.

OWNER TYPE:

SITE NAME:

D

Е

PRIORITY CATEGORY:

LIST ENTRY NUMBER:

© Historic England



SITE NAME:	Glibes Farmhouse, Michaelchurch Escley	A remote farmhouse probably C17 with C18 alterations. The walls are of thin coursed rubble stone. The roof was of
DESIGNATION:	Listed Building grade II*	stone tiles but has been temporarily replaced with metal sheet. The building is unoccupied and in need of
CONDITION:	Very bad	comprehensive repair. A programme of urgent works, including repair of the temporary roof and rebuilding of
OCCUPANCY:	Vacant/not in use	fallen masonry, has improved its condition but the chimney stacks are deteriorating and further long term repairs are necessary.
PRIORITY CATEGORY:	C (C)	
OWNER TYPE:	Private	
LIST ENTRY NUMBER:	1223549	Contact: Cristina Gardiner 0121 625 6850

© Historic England

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed. Immediate risk of further rapid В deterioration or loss of fabric; solution agreed but not yet implemented.
- С Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented. Under repair or in fair to good
- repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use)

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise. New Entry is noted).

Reputedly associated with the manor of the Knights Hospitallers who held lands in Marstow and probably

originally a house, C15. Built of sandstone rubble under a Welsh slate roof with C18 and C19 alterations. The

and missing roof slates and the windows and doors are in

poor condition. A scheme for conversion was approved several years ago, but works are yet to take place.

A four bay barn with an extra bay for a cow house and

further loft bay linking to the farmhouse, which has collapsed. Probably C18 in date. A temporary metal sheet

roof protects the building, which is unused and in need of

repair of the building, and its future is uncertain.

Contact: Cristina Gardiner 0121 625 6850

comprehensive repair. The owner has no proposals for the

Contact: Steven McLeish 0121 625 6884

building is now in agricultural use. The stonework and pointing are generally in poor condition; there are slipped

ABBREVIATIONS

- Conservation Area Listed Building LB
- I PA
- Local Planning Authority National Park NP
- RPG

- Registered Park and Garden Scheduled Monument SM
- ΪA Unitary Authority World Heritage Site WHS

HERITAGE AT RISK 2023 / MIDLAI	NDS / HEREFORDSHIRE	, COUNTY OF (UA)	
	SITE NAME:	Urishay Castle, Peterchurch	Remains of C12 motte castle, a ruined C17 house and a
	DESIGNATION:	Scheduled Monument and Listed Building grade II*	partly ruined C16 chapel. The chapel is stable and in good condition, but the C17 house is without a roof and the masonry is disintegrating as a result. Lintels are also failing
	CONDITION:	Poor	and in danger of collapse. An assessment of the structure to establish the survival of medieval fabric and development
	OCCUPANCY:	N/A	of a strategy are required. Clearance of ground level
	PRIORITY CATEGORY:	A (A)	vegetation and some fencing has been undertaken
	OWNER TYPE:	Private	
© Historic England	LIST ENTRY NUMBER:	1014547 and 1099487	Contact: Neil Rimmington 07775 550 674
	SITE NAME:	Court Farmhouse, Preston Wynne	A former hall house dating from the C14 which retains a spere truss and cruck truss. This building is now used for
	DESIGNATION:	Listed Building grade II*	storage with residential accommodation in the later C17 house which was added to the south end. Essential
	CONDITION:	Poor	stabilisation and roofing works have previously been undertaken but the condition of the building continues to
	OCCUPANCY:	Part occupied/part in use	decline.
	PRIORITY CATEGORY:	C (C)	
	OWNER TYPE:	Private	
© Historic England	LIST ENTRY NUMBER:	1099380	Contact: Steven McLeish 0121 625 6884
X	SITE NAME:	Post-medieval house at Willey Court, Willey	This monument includes the buried, earthwork and upstanding remains of the post-medieval house and
	DESIGNATION:	Scheduled Monument	gardens at Willey Court. The owners are in negotiations with Historic England to determine an appropriate strategy
	CONDITION:	Poor	for consolidation of the structural remains, which are the element at risk. A new Natural England Stewardship
The state of the second	OCCUPANCY:	N/A	scheme should provide suitable, simple management of the
	PRIORITY CATEGORY:	A (A)	surrounding site in grazed pasture.
	OWNER TYPE:	Private	
© Historic England	LIST ENTRY NUMBER:	1017251	Contact: Jez Bretherton 0121 625 6855
A	SITE NAME:	Church of St Andrew, Wolferlow	St Andrew's is an early C12 church restored in 1863 by Kempson. It is constructed from stone under a roof of
Antima	DESIGNATION:	Listed Building grade II*	mixed concrete and clay tiles with timber framed tower and shingle spire. The churchyard is maintained and in use,
	CONDITION:	Poor	sale of the building has been agreed; planning permission was granted for re-use as a dwelling but has lapsed.
	OCCUPANCY:	Vacant/not in use	Holding repairs to roofs have been completed.
losan al	PRIORITY CATEGORY:	D (D)	
	OWNER TYPE:	Religious organisation	
© Historic England	LIST ENTRY NUMBER:	1217197	Contact: Cristina Gardiner 0121 625 6850
	SITE NAME:	Church of St Mary, Abbey Dore, Abbey Dore	Large parish church created in c1634 from the derelict Abbey church of the dissolved Cistercian Dore Abbey. The
	DESIGNATION:	Listed Place of Worship grade I, SM	c1220 transepts crossing and chancel remain with a C17 tower inserted on the south east angle of the crossing.



	SITE NAME:	Church of St Mary, Abbey Dore, Abbey Dore	Large parish church created in c1634 from the derelict Abbey church of the dissolved Cistercian Dore Abbey. The
	DESIGNATION:	Listed Place of Worship grade I, SM	c1220 transepts crossing and chancel remain with a C17 tower inserted on the south east angle of the crossing. Repairs have been completed on the north chapel roof,
	CONDITION:	Poor	remaining issues are: the roof and drainage from the tower as well as the sandstone ashlar walling, the south
6	PRIORITY CATEGORY:	C (C)	ambulatory roof and parts of the north ambulatory roof.
A W	OWNER TYPE:	Religious organisation	
	LIST ENTRY NUMBER:	1099794	Contact: Cristina Gardiner 0121 625 6850

© Historic England

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed.
 C Slow decay; no solution agreed.

- D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user lidentified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).


Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

	SITE NAME:	Church of St Peter, Birley, Birley with Upper Hill	Small parish church in a large level churchyard in the middle of a scattered village. C12 and C13 nave and chancel and
	DESIGNATION:	Listed Place of Worship grade I	late C14 south chapel. The west tower is c1200. A National Lottery Heritage Fund and Historic England Repair Grant for Places of Worship funded repairs in 2004 remedied tower roof problems and the stonework to the chancel and vestry. However, the sandstone rubble stonework is still poor on the tower and south chapel gable and structural issues have been identified. The churc
A	CONDITION:	Poor	
	PRIORITY CATEGORY:	B (D)	
	OWNER TYPE:	Religious organisation	
	LIST ENTRY NUMBER:	1081970	has high aspirations and are working to increase the capacity for activities.
			capacity for activities.
© Historic England			Contact: Cristina Gardiner 0121 625 6850

Contact: Cristina Gardiner 0121 625 6850

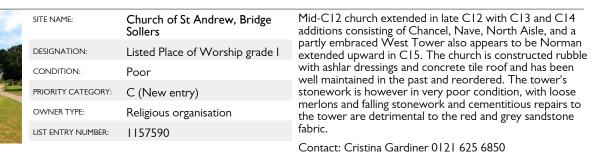

© Historic England

	SITE NAME:	Chapel at Brockhampton Park, Brockhampton	Tiny chapel in the grounds of Brockhampton Park. Built in 1798 by Byfield in the Gothic Revival style of a nave and west tower. Grey sandstone ashlar with battlemented parapets on the principal elevations but coursed rubble ar conventional eaves to the north. Structurally bowed slate roof. The ashlar stone mouldings are heavily eroded but the parapet gutter was repaired in 2017.
	DESIGNATION:	Listed Place of Worship grade II*, RPG grade II	
	CONDITION:	Poor	
	PRIORITY CATEGORY:	C (C)	the parapet gutter was repaired in 2017.
	OWNER TYPE:	Religious organisation	
	LIST ENTRY NUMBER:	1349630	Contact: Cristina Gardiner 0121 625 6850
c England			

© Historic England

	SITE NAME:	Church of St George, Burrington	Small rural church. Of medieval origins, the nave was rebuilt in c1855 by S Pountney Smith and the chancel
	DESIGNATION:	Listed Place of Worship grade II	rebuilt and shortened in 1864 by Bodley. Simple plan of chancel and nave with belfry. The church has been shut
	CONDITION:	Very bad	since 2016 as the roof is in a dangerous condition. The perimeter of the chuch has been cordoned off due to
	PRIORITY CATEGORY:	A (A)	ongoing falls of tiles. The bad condition of the roof has
	OWNER TYPE:	Religious organisation	caused falls of plaster inside the church.
	LIST ENTRY NUMBER:	1081799	Contact: Cristina Gardiner 0121 625 6850

© Historic England

	SITE NAME:	Church of St Mary, Craswall	Small rural parish church. Continuous early C15 nave and
A Street owner	DESIGNATION:	Listed Place of Worship grade II*	chancel with belfry and C17 south entrance porch. Sandstone slate roofs with Welsh slate to the north pitch.
	CONDITION:	Very bad	Sandstone rubble walls partly rendered with sandstone ashlar window tracery. Timber boarded belfry. The walls
	PRIORITY CATEGORY:	C (A)	have severe open jointing, structural cracking and the
	OWNER TYPE:	Religious organisation	render is falling. The roof slates and rooflights are failing. The rainwater goods have part fallen.
	LIST ENTRY NUMBER:	1078203	Contact: Cristina Gardiner 0121 625 6850

© Historic England

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; В solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.

D

Е

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA
- LB LPA
- Conservation Area Listed Building Local Planning Authority National Park NP
- RPG Registered Park and Garden Scheduled Monument
- SM
- UA Unitary Authority WHS World Heritage Site



SITE NAME:	Chapel of St Silas, Bollingham, Eardisley	Small chapel of three bays, and a nave and chancel. Rebuilt between 1865 and 1867 with the addition of south porch
DESIGNATION:	Listed Place of Worship grade II*	and bellcote. The nave roof is C14 and the roof is covered with sandstone slates. These are heavily overgrown with
CONDITION:	Very bad	moss and ferns, decaying the slates. Holes have appeared in the slates covering both roof pitches. The interior is
PRIORITY CATEGORY:	A (A)	netted to catch falls of plaster from the roof lining.
OWNER TYPE:	Religious organisation	
LIST ENTRY NUMBER:	1157325	Contact: Cristina Gardiner 0121 625 6850

© Historic England

© Historic England

	LIST ENTRY NUMBER:	1099751	extended in C17 and cracks have appeared above the intermediate chamber; slipped or missing tiles to the roof. Stonework and rainwater goods need repairs. Contact: Cristina Gardiner 0121 625 6850
	OWNER TYPE:	Religious organisation	passage. The battered tower with a pyramidal roof wa extended in C17 and cracks have appeared above the
	PRIORITY CATEGORY:	C (New entry)	The South Chapel has a C13 arcade of 2 arches. The tower is set separate to the North West linked via a C17
	CONDITION:	Poor	church to Chancel via a three orders ornate and round arch. Steps to the east of the Chancel led to the rood loft.
	DESIGNATION:	Listed Place of Worship grade I	tiles. Former preceptory of the Knights Templars, dating from C12 but extended in C13 and C17. Single nave
	SITE NAME:	Church of St Michael, Garway	Roughly coursed sandstone rubble with tufa and stone slate

	SITE NAME:	Church of St John the Baptist, Grendon Bishop	Parish church built in 1787-88 with earlier origins. The church was altered and extended in 1870 by FR Kempson.
	DESIGNATION:	Listed Place of Worship grade II	The church is built of old red sandstone rubble with tile roofs. The church has severe damp problems and slipped
	CONDITION:	Very bad	tiles are allowing water into the chancel.
	PRIORITY CATEGORY:	A (A)	
	OWNER TYPE:	Religious organisation	
	LIST ENTRY NUMBER:	1307407	Contact: Cristina Gardiner 0121 625 6850

© Historic England

	SITE NAME:	Church of St Catherine, Hentland	Church of 1842 enlarged 1854-1901 in an Italianate style with apse, cloisters, narthex and campanile by J.P.Seddon
	DESIGNATION:	Listed Place of Worship grade I, CA	for the Rev. William Poole. Fine mosaic work and fittings, including marble altar and pulpit and carved wooden stalls. The latest quinquennial report has identified the need for
	CONDITION:	Poor	significant re-roofing, drainage upgrade, and further masonry and pointing repairs. The failure of parts of the
	PRIORITY CATEGORY:	C (C)	roofs is now having a detrimental effect upon the interior
	OWNER TYPE:	Religious organisation	with evidence of dampness and damage to timber work.
	LIST ENTRY NUMBER:	1214570	Contact: Cristina Gardiner 0121 625 6850

© Historic England

ADDE ADDA &



D

Е

SITE NAME:	Church of St Peter, St Peter's Square, Hereford	Large urban parish church in the city centre of Hereford. A C13 tower and four bay arcade, chancel and south chapel,
DESIGNATION:	Listed Place of Worship grade II*, CA	all dating to c1300. Extensively rebuilt by Thomas Nicholson between 1880 and 1885. The valley between the nave and north aisle leaks and the south pitch slate roof
CONDITION:	Poor	needs urgent renewal.
PRIORITY CATEGORY:	A (A)	
OWNER TYPE:	Religious organisation	
LIST ENTRY NUMBER:	1196883	Contact: Cristina Gardiner 0121 625 6850

© Historic England

- Immediate risk of further rapid deterioration or loss of fabric; no А
- Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented. Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site
 - Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

87

	SITE NAME:	Church of St Mary, Hope under Dinmore	Small but lengthy parish church on a hillside setting next to the A49. Heavily restored by Kempson in 1877 and 1896, with the small west tower and north chapel still retaining C12 and C13 fabric. The north chapel gable has structural movement and the cast iron gutters are cracked, rusting and leaking. The tower sandstone rubble is heavily eroded and has harmful vegetation growth.
	DESIGNATION:	Listed Place of Worship grade II*	
	CONDITION:	Poor	
	PRIORITY CATEGORY:	C (C)	
	OWNER TYPE:	Religious organisation	
	LIST ENTRY NUMBER:	1301623	Contact: Cristina Gardiner 0121 625 6850

© Historic England

	SITE NAME:	Church of St Andrew and St Mary, How Caple	Parish church in a hillside setting overlooking the River Wye. C14 chancel with a later low pitched roof. The
	DESIGNATION:	Listed Place of Worship grade II*	tower, nave and chancel date to between 1693 and 1695 and the windows are C19. The rainwater goods are undersized and failing. The ashlar stonework of the tower is delaminating and failing. The parapet stonework of the tower is structurally unsound next to the tower access
	CONDITION:	Poor	
	PRIORITY CATEGORY:	C (C)	
	OWNER TYPE:	Religious organisation	door.
	LIST ENTRY NUMBER:	1166452	Contact: Cristina Gardiner 0121 625 6850

© Historic England

	SITE NAME:	Church of St James, Kinnersley	Sandstone parish church predominantly of the CI3 and
	DESIGNATION:	Listed Place of Worship grade I	CI4. Noted for a late CI9 decorative scheme by GF Bodley. The roofs, particularly to the north, were in poor
	CONDITION:	Poor	condition due to harmful vegetation growth The roof is now repaired. The interior shows significant signs of dam possibly associated with the poor condition of the roof.
	PRIORITY CATEGORY:	C (C)	
	OWNER TYPE:	Religious organisation	This is affecting much of the C19 decoration.
	LIST ENTRY NUMBER:	1157630	Contact: Cristina Gardiner 0121 625 6850

© Historic England

-

	SITE NAME:	Church of St Mary Magdalene, Leintwardine	Large complex church in the small town of Leintwardine. It consists of several phases of medieval work and
	DESIGNATION:	Listed Place of Worship grade I, CA	restorations in the late C19 and early C20. Repairs were carried out in 2004 but further work was required to roofs over the north aisle, and chapel, and to rainwater goods. A
	CONDITION:	Poor	National Lottery Heritage Fund and Historic England Repair Grant for Places of Worship for work to address
	PRIORITY CATEGORY:	C (C)	these was completed in 2014. However problems remain
	OWNER TYPE:	Religious organisation	with the north chapel roof and further problems have now emerged of falling mortar from the tower.
	LIST ENTRY NUMBER:	1349757	Contact: Cristina Gardiner 0121 625 6850

© Historic England



	SITE NAME:	Christ Church, Llanwarne	Large circa 1864 church. Sandstone coursed rubble with
	DESIGNATION:	Listed Place of Worship grade II, CA	bath stone ashlar dressings and plain clay tile roofs. Cruciform plan with a polygonal apse and a lantern spire over the entrance porch. The sandstone has erosion
	CONDITION:	Poor	problems and has reacted badly with the limestone ashlar causing severe decay especially on the entrance porch.
1	PRIORITY CATEGORY:	C (C)	causing severe decay especially of the entrance porch.
	OWNER TYPE:	Religious organisation	
	LIST ENTRY NUMBER:	1099767	Contact: Cristina Gardiner 0121 625 6850

© Historic England

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В implemented.
- C Slow decay; no solution agreed.
- D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

88

	SITE NAME:	Church of the Nativity of the Blessed Virgin Mary, Madley	Large church with most phases built between C12 and C14. Aisled nave, outer south aisle, tower, entrance po
and the second	DESIGNATION:	Listed Place of Worship grade I	and chancel with polygonal apse and crypt below. Major roof repairs are needed to the entire church. Repairs have
	CONDITION:	Poor	been done to the chancel as there is a chancel repair liability, but the rest of the aisles and nave roofs continue to
	PRIORITY CATEGORY:	C (C)	fail and deteriorate. Failing rainwater goods and inadequate
	OWNER TYPE:	Religious organisation	ground drainage are exacerbating the problems. Some masonry repair and repointing also needed.
	LIST ENTRY NUMBER:	1348768	Contact: Cristina Gardiner 0121 625 6850

© Historic England

	SITE NAME:	Church of St James, Ocle Pychard	Rural parish church. Coursed rubble walled continuous nave and chancel and partly integral west tower with a
1	DESIGNATION:	Listed Place of Worship grade II*, CA	leaded broach spire. Ċ19 decorative clay tile roof slopes are in very poor condition and need re-roofing. The rainwater goods are inadequate and in poor condition, as
	CONDITION:	Poor	are the surface water drains. There are low level open joints to the external walls and some damage to dressed
	PRIORITY CATEGORY:	C (C)	stonework.
	OWNER TYPE:	Religious organisation	
ngland	LIST ENTRY NUMBER:	1276199	Contact: Cristina Gardiner 0121 625 6850

© Historic England

	SITE NAME:	Church of St Peter, B 4348, Peterchurch, Peterchurch	Large Norman church of nave, former tower base, chancel, and apse with some later medieval features. Tower of 13th
	DESIGNATION:	Listed Place of Worship grade I	century, with a fibreglass spire of 1972 replacing a stone spire removed in 1949. Interior remodelled for community
	CONDITION:	Poor	use in 2009. The true condition of the spire is unknown, and options for its future repair need now to be
	PRIORITY CATEGORY:	C (C)	considered. Other essential repairs remain outstanding
SA DE	OWNER TYPE:	Religious organisation	from the 2016 QIR including replacing missing tiles, repair to roof flashings, urgent holding repair work to the tower
	LIST ENTRY NUMBER:	1296560	parapet gutter, which is cracked and allowing water into the tower.
© Historic England	_		Contact: Cristina Gardiner 0121 625 6850

Contact: Cristina Gardiner 0121 625 6850

	SITE NAME:	Church of St Peter, Pipe and Lyde	Small parish church set at the end of a village and facing the A49. Late C12 nave and C14 chancel largely rebuilt by F
	DESIGNATION:	Listed Place of Worship grade II*	Kempson in 1874 who also added the broach spire to the C13 tower. The roof needs repair and work is also needed
	CONDITION:	Poor	to the tower.
	PRIORITY CATEGORY:	C (C)	
	OWNER TYPE:	Religious organisation	
	LIST ENTRY NUMBER:	1172739	Contact: Cristina Gardiner 0121 625 6850

© Historic England

	SITE NAME:	Church of St Mary, Stoke Edith	Large parish church, rebuilt by the Foleys of Stoke Edith
	DESIGNATION:	Listed Place of Worship grade I	Park in 1740 in the Palladian style by Henry Flitcroft. The C14 tower with truncated spire was retained. The roof
	CONDITION:	Very bad	leaks, causing rot in the nave beam and falls in the plasterwork. The ashlar stone facings are eroding severely.
	PRIORITY CATEGORY:	A (A)	A few stones have fallen from the tower and spire.
	OWNER TYPE:	Religious organisation	
	LIST ENTRY NUMBER:	1099825	Contact: Cristina Gardiner 0121 625 6850
and the second sec			

© Historic England

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В implemented.
- C Slow decay; no solution agreed.
- D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user lidentified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA LB LPA NP RPG SM
- Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument
- UA Unitary Authority WHS World Heritage Site

1	SITE NAME:	Church of St Mary, Tyberton	Originally a C12 church rebuilt in 1720 by local mason
	DESIGNATION:	Listed Place of Worship grade II*	Robert Pritchard for William Brydges. English bond brick construction on a sandstone plinth and slate roof. Four-
	CONDITION:	Poor	stage tower finishing with 4 pediments above the stone cornice and corner stone urns. The church lancet windows
	PRIORITY CATEGORY:	C (New entry)	were unfortunately glazed with plain plate glazing in 1880
	OWNER TYPE:	Religious organisation	and the original guttering has been replaced with Upvc square guttering. Internally the C18 furnishings are well
	LIST ENTRY NUMBER:	1348758	preserved. The roofs of church and naves are in poor conditions and need reroofing and the rest of the fabric is
			also in relatively poor condition

© Historic England

Contact: Cristina Gardiner 0121 625 6850

also in relatively poor condition.

	Offa's Dyke: the section extending 950yds (870m)	N and S of Big Oak	s, Bishopstone / Bridge Sollers / Byfor
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1001738
CONDITION:	Generally satisfactory but with minor localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable clipping	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Jez Bretherton 0121 625 6855
SITE NAME:	Mouse motte and bailey castle, Cusop		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1019488
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Improving
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Government or agency	CONTACT:	Neil Rimmington 07775 550 674
SITE NAME:	Dinedor Camp, Dinedor		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1001758
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Improving
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Other not for profit group	CONTACT:	Neil Rimmington 07775 550 674
SITE NAME:	Promontory fort on Dorstone Hill, Dorstone		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1014544
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Jez Bretherton 0121 625 6855
SITE NAME:	Moated site 360 metres north of Joanshill Farm, Fo	wnhope / Mordifor	ď
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1019853
DESIGNATION: CONDITION:	Scheduled Monument Generally unsatisfactory with major localised problems	TREND:	Declining
	Generally unsatisfactory with major localised		
CONDITION: PRINCIPAL VULNERABILITY:	Generally unsatisfactory with major localised problems	TREND:	Declining
CONDITION:	Generally unsatisfactory with major localised problems Deterioration - in need of management	TREND: NEW ENTRY?: CONTACT:	Declining No
CONDITION: PRINCIPAL VULNERABILITY: DWNER TYPE: SITE NAME:	Generally unsatisfactory with major localised problems Deterioration - in need of management Unknown	TREND: NEW ENTRY?: CONTACT:	Declining No
CONDITION: PRINCIPAL VULNERABILITY: DWNER TYPE: DITE NAME: DESIGNATION:	Generally unsatisfactory with major localised problems Deterioration - in need of management Unknown Huntington Castle, Huntington / Gladestry Commu	TREND: NEW ENTRY?: CONTACT:	Declining No Jez Bretherton 0121 625 6855
Condition: Principal Vulnerability: Dwner Type:	Generally unsatisfactory with major localised problems Deterioration - in need of management Unknown Huntington Castle, Huntington / Gladestry Commu Scheduled Monument and Listed Building grade II Generally unsatisfactory with major localised	TREND: NEW ENTRY?: CONTACT: UNITY LIST ENTRY NUMBER:	Declining No Jez Bretherton 0121 625 6855 1002939 and 1157544

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no А

Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В

implemented. C Slow decay; no solution agreed.

 D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA LB LPA NP RPG SM

- Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

UA Unitary Authority WHS World Heritage Site

DEGRAPTION: Scheduled Monument UTITATIVE NAMERS [00173] CORRENTION: Generally statisticatory but with significant localised memory. UNIXABABUTY: No No Statisticatory but with significant localised memory. UNIXABABUTY: Stock erosion - localised/limited NO No OWNER TWO: Private Offa's Dyte: section S of Riddings Brook on Herox/HUTIK NUMERS IO01735 CORRENT: Scheduled Monument UTITATIVE NUMERS IO003358 CORRENT: Scheduled Monument UTITATIVE NUMERS No CORRENT: Notatificatory but with minor localised INVOITIVE No CORRENT: Offa's Dyte: section north west of Holme Marsh wetter Ming 61 Syrads Scheduled Monument UTITATIVE No CORRENT: Development requiring planning permission NO No No OWNERTIFIC Scheduled Monument UTITATIVE No No CORRENT: Development requiring planning permission No No OWNERTIFIC Scheduled Monument UTITATIVE No UTITATIVE Scheduled Monument UTITATIVE No	SITE NAME:	Offa's Dyke: Rushock Hill section, extending 1630y	rds (1490m) east to	Kennel Wood, Kington Rural / Knill
problems problems map using with the second of coalsed / limited New Second of Coard Action New Second of Coard Action BIRGRAD WOLFFARE Protec Coard Action Jez Bertherton 0121 625 6855 BIRGRAD WOLFFARE Offs'S Dyke: section S of Riddings Brook on Herrock Hill, Kington Rumark 1005358 BIRGRAD WOLFFARE Scheduled Monument Its Hunry Numerk 1005358 Condot Action Generally satisfactory but with minor localised / limited No Stable Other Coard Action Jez Bertherton 0121 625 6855 MILENAME Offs'S Dyke: section north west of Holme Marsh extending 61 Systads (560 metres) to the railway, Lyonsh Bascakarizan Scheduled Monument Its Hunry Numerk 1001735 BIRCRAD WOLFFARE Offs'S Dyke: section north west of Holme Marsh extending 61 Systads (560 metres) to the railway, Lyonsh Bascakarizan Scheduled Monument Its Hunry Numerk 1001735 BIRCRAD WOLFFARE Offs'S Dyke: section north west of Holme Marsh extending 61 Systads (560 metres) to the railway, Lyonsh Bascakarizan Scheduled Monument Its Hunry Numerk 1001735 BIRCRAD WOLFFARE Proteins Scheduled Monument Its Hunry Numerk 1001747 BIRCRAD WOLFFARE <t< th=""><th>DESIGNATION:</th><th>Scheduled Monument</th><th>LIST ENTRY NUMBER:</th><th>1001731</th></t<>	DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1001731
WHEN IPPPrivateCONTACT:Jez Bretherton 0121 625 6855INTERNATE:Offa's Dyke: section S of Riddings Brook on Herrox-L Hill, Kington Rutt-/ Kmill / Lower HarptonSEGUATION:Scheduled MonumentINTERNATION MURRER1005358Scheduled MonumentINTERNATIONStableStableScheduled MonumentINTERNATIONNoSMICKAN MARKERITY:Natural erosion - localised /limitedNEW KIRP;NaturalSMICKAN MARKERITY:Natural erosion - localised /limitedNEW KIRP;NoSMICKAN MARKERITY:OtherCONTACT:Jez Bretherton 0121 625 6855SMICKAN MARKERITY:OtherCONTACT:Jez Bretherton 0121 625 6855SMICKAN MARKERITY:OtherUSI EMIX NAMESEIO01735SCHEDURERITY:Development requiring planning permissionNEW EMIX*NoSMIRATION:Scheduled MonumentUSI EMIX*NUMESEIO01747SMIRATION:Scheduled MonumentCONTACT:Jez Bretherton 0121 625 6855SMIRATION:Scheduled MonumentUSI EMIX*NUMESEIO01747SMIRATION:Scheduled MonumentUSI EMIX*NUMESEIO01747SMIRATION:Scheduled MonumentUSI EMIX*NUMESEIO01747SMIRATION:Scheduled MonumentUSI EMIX*NUMESEIO01747SMIRATION:Scheduled MonumentUSI EMIX*NUMESEIO01745SMIRATION:Scheduled MonumentUSI EMIX*NUMESEIO01745SMIRATION:Scheduled MonumentUSI EMIX*NUMESEIO01745SMIRATION:Scheduled MonumentUSI	CONDITION:		TREND:	Improving
Contract Offa's Dyke: section S of Riddings Brook on Herror Hull, Kington Rural / Knill / Lower Harpton DBIGNATION Scheduled Monument UIST FRITER NUMBER 1005358 CONDITION Generally statisfactory but with minor localised / Imited New STREY. Natural arosion - localised / Imited New STREY. Natural - localised / Imited	PRINCIPAL VULNERABILITY:	Stock erosion - localised/limited	NEW ENTRY?:	No
Designation: Scheduled Monument List INTERVENUESE 1005358 condition: Generally statisficatory but with minor localised problems TRAND: Stable problems Matural erosion - localised/limited No No problems Other CONTACT: Jez Bretherton 0121 625 6855 problems Other CONTACT: Jez Bretherton 0121 625 6855 problems Scheduled Monument List ENTRY NUMBER 1001735 problems Generally statisfactory but with significant localised problems TRND: Declining problems Generally statisfactory but with significant localised problems TRND: No problems Generally statisfactory but with significant localised problems TRND: No problems Generally statisfactory but with significant localised problems TRND: No problems Generally statisfactory but with significant localised problems TRND: Stable problems Generally unatisfactory with significant problems TRND: Stable problems Durupting No Stable problems	OWNER TYPE:	Private	CONTACT:	Jez Bretherton 0121 625 6855
Constraint Generally satisfactory but with minor localised problems THEND: Stable SPRINCERAL VALUERSAULTY: Natural erosion - localised/limited New ENTRY: No SPRINCERAL VALUERSAULTY: Other CONTACT: Jez Bretherton 0121 625 6855 SPRINCERAL VALUERSAULTY: Other CONTACT: Jez Bretherton 0121 625 6855 STREME Offa's Dyke: section north west of Holme Marsh extending 615 yards: [560 metres) to the railway, Lyonsh Declining Declining SERENATION: Scheduled Monument List PNTRY NUMBER: 1001735 SERENATION: Scheduled Monument List PNTRY NUMBER: 1001747 SERENATION: Development requiring planning permission New ENTRY: No SERENATION: Scheduled Monument UST PNTRY NUMBER: 1001747 SCONDITION: Scheduled Monument UST PNTRY NUMBER: 1001747 SCONDITION: Scheduled Monument UST PNTRY NUMBER: 1014103 SCONDITION: Scheduled Monument UST PNTRY NUMBER: 1014103 SCONDITION: Generality satisfactory with major localised problems TREND: Declining	SITE NAME:	Offa's Dyke: section S of Riddings Brook on Herro	ck Hill, Kington Ru	ral / Knill / Lower Harpton
Concention problems Intensity Natural Parameters PRENCIPAL VULNERABULY: Natural erosion - localised/limited NEW ENTRY: No PRENCIPAL VULNERABULY: Other CONTACT: Jze Bretherton 0121 625 6855 STET NAME: Offa's Dyke: section north west of Holme Marsh extending 615 yards (560 metres) to the railway, Lyonsh DESIGNATION Control 121 625 6855 CONTROM Generally satifactory but with significant localised problems TREND: Declining Prevention Development requiring planning permission NEW ENTRY: No DESIGNATION Scheduled Monument UST ENTRY NUMBER 1001747 DESIGNATION Scheduled Monument UST ENTRY NUMBER 1001747 DESIGNATION Scheduled Monument UST ENTRY NUMBER 1001747 DESIGNATION Scheduled Monument UST ENTRY NUMBER 101103 DESIGNATION Scheduled Monument UST ENTRY NUMBER 1014103 DESIGNATION Generally unsatifactory with major localised problems TREND Scheduled Monument UST ENTRY NUMBER 1014103 DESIGNATION Generally unsatifactory with major localised pre	DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1005358
OWNER TYPEOtherOWNER TYPEJez Bretherton 0121 625 6855STEI NAME:Scheduled MonumentUIST INTER NUMBER1001 735CONDITION:Generally satisfactory but with significant localised problemsINEND:DecliningRINCIPAL VULNERABULTY:Development requiring planning permissionNEW DYTRY:NoOWNER TYPE:Statom Walls (camp), Marden / SuttomINTENTER NUMBER:1001 747STEINAME:Suttom Walls (camp), Marden / SuttomINTENTER NUMBER:1001 747CONDITION:Scheduled MonumentUIST INTER NUMBER:1001 747CONDITION:Extensive significant problemsTREND:StableCONDITION:Charity (heritage)CONTACT:Jez Bretherton 0121 625 6855STEINAME:Bowl barrow 460 mettres south of Milton Cross, PertureNoCONDITION:Scheduled MonumentUIST INTER NUMBER:1014103CONDITION:Generally unsatisfactory with major localised problemsTREND:DecliningCONDITION:Scheduled MonumentUIST INTER NUMBER:1014103CONDITION:Generally unsatisfactory with major localised problemsTREND:DecliningCONDITION:Scheduled MonumentUIST INTER NUMBER:1014112CONDITION:Scheduled MonumentUIST INTER NUMBER:1014112CONDITION:Scheduled MonumentUIST INTER NUMBER:1014112CONDITION:Scheduled MonumentUIST INTER NUMBER:1014112CONDITION:Scheduled MonumentUIST INTER NUMBER:1014112	CONDITION:		TREND:	Stable
STEENAME: Offa's Dyke: section north west of Holme Marsh extending 615 yards (560 metres) to the railway, Lyonsh Designation) Scheduled Monument LIST ENTRY NUMBER 1001735 CONDITION: Generally satisfactory but with significant localised problems TREND: Declining RINGRAR VULNERABULTY: Development requiring planning permission NEW UNTRY: No OWNER TYPE: Private, multiple owners CONTACT: Jez Bretherton 0121 625 6855 STEENAME: Sutton Walls (camp), Marden / Sutton Stable DEDRIGHTON: Extensive significant problems INEND: Stable CONTACT: Dumping CONTACT: Jez Bretherton 0121 625 6855 CONTACT: Declining CONTACT: Jez Bretherton 0121 625 6855 CONTACT: Bowl barrow 460 metres south of Milton Cross. Permitige Declining CONTACT: Generally unsatisfactory with major localised problems INTACT: Jez Bretherton 0121 625 6855 CONTACT: Bowl barrow 490 metres south east of Milton Cross. Permitige Declining DEGIGNATION: Scheduled Monumen	PRINCIPAL VULNERABILITY:	Natural erosion - localised/limited	NEW ENTRY ?:	No
Designation:Scheduled MonumentList ENTRY NUMBER1001735CONDITION:Generally satisfactory but with significant localised problemsINEND:DecliningRIRRICITAL VULNERABILITY:Development requiring planning permissionNEW ENTRY:NoDevelopment requiring planning permissionNEW ENTRY:NoCONTACT:Jez Bretherton 0121 625 6855STEENAME:Sutton Walls (camp), Marden / SuttonISTE ENTRY NUMBER:1001747CONTACT:DevelopmentUST ENTRY NUMBER:1001747CONTACT:DumpingNEW ENTRY:NoCONTACT:DumpingNEW ENTRY:NoCONTACT:DumpingNEW ENTRY:NoCONTACT:DumpingNEW ENTRY:NoCONTACT:DecliningISTE ENTRY NUMBER:101103CONTACT:Bowl barrow 460 metres south of Milton Cross, PembridgeDecliningDESIGNATION:Scheduled MonumentUST ENTRY NUMBER:1014103CONTACT:Generally unsatisfactory with major localised problemsISTE ENTRY NUMBER:NoOWNER TYPE:Anable ploughingNEW ENTRY:NoOWNER TYPE:Bowl barrow 490 metres south east of Milton Cross, PembridgeDecliningDESIGNATION:Generally unsatisfactory with major localised problemsISTE ENTRY NUMBER:1014112CONTACT:Bowl barrow 490 metres south east of Milton Cross, PembridgeDecliningCONTACT:Scheduled MonumentISTE ENTRY NUMBER:1014112CONTACT:Generally unsatisfactory with major loc	OWNER TYPE:	Other	CONTACT:	Jez Bretherton 0121 625 6855
CONDITION:Generally satisfactory but with significant localised problemsTREND:DecliningRINICIPAL VLUNERABLITY:Development requiring planning permissionNEW ENTRY:NoOWNER TYPE:Private, multiple ownersCONTACT:Jez Bretherton 0121 625 6855STET MATE:Sutton Walls (camp), Marden / SuttonStef ENTRY NUMBER:1001747DEBIGRATION:Scheduled MonumentLIST ENTRY NUMBER:1001747DEBIGRATION:Extensive significant problemsTREND:StableCONDITION:Extensive significant problemsREND:Jez Bretherton 0121 625 6855OWNER TYPE:DumpingNEW ENTRY:NoOWNER TYPE:Charity (heritage)CONTACT:Jez Bretherton 0121 625 6855STE NAME:Bowl barrow 460 metres south of Milton Cross, Permirige1014103CONDITION:Scheduled MonumentLIST ENTRY NUMBER:1014103CONDITION:Generally unsatisfactory with major localised problemsREND:DecliningRINCIPAL VULNERABILITY:Arable ploughingNEW ENTRY:NoOWNER TYPE:FrivateBowl barrow 490 metres south east of Milton Cross, PermirdgeJez Bretherton 0121 625 6855RINCIPAL VULNERABILITY:Arable ploughingNEW ENTRY:NoCONDITION:Scheduled MonumentLIST ENTRY NUMBER:Jold112CONDITION:Scheduled MonumentNEW ENTRY:NoCONDITION:Scheduled MonumentMEN ENTRY:NoCONDITION:Scheduled MonumentNEW ENTRY:NoCONDITION:<	SITE NAME:	Offa's Dyke: section north west of Holme Marsh e	xtending 615 yards	(560 metres) to the railway, Lyonsha
problemsproblemsDecliningRRINCIPAL VULNERABILITY:Development requiring planning permissionNEW ENTRY:NoDOWNER TYPE:Private, multiple ownersCONTACT:Jez Bretherton 0121 625 6855SITE NAME:Sutton Walls (camp), Marden / SuttonUST ENTRY NUMBER:1001747DEBIGNATION:Scheduled MonumentUST ENTRY NUMBER:1001747CONDITIONExtensive significant problemsTEND:StableRRINCIPAL VULNERABILITY:DumpingNEW ENTRY:NoDWNER TYPE:Charity (heritage)CONTACT:Jez Bretherton 0121 625 6855STETE NAME:Bowl barrow 460 metres south of Milton Cross, Permiridge1014103CONDITION:Scheduled MonumentUST ENTRY NUMBER:1014103CONDITION:Generally unsatisfactory with major localised problemsTEND:DecliningRINCIPAL VULNERABILITY:Arable ploughingNEW ENTRY:NoOWNER TYPE:FrivateBowl barrow 490 metres south east of Milton Cross; PermiridgeScheduled MonumentCONDITION:Generally unsatisfactory with major localised problemsTEND:DecliningStenduled MonumentUST ENTRY NUMBER:1014112Condition:Generally unsatisfactory with major localised problemsNIW ENTRY:NoDEGISMATION:Scheduled MonumentUST ENTRY NUMBER:1014112Condition:Generally unsatisfactory with major localised problemsNIW ENTRY:NoDEVINER TYPE:Arable ploughingNIW ENTRY:NoDEVINER TYP	DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1001735
DWNRER TYPE:Private, multiple ownersCONTACT:Jez Bretherton 0121 625 6855DERIGNATION:Sutton Walls (camp), Marden / SuttonISTE INTRY NUMBER1001747DERIGNATION:Scheduled MonumentLIST ENTRY NUMBER1001747CONTON:Extensive significant problemsTREND:StableBRINGPAL VULNERABILIT?DumpingNEW ENTRY:NoOWNRER TYPE:Charity (heritage)CONTACT:Jez Bretherton 0121 625 6855BRINGPAL VULNERABILIT?Bowl barrow 460 metres south of Milton Cross, PertureIo14103DERIGNATION:Scheduled MonumentLIST ENTRY NUMBER1014103CONTON:Generally unsatisfactory with major localised problemsTREND:DecliningCONTACT:PrivateNoScheduled MonumentLIST ENTRY NUMBERDERIGNATION:Arable ploughingNEW ENTRY:NoOWNRER TYPE:PrivateCONTACT:Jez Bretherton 0121 625 6855DERIGNATION:Scheduled MonumentLIST ENTRY NUMBER1014112DERIGNATION:Scheduled MonumentLIST ENTRY NUMBER1014112DERIGNATION:Scheduled MonumentLIST ENTRY NUMBER1014112CONDITION:Generally unsatisfactory with major localised problemsTREND:DecliningRRINCIPAL VULNERABILITY:Arable ploughingNEW ENTRY:NoOWNER TYPE:PrivateCONTACT:Jez Bretherton 0121 625 6855BRINCIPAL VULNERABILITY:Arable ploughingNEW ENTRY:NoOWNER TYPE:PrivateCONTACT:Je	CONDITION:		TREND:	Declining
Sutton Walls (camp), Marden / Sutton UIST ENTRY NUMBER 1001747 DEBIGNATION: Scheduled Monument UIST ENTRY NUMBER 1001747 CONDITION: Extensive significant problems TREND: Stable PRINCIPAL VOLNERABILITY: Dumping No No OWNER TYPE: Charity (heritage) CONTACT: Jez Bretherton 0121 625 6855 STEE NAME: Bowl barrow 460 meteres south of Milton Cross, Permbridge 1014103 DEBIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1014103 CONDITION: Generally unsatisfactory with major localised problems TREND: Declining CONTACT: Private No Sociect Contract: Jez Bretherton 0121 625 6855 STEE NAME: Generally unsatisfactory with major localised problems TREND: Declining OWNER TYPE: Private CONTACT: Jez Bretherton 0121 625 6855 DEBIGNATION: Scheduled Monument UST ENTRY NUMBER 1014112 CONDITION: Scheduled Monument UST ENTRY NUMBER 1014112 CONDITION: Generally unsatisfactory with major localised problems <td>PRINCIPAL VULNERABILITY:</td> <td>Development requiring planning permission</td> <td>NEW ENTRY?:</td> <td>No</td>	PRINCIPAL VULNERABILITY:	Development requiring planning permission	NEW ENTRY?:	No
DesignationUsing indicating interest occessScheduled MonumentUST ENTRY NUMBER:1001747CONTRCT:Extensive significant problemsTREND:StablePRINCIPAL VULNERABILITY:DumpingNeW ENTRY:NoOWINER TYPE:Charity (heritage)CONTACT:Jez Bretherton 0121 625 6855SITE NAME:Bowl barrow 460 metres south of Milton Cross, Pembridge1014103Designation:Scheduled MonumentUST ENTRY NUMBER:1014103Condition:Scheduled MonumentUST ENTRY NUMBER:1014103Condition:Generally unsatisfactory with major localised problemsTREND:DecliningCondition:Bowl barrow 490 metres south east of Milton Cross, PembridgeJez Bretherton 0121 625 6855SITE NAME:Bowl barrow 490 metres south east of Milton Cross, PembridgeJez Bretherton 0121 625 6855SITE NAME:Bowl barrow 490 metres south east of Milton Cross, PembridgeJez Bretherton 0121 625 6855SITE NAME:Generally unsatisfactory with major localised problemsTREND:DecliningCondition:Generally unsatisfactory with major localised problemsTREND:NoCondition:Scheduled MonumentUST ENTRY NUMBER:Jez Bretherton 0121 625 6855SITE NAME:Bowl barrow 550 metres south east of Milton CrossJez Bretherton 0121 625 6855SITE NAME:Bowl barrow 550 metres south east of Milton CrossJez Bretherton 0121 625 6855SITE NAME:Bowl barrow 550 metres south east of Milton CrossJez Bretherton 0121 625 6855SITE NAME: <td< td=""><td>OWNER TYPE:</td><td>Private, multiple owners</td><td>CONTACT:</td><td>Jez Bretherton 0121 625 6855</td></td<>	OWNER TYPE:	Private, multiple owners	CONTACT:	Jez Bretherton 0121 625 6855
CONDITION:Extensive significant problemsTREND:StableRINCIPAL VULNERABILITY:DumpingNEW ENTRY:NoWINER TYPE:Charity (heritage)CONTACT:Jez Bretherton 0121 625 6855UTE NAME:Bow barrow 460 mettres south of Milton Cross, Jez1014103DESIGNATION:Scheduled MonumentUST ENTRY NUMBER:1014103CONDITION:Generally unsatisfactory with major localised problemsNEW ENTRY:NoCONDITION:Arable ploughingNEW ENTRY:NoCONDITION:PrivateCONTACT:Jez Bretherton 0121 625 6855CONDITION:Scheduled MonumentUST ENTRY NUMBER:1014112CONDITION:Scheduled MonumentUST ENTRY NUMBER:1014112CONDITION:Scheduled MonumentUST ENTRY NUMBER:1014112CONDITION:Generally unsatisfactory with major localised problemsNEW ENTRY:NoCONDITION:Scheduled MonumentUST ENTRY NUMBER:1014112CONDITION:Generally unsatisfactory with major localised problemsNEW ENTRY:NoCONDITION:Generally unsatisfactory with major localised problemsNEW ENTRY:NoCONDITION:Generally unsatisfactory with major localised problemsNEW ENTRY:NoCONDITION:FranceScheduled MonumentUST ENTRY NUMBER1014192CONDITION:Scheduled MonumentUST ENTRY NUMBER101495CONDITION:Scheduled MonumentUST ENTRY NUMBER1014895CONDITION:Scheduled Monument <td>ITE NAME:</td> <td>Sutton Walls (camp), Marden / Sutton</td> <td></td> <td></td>	ITE NAME:	Sutton Walls (camp), Marden / Sutton		
NRINCIPAL VULNERABILITY: Dumping New ENTRY: No DWN RE TYPE: Charity (heritage) CONTACT: Jez Bretherton 0121 625 6855 DESIGNATION: Bowl barrow 460 metres south of Milton Cross, Pembridge 1014103 DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1014103 CONDITION: Generally unsatisfactory with major localised problems TREND: Declining RINCIPAL VULNERABILITY: Arable ploughing New ENTRY: No DWN RE TYPE: Private CONTACT: Jez Bretherton 0121 625 6855 Generally unsatisfactory with major localised problems New ENTRY: No Scheduled Monument LIST ENTRY NUMBER: 1014112 CONDITION: Scheduled Monument LIST ENTRY NUMBER: 1014112 CONDITION: Scheduled Monument LIST ENTRY NUMBER: 1014112 CONTACT: Beelining Declining CONTACT: Jez Bretherton 0121 625 6855 CONTACT: Jez Bretherton 0121 625 6855 CONTACT: Jez Bretherton 0121 625 6855 CONTACT: Jez Bretherton 0121 625 6855 </td <td>DESIGNATION:</td> <td>Scheduled Monument</td> <td>LIST ENTRY NUMBER:</td> <td>1001747</td>	DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1001747
DWN NER TYPE:Charity (heritage)CONTACT:Jez Bretherton 0121 625 6855SITE NAME:Bowl barrow 460 metres south of Milton Cross, Pembridge1014103DESIGNATION:Scheduled MonumentLIST ENTRY NUMBER:1014103CONDITION:Generally unsatisfactory with major localised problemsREND:DecliningRRINCIPAL VULNERABILITY:Arable ploughingNEW ENTRY:NoOWN NER TYPE:PrivateCONTACT:Jez Bretherton 0121 625 6855DESIGNATION:Scheduled MonumentLIST ENTRY NUMBER:1014112DESIGNATION:Scheduled MonumentLIST ENTRY NUMBER:1014112CONDITION:Generally unsatisfactory with major localised problemsREND:DecliningCONTACT:Scheduled MonumentLIST ENTRY NUMBER:1014112CONTACT:Generally unsatisfactory with major localised problemsREND:DecliningCONTACT:PrivateCONTACT:Jez Bretherton 0121 625 6855CONDITION:PrivateScheduled MonumentNEW ENTRY:OWNER TYPE:Arable ploughingNEW ENTRY:NoOWNER TYPE:Bowl barrow 550 metres south east of Milton Cross.PembridgeDESIGNATION:Scheduled MonumentLIST ENTRY NUMBER:1014895DESIGNATION:Scheduled MonumentLIST ENTRY NUMBER:1014895DESIGNATION:Scheduled MonumentLIST ENTRY NUMBER:1014895DESIGNATION:Scheduled MonumentLIST ENTRY NUMBER:1014895DESIGNATION:Scheduled MonumentLIST ENTRY NU	CONDITION:	Extensive significant problems	TREND:	Stable
STITE NAME: Bowl barrow 460 metres south of Milton Cross, Pembridge DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1014103 CONDITION: Generally unsatisfactory with major localised problems TREND: Declining DRINCIPAL VULNERABILITY: Arable ploughing NEW ENTRY: No DRINCIPAL VULNERABILITY: Arable ploughing NEW ENTRY: No DWNER TYPE: Private CONTACT: Jez Bretherton 0121 625 6855 STE NAME: Bowl barrow 490 metres south east of Milton Cross, Pembridge 1014112 DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1014112 CONDITION: Generally unsatisfactory with major localised problems TREND: Declining RRINCIPAL VULNERABILITY: Arable ploughing NEW ENTRY: No OWNER TYPE: Private CONTACT: Jez Bretherton 0121 625 6855 STE NAME: Bowl barrow 550 metres south east of Milton Cross, Pembridge No DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1014895 DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1014895 DESIGNATION: Scheduled Monument	PRINCIPAL VULNERABILITY:	Dumping	NEW ENTRY ?:	No
DESIGNATION:Scheduled MonumentLIST ENTRY NUMBER:1014103CONDITION:Generally unsatisfactory with major localised problemsTREND:DecliningRRINCIPAL VULNERABILITY:Arable ploughingNEW ENTRY?:NoOWNER TYPE:PrivateCONTACT:Jez Bretherton 0121 625 6855STE NAME:Bowl barrow 490 metres south east of Milton CrossFREND:1014112DESIGNATION:Scheduled MonumentLIST ENTRY NUMBER:1014112CONDITION:Generally unsatisfactory with major localised problemsTREND:DecliningCONDITION:PrivateGenerally unsatisfactory with major localised problemsNEW ENTRY:NoCONDITION:PrivateBowl barrow 550 metres south east of Milton CrossJez Bretherton 0121 625 6855STE NAME:Bowl barrow 550 metres south east of Milton CrossJez Bretherton 0121 625 6855STE NAME:Scheduled MonumentLIST ENTRY NUMBER:1014895DESIGNATION:Scheduled MonumentLIST ENTRY NUMBER:Jez Bretherton 0121 625 6855STE NAME:Bowl barrow 550 metres south east of Milton CrossJez Bretherton 0121 625 6855STE NAME:Scheduled MonumentLIST ENTRY NUMBER:1014895DESIGNATION:Scheduled MonumentLIST ENTRY NUMBER:1014895CONDITION:Generally unsatisfactory with major localised problemsREND:DecliningCONDITION:Generally unsatisfactory with major localised problemsREND:DecliningCONDITION:Generally unsatisfactory with major localised <td>OWNER TYPE:</td> <td>Charity (heritage)</td> <td>CONTACT:</td> <td>Jez Bretherton 0121 625 6855</td>	OWNER TYPE:	Charity (heritage)	CONTACT:	Jez Bretherton 0121 625 6855
CONDITION:Generally unsatisfactory with major localised problemsTREND:DecliningRINCIPAL VULNERABILITY:Arable ploughingNEW ENTRY:NoOWNER TYPE:PrivateCONTACT:Jez Bretherton 0121 625 6855SITE NAME:Bowl barrow 490 metres south east of Milton CrossVermer vol1014112DESIGNATION:Scheduled MonumentUST ENTRY NUMBER1014112CONDITION:Generally unsatisfactory with major localised problemsNEW ENTRY:NoRINCIPAL VULNERABILITY:Arable ploughingNEW ENTRY:NoOWNER TYPE:Eowl barrow 550 metres south east of Milton CrossJez Bretherton 0121 625 6855SITE NAME:Bowl barrow 550 metres south east of Milton CrossJez Bretherton 0121 625 6855SITE NAME:Scheduled MonumentUST ENTRY NUMBER1014895DESIGNATION:Scheduled MonumentUST ENTRY NUMBER1014895ODE SITE NAME:Bowl barrow 550 metres south east of Milton CrossJez Bretherton 0121 625 6855DESIGNATION:Scheduled MonumentUST ENTRY NUMBER1014895CONDITION:Scheduled MonumentUST ENTRY NUMBER1014895CONDITION:Scheduled MonumentIst ENTRY NUMBER1014895CONDITION:Schedu	SITE NAME:	Bowl barrow 460 metres south of Milton Cross, Po	embridge	
problemsnew end of the formnew end of the formDecliningPRINCIPAL VULNERABILITY:Arable ploughingNEW ENTRY?:Noowner type:PrivateCONTACT:Jez Bretherton 0121 625 6855STE NAME:Bowl barrow 490 metres south east of Milton CrossPermbridgeDESIGNATION:Scheduled MonumentLIST ENTRY NUMBER:1014112CONDITION:Generally unsatisfactory with major localised problemsTREND:DecliningPRINCIPAL VULNERABILITY:Arable ploughingNEW ENTRY?:NoOWNER TYPE:PrivateCONTACT:Jez Bretherton 0121 625 6855SITE NAME:Bowl barrow 550 metres south east of Milton CrossPermiritiesNoSITE NAME:Scheduled MonumentLIST ENTRY NUMBER:1014895DESIGNATION:Scheduled MonumentLIST ENTRY NUMBER:1014895DESIGNATION:Generally unsatisfactory with major localised problemsTREND:DecliningDESIGNATION:Scheduled MonumentLIST ENTRY NUMBER:1014895CONDITION:Generally unsatisfactory with major localised problemsTREND:DecliningCONDITION:Arable ploughingNEW ENTRY?:No	DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1014103
DWNER TYPE:PrivateCONTACT:Jez Bretherton 0121 625 6855BOWI barrow 490 metres south east of Milton CrossFembridgeDESIGNATION:Scheduled MonumentLIST ENTRY NUMBER:1014112CONDITION:Generally unsatisfactory with major localised problemsTREND:DecliningRINCIPAL VULNERABILITY:Arable ploughingNEW ENTRY?NoDWNER TYPE:BowI barrow 550 metres south east of Milton CrossPembridgeDESIGNATION:Scheduled MonumentLIST ENTRY NUMBER:1014895DESIGNATION:Scheduled MonumentLIST ENTRY NUMBER:1014895DESIGNATION:Scheduled MonumentLIST ENTRY NUMBER:1014895CONDITION:Generally unsatisfactory with major localised problemsINST ENTRY NUMBER:1014895DESIGNATION:Scheduled MonumentLIST ENTRY NUMBER:1014895CONDITION:Generally unsatisfactory with major localised problemsIREND:DecliningCONDITION:Arable ploughingNEW ENTRY:No	CONDITION:		TREND:	Declining
Bowl barrow 490 metres south east of Milton Cross-Pembridge Designation: Scheduled Monument LIST ENTRY NUMBER: 1014112 CONDITION: Generally unsatisfactory with major localised problems TREND: Declining PRINCIPAL VULNERABILITY: Arable ploughing NEW ENTRY?: No Development Eowl barrow 550 metres south east of Milton Cross-Pembridge Jez Bretherton 0121 625 6855 DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1014895 Option: Scheduled Monument LIST ENTRY NUMBER: 1014895 Option: Generally unsatisfactory with major localised problems LIST ENTRY NUMBER: 1014895 Option: Generally unsatisfactory with major localised problems LIST ENTRY NUMBER: 1014895 Option: Generally unsatisfactory with major localised problems LIST ENTRY NUMBER: 1014895	PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
DESIGNATION:Scheduled MonumentLIST ENTRY NUMBER:1014112CONDITION:Generally unsatisfactory with major localised problemsTREND:DecliningPRINCIPAL VULNERABILITY:Arable ploughingNEW ENTRY?:NoOWNER TYPE:PrivateCONTACT:Jez Bretherton 0121 625 6855SITE NAME:Bowl barrow 550 metres south east of Milton CrossPembridgeDESIGNATION:Scheduled MonumentIST ENTRY NUMBER:1014895CONDITION:Generally unsatisfactory with major localised problemsTREND:DecliningCONDITION:Arable ploughingNEW ENTRY?:No	OWNER TYPE:	Private	CONTACT:	Jez Bretherton 0121 625 6855
CONDITION:Generally unsatisfactory with major localised problemsTREND:DecliningPRINCIPAL VULNERABILITY:Arable ploughingNEW ENTRY:NoDWNER TYPE:PrivateCONTACT:Jzz Bretherton 0121 625 6855SITE NAME:Bowl barrow 550 metres south east of Milton Cross- PembridgeIst ENTRY NUMBER:1014895DESIGNATION:Scheduled MonumentIst ENTRY NUMBER:1014895CONDITION:Generally unsatisfactory with major localised problemsTREND:DecliningRINCIPAL VULNERABILITY:Arable ploughingNEW ENTRY:No	SITE NAME:	Bowl barrow 490 metres south east of Milton Cro	ss, Pembridge	
PRINCIPAL VULNERABILITY:Arable ploughingNEW ENTRY?:NoPRINCIPAL VULNERABILITY:Arable ploughingCONTACT:Jez Bretherton 0121 625 6855SITE NAME:Bowl barrow 550 metres south east of Milton Cross, PembridgeIst ENTRY NUMBER:1014895DESIGNATION:Scheduled MonumentLIST ENTRY NUMBER:1014895CONDITION:Generally unsatisfactory with major localised problemsTREND:DecliningPRINCIPAL VULNERABILITY:Arable ploughingNEW ENTRY?:No	DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1014112
DWNER TYPE:PrivateCONTACT:Jez Bretherton 0121 625 6855SITE NAME:Bowl barrow 550 metres south east of Milton Cross, PembridgeDESIGNATION:Scheduled MonumentLIST ENTRY NUMBER:1014895CONDITION:Generally unsatisfactory with major localised problemsTREND:DecliningPRINCIPAL VULNERABILITY:Arable ploughingNEW ENTRY?:No	CONDITION:		TREND:	Declining
Bowl barrow 550 metres south east of Milton Cross, Pembridge DESIGNATION: Scheduled Monument CONDITION: Generally unsatisfactory with major localised problems DESIGNATION: Arable ploughing NEW ENTRY: No	PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY ?:	No
Designation: Scheduled Monument LIST ENTRY NUMBER: 1014895 condition: Generally unsatisfactory with major localised problems TREND: Declining principal vulnerability: Arable ploughing NEW ENTRY?: No	OWNER TYPE:	Private	CONTACT:	Jez Bretherton 0121 625 6855
CONDITION:Generally unsatisfactory with major localised problemsTREND:DecliningPRINCIPAL VULNERABILITY:Arable ploughingNEW ENTRY?:No	SITE NAME:	Bowl barrow 550 metres south east of Milton Cro	ss, Pembridge	
problems New ENTRY?: No	DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1014895
	CONDITION:		TREND:	Declining
OWNER TYPE: Private CONTACT: Jez Bretherton 0121 625 6855	PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY ?:	No
	OWNER TYPE:	Private	CONTACT:	Jez Bretherton 0121 625 6855

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no А

- Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В
- implemented. C Slow decay; no solution agreed.

 D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

SITE NAME:	North Herefordshire Rowe Ditch, Pembridge / Staunton on Arrow			
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1005382	
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No	
OWNER TYPE:	Private, multiple owners	CONTACT:	Jez Bretherton 0121 625 6855	
SITE NAME:	Castle mound W of Court Farm, Rowlstone			
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1005366	
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Stable	
PRINCIPAL VULNERABILITY:	Deterioration - in need of management	NEW ENTRY?:	No	
OWNER TYPE:	Private	CONTACT:	Jez Bretherton 0121 625 6855	
SITE NAME:	Thruxton Tump, a motte castle at Thruxton Court	t, Thruxton		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1015341	
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Deterioration - in need of management	NEW ENTRY?:	No	
OWNER TYPE:	Private	CONTACT:	Neil Rimmington 07775 550 674	
SITE NAME:	Motte and bailey, west of St Mary's Church, Walte	rstone		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1001778	
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No	
OWNER TYPE:	Private	CONTACT:	Jez Bretherton 0121 625 6855	
SITE NAME:	Roman town of Ariconium, Weston under Penyard	1		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1005364	
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No	
OWNER TYPE:	Private	CONTACT:	Jez Bretherton 0121 625 6855	
SITE NAME:	Kington			
DESIGNATION:	Conservation Area, 124 LBs, SM	NEW ENTRY?:	No	
CONDITION:	Very bad	TREND:	Deteriorating	
VULNERABILITY:	Low	CONTACT:	Herefordshire Council (LPA) 01432 260386	
SITE NAME:	Ross-on-Wye, Bridstow / Ross-on-Wye			
DESIGNATION:	Conservation Area, 153 LBs, 4 SMs	NEW ENTRY?:	No	
CONDITION:	Very bad	TREND:	Deteriorating	
VULNERABILITY:	Medium	CONTACT:	Herefordshire Council (LPA) 01432 260386	

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no А

- Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В
- implemented. C Slow decay; no solution agreed.


 D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

SHROPSHIRE (UA)

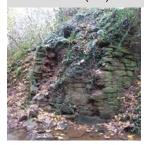

SITE NAME: Abutment of Roman Bridge at Radnor Bridge, Acton Burnell / Pitchford DESIGNATION: Scheduled Monument CONDITION: Very bad OCCUPANCY: N/A PRIORITY CATEGORY: B (B) OWNER TYPE: Private

1006280

Alberbury Castle, Alberbury, Alberbury with Cardeston

Building grade II, CA

1020662 and 1175344

Barn to west of Hall

Farmhouse, Aston Eyre

Listed Building grade II*

48 Mill Street, Bridgnorth

Part occupied/part in use

Listed Building grade II*, CA

Vacant/not in use

Very bad

N/A

A (A)

Private

Poor

F (F)

Fair

E (E)

Private

1177762

Private

1053205

Scheduled Monument and Listed

LIST ENTRY NUMBER:

SITE NAME:

DESIGNATION:

CONDITION:

OCCUPANCY:

OWNER TYPE:

SITE NAME:

DESIGNATION:

CONDITION:

OCCUPANCY:

OWNER TYPE:

SITE NAME:

DESIGNATION:

CONDITION

OCCUPANCY:

OWNER TYPE:

D

Е

PRIORITY CATEGORY:

LIST ENTRY NUMBER:

PRIORITY CATEGORY:

LIST ENTRY NUMBER:

PRIORITY CATEGORY:

LIST ENTRY NUMBER:

The disrupted masonry abutment on the south bank of the Row Brook at Radnor Bridge is all that remains of a former bridge constructed by the Romans. A Management Agreement to compile a repairs specification to quantify and assess repair costs was funded by Historic England in 2020. Tenders to consolidate the masonry structure were obtained in March 2021 but funding to enable the repair works to proceed has yet to be agreed.

The masonry remains of this C13 castle tower keep are

was commissioned by Historic England in 2013 as a basis

rapidly eroding, heavily colonised by ivy and assorted vegetation and undermined by burrowing animals. A survey

for designing a programme of urgent repair works for discussion with the owner. Subsequent discussions with the

Loton Park Estate in 2018 to find a way forward to

consolidate and repair the ruin and make it safe and

Used as a barn for many years, this building is in fact a

medieval hall with a solar wing and dates from the C15.

Consent has been given for conversion back to residential

accessible to the public have stalled.

Contact: John Tiernan 0121 625 6839

use and repair works are ongoing.

Contact: Louisa Moore 0777 043 5511

This three-storey building, c.1675, forms part of

building fronting the road was in poor condition, but extensive re-roofing and external render repairs have been

completed with the benefit of funding from Historic

contained holiday lets on three levels are under

England. Masonry works to the return elevation of the

building range immediately behind the front together with

window and door repairs remain outstanding. Unoccupied for several years, plans to convert the front range into self-

commercial premises used as an antique centre. The oldest

Contact: Tim Allen 07770 610214

© Historic England



SITE NAME: Wattlesborough C (uninhabited parts) with Cardeston		Wattlesborough Castle (uninhabited parts), Alberbury with Cardeston	Remains of a large square tower of the castle, now with a roof. Probably late C13 for Sir Robert Corbet. The wa heads are particularly vulnerable; some blocks of mason
	DESIGNATION:	Scheduled Monument and Listed Building grade I	have fallen from high level. The owner was previously considering consolidation and re-roofing works to facilitate domestic use, but a repair and development scheme has
	CONDITION:	Poor	yet to be put forward.
	OCCUPANCY:	N/A	
22	PRIORITY CATEGORY:	A (A)	
	OWNER TYPE:	Private	
	LIST ENTRY NUMBER:	1006285 and 1366883	Contact: John Tiernan 0121 625 6839

© Historic England Archive



© Historic England



© Historic England



© Historic England

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- Slow decay; no solution agreed. С

Slow decay; solution agreed but not yet implemented.

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use)

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.


NOTE Last year's priority category is shown in brackets (otherwise. New Entry is noted).

Contact: John Tiernan 0121 625 6839

consideration.

- Conservation Area Listed Building
- LB I PA
- Local Planning Authority National Park NP
- RPG
- Registered Park and Garden Scheduled Monument SM
- ΪA Unitary Authority World Heritage Site WHS

and the second	SITE NAME:	Rockley Farmhouse, Chirbury with Brompton	This early C17 farmhouse with C20 alterations is built on an H-shape plan and configured as two floors with an attic:
	DESIGNATION:	Listed Building grade II*	the east wing was originally used for stabling and still contains stalls. Constructed in brickwork with steeply
	CONDITION:	Poor	pitched tiled roofs, the building has an assortment of building fabric and structural defects affecting the external
	OCCUPANCY:	Vacant/not in use	walls, chimneys and roof. Temporary works to address
	PRIORITY CATEGORY:	C (C)	aspects of structural instability were put in place during the summer of 2019 but the long-term sustainable use of the
	OWNER TYPE:	Commercial company	farmhouse and surrounding land by the Lymore Estate is still to be resolved.
England Archive	LIST ENTRY NUMBER:	1054405	Contact: John Tiernan 0121 625 6839
	SITE NAME:	Old Hall and attached garden wall, Old Marton, Ellesmere Rural	Large farmhouse, mid to late CI6 with later additions a alterations. Timber framed with painted brick and rend infill. The owner has repaired the roof, and repairs to t
	DESIGNATION:	Listed Building grade II*	timber frame and infill panels are on-going. The adjoining C18 garden wall, of red brick with moulded stone coping,
	CONDITION:	Poor	has partially collapsed.
	OCCUPANCY:	Vacant/not in use	
	PRIORITY CATEGORY:	F (F)	
The second se			
	OWNER TYPE:	Private	

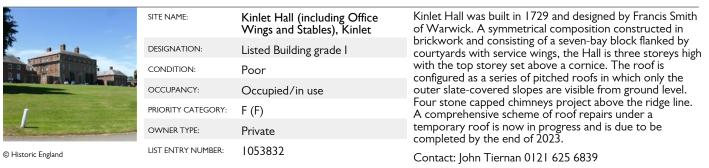

	SITE NAME:	Adcote and adjoining Forecourt Walls, Little Ness	Adcote Hall was designed by Norman Shaw and built in 1876-81 for Mrs Rebecca Darby of the Coalbrookdale
	DESIGNATION:	Listed Building grade I	Ironmasters' family. Regarded as one of the finest houses of Shaw's maturity, it has been a girls' school since 1927. An
	CONDITION:	Poor	asymmetrical composition of ashlar sandstone walls, straight gables, soaring red brick chimney stacks and
	OCCUPANCY:	Occupied/in use	expansive mullion and transom windows, most of the plai
Constantin and	PRIORITY CATEGORY:	C (C)	clay tile roof coverings, lead gutter linings and cast-iron rainwater goods appear to be original and are now in
Constantion of the local division of the loc	OWNER TYPE:	Educational (independent)	urgent need of renewal. Assorted structural defects in several locations also need to be addressed.
	LIST ENTRY NUMBER:	1055113	Contact: John Tiernan 0121 625 6839

© Historic England

© Historic England

© His



Medieval town walls in multiple ownership. Historic SITE NAME. Ludlow town walls, Ludlow England has helped to fund a town walls management plan Scheduled Monument and Listed and the repair of sections of wall in both private and local DESIGNATION Buildings - 8 grade II, 2 CAs authority ownership. Following the collapse of a substantial length of wall below the parish Churchyard in 2013, CONDITION: Very bad Historic England provided advice to the Town Council who are primarily responsible for its repair. The Town Council OCCUPANCY: N/A has appointed a consultant Structural Engineer to carry out PRIORITY CATEGORY: C (C) an options appraisal to inform repair costs and this report was completed in 2022. The Town Council is currently OWNER TYPE: Mixed, multiple owners considering its options. 1006278 and 1219038; Contact: John Tiernan 0121 625 6839 1289747; 1291656; 1202827; 1202825; 1202826; 1219077; LIST ENTRY NUMBER: 1282007

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no

- solution agreed. Immediate risk of further rapid В deterioration or loss of fabric; solution agreed but not yet implemented.
- С Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.

D

Е

use)

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise. New Entry is noted).

- Conservation Area Listed Building
- LB I PA
- Local Planning Authority National Park NP
- Registered Park and Garden Scheduled Monument RPG
- SM
- ΪA Unitary Authority World Heritage Site WHS

	,	,	
	SITE NAME:	Pendover Tower, Ludlow Castle, Ludlow	Ludlow Castle is one of England's finest and best-preserved castles. it played an important role as seat of the president
	DESIGNATION:	Listed Building grade I, SM, CA	of the Council of the Marches and demonstrates significar phases of development between CII and CI6.
	CONDITION:	Poor	Construction began shortly after the Norman Conquest with the inner bailey in which all the components of the
	OCCUPANCY:	Vacant/not in use	early Norman castle survive, including the square mural
	PRIORITY CATEGORY:	C (New entry)	towers. The standing ruin that is the north east Pendover Tower requires assorted structural repairs and general
	OWNER TYPE:	Commercial company	consolidation for which a repair grant application to Historic England is anticipated.
storic England	LIST ENTRY NUMBER:	1291698	Contact: John Tiernan 0121 625 6839


© Hist

© Historic England

© Historic England



	SITE NAME:	Remains of Lea Castle at Lower Lea Farm, Lea, Lydham	This monument consists of fragmentary remains of a C12 castle surviving in the middle of a working farm: it was
	DESIGNATION:	Scheduled Monument and Listed Building grade II, 2 LBs	formerly a castle of the Bishops of Hereford. A Victorian house abuts the castle remains which are heavily overgrown. There is an urgent need to reduce ivy growth
	CONDITION:	Poor	and carry out consolidation works to the standing masc Following encouragement by Historic England to under
	OCCUPANCY:	N/A	vegetation clearance and repair works, a grant application
	PRIORITY CATEGORY:	C (C)	was submitted by the owner in 2018 but subsequently withdrawn for financial reasons. No further progress on
	OWNER TYPE:	Private	repair works has been made to date.
	LIST ENTRY NUMBER:	1021064 and 1054509	Contact: John Tiernan 0121 625 6839

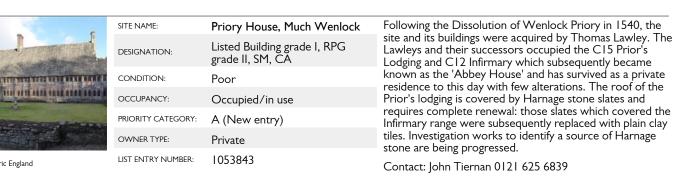

This CI6 timber frame building was originally four bays SITE NAME: Llwyd Mansion, I and 3, Cross long and is thought to have consisted of four separate units, Street, Oswestry the ground and first floors of each bay forming a two-DESIGNATION: Listed Building grade I, CA storey shop with an open solar above. Remodelled as Llwyd Mansion in 1604, it has subsequently been altered on CONDITION: Fair several occasions, including the insertion of a ground floor OCCUPANCY: Vacant/not in use mezzanine: the end bay was truncated when Bailey Street was widened in the late C19. The building was last used as PRIORITY CATEGORY: C (New entry) a shop and is currently vacant. It is in the process of being acquired by Oswestry Town Council, but a new use is still OWNER TYPE: Local authority to be agreed. LIST ENTRY NUMBER: 1054299 © Historic England Contact: Imogen Newcombe 07387 524030 vith at the h ınd en anted ection

© Historic England

			Contact: Imogen Newcombe 07387 324030
-	SITE NAME:	Brogyntyn Hall, Brogyntyn Park, Selattyn and Gobowen	A mainly C18 country house, extended in the C19, wi most of the interior of this date. The property stands
P	DESIGNATION:	Listed Building grade II*, RPG grade II, CA	centre of the grade II registered park and garden with pleasure grounds, a walled garden, lodges, cottages an model farm. Last used as offices the property has beer
	CONDITION:	Poor	vacant for over a decade. Planning permission was gra for an enabling development housing scheme in the
	OCCUPANCY:	Vacant/not in use	grounds to secure the repair of the hall subject to a Se
	PRIORITY CATEGORY:	F (F)	106 agreement. Repairs to the hall are ongoing.
	OWNER TYPE:	Commercial company	
	LIST ENTRY NUMBER:	1367373	Contact: Louisa Moore 0777 043 5511

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed. Immediate risk of further rapid В deterioration or loss of fabric; solution agreed but not yet implemented.
- С Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented. Under repair or in fair to good

D

Е

use)

repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- Conservation Area Listed Building
- LB I PA
- Local Planning Authority National Park NP
- Registered Park and Garden Scheduled Monument RPG
- SM ΪA
- Unitary Authority World Heritage Site WHS

	HERITAGE AT RISK	2023 / MIDLANDS	/ SHROPSHIRE	(UA)
--	------------------	-----------------	--------------	------

HERITAGE AT RISK 2023 / MIDLAI	NDS / SHROPSHIRE (UA	A)	
	SITE NAME:	Ditherington Flax Mill: Cross Building, Shrewsbury	Originally built in c.1799, the cross building was rebuilt in c.1812 after a fire. The cast iron frame represents the rapid
XUS	DESIGNATION:	Listed Building grade I, CA	development of the use of this material for fire-proofing in the first decade of the 19th century. Outline planning
	CONDITION:	Poor	approval was secured for the whole site in 2010, renewed in 2020 Funding has been secured for the repair of the
	OCCUPANCY:	Vacant/not in use	spinning mill. This building will be repaired in a later phase
in the second	PRIORITY CATEGORY:	B (B)	of the works.
	OWNER TYPE:	Government or agency	
© Historic England	LIST ENTRY NUMBER:	1428700	Contact: Louisa Moore 0777 043 5511
•	SITE NAME:	Ditherington Flax Mill: Flax Warehouse, Shrewsbury	Built c.1810 as part of the mill's expansion; the cast iron frame represents the rapid development of the use of this
	DESIGNATION:	Listed Building grade I, CA	material in the first decade of the C19. Outline planning approval was secured for the whole site in 2010, renewed
	CONDITION:	Poor	2020. Funding has been secured for the main spinning mill and the grade II listed malt kiln which adjoins this building.
	OCCUPANCY:	Vacant/not in use	The warehouse will be repaired in a later phase.
	PRIORITY CATEGORY:	B (B)	
	OWNER TYPE:	Government or agency	
© Historic England	LIST ENTRY NUMBER:	42873	Contact: Louisa Moore 0777 043 5511
	SITE NAME:	Ditherington Flax Mill: Apprentice House, Shrewsbury	Former apprentice house for the Flax Mill c.1812, now mothballed. Historic England is working in partnership with
	DESIGNATION:	Listed Building grade II*, CA	the local authority. Outline planning approval was secured for the whole site in 2010, renewed 2020. Work has
	CONDITION:	Poor	commenced on the main spinning mill, and this building will be part of a later phase.
	OCCUPANCY:	Vacant/not in use	be part of a later phase.
ALTIN	PRIORITY CATEGORY:	D (D)	
	OWNER TYPE:	Government or agency	
© Historic England	LIST ENTRY NUMBER:	1254855	Contact: Louisa Moore 0777 043 5511
	SITE NAME:	Ditherington Flax Mill: Stove House and Dye House, Shrewsbury	Former drying stove house and dye house of the flax in Outline planning approval was secured for the whole 2010, renewed in 2020, Funding has been secured and provide of the provide secure and the build
	DESIGNATION:	Listed Building grade II*, CA	repair of the main spinning mill is underway. This building has been repaired to allow for a small Historic England
ALL ALL	CONDITION:	Poor	office. The main space has been cleared of later interventions to allow it be used for events, but the roof is
	OCCUPANCY:	Part occupied/part in use	still in need of major repair.
	PRIORITY CATEGORY:	B (B)	
	OWNER TYPE:	Government or agency	
© Historic England	LIST ENTRY NUMBER:	1270566	Contact: Louisa Moore 0777 043 5511
	SITE NAME:	Hargreaves Farmhouse, Winnington, Westbury	Timber framed farmhouse dating from early C17 with C19 additions including a stone extension. The property has
	DESIGNATION:	Listed Building grade II*	been unoccupied for over 20 years and is very dilapidated. The roof has holes, many infill panels are missing and parts
	CONDITION:	Very bad	of the frame have collapsed. The erection of scaffolding and a temporary roof is providing limited support and
	OCCUPANCY:	Vacant/not in use	protection.
	PRIORITY CATEGORY:	C (C)	
	OWNER TYPE:	Private	
© Historic England	LIST ENTRY NUMBER:	1055173	Contact: Louisa Moore 0777 043 5511

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed.
 C Slow decay; no solution agreed.

 D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument



© Historic England


	SITE NAME:	Hawkstone Windmill, Hawkstone Park, Weston- under-Redcastle	Late C18 windmill located just outside the registered park and garden at Hawkstone Hall which was designed by William Emes in the mid-C18. The windmill sits above the
	DESIGNATION:	Listed Building grade II*	Hawk Lake in the part of the park which is now a golf course and benefits from extensive views. The building is
	CONDITION:	Very bad	no longer secure, and is deteriorating under a temporary roof erected in 1994. All internal machinery and floor structure has largely and recently collapsed with the
	OCCUPANCY:	Vacant/not in use	
	PRIORITY CATEGORY:	C (C)	exception of principal floor beams, curb ring, windshaft and brakewheel.
	OWNER TYPE:	Commercial company	
	LIST ENTRY NUMBER:	1264219	Contact: Jez Bretherton 0121 625 6855



© Historic England Archive

	SITE NAME:	Red Castle, Hawkstone Park, Weston-under-Redcastle	The standing remains of a C12/C13 medieval castle in a largely restored C18 landscape. Recent research suggests
	DESIGNATION:	Scheduled Monument and Listed Buildings - 2 grade II, RPG grade I	that the remains were significantly adapted as part of the designed landscape which includes the adjacent Hawkstone Follies. The masonry is in vulnerable condition and deteriorating. Invasive vegetation needs to be brought
	CONDITION:	Poor	under control. A management plan for the site has been completed with recommendations.
	OCCUPANCY:	N/A	completed with economic nearbors.
	PRIORITY CATEGORY:	B (B)	
	OWNER TYPE:	Commercial company	
	LIST ENTRY NUMBER:	1020850 and 1237180; 1264271	Contact: Jez Bretherton 0121 625 6855



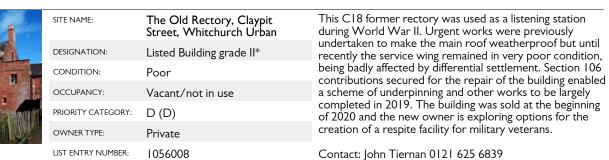

© Historic England

© Historic England

A fortified manor house complex dating from 1677 set SITE NAME: Range Approximately 20 metres south east of Castle Farmhouse, around a courtyard. The east and north wing are in partial low-key agricultural use and are at risk as the roof covering Wistanstow fails, allowing water to rot structural timbers, and loosen DESIGNATION: Listed Building grade II*, SM, CA structural stonework. Long term plans for a mixed use conversion to holiday accommodation and heritage CONDITION: Very bad interpretation have not yet been implemented. OCCUPANCY: Part occupied/part in use PRIORITY CATEGORY: D (D) OWNER TYPE: Private LIST ENTRY NUMBER 1269775 Contact: Jez Bretherton 0121 625 6855

	SITE NAME:	Snailbeach New Smeltmill, Worthen with Shelve	The monument comprises a smelt mill and slag mill built in 1862 for the Snailbeach Mining Company. The slag mill has
	DESIGNATION:	Scheduled Monument and Listed Buildings - 2 grade II	been stabilised but standing remains of the smelt mill furnaces are in very poor condition due to invasive uncontrolled vegetation. Historic England has completed archaeological survey to record the earthworks and ruine smelters at the site. Further vegetation clearance and
	CONDITION:	Very bad	
	OCCUPANCY:	N/A	emergency repairs are needed to secure this important
	PRIORITY CATEGORY:	A (A)	lead smelting complex.
	OWNER TYPE:	Private	
	LIST ENTRY NUMBER:	1017764 and 1307989; 1055031	Contact: Imogen Newcombe 07387 524030

PRIORITY CATEGORIES

© Historic England

- Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed. Immediate risk of further rapid В deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented. Under repair or in fair to good

D

Е

repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use)

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- Conservation Area Listed Building LB
- I PA
- Local Planning Authority National Park NP
- RPG Registered Park and Garden Scheduled Monument
- SM ÍΙΑ
- Unitary Authority World Heritage Site WHS



© Historic England

© Historic England

X	SITE NAME:	Candle House, Snailbeach Lead Mine, Worthen with Shelve	This building is part of the scheduled site of the Snailbeach Lead Mine and was where miners collected their candles
	DESIGNATION:	Scheduled Monument and Listed Buildings - 10 grade II, LB grade II, part in CA	before going underground. It dates from the early C19 and is constructed from coursed rubble with brick dressings under the remains of a Welsh slate roof. The walls are substantially intact, but the roof has collapsed and the
	CONDITION:	Very bad	building is derelict.
	OCCUPANCY:	Vacant/not in use	
	PRIORITY CATEGORY:	A (A)	
	OWNER TYPE:	Private	
	LIST ENTRY NUMBER:	1014866 and 1261135; 1055011; 1055012; 1176609; 1176636; 1176648; 1176660; 1366969; 1367007; 1055013	Contact: Imogen Newcombe 07387 524030



		THRACE	
	LIST ENTRY NUMBER:	1014866 and 1261135; 1055011; 1055012; 1176609; 1176636; 1176648; 1176660; 1366969; 1367007; 1055013	Contact: Imogen Newcombe 07387 524030
	SITE NAME:	Church of St Michael, Alberbury with Cardeston	The original C12 church was replaced by the existing nave and chancel built in 1749. The semi-detached west tower
	DESIGNATION:	Listed Place of Worship grade II	was added in 1844. Restored in 1905 by AE Lloyd Oswell, the church is built of uncoursed Alberbury breccia with
	CONDITION:	Poor	sandstone ashlar dressings and roofs mostly covered by plain clay tiles. The slate covering to the tower roof has
	PRIORITY CATEGORY:	D (D)	failed and needs to be re-laid. The parapet gutter also
	OWNER TYPE:	Religious organisation	requires complete renewal, the decorative weathervane overhauling and access up and onto the tower parapet
	LIST ENTRY NUMBER:	1055215	gutter improved. Fundraising to address these repairs is currently in progress.
			Contact: John Tiernan 0121 625 6839
	SITE NAME:	Church of St Giles, Barrow	St Giles is one of the most complete surviving early
	DESIGNATION:	Listed Place of Worship grade I	churches in the county and consists of a CII nave and chancel and CI2 west tower with a CI8 top stage: the late
	CONDITION:	Poor	C19 north side chapel replaced a C17 earlier addition and the south porch was added C18. Restored by GE Street, it
and the second s	PRIORITY CATEGORY:	D (D)	has steeply pitched plain clay tile roof coverings and
	OWNER TYPE:	Religious organisation	replacement plastic rainwater goods: significant areas of primary masonry survive intact, Repairs to roof coverings
	LIST ENTRY NUMBER:	1367837	were carried out in 2022 but ineffective surface water drainage and raised ground levels continue to exacerbate damp conditions inside the church
			Contact: John Tiernan 0121 625 6839
	SITE NAME:	Church of St Mary, Bedstone	The CI2 church of St Mary consists of a nave with a lower
E	DESIGNATION:	Listed Place of Worship grade II*, CA	chancel, a C17 west end timber framed bell-cote and a C19 shingled broached spire. The original chancel arch and two windows survived the restoration in 1878 - 9 by F R
	CONDITION:	Poor	Kempson who grouped the nave windows together. The spire was re-shingled in 1996 but is now in need of urgent
	PRIORITY CATEGORY:	C (C)	repair as is the bell-cote timber framing and infill panels
	OWNER TYPE:	Religious organisation	below. Moisture levels within external walls requires the reduction of adjacent ground levels, the replacement of
	LIST ENTRY NUMBER:	1055017	impervious re-pointing and the installation of a perimeter surface water drainage system.
			Contact: John Tiernan 0121 625 6839

© Historic England

© Historic England

Church of St Margaret, SITE NAME: Berrington DESIGNATION: Listed Place of Worship grade II CONDITION: Poor PRIORITY CATEGORY: C (New entry) OWNER TYPE: Religious organisation LIST ENTRY NUMBER: 1055547

This church is located within the grounds of Betton Strange Hall and surrounded by woodland. It was designed by Richard Dodson and built in 1857 - 8. It consists of a nave with a north porch and a lower chancel: the west end bellcote has been removed leaving only the base intact. The walls are constructed in coursed red ashlar with buff sandstone dressings and steeply pitched roofs covered by plain clay tiles. Notwithstanding unchecked vegetation and tree growth, the church is in reasonable condition. It is in the process of being closed but rights of access to it have still to be clarified.

Contact: John Tiernan 0121 625 6839

PRIORITY CATEGORIES

© Historic England

- Immediate risk of further rapid deterioration or loss of fabric; no А
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; В solution agreed but not yet implemented.
- С Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.

D

Е

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use)

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

Last year's priority category is shown in brackets (otherwise, New Entry is noted).

NOTE

- Conservation Area Listed Building CA LB
- LPA
- Local Planning Authority National Park NP
- RPG Registered Park and Garden Scheduled Monument
- SM
- UA Unitary Authority WHS World Heritage Site

	SITE NAME:	Church of St Mary, Bitterley	This late C13 church consists of a nave, chancel and west
	DESIGNATION:	Listed Place of Worship grade II*	tower. It was restored by Thomas Nicholson between 1880 and 1888 who added the south side timber porch,
	CONDITION:	Poor	the timber framed top stage to the tower and its short broad shingled spire. All the tile coverings to the nave,
	PRIORITY CATEGORY:	C (C)	chancel and porch roofs together with the cast iron
	OWNER TYPE:	Religious organisation	rainwater goods are failing and require renewal. The surface water drainage system is largely ineffective and
	LIST ENTRY NUMBER:	1383652	needs to be replaced. Limited high-level masonry repairs are also required. Work to re-shingle the tower spire was
			are also required. Work to re-similigie the tower spire was

© Historic England



	SITE NAME:	Church of St Mary, Cleeton St Mary, Bitterley	This church was built in 1876-8 and designed by Thomas Nicholson. It consists of a chancel with a lean-to north
	DESIGNATION:	Listed Place of Worship grade II	vestry and a nave with a tower built into its west end. Recent repairs to the chancel roof have confirmed that the
	CONDITION:	Poor	original tile batten fixings are failing and require renewal: other roofs are of the same date so must be considered
	PRIORITY CATEGORY:	D (C)	equally suspect. Rainwater goods and the surface water
N. I.	OWNER TYPE:	Religious organisation	drainage system also require overhauling. A grant was awarded by the Shropshire historic churches Trust in 2022
	LIST ENTRY NUMBER:	1383665	for the preparation of a re-roofing specification and this project work is now in hand.

completed at the end of 2020.

Contact: John Tiernan 0121 625 6839

© Historic England



SITE NAME:

DESIGNATION:

CONDITION:

OWNER TYPE:

SITE NAME:

DESIGNATION:

CONDITION:

OWNER TYPE:

D

Е

PRIORITY CATEGORY:

LIST ENTRY NUMBER:

PRIORITY CATEGORY:

LIST ENTRY NUMBER:

Church of Holy Trinity,

Religious organisation

Listed Place of Worship grade II

Church of St George, Church

Listed Place of Worship grade

Religious organisation

Buildwas

Poor

D (C)

1366860

Street, Clun

II*, CA

Poor

D (D)

1367257

© Historic England

© Historic England

© Historic England

-	LIST ENTRY NUMBER:	1383665	project work is now in hand.	
			Contact: John Tiernan 0121 625 6839	
	SITE NAME:	Parish Church (dedication unknown), Boraston	This CI2 church was mostly rebuilt between 1884-7 by Henry Curzon at the expense of Lord Northwick of	
-	DESIGNATION:	Listed Place of Worship grade II, CA	Burford House. Built as a chapel of Burford, it has a nave with a west tower and shingled spire, a south porch and an apsidal chancel with north side vestry. Differential	
N.	CONDITION:	Poor	settlement has occurred at the east end of the church and is thought to have been exacerbated by defective surface	
	PRIORITY CATEGORY:	D (D)	water drainage. The chancel and vestry tiled roof coverings	
	OWNER TYPE:	Religious organisation	have been patch repaired but the oak shingles to the spire require complete renewal. A new surface water drainage	
ida)	LIST ENTRY NUMBER:	1383416	system was installed in 2020.	
			Contact: John Tiernan 0121 625 6839	

This C18 church replaced a medieval one and consists of a nave and chancel with a north side vestry, a west end timber framed bell-cote and a south porch: the porch arch is formed of reused C13 mouldings above which a cast iron plate records its rebuilding as 1720. The walls of the church are constructed in squared sandstone blocks and roofs are covered in plain clay tiles. The bell-cote timber framing is original but the C20 render covering is no longer weatherproof and is effectively life-expired: wall frame timbers require assorted carpentry repairs and infill panels complete renewal.

Contact: John Tiernan 0121 625 6839

The C12 church of St George consists of a nave with same height chancel, north and south aisles, a north porch and a west tower of several stages. The body of the church sustained damage during the Civil War and was virtually reconstructed by GE Street in 1877. Roofs re-laid at that time are now failing and recently sustained storm damage has exacerbated conditions. The south aisle slate roof was stripped and re-laid in 2017 and the stone slate porch roof similarly overhauled in 2020 but plans and a timescale to deal with the nave, chancel and north aisle roof coverings are still to be agreed.

Contact: John Tiernan 0121 625 6839

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no

- solution agreed. Immediate risk of further rapid В deterioration or loss of fabric; solution agreed but not yet implemented.
- С Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use)

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- Conservation Area Listed Building
- LB I PA
- Local Planning Authority National Park NP
- RPG Registered Park and Garden Scheduled Monument
- SM
- UA Unitary Authority World Heritage Site WHS

	SITE NAME:	Church of St Edward, Dorrington, Condover	This church was designed by Edward Haycock for John Thomas Hope of Netley Hall and built in 1845. It consists
Lam 1	DESIGNATION:	Listed Place of Worship grade II	of a nave with a west tower with spirelet, short transepts for family pews and a short chancel with flanking vestries.
	CONDITION:	Poor	Walls are constructed in tooled ashlar and steeply pitched roofs covered in plain clay tiles. The condition of the tower
三丁二小家家	PRIORITY CATEGORY:	C (C)	parapet is poor as both finials to the east facing corner
And The Part	OWNER TYPE:	Religious organisation	pinnacles have been taken down and both corners secured back to the steeple with wire ties. Tower parapet access
	LIST ENTRY NUMBER:	1366638	needs to be improved and all cast iron rainwater goods overhauled.
			Over nauleu.

Contact: John Tiernan 0121 625 6839

This church has a C13 unbuttressed west tower with a SITE NAME: Church of St Peter, Coreley later shingled broach spire. Both the nave and lower DESIGNATION: Listed Place of Worship grade II* chancel were rebuilt in CI8 in brickwork on the former medieval footprint. Roofs are steeply pitched with plain CONDITION Poor clay tiles which appear to be almost at the end of their life, PRIORITY CATEGORY: C (C) along with most of the rainwater goods. Ineffective drainage and/or roof leaks are responsible for the OWNER TYPE: Religious organisation deteriorating condition of the vestry plasterwork. Stone repairs are also required to the chancel east window. LIST ENTRY NUMBER: 1383711 Contact: John Tiernan 0121 625 6839

© Historic England

© Historic England

	SITE NAME:	Church of St Giles, Farlow	The church of St Giles was built in 1857-8 and consists of a
	DESIGNATION:	Listed Place of Worship grade II	nave with a west end bell-cote and a south side porch and a lower chancel with a north side vestry. Except for the
	CONDITION:	Poor	south side of the nave, all other roof slopes are failing, underlying plaster infill ceiling panels to the exposed roof
	PRIORITY CATEGORY:	D (E)	structures are also known to be unstable. Rainwater goods
	OWNER TYPE:	Religious organisation	require increased capacity together with a new surface water drainage system. Works to re-lay the north slope of
-	LIST ENTRY NUMBER:	8865	the nave roof together with assorted improvements to the rainwater goods are planned to be completed by the end
and the second second			of 2023.

© Historic England

100

Contact: John Tiernan 0121 625 6839 SITE NAME: The CI5 church of St John the Baptist consists of a nave Church of St John the Baptist, with a west tower and a south porch, a north aisle and a Church Street, Ightfield chancel. Designed in Perpendicular Gothic with crenellated DESIGNATION: Listed Place of Worship grade II* parapets, multi-stepped buttresses and decorative finials, it is constructed in grey ashlar stone and has steeply pitched CONDITION: Poor roofs covered in plain clay tiles. The tower roof coverings PRIORITY CATEGORY: C (C) and parapet gutter linings require complete renewal. High level masonry repairs to the tower are also needed OWNER TYPE: Religious organisation together with a new surface water drainage system. The congregation are investigating sources of grant funding to 1366502 LIST ENTRY NUMBER: carry out repairs.

© Historic England



SITE NAME:	Church of St Michael and All Angels, Lydbury North, Lydbury North	This C12 cruciform Church has a long nave with a slightly lower chancel, a consolidated west tower, a timber framed south porch and rebuilt transepts known as the Plowden
DESIGNATION:	Listed Place of Worship grade I, CA	Chapel (N) and the Walcot chapel (S). It was sensitively restored by JT Micklethwaite in 1901-2 and 1908. The walls are constructed in coursed rubble with red sandstone
CONDITION:	Poor	dressings: both nave and chancel walls are rendered. The roofs are mostly covered in sandstone flags laid in
PRIORITY CATEGORY:	C (New entry)	diminishing courses: those to the nave and chancel date
OWNER TYPE:	Religious organisation	from the last phase of restoration work and now require stripping and relaying again.
LIST ENTRY NUMBER:	1054540	Contact: John Tiernan 0121 625 6839

© Historic England

PR	r c	ATEG	ORIES	
	ю		C C	

- Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed. Immediate risk of further rapid В deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.

D

Е

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use)

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

Contact: John Tiernan 0121 625 6839

ABBREVIATIONS

- Conservation Area Listed Building CA
- LB I PA
- Local Planning Authority National Park NP
- RPG Registered Park and Garden Scheduled Monument
- SM ΪA

Unitary Authority World Heritage Site WHS

CONDITION

OWNER TYPE:

SITE NAME

CONDITION:

OWNER TYPE:

SITE NAME:

DESIGNATION:

CONDITION:

OWNER TYPE:

D

Е

PRIORITY CATEGORY:

LIST ENTRY NUMBER:

PRIORITY CATEGORY:

LIST ENTRY NUMBER:

PRIORITY CATEGORY:

LIST ENTRY NUMBER:

Poor

C (C)

Poor

C (C)

Poor

C (C)

1053743

1054466

Religious organisation

1383354

Religious organisation

Church of St John the Baptist,

		·)	
	SITE NAME:	Church of the Holy Trinity, Minsterley	Built as a chapel of Westbury between 1688-9, the church consists of a nave and chancel in one with a west end bell-
K ZA	DESIGNATION:	Listed Place of Worship grade II*	cote and a south porch. The use of classical and baroque elements, the extensive use of brickwork, raking buttresses
	CONDITION:	Fair	without offsets and a steeply pitched tiled roof, creates an unusual composition. A reduced scheme of repairs funded
The A CLE	PRIORITY CATEGORY:	D (D)	by the National Lottery Heritage Fund Grant for Places of
	OWNER TYPE:	Religious organisation	Worship was completed in 2020 but concealed defects necessitated the omission of assorted urgent high-level
See Market	LIST ENTRY NUMBER:	1055228	masonry repairs and the installation of a new surface water drainage system.
© Historic England			Contact: John Tiernan 0121 625 6839
	SITE NAME:	Broadstone Chapel, Broadstone, Munslow	Set within a walled enclosure within open pasture, this C17 single cell former agricultural building with bi-annual church
Thomas .	DESIGNATION:	Listed Place of Worship grade II	services was re-purposed as a chapel of ease to Munslow in 1843 when the west bell-cote, lancet windows and
A POINT			an a

© Historic England

	-		2
À.			1
			nt
Am	111	T	
	10		Ka

© Historic England

© Historic England

© Historic England

		Nash	continuous roof, a west tower and a south porch. Built as a
	DESIGNATION:	Listed Place of Worship grade II*	chapel of ease to St Mary Burford, it was given a broached spire in the C14 and a north aisle in 1865: the nave roof
	CONDITION:	Poor	structure also dates from C19. The plaster infill ceiling panels to the nave and north aisle roofs have become
	PRIORITY CATEGORY:	D (C)	unstable with age and require renewal. The spire timber
	OWNER TYPE:	Religious organisation	cladding also needs to be overhauled. Emergency masonry repairs to the east gable were carried out in 2018. A
	LIST ENTRY NUMBER:	1383565	scheme to address repairs to the spire cladding is in the process of being developed.
			Contact: John Tiernan 0121 625 6839
	SITE NAME:	Church of St John, Church Road, Newcastle on Clun	This church was designed by Edward Haycock in 1846 and completed in 1848. It consists of a wide nave with a west
	DESIGNATION:	Listed Place of Worship grade II	end bell-cote, a south porch, north vestry and a short low chancel. Walls are constructed in coursed rubble siltstone
			منه من

stry and a short low sed rubble siltstone and steeply pitched roofs covered with Welsh slate laid in equal courses. Failure of slate fixings is an on-going issue and roofs require stripping and re-laying. Defective rainwater goods also need to be overhauled together with selective repointing of areas of high-level masonry. Removal of a defective water cistern adjacent to the north wall has been undertaken

entrance were inserted. Built of rubble siltstone with

This CI3 church has a nave and chancel under one

urgently required.

Contact: John Tiernan 0121 625 6839

dressed stone to openings and a pitched roof covered by plain clay tiles, cracks to the east wall corners indicates de-

bonding of the masonry core which needs urgent attention.

Assorted repairs to the roof coverings, cast iron rainwater goods and the surface water drainage system are also

Contact: John Tiernan 0121 625 6839

This church has CI2 origins but was heavily restored in Church of St Chad, Stockton 1858-8 at the expense of TC Whitmore of Apley Park. The Listed Place of Worship grade II* church has a nave with a west end tower, short transepts and a chancel with a north side vestry. The tower, transepts and nave roofs and associated parapet gutters urgently require renewal of surface coverings and linings. Assorted masonry repairs and repointing to both tower Religious organisation and nave walls are also required together with modifications to the surface water drainage system to control and manage water discharged from high level gargoyles and chutes.

Contact: John Tiernan 0121 625 6839

PRIORITY	CATEGORIES
----------	------------

- Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- С Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.
- Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use)

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise. New Entry is noted).

ABBREVIATIONS

- Conservation Area Listed Building
- LB I PA
- Local Planning Authority National Park NP
- RPG
- Registered Park and Garden Scheduled Monument SM
- ΪA Unitary Authority World Heritage Site WHS

1. A.	SITE NAME:	Church of St Michael, Silvington, Wheathill	This church consists of a short C12 nave with an asymmetrical west tower of similar date aligned with the
and the second	DESIGNATION:	Listed Place of Worship grade II*	north wall, a C14 chancel and a C16 porch. Walls are constructed in coursed and squared rubble reflecting the
	CONDITION:	Poor	local geology and roofs are steeply pitched and covered with red plain clay tiles. The nave north wall has raking
	PRIORITY CATEGORY:	A (A)	buttresses installed in C19 to address structural
3	OWNER TYPE:	Religious organisation	deficiencies. Extensive cracking to both nave and tower walls suggests inadequate bonding of the external facework
	LIST ENTRY NUMBER:	1383760	and the presence of voids in the core of the walls. The extent and scope of repairs has yet to be agreed.
			exterit and scope of repairs has yet to be agreed.

© Historic England



A	SITE NAME:	Loughton Parish Church, Wheathill	This church was built in 1622 at the expense of Bonham Norton of Church Stretton to replace a C13 chapel.
	DESIGNATION:	Listed Place of Worship grade II	Constructed in rubble stone with steeply pitched roofs covered by plain clay tiles, it consists of a nave with a west
	CONDITION:	Poor	bell-cote and a lower chancel. It was subsequently restored in 1904 when the south porch and north vestry were
	PRIORITY CATEGORY:	C (C)	added. This was possibly the last occasion when all the roof
	OWNER TYPE:	Religious organisation	coverings were re-laid and accounts for their poor condition. Rainwater goods are also failing and a new
	LIST ENTRY NUMBER:	1383759	modified surface water drainage system is urgently required.

© Historic England



DESIGNATION:

CONDITION:

OWNER TYPE:

PRIORITY CATEGORY:

LIST ENTRY NUMBER:

© Historic England

	SITE NAME:	Church of St John the Baptist, Boot Street, Whittington	The earliest part of this red brick church is the west tower built in 1747: the neoclassical nave was designed by
	DESIGNATION:	Listed Place of Worship grade II, CA	Thomas Harrison and built in 1805-6 and the pyramid roof added to the tower in 1894. The Early English chancel with south organ chamber and north chapel was added in 1861.
	CONDITION:	Poor	Partial re-roofing of the north slope of the nave roof in 2017 has eliminated water ingress but all the cast iron
	PRIORITY CATEGORY:	C (C)	rainwater goods are defective and require renewal. The
	OWNER TYPE:	Religious organisation	surface water drainage system is also ineffective and complete renewal is anticipated. The Congregation are
	LIST ENTRY NUMBER:	1367372	reviewing sources of grant funding.
			Contact: John Tiernan 0121 625 6839
	SITE NAME:	Church of All Saints, Worthen with Shelve	This small church set below the Stiperstones was built in 1839-40 to the designs of the rector, the Revd TF More

was built in d TF More under John Carline's supervision. It consists of a nave and chancel in one with a narrow west tower. The walls are constructed in coursed rubble stone and roofs covered by plain clay tiles. All the cast iron rainwater goods require overhauling as does the surface water drainage system. Following minor roof repairs carried out in 2021, the poor condition of the tile battens uncovered suggests that reroofing of the nave/chancel roof should be anticipated in the near future.

© Historic England

Contact: John Tiernan 0121 625 6839

Contact: John Tiernan 0121 625 6839

Contact: John Tiernan 0121 625 6839

SITE NAME:	Medieval fishpond reservoir north east of Haughmo	ond Abbey and sou	th west of the hamlet of Haughton
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002953
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Animal burrowing - extensive	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Jez Bretherton 0121 625 6855
SITE NAME:			
SITE MAINE:	Little Shrawardine motte and bailey castle, Alberbu	ry with Cardeston	
DESIGNATION:	Little Shrawardine motte and bailey castle, Alberbu Scheduled Monument	LIST ENTRY NUMBER:	1019198
		,	
DESIGNATION:	Scheduled Monument Generally unsatisfactory with major localised	LIST ENTRY NUMBER:	1019198

Listed Place of Worship grade II

Religious organisation

Poor

D (D)

1055026

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no А

D

Е

solution agreed. Immediate risk of further rapid deterioration or loss of fabric; В solution agreed but not yet implemented.

C Slow decay; no solution agreed.

Slow decay; solution agreed but F not yet implemented.

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA LB

LPA

- Conservation Area Listed Building Local Planning Authority National Park NP RPG
 - Registered Park and Garden Scheduled Monument
- SM

UA Unitary Authority WHS World Heritage Site

SITE NAME:	Ringwork 540 metres north of Lane Farm, Alberbu	iry with Cardeston	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1019831
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable clipping	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Jez Bretherton 0121 625 6855
SITE NAME:	Stanwardine moated site and associated fishpond, I	Baschurch	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1017240
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Jez Bretherton 0121 625 6855
SITE NAME:	Lower Cleeton moat, a moat and fishponds 380 m	etres south east of	Cleeton Court, Bitterley
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1010496
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Jez Bretherton 0121 625 6855
SITE NAME:	White Ladies (St Leonard's) Priory, Boscobel		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1015290
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Vandalism	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Harriet Halliday
SITE NAME:	Castle Tump, a motte castle and causeway, 150 me	etres west of Teme	Bridge, Burford
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1008392
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Stock erosion - extensive	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Jez Bretherton 0121 625 6855
SITE NAME:	Motte and bailey castle 150 metres north east of V	Vilmington, Chirbu	ry with Brompton
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1012864
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Animal burrowing - extensive	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Jez Bretherton 0121 625 6855
SITE NAME:	Motte castle 400m north east of Upper Gwarthlov	v Farm, Chirbury w	vith Brompton
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1013500
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Deterioration - in need of management	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Jez Bretherton 0121 625 6855

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no А

- Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В
- implemented. C Slow decay; no solution agreed.

 D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user lidentified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site

 - Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

SITE NAME:	Offa's Dyke: section 2/3 mile (1170 metres) long, with Brompton	north from souther	n boundary of Rownal Covert, Chirbur
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1003013
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Other not for profit group	CONTACT:	Harriet Halliday
SITE NAME:	Motte castle 80 metres north east of Home Farm	n, Church Stretton	
DESIGNATION:	Scheduled Monument, CA	LIST ENTRY NUMBER:	1008396
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Jez Bretherton 0121 625 6855
SITE NAME:	Offa's Dyke: section 730m south east of The Yew	/ Tree, Clun / Newca	astle on Clun
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1020900
CONDITION:	Generally satisfactory but with minor localised problems	TREND:	Improving
PRINCIPAL VULNERABILITY:	Other	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Harriet Halliday
ITE NAME:	Norton Camp: a large multivallate hillfort, Craver	n Arms / Culmington	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1021073
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Animal burrowing - extensive	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Jez Bretherton 0121 625 6855
ITE NAME:	The Mount motte and bailey castle, 120 metres n	orth east of Hill Hou	use Farm, Diddlebury
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1012856
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Animal burrowing - extensive	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Jez Bretherton 0121 625 6855
ITE NAME:	Offa's Dyke: section 400m north and 170m east o	of Selley Hall, Llanfair	• Waterdine
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1020904
CONDITION:	Generally satisfactory but with minor localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Harriet Halliday
ITE NAME:	Offa's Dyke: section 400 metres south west of Sp Clun	oringhill Farm, Llanfai	r Waterdine / Newcastle on Clun /
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1020901
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Stock erosion - extensive	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners	CONTACT:	Harriet Halliday
	· · · · · · · · · · · · · · · · · · ·		,

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no А

Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В

implemented. C Slow decay; no solution agreed.

 D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user lidentified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

SITE NAME:	St Julian's Well: a holy well in the middle of Livesey Road, Ludlow	Road, 155m south	n west of the junction with Sandpits
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1020656
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY ?:	No
OWNER TYPE:	Local authority	CONTACT:	Imogen Newcombe 07387 524030
SITE NAME:	Offa's Dyke: section 1600yds (1460m) long, N from	n St John the Baptis	st's Church to River Unk, Mainstone
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1003246
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Improving
PRINCIPAL VULNERABILITY:	Stock erosion - localised/limited	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Harriet Halliday
SITE NAME:	Nickless moat, Milson		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1009552
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Deterioration - in need of management	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners	CONTACT:	Jez Bretherton 0121 625 6855
ITE NAME:	Callow Hill Camp: a small multivallate hillfort, Mins	terley	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1019828
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Vandalism	NEW ENTRY ?:	No
OWNER TYPE:	Government or agency	CONTACT:	Jez Bretherton 0121 625 6855
SITE NAME:	Offa's Dyke: section one mile 750 yards (2290 met metres) north of Lack Brook - Also in Powys: Wal		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1003797
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Deterioration - in need of management	NEW ENTRY ?:	No
OWNER TYPE:	Private	CONTACT:	Harriet Halliday
SITE NAME:	Roman villa at Linley Hall, More		
DESIGNATION:	Scheduled Monument, part in RPG grade II	LIST ENTRY NUMBER:	1006253
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Jez Bretherton 0121 625 6855
SITE NAME:	Small enclosed settlement on Fron, 340 metres we	est of St John's Chu	rch, Newcastle on Clun
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1021069
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners	CONTACT:	Jez Bretherton 0121 625 6855

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no А

Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В

implemented. C Slow decay; no solution agreed.

 D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user lidentified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

PrinterScheduled MonumentINTERPRIVATE1006/260ConstranceGenerally satisfactory but with minor localised manonemeno.DecliningMIRICIPEL WARKMONTScrub / Cree growthMCV 071101NMIRICIPEL WARKMONTScrub / Cree growthMCV 071101Marrie HalldayStatus / Cree growthScrub / Cree growthMCV 071101Harrie HalldayStatus / Cree growthScrub / Cree growthMCV 071101MCV 07101Status / Cree growthScrub / Cree growthMCV 071101MCV 071101Status / Cree growthScrub / Cree growthMC	SITE NAME:	Offa's Dyke: section 200yds (180m) long, S of Th	e Royal Oak Inn, Osv	westry Rural
problemsproblemsproblemsproblemsNoticeDeclaring problemsBIRMORAL WURDRAUTYScrub / tree growthNOVNOVNoBIRMORAL WURDRAUTYScrub / tree growthCOM / SHarret HalldayBIRMORAL WURDRAUTYScheduled Monumentutro trivin Namece1004767BEISONAL WURDRAUTYScheduled Monumentutro trivin NameceNoColumonaGenerally satisfactory but with minor localised problemsmtbb:StableBEISONAL WURDRAUTYStock erosion - moderateNOHarriet HalldayBEISONAL WURDRAUTYStock erosion - moderateMtbN:UnknownBEISONAL WURDRAUTYArable ploughingMtbN:UnknownBEISONAL WURDRAUTYOffa's Dyke:	DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1006260
Devide TYPE Private CONTRCT: Harriet Hallday INTE MATE: Offa's Dyke: section 230yds (210m) long, SE from Pertre-Shanel, Oxer TYP NUMECE 1004767 Scheduled Monument IST SMTRY NUMECE 1004767 Scheduled Monument IST SMTRY NUMECE Scable Scheduled Monument No No Scheduled Monument IST SMTRY NUMECE Mod Oxer Scheduled Monument IST SMTRY NUMECE 106246 Scheduled Monument IST SMTRY NUMECE Unknown Scheduled Monument IST SMTRY NUMECE Unknown Scheduled Monument IST SMTRY NUMECE Unknown Scheduled Monument IST SMTRY NUMECE IDAGOM Scheduled Monument IST	CONDITION:		TREND:	Declining
Answer Offa's Dyke: section 230yds (210m) long. SE from Pertre-Shannel, Oxestry Rural Designation Scheduled Monument Intervations: 004767 Designation: Generally satisfactory but with minor localised problems TREND: Stable Designation: Generally satisfactory but with minor localised problems Nov Dettiny: No Designation: Scheduled Monument Designation: Nov Dettiny: Designation: Scheduled Monument Designation: Distribution: Designation: Scheduled Monument Distribution: Distribution: Designation: Arable ploughing Nov Designation: Distribution: Designation: Private Contract: Jez Bretherton 0121 625 6855 Designation: Offa's Dyke: section S50yds (500m) long, on Bakers No Designation: Offa's Dyke: section S50yds (500m) long, on Bakers No Designation: Offa's Dyke: section S50yds (500m) long, on Bakers No Designation: Offa's Dyke: section S50yds (500m) long, on Bakers No Designation: Offa's Dyke: section S50yds (500m) long, on Bakers No	PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
Beside/Antional Scheduled Monument UST ENTRY NUMBER 1004767 conkDitional Generally satisfactory but with minor localised problems Tranco Stable environal Generally satisfactory but with minor localised problems No No environal Stock erosion - moderate No No environal Barriet Halliday Harriet Halliday environal Scheduled Monument UT ENTRY NUMBER 1006246 convolutional Scheduled Monument UT ENTRY NUMBER 1006246 convolutional Scheduled Monument Unknown No convolutional Scheduled Monument UST ENTRY NUMBER 1002933 environal Generally satisfactory but with minor localised problems Improving 1002933 environal Generally satisfactory but with minor localised problems Improving 101737 environal Generally satisfactory but with minor localised problems Improving 101737 environal Generally satisfactory but with minor localised problems Improving 101737 environa Scheduled Monument	OWNER TYPE:	Private	CONTACT:	Harriet Halliday
Constraint Constraint Stable RENCONTION Generally satisfactory but with minor localised problems No RENCONTION Stock erosion - moderate NoW PRTWY: No WARE TWO: Private CONTACT: Harriet Hallday WARE TWO: Roman villa 150 yards (140 metres) south east of La Hall, Pontsubury Harriet Hallday WARE TWO: Scheduled Monument IST ENTRY NUMBER 1006246 CONTACT: Stable Unknown Ist ENTRY NUMBER CONTACT: Arable ploughing No Ist ENTRY NUMBER CONTACT: Scheduled Monument Ist ENTRY NUMBER 100233 CONTACT: Generally satisfactory but with minor localised problems Improving 100233 CONTACT: Rence ally satisfactory but with minor localised problems Improving 100233 CONTACT: Rence ally satisfactory but with minor localised problems Improving 1017237 CONTACT: Rence ally satisfactory but with minor localised problems Improving 1017237 CONTACT: Rence ally satisfactory but with minor localised problems Improving <	SITE NAME:	Offa's Dyke: section 230yds (210m) long, SE from	n Pentre-Shannel, Os	westry Rural
problems problems problems problems problems problems problems StackParLVULEIRAULTY: Stock erosion - moderate NEW DITYPE: No StackParLVULEIRAULTY: Stock erosion - moderate CONTACT: Harriet Hallday StackParLVON: Scheduled Monument USI FMITXY MIREE 1006246 CONTIACT: Harriet Hallday Unknown StackParLVON: Scheduled Monument USI FMITXY MIREE 1006246 CONTIACT: Arable ploughing New DITXY: No StackParLVON: Scheduled Monument USI FMITXY MIREE 1002933 StackParLVON: Scheduled Monument USI FMITXY MIREE 102737 StackParLVON: Scheduled Monument USI FMITXY MIREE 102737	DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004767
WMRTTPS:PrivateCONTACT:Harriet HallidayBIGNAMIONScheduled MonumentLST ENTRY NUMBER1006246CONTACT:Scheduled MonumentLST ENTRY NUMBER1006246CONTACT:Private, multiple ownersCONTACT:Jzz Bretherton 0121 625 6855CONTACT:Offa's Dyke: section 550yds (500m) long, on BakerLST ENTRY NUMBER1002933CONTACT:Offa's Dyke: section 550yds (500m) long, on BakerLST ENTRY NUMBER1002933CONTACT:Offa's Dyke: section 550yds (500m) long, on BakerIntervo1002933CONTACT:Offa's Dyke: section 550yds (500m) long, on BakerIntervoNoCONTACT:OtherNEW DYKENoIntervoCONTACT:OtherNEW DYKENoIntervoCONTACT:OtherStadiadatory Dut with minor localised problemsIntervoNoCONTACT:PrivateNoIntervoNoCONTACT:PrivateNoIntervoNoCONTACT:PrivateNoIntervoNoCONTACT:PrivateNoIntervoNoCONTACT:PrivateNoIntervoNoCONTACT:<	CONDITION:		TREND:	Stable
THE NAME Roman vill 150 yards (140 metres) south east of Le Hall, Pontesbury DESIGNATION: Scheduled Monument URE NAME 1006246 DESIGNATION: Extensive significant problems TRENO: Unknown RINKERM VULNERABURY: Axable ploughing NEW INTRY: No RINKERM VULNERABURY: Offa's Dyke: section S50yds (500m) long, on Bakers IUS ENTRY NUMBER 1002933 SERIENAME Offa's Dyke: section S50yds (500m) long, on Bakers IUS ENTRY NUMBER 1002933 SERIENAME Scheduled Monument UST ENTRY NUMBER 1002933 SCONDITION: Scheduled Monument UST ENTRY NUMBER 1002933 SCONDITION: Generally satisfactory but with minor localised problems TREND: No SCONDITION: Generally satisfactory but with minor localised problems TREND: No SCONDITION: Generally satisfactory but with minor localised problems TREND: No SCONDITION: Generally satisfactory but with minor localised problems TREND: No SCONDITION: Generally satisfactory but with minor localised problems TREND: No SCONDITION: Generally satisfactory but with minor localised problems TREND: No SCONDITION: Generally satisfactory but with minor localised problems TREND: <t< td=""><td>PRINCIPAL VULNERABILITY:</td><td>Stock erosion - moderate</td><td>NEW ENTRY?:</td><td>No</td></t<>	PRINCIPAL VULNERABILITY:	Stock erosion - moderate	NEW ENTRY?:	No
Designation: Scheduled Monument LIST ENTRY NUMBER: 1006246 CONDITION: Extensive significant problems TREND: Unknown RIBKIRAL VULKERABULTY: Arable ploughing New VERTEY: No RIBKIRAL VULKERABULTY: Arable ploughing New VERTEY: Jez Bretherton 0121 625 6855 STEE NAME: Offa's Dyke: section 550yds (500m) long, on Bakers Hill, Selatyn and Gobowen Joo2933 SCHOUTION: Generally satisfactory but with minor localised problems TREND: Improving SCHOUTION: Generally satisfactory but with minor localised problems TREND: Improving SCHOUTION: Generally satisfactory but with minor localised problems TREND: Inproving SCHOUTION: Generally satisfactory but with minor localised problems TREND: Declining SCHOUTION: Generally satisfactory but with minor localised problems TREND: Declining SCHOUTION: Generally satisfactory but with minor localised problems TREND: Declining SCHOUTION: Generally satisfactory but with minor localised problems TREND: Declining SCHOUTION: Generally satisfactory bu	OWNER TYPE:	Private	CONTACT:	Harriet Halliday
CONDITION-Extensive significant problemsTREND.UnknownRINCIPAL YULNERABULTY:Arable ploughingNEW ENTRY:NoRINCIPAL YULNERABULTY:Arable ploughingNEW ENTRY:NoOWNER TYPE:Offa's Dyke: section S50yds (500m) long, on Bakers'Jell Betterherton 0121 625 6855TITE NAME:Offa's Dyke: section S50yds (500m) long, on Bakers'IUST ENTRY NUMBER:1002933SENGUATION:Scheduled MonumentLIST ENTRY NUMBER:1002933CONDITION:Generally satisfactory but with minor localised problemsNEW ENTRY:NoCONTACT:Harriet HallidayINTERNOCONTACT:Harriet HallidayCONDITION:Scheduled MonumentLIST ENTRY NUMBER:107237CONDITION:Generally satisfactory but with minor localised problemsNoInter NAME:CONDITION:Generally satisfactory but with minor localised problemsNoInter NAME:CONDITION:Generally satisfactory but with minor localised problemsNoInter NAME:CONTACT:PrivateNoInter NAME:NoCONTACT:PrivateNoInter NAME:IO20617CONTACT:Scheduled MonumentLIST ENTRY NUMBER:IO20617CONTACT:PrivateScheduled MonumentLIST ENTRY NUMBER:IO20617CONTACT:Scheduled MonumentLIST ENTRY NUMBER:IO20617CONTACT:Scheduled MonumentLIST ENTRY NUMBER:IO20617CONTACT:Scheduled MonumentLIST ENTRY NUMBER:IO20617<	ITE NAME:	Roman villa 150 yards (140 metres) south east of	Lea Hall, Pontesbury	/
RINCIPAL VULNERABILITY: Arable ploughing NEW ENTRY: No DWINER TYPE: Private, multiple owners CONTACT: Jez Bretherton 0121 625 6855 DWINER TYPE: Offa's Dyke: section 550yds (500m) long, on Bakers Hill, Selattyn and Gobowen Joo2933 DESERVATION: Scheduled Monument LIST ENTRY NUMBER IO02933 DONNER TYPE: Generally satisfactory but with minor localised problems TREND: Improving DONNER TYPE: Other NEW ENTRY: No DONNER TYPE: Private CONTACT: Harriet Halliday DESERVATION: Scheduled Monument LIST ENTRY NUMBER 1017237 DESERVATION: Scheduled Monument LIST ENTRY NUMBER 1017237 DESERVATION: Forestry No Declining DESERVATION: Forestry No Declining DESERVATION: Scheduled Monument LIST ENTRY NUMBER 1020617 DESERVATION: Forestry No Declining DESERVATION: Scheduled Monument LIST ENTRY NUMBER 1020617 DESERVATION:	DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1006246
DWNER TYPE:Private, multiple ownersCONTACT:Je z Brether ton 0121 625 6855ATE NAME:Offa's Dyke: section S50yds (500m) long, on Bakers Hill, Selatyna HOREN1002933DESIGNATION:Scheduled MonumentISTE NTRY NUMBER1002933CONDITION:OtherNew ENTRY:NoPrivateOtherNoNoSTE NAME:NoNoNoSTE NAME:Scheduled MonumentISTE NTRY NUMBER1017237CONDITION:Scheduled MonumentISTE NTRY NUMBER1017237CONDITION:Generally satisfactory but with minor localised problemsNoNoCONDITION:Generally satisfactory but with minor localised problemsNoNoCONDITION:ForestryNoNoNoCONDITION:Generally satisfactory but with minor localised problemsNoNoCONDITION:FrivateForestryNoNoCONDITION:Scheduled MonumentISTE NTRY NUMBER102017CONDITION:Scheduled MonumentISTE NTRY NUMBERNoCONDITION:Scheduled Monu	CONDITION:	Extensive significant problems	TREND:	Unknown
ATTE NAME: Offa's Dyke: section 550yds (500m) long, on Bakers Hill, Selattyn and Gobowen DesiGNATION: Scheduled Monument UST ENTRY NUMBER: 1002933 DONDITION: Generally satisfactory but with minor localised problems Improving Improving SRINCIPAL VULNERABILITY: Other NEW ENTRY: No DONDITION: Ring cairn and Selattyn Tower on Selattyn Hill, Selattyn and Gobowen Improving SRINCIPAL VULNERABILITY: Other UST ENTRY NUMBER: 1017237 DONDITION: Generally satisfactory but with minor localised problems ITREND: Declining SCHOULD WULNERABILITY: Forestry NEW ENTRY: No No CONDITION: Generally satisfactory but with minor localised problems ITREND: Declining SCHOULD WULNERABILITY: Forestry New ENTRY: No CONDITION: Generally satisfactory but with minor localised problems Its FINTRY NUMBER: 1020617 SCHOULD WULNERABILITY: Stock erosion - moderate UST ENTRY NUMBER: 1020617 SCHOULD WULNERABILITY: Stock erosion - moderate NEW ENTRY: No SCHOULD WULNERABILITY: Stock erosion - moderate NEW ENTRY:	PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY ?:	No
DeskGNATION: Scheduled Monument UST ENTRY NUMBER: 1002933 CONDITION: Generally satisfactory but with minor localised problems TREND: Improving GRINCHAL VULNEAABILTY: Other NEW ENTRY: No OWNER TYPE: Private CONTACT: Harriet Halliday STEE NAME: Ring cairn and Selattyn Tower on Selattyn Hill, Selattyn and Gobowen 1017237 DeskGNATION: Scheduled Monument UST ENTRY NUMBER: 1017237 CONDITION: Generally satisfactory but with minor localised problems TREND: Declining CONTACT: Forestry No No DEVENTRY NUMERABILTY: Forestry No No DEVENTRY NUMERABILTY: Forestry No No DEVENTRY: Rancin's Road, Selattyn and Gobowen No No DESKGNATION: Scheduled Monument UST ENTRY NUMBER: 1020617 CONDITION: Generally satisfactory but with minor localised problems TREND: Declining DESKGNATION: Scheduled Monument UST ENTRY NUMBER: 1020617 CONDITIO	OWNER TYPE:	Private, multiple owners	CONTACT:	Jez Bretherton 0121 625 6855
CONDITION:Generally satisfactory but with minor localised problemsTREND:ImprovingRINCIPAL VULNERABILITY:OtherNEV ENTRY:NoOWNER TYPE:PrivateCONTACT:Harriet HallidayITE NAME:Ring cairn and Selatyn Tower on Selatyn Hill, Sel XITRY NUMBER1017237DESIGNATION:Scheduled MonumentUST ENTRY NUMBER1017237CONDITION:Generally satisfactory but with minor localised problemsNEND:NoRINCLEAL VULNERABILITY:ForestryNEW ENTRY:NoWAR'S Dyke, 420 metres long section, 190 metres:Vorteen Preshenlle Lane and SciIFE NAME:Scheduled MonumentUST ENTRY NUMBER1020617IFE NAME:Scheduled MonumentIST ENTRY NUMBER1020617CONDITION:Scheduled MonumentUST ENTRY NUMBER1020617CONDITION:Scheduled MonumentUST ENTRY NUMBER1020617CONDITION:Stock erosion - moderateNEV ENTRY:NoVINNER TYPE:Stock erosion - moderateNEV ENTRY:NoVINNER TYPE:Scheduled MonumentUST ENTRY NUMBER103811VINNER TYPE:Scheduled MonumentIST	ITE NAME:	Offa's Dyke: section 550yds (500m) long, on Bake	ers Hill, Selattyn and	Gobowen
RENCIPAL VULNERABILITY:OtherNEW ENTRY:NoRINCIPAL VULNERABILITY:OtherNEW ENTRY:NoDWNER TYPE:PrivateCONTACT:Harriet HallidayTTE NAME:Ring cairn and Selattyn Tower on Selattyn Hill, Selattyr and Gobowen1017237DESIGNATION:Scheduled MonumentUST ENTRY NUMBER:1017237DRINCIPAL VULNERABILITY:ForestryNEW ENTRY:NoDONDITION:Generally satisfactory but with minor localised problemsNEW ENTRY:NoRINCIPAL VULNERABILITY:ForestryNEW ENTRY:NoWart's Dyke, 420 metres long section, 190 metres:CONTACT:Harriet HallidayTTE NAME:Wart's Dyke, 420 metres long section, 190 metres:tot ENTRY NUMBER:1020617TERNAME:Scheduled MonumentUST ENTRY NUMBER:1020617CONDITION:Generally satisfactory but with minor localised problemsTREND:NoCONDITION:Stock erosion - moderateNEW ENTRY:NoWINER TYPE:PrivateCONTACT:Ize Bretherton 0121 625 6855RINCIPAL VULNERABILITY:Scheduled MonumentUST ENTRY NUMBER:1003811LITE NAME:Scheduled MonumentUST ENTRY NUMBER:1003811LITE NAME:Scheduled MonumentUST ENTRY NUMBER:1003811LITENAME:Scheduled MonumentUST ENTRY NUMBER:1003811LITENAME:Scheduled MonumentUST ENTRY NUMBER:1003811LITENAME:Scheduled MonumentUST ENTRY NUMBER:1003811LITENAME:	DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002933
WNRET TYPE:PrivatePrivateCONTACT:Harriet HallidayINTER NAME:Ring cairn and Selattyn Tower on Selattyn Hill, Selattymal GobownDESIGNATION:Scheduled MonumentLIST ENTRY NUMBER1017237DONDITION:Generally satisfactory but with minor localised problemsRIND:DecliningCONDITION:ForestryNew ENTRY:NoDONNER TYPE:PrivateCONTACT:Harriet HallidayDYNER TYPE:PrivateCONTACT:Harriet HallidayDYNER TYPE:Scheduled MonumentLIST ENTRY NUMBER:JO20617DEGINITION:Scheduled MonumentLIST ENTRY NUMBER:1020617DONDITION:Scheduled MonumentLIST ENTRY NUMBER:JO20617DYNER TYPE:Scheduled MonumentNoIST ENTRY NUMBER:DYNER TYPE:Stock erosion - moderateNEW ENTRY:NoDYNER TYPE:PrivateStock erosion - moderateNEW ENTRY:Jo20617DYNER TYPE:PrivateCONTACT:JEST ENTRY NUMBER:JO20617DYNER TYPE:PrivateStock erosion - moderateNEW ENTRY:NoDYNER TYPE:PrivateScheduled MonumentLIST ENTRY NUMBER:JO20811DYNER TYPE:Scheduled MonumentLIST ENTRY NUMBER:JO20811DYNER TYPE:Scheduled MonumentLIST ENTRY NUMBER:JO20811DYNER TYPE:Scheduled MonumentLIST ENTRY NUMBER:JO20811DYNER TYPE:Scheduled MonumentLIST ENTRY NUMBER:JO20811DYNER TYPE: <td< td=""><td>CONDITION:</td><td></td><td>TREND:</td><td>Improving</td></td<>	CONDITION:		TREND:	Improving
Arrite Ring cairn and Selattyn Tower on Selattyn Hill, Selattyn and Gobowen DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1017237 CONDITION: Generally satisfactory but with minor localised problems TREND: Declining CONDITION: Forestry New ENTRY: No DWNER TYPE: Private CONTACT: Harriet Halliday STE NAME: Wat's Dyke, 420 metres long section, 190 metres to the junction Harriet Halliday SEIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1020617 CONDITION: Generally satisfactory but with minor localised problems TREND: Declining CONDITION: Scheduled Monument LIST ENTRY NUMBER: 1020617 CONDITION: Generally satisfactory but with minor localised problems TREND: Declining CONDITION: Scheduled Monument LIST ENTRY NUMBER: No CONTACT: Ige Bretherton 0121 625 6855 Staffa Name: No DWINER TYPE: Vaccona Roman site (see also Telford and Wrek TYP: No Stable DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1003811 DECONDITION:	PRINCIPAL VULNERABILITY:	Other	NEW ENTRY?:	No
Designation:Scheduled MonumentLIST ENTRY NUMBER:[017237CONDITION:Generally satisfactory but with minor localised problemsTREND:DecliningRINCIPAL VULNERABILITY:ForestryNEW ENTRY:NoDOWNER TYPE:PrivateCONTACT:Harriet HallidayDESIGNATION:Scheduled MonumentLIST ENTRY NUMBER:1020617DESIGNATION:Scheduled MonumentLIST ENTRY NUMBER:1020617CONTION:Generally satisfactory but with minor localised problemsTREND:DecliningCONTION:Scheduled MonumentLIST ENTRY NUMBER:1020617CONDITION:Generally satisfactory but with minor localised problemsTREND:DecliningCONTION:PrivateStock erosion - moderateNEW ENTRY:NoDOWNER TYPE:PrivateCONTACT:Jez Bretherton 0121 625 6855CITE NAME:UXacona Roman site (see also Telford and Wrekin Unitary Authority).Shifnal / St. Georges and Priorslee / Donnington and MuxtonDESIGNATION:Scheduled MonumentLIST ENTRY NUMBER:1003811DESIGNATION:Scheduled MonumentLIST ENTRY NUMBER:1003811DESIGNATION:Scheduled MonumentLIST ENTRY NUMBER:1003811DESIGNATION:Scheduled MonumentLIST ENTRY NUMBER:StableDESIGNATION:Arable ploughingNEW ENTRY:No	OWNER TYPE:	Private	CONTACT:	Harriet Halliday
CONDITION:Generally satisfactory but with minor localised problemsTREND:DecliningRINCIPAL VULNERABILITY:ForestryNoOWNER TYPE:PrivateCONTACT:Harriet HallidaySTE NAME:Wat's Dyke, 420 metres long section, 190 metres ver of the junct:between Preeshenlle Lane and StSTE NAME:Scheduled MonumentLIST ENTRY NUMBER:1020617CONDITION:Scheduled MonumentINTEND:DecliningCONDITION:Stock erosion - moderateNEW ENTRY:NoDOWNER TYPE:PrivateContact:Jez Bretherton 0121 625 6855STE NAME:Scheduled MonumentINTEND:Scheduled Scheduled MonumentCONDITION:Stock erosion - moderateNEW ENTRY:NoDOWNER TYPE:PrivateContact:Jez Bretherton 0121 625 6855STE NAME:Scheduled MonumentINTEND:Scheduled Scheduled MonumentSTE NAME:Scheduled MonumentINTERY NUMBER:10038 1STE NAME:Generally satisfactory but with significant localised problemsTREND:StableSTE NAME:Generally satisfactory but with significant localised problemsTREND:Stable	SITE NAME:	Ring cairn and Selattyn Tower on Selattyn Hill, Se	elattyn and Gobowen	
problemsproblemsDecliningPRINCIPAL VULNERABILITY:ForestryNew ENTRY?:NoPrivateCONTACT:Harriet HallidaySATE NAME:Wat's Dyke, 420 metres long section, 190 metres west of the junctionbetween Preeshenlle Lane and StSATE NAME:Wat's Dyke, 420 metres long section, 190 metres west of the junction1020617DESIGNATION:Scheduled MonumentLIST ENTRY NUMBER:1020617DESIGNATION:Scheduled MonumentLIST ENTRY NUMBER:1020617DONDITION:Generally satisfactory but with minor localised problemsTREND:DecliningRINCIPAL VULNERABILITY:Stock erosion - moderateNEW ENTRY?:NoDWNER TYPE:PrivateCONTACT:Jez Bretherton 0121 625 6855DESIGNATION:Scheduled MonumentLIST ENTRY NUMBER:1003811DESIGNATION:Scheduled MonumentLIST ENTRY NUMBER:1003811DESIGNATION:Scheduled MonumentLIST ENTRY NUMBER:1003811DESIGNATION:Scheduled MonumentLIST ENTRY NUMBER:1003811DESIGNATION:Scheduled MonumentNEW ENTRY:NoCONDITION:Generally satisfactory but with significant localised problemsTREND:StableCONDITION:Generally satisfactory but with significant localised problemsNew ENTRY:NoCONDITION:Arable ploughingNEW ENTRY:No	DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1017237
DWN RET TYPE:PrivateCONTACT:Harriet HallidayBITE NAME:Wat's Dyke, 420 metres long section, 190 metres to the junctionWeten Preeshenlle Lane and StatianDESIGNATION:Scheduled MonumentUST ENTRY NUMBER:1020617CONDITION:Generally satisfactory but with minor localised problemsNEW ENTRY:NoDRINCIPAL VULNERABILITY:Stock erosion - moderateNEW ENTRY:NoDAMER TYPE:PrivateCONTACT:Jez Breherton 0121 625 6855DESIGNATION:Scheduled MonumentUST ENTRY NUMBER:1003811DESIGNATION:Scheduled MonumentUST ENTRY NUMBER:1003811DESIGNATION:Scheduled MonumentUST ENTRY NUMBER:1003811CONDITION:Generally satisfactory but with significant localised problemsTREND:StableCONDITION:Arable ploughingNEW ENTRY:No	CONDITION:		TREND:	Declining
Martin's Road, Selattyn and Gobowen Lust entry NUMBER Detween Preeshenlle Lane and St DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1020617 CONDITION: Generally satisfactory but with minor localised problems TREND: Declining CONDITION: Stock erosion - moderate NEW ENTRY: No DWNER TYPE: Private CONTACT: Jez Bretherton 0121 625 6855 WITE NAME: Uxacona Roman site (see also Telford and Wrekin, Yuthority) Shifnal / St. Georges and Priorslee / Donnington and Muxton DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1003811 ODITION: Generally satisfactory but with significant localised problems TREND: Stable	PRINCIPAL VULNERABILITY:	Forestry	NEW ENTRY?:	No
Martin's Road, Selattyn and Gobowen LIST ENTRY NUMBER: 1020617 DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1020617 CONDITION: Generally satisfactory but with minor localised problems REND: Declining PRINCIPAL VULNERABILITY: Stock erosion - moderate NEW ENTRY: No DOWNER TYPE: Private CONTACT: Jez Bretherton 0121 625 6855 DISTE NAME: Vaxcona Roman site (see also Telford and Wrekin Yauthority) Shifnal / St. Georges and Priorslee / DOSIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1003811 DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1003811 DOSIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1003811 CONDITION: Generally satisfactory but with significant localised problems REND: Stable	OWNER TYPE:	Private	CONTACT:	Harriet Halliday
CONDITION:Generally satisfactory but with minor localised problemsTREND:DecliningPRINCIPAL VULNERABILITY:Stock erosion - moderateNEW ENTRY?:NoDOWNER TYPE:PrivateCONTACT:Jez Bretherton 0121 625 6855SITE NAME:Uxacona Roman site (see also Telford and Wrekin Unitary Authority), Shifnal / St. Georges and Priorslee / Donnington and MuxtonIIST ENTRY NUMBER:1003811DESIGNATION:Scheduled MonumentIIST ENTRY NUMBER:1003811CONDITION:Generally satisfactory but with significant localised problemsTREND:StablePRINCIPAL VULNERABILITY:Arable ploughingNEW ENTRY?:No	SITE NAME:	Wat's Dyke, 420 metres long section, 190 metres	s west of the junction	n between Preeshenlle Lane and St
CONDITION: problems problems Interde Declining PRINCIPAL VULNERABILITY: Stock erosion - moderate NEW ENTRY?: No DWW ER TYPE: Private CONTACT: Jez Bretherton 0121 625 6855 SITE NAME: Uxacona Roman site (see also Telford and Wrekin Unitary Authority), Shifnal / St. Georges and Priorslee / Donnington and Muxton ISTE ENTRY NUMBER: 1003811 DESIGNATION: Scheduled Monument IST ENTRY NUMBER: 1003811 CONDITION: Generally satisfactory but with significant localised problems TREND: Stable PRINCIPAL VULNERABILITY: Arable ploughing NEW ENTRY: No		Martin's Road, Selattyn and Gobowen		
DWNER TYPE:PrivateCONTACT:Jez Bretherton 0121 625 6855BITE NAME:Uxacona Roman site (see also Telford and Wrekin Uritary Authority)Shifal / St. Georges and Priorslee / Donnington and MuxtonDESIGNATION:Scheduled MonumentLIST ENTRY NUMBER:1003811CONDITION:Generally satisfactory but with significant localised problemsTREND:StableRINCIPAL VULNERABILITY:Arable ploughingNEW ENTRY:No	DESIGNATION:		LIST ENTRY NUMBER:	1020617
Sitte NAME: Uxacona Roman site (see also Telford and Wrekin Unitary Authority), Shifnal / St. Georges and Priorslee / Donnington and Muxton DESIGNATION: Scheduled Monument LIST ENTRY NUMBER: 1003811 CONDITION: Generally satisfactory but with significant localised problems TREND: Stable RINCIPAL VULNERABILITY: Arable ploughing NEW ENTRY?: No		Scheduled Monument Generally satisfactory but with minor localised		
Instrume Donnington and Muxton Designation: Scheduled Monument List ENTRY NUMBER: 1003811 CONDITION: Generally satisfactory but with significant localised problems TREND: Stable PRINCIPAL VULNERABILITY: Arable ploughing NEW ENTRY: No	CONDITION:	Scheduled Monument Generally satisfactory but with minor localised problems	TREND:	Declining
CONDITION:Generally satisfactory but with significant localised problemsTREND:StablePRINCIPAL VULNERABILITY:Arable ploughingNEW ENTRY?:No	CONDITION: PRINCIPAL VULNERABILITY:	Scheduled Monument Generally satisfactory but with minor localised problems Stock erosion - moderate	TREND: NEW ENTRY?:	Declining
problems new entry: No	CONDITION: PRINCIPAL VULNERABILITY: DWNER TYPE:	Scheduled Monument Generally satisfactory but with minor localised problems Stock erosion - moderate Private Uxacona Roman site (see also Telford and Wreki	TREND: NEW ENTRY?: CONTACT:	Declining No Jez Bretherton 0121 625 6855
	CONDITION: PRINCIPAL VULNERABILITY: OWNER TYPE: SITE NAME:	Scheduled Monument Generally satisfactory but with minor localised problems Stock erosion - moderate Private Uxacona Roman site (see also Telford and Wreki Donnington and Muxton	TREND: NEW ENTRY?: CONTACT: in Unitary Authority)	Declining No Jez Bretherton 0121 625 6855 , Shifnal / St. Georges and Priorslee /
DWNER TYPE: Private, multiple owners CONTACT: Jez Bretherton 0121 625 6855	CONDITION: PRINCIPAL VULNERABILITY: DWNER TYPE: SITE NAME: DESIGNATION:	Scheduled Monument Generally satisfactory but with minor localised problems Stock erosion - moderate Private Uxacona Roman site (see also Telford and Wreke Donnington and Muxton Scheduled Monument Generally satisfactory but with significant localised	TREND: NEW ENTRY?: CONTACT: in Unitary Authority) LIST ENTRY NUMBER:	Declining No Jez Bretherton 0121 625 6855 , Shifnal / St. Georges and Priorslee / 1003811
	CONDITION: PRINCIPAL VULNERABILITY: DWNER TYPE: SITE NAME: DESIGNATION: CONDITION:	Scheduled Monument Generally satisfactory but with minor localised problems Stock erosion - moderate Private Uxacona Roman site (see also Telford and Wreki Donnington and Muxton Scheduled Monument Generally satisfactory but with significant localised problems	TREND: NEW ENTRY?: CONTACT: in Unitary Authority) LIST ENTRY NUMBER: TREND:	Declining No Jez Bretherton 0121 625 6855 , Shifnal / St. Georges and Priorslee / 1003811 Stable

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no А

- Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В implemented.
- C Slow decay; no solution agreed.

 D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

HERITAGE AT RISK 2023 / MIDLANDS / SHROPSHIRE (UA) / EAST STAFFORDSHIRE

HERITAGE AT RISK 2025 / THE	LANDS / SHROFSHIKE (OA) / EAST STAFFORDSHIKE		
SITE NAME:	Robury Ring: a small enclosed settlement on Went	tnor Prolley Moor,	Wentnor
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1021072
CONDITION:	Unknown	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Other	NEW ENTRY ?:	No
OWNER TYPE:	Private	CONTACT:	Jez Bretherton 0121 625 6855
SITE NAME:	Hawcocks Mount ringwork castle 200 metres nort	h east of Hawcock	s Farm, Westbury
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1013494
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Deterioration - in need of management	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Jez Bretherton 0121 625 6855
SITE NAME:	Upper Barn moat, Wistanstow		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1012455
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY ?:	No
OWNER TYPE:	Private	CONTACT:	Jez Bretherton 0121 625 6855
SITE NAME:	Bowl barrow at The Napp, Worthen with Shelve		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1017347
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Animal burrowing - extensive	NEW ENTRY ?:	No
OWNER TYPE:	Private	CONTACT:	Harriet Halliday
SITE NAME:	Snailbeach New Smeltmill, 350 metres north east o	of Green Acres, W	orthen with Shelve
DESIGNATION:	Scheduled Monument and Listed Buildings - 2 grade II	LIST ENTRY NUMBER:	1017764 and 1307989; 1055031
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners	CONTACT:	Imogen Newcombe 07387 524030

STAFFORDSHIRE

EAST STAFFORDSHIRE

4	SIT
	D
	C
	0
and because	PR
	0

Mid-C17 timber framed house, one wing of which was SITE NAME Sinai Park, Burton on Trent, repaired some years ago. The remainder is in very poor Shobnall condition and continues to deteriorate. It is in critical ESIGNATION: Listed Building grade II*, SM condition with areas of partial collapse but no agreed plans for its repair. ONDITION: Very bad CCUPANCY: Part occupied/part in use RIORITY CATEGORY: A (A) WNER TYPE: Private LIST ENTRY NUMBER: 1038484 Contact: Louisa Moore 0777 043 5511

© Historic England

PRIORITY CATEGORIES			
А	Immediate risk of further rapid		

D

Е

- deterioration or loss of fabric; no solution agreed. Immediate risk of further rapid deterioration or loss of fabric; В
- solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- Conservation Area Listed Building Local Planning Authority National Park CA
- LB LPA
- NP RPG
- Registered Park and Garden Scheduled Monument SM
- UA Unitary Authority WHS World Heritage Site

HERITAGE AT RISK 2023 / MIDLANDS / EAST STAFFORDSHIRE / LICHFIELD

SITE NAME:	Enclosures and cursus 300 yards (270 metres) sout	h east of Efflinch, B	Barton-under-Needwood
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1006073
CONDITION:	Unknown	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY ?:	No
OWNER TYPE:	Commercial company	CONTACT:	Nick Carter 0121 625 6860
SITE NAME:	Timber circle, hengi-form monument and part of a	pit alignment at Ca	tholme, Barton-under-Needwood
SITE NAME: DESIGNATION:	Timber circle, hengi-form monument and part of a Scheduled Monument	pit alignment at Ca LIST ENTRY NUMBER:	tholme, Barton-under-Needwood
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1019109

LICHFIELD

	SITE NAME:	Manor House, Hamstall Ridware	Porch, walls and gatehouse to timber framed C15 country house, substantially altered in C16 and C18 with brick hall,
	DESIGNATION:	Scheduled Monument, CA	tower and courtyard walls. The tower remains as a prominent garden folly with considerable structural issues.
	CONDITION:	Very bad	The house is still in use, but the tower is derelict and in very bad condition. Vegetation was cleared from the tower
1	OCCUPANCY:	N/A	and a detailed recording survey has been completed. Further structural assessment of the site is needed.
	PRIORITY CATEGORY:	A (A)	Further structural assessment of the site is needed.
And and a second second	OWNER TYPE:	Private	
	LIST ENTRY NUMBER:	1006119	Contact: Imogen Newcombe 07387 524030

© Historic England



	SITE NAME:	Sandfields Pumping Station east Building, Chesterfield Road, Lichfield	This C19 engine house was built in 1872-3 by Henry Naden for the South Staffordshire Waterworks Company as an extension to their 1858 engine house, demolished
	DESIGNATION:	Listed Building grade II*	when the replacement pump house was constructed in 1966. One of only four pumping stations in England to
	CONDITION:	Poor	retain its original Cornish beam engine in situ, water extraction ceased in 1997 and the surrounding land was
	OCCUPANCY:	Vacant/not in use	developed as housing. The building was upgraded to II* in
No. of Lot of Lo	PRIORITY CATEGORY:	D (D)	2014 and is currently unused. Negotiations to transfer ownership from the Developer Persimmon to the Lichfield
	OWNER TYPE:	Commercial company	Waterworks Trust are in progress.
	LIST ENTRY NUMBER:	1187742	Contact: John Tiernan 0121 625 6839

© Historic England

© Historic England



D

Е

use).

SITE NAME:	Church of St John the Baptist, Edingale	T c
DESIGNATION:	Listed Place of Worship grade II*	n re
CONDITION:	Poor	P 2
PRIORITY CATEGORY:	D (D)	r
OWNER TYPE:	Religious organisation	R
LIST ENTRY NUMBER:	1188243	a

The church of St John the Baptist has C13 origins and consists of a nave with a west tower and a chancel with a north side organ chamber. Several phases of past repairs, emodelling and rebuilding are clearly evident. A Listed Places of Worship Roof Repairs Grant awarded in June 2016 facilitated the renewal of the tower, nave and chancel roof coverings, parapet gutter linings, rainwater goods and new surface water drainage. A grant from the Cultural Recovery Fund programme has enabled high level masonry and repointing works to be carried out but low-level repointing work remains outstanding.

Contact: John Tiernan 0121 625 6839

SITE NAME:	Site of round barrow near River Tame, Alrewas		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1006090
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Gardening	NEW ENTRY ?:	No
OWNER TYPE:	Charity (heritage)	CONTACT:	Nick Carter 0121 625 6860

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no А

solution agreed. Immediate risk of further rapid deterioration or loss of fabric; В solution agreed but not yet implemented.

C Slow decay; no solution agreed.

Slow decay; solution agreed but F not yet implemented.

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA

- LB LPA
- Conservation Area Listed Building Local Planning Authority National Park NP
- RPG
- Registered Park and Garden Scheduled Monument SM

UA WHS

Unitary Authority World Heritage Site

HERITAGE AT RISK 2023 / MIDLANDS / LICHFIELD / NEWCASTLE-UNDER-LYME / PEAK DISTRICT (NP)

SITE NAME: Air photographic site south west of Elford, Fisherwick				
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1006100	
CONDITION:	Unknown	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY ?:	No	
OWNER TYPE:	Local authority, multiple owners	CONTACT:	Nick Carter 0121 625 6860	
SITE NAME:	Causewayed enclosure, Fradley and Streethay			
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002964	
CONDITION:	Extensive significant problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY ?:	No	
OWNER TYPE:	Private, multiple owners	CONTACT:	Nick Carter 0121 625 6860	
SITE NAME:	Fazeley and Bonehill, Drayton Bassett / Fazeley			
DESIGNATION:	Conservation Area, 12 LBs	NEW ENTRY?:	No	
CONDITION:	Very bad	TREND:	Deteriorating	
VULNERABILITY:	Medium	CONTACT:	Ed Higgins (LPA) 01543 308203	

NEWCASTLE-UNDER-LYME

	SITE NAME:	Model farm complex south west of Betley Old Hall, Main Street, Betley	Early C19 model farm including a range of cowhouses, a granary, cart shed, stables and watermill. Repairs are well underway with only the south range left to complete.
	DESIGNATION:	Listed Building grade II*, CA	Possible alternative uses for the buildings continue to be discussed with the Local Authority.
	CONDITION:	Fair	
	OCCUPANCY:	Vacant/not in use	
And And And	PRIORITY CATEGORY:	E (E)	
	OWNER TYPE:	Private	
© Historic England	LIST ENTRY NUMBER:	1 188395	Contact: Louisa Moore 0777 043 5511

	SITE NAME:	Gatehouse, walls and bollards to Maer Hall, Maer	Late C18 gatehouse, walls and bollards forming the approach to Maer Hall. The Hall is set in an early C19 park
	DESIGNATION:	Listed Building grade II*, CA	by John Webb. The property is associated with the Wedgwood and Darwin families. The condition of the
10	CONDITION:	Poor	gatehouse continues to deteriorate with repairs to the roof, gables and stonework required. Stabilising works have
	OCCUPANCY:	N/A	taken place and further negotiations are underway
	PRIORITY CATEGORY:	C (C)	regarding more permanent repairs.
A SPL	OWNER TYPE:	Private	
Newcastle under Lyme Borough	LIST ENTRY NUMBER:	1027834	Contact: Jez Bretherton 0121 625 6855

© Newo Council ugł Lyn

PEAK DISTRICT (NP)

U	1		HT A	
2		107	4	Contra la
	Ĩ	III		
in the	A Kilowe	1	-37A	
			di .	-

·			
	SITE NAME:	Hall Farmhouse, Church Street, Alstonefield, Staffordshire Moorlands	Hall Farmhouse, also known as Alstonefield Hall, is a substantial 16th century property which has evolved over time; reflecting the fortunes and needs of its various
	DESIGNATION:	Listed Building grade II*, CA	owners over the last 400years. In 2019 the new owner undertook the unauthorised extensive stripping out of the
	CONDITION:	Very bad	historic interior. A listed building application was submitted in 2022. The owner is in engaged discussions with the local
	OCCUPANCY:	Vacant/not in use	authority but the situation remains unresolved.
	PRIORITY CATEGORY:	C (C)	
	OWNER TYPE:	Private	
	LIST ENTRY NUMBER:	1374580	Contact: Louisa Moore 0777 043 5511

PRIORITY CATEGORIES

© Historic England

- Immediate risk of further rapid deterioration or loss of fabric; no А
- Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В implemented.
- C Slow decay; no solution agreed.

 D Slow decay: solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA LB
- LB LPA NP RPG SM
- Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument
- UA Unitary Authority WHS World Heritage Site

HERITAGE AT RISK 2023 / MIDLANDS / PEAK DISTRICT (NP) / SOUTH STAFFORDSHIRE

0.00	SITE NAME:	Critchlow Monument, Sheen, Staffordshire Moorlands
	DESIGNATION:	Listed Building grade II*, CA
	CONDITION:	Very bad
	OCCUPANCY:	N/A
	PRIORITY CATEGORY:	C (C)
	OWNER TYPE:	Private
© Historic England	LIST ENTRY NUMBER:	37455

© Historic England

Chest tomb and railings to the Critchlow family, c.1853 with large aedicular Gothic stone chest and spike headed wrought iron railing surround. The north face of the tomb has suffered two fragment losses to the blind arcading panels at the west and east end. The surrounding railings on all four sides have deteriorated where they fix into the stone base, in some cases to a point of complete loss, potentially jeopardising the long term stability of the monument.

Contact: Imogen Newcombe 07387 524030

SITE NAME:	Bowl barrow 450 metres east of Stanshope, Alstor	nefield, Staffordshire	e Moorlands
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1010798
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Animal burrowing - Badger - extensive	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nick Carter 0121 625 6860
SITE NAME:	Bowl barrow 350m south west of Merryton Low, (Onecote, Staffordsł	nire Moorlands
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1008974
CONDITION:	Extensive significant problems	TREND:	Improving
PRINCIPAL VULNERABILITY:	Natural erosion - extensive	NEW ENTRY?:	No
OWNER TYPE:	Government or agency	CONTACT:	Nick Carter 0121 625 6860
SITE NAME: Merryton Low bowl barrow, Onecote / Fawfieldhead, Staffordshire Moorlands			oorlands
DESIGNATION:	Scheduled Monument, LB grade II	LIST ENTRY NUMBER:	1008973
CONDITION:	Extensive significant problems	TREND:	Improving
PRINCIPAL VULNERABILITY:			
FRINCIPAL VOLINERABILITT:	Vehicle damage/erosion - limited/localised	NEW ENTRY ?:	No
OWNER TYPE:	Vehicle damage/erosion - limited/localised Government or agency	NEW ENTRY?: CONTACT:	No Nick Carter 0121 625 6860
	C C	CONTACT:	
OWNER TYPE:	Government or agency	CONTACT:	
OWNER TYPE:	Government or agency Copper mines on Ecton Hill, Wetton, Staffordshire	CONTACT: Moorlands	Nick Carter 0121 625 6860
OWNER TYPE: SITE NAME: DESIGNATION:	Government or agency Copper mines on Ecton Hill, Wetton, Staffordshire Scheduled Monument Generally satisfactory but with significant localised	CONTACT: Moorlands LIST ENTRY NUMBER:	Nick Carter 0121 625 6860

SOUTH STAFFORDSHIRE

5 5 ° 6	SITE NAME:	Stable Court at Four Ashes Hall, Four Ashes, Enville	Th of
1.0 4 3 1	DESIGNATION:	Listed Building grade II*	ind re
1.0	CONDITION:	Very bad	Hi
	OCCUPANCY:	Vacant/not in use	pr
LAR DEARN	PRIORITY CATEGORY:	A (A)	re to
	OWNER TYPE:	Commercial company	ve
© Historic England	LIST ENTRY NUMBER:	1277027	ass

he Stable Court at Four Ashes Hall consists of four ranges f outbuildings and dates from the mid to late C18 ncorporating C20 alterations. A programme of urgent epairs to the principal range was completed in 2006 with listoric England funding but the rest of the complex emains in very poor condition. Historic England funded roject development work to assess and quantify the emaining repairs which was completed in 2018. A scheme o develop the Stable Court as a sustainable wedding enue with other business partners is currently being ssessed.

Contact: John Tiernan 0121 625 6839

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; В solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.

D

Е

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use)

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- Conservation Area Listed Building CA
- LB LPA
- Local Planning Authority National Park NP
- RPG Registered Park and Garden Scheduled Monument
- SM UÁ
- Unitary Authority World Heritage Site WHS

HERITAGE AT RISK 2023 / MIDLANDS / SOUTH STAFFORDSHIRE / STAFFORD

SITE NAME: Roman fort west of Eaton House, Brewood and Coven				
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1006098	
CONDITION:	Unknown	TREND:	Unknown	
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No	
OWNER TYPE:	Private	CONTACT:	Jez Bretherton 0121 625 6855	
SITE NAME:	Site of Pennocrucium, east of Stretton Bridge, Brew	vood and Coven /	Lapley, Stretton and Wheaton Aston	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1006121	
CONDITION:	Extensive significant problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	Yes	
OWNER TYPE:	Private, multiple owners	CONTACT:	Imogen Newcombe 07387 524030	
SITE NAME:	Roman camp, Kinvaston, Penkridge / Lapley, Stretto	on and Wheaton A	ston	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1006104	
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Unknown	
PRINCIPAL VULNERABILITY:	Stock erosion - moderate	NEW ENTRY?:	No	
OWNER TYPE:	Private, multiple owners	CONTACT:	Jez Bretherton 0121 625 6855	

STAFFORD

	SITE NAME:	Bishton Hall, Bellamour Lane, Colwich	C18 Bishton Hall is three storeys with a principal south elevation of seven bays. The centre three bays project
	DESIGNATION:	Listed Building grade II*	forward with a pediment, rusticated stone quoins, string courses and moulded window architraves. The central
	CONDITION:	Poor	doorway has a C19 Tuscan tetrastyle stone portico. The hall has a C19 extension with a convex front to the west
	OCCUPANCY:	Occupied/in use	and a similar extension to the east, albeit of one storey.
	PRIORITY CATEGORY:	C (New entry)	The tile covered hipped roof has concealed lead flats and valleys and moulded stone cornice gutters. Most of the
	OWNER TYPE:	Commercial company	lead sheet roof coverings and cornice gutter linings require complete renewal.
© Historic England	LIST ENTRY NUMBER:	1116588	Contact: John Tiernan 0121 625 6839

© Historic England	SITE NAME:	Engine House and Boiler House at Mill Meece Pumping Station, Standon	Former pumping station built c.1914 for the Staffordshire Potteries Waterworks Company. It now operates as a museum. The building was designed by William Campbell
	DESIGNATION:	Listed Building grade II*	and constructed by Thomas Godwin and Son. The engine house and boiler house form part of an exceptionally
	CONDITION:	Poor	complete pumping station site in which the integrated process of water pumping is still readable. Works to repair
	OCCUPANCY:	Occupied/in use	damage to the boilers caused by asbestos removal were
	PRIORITY CATEGORY:	E (E)	completed in 2020, enabling the steam engines to be used once more. Roof repairs are expected to commence in
	OWNER TYPE:	Utility	2022.
	LIST ENTRY NUMBER:	1039047	Contact: Imogen Newcombe 07387 524030

	SITE NAME:	Remains of Trentham Hall, the Grand Entrance and Orangery, Park Drive, Trentham Gardens, Swynnerton	The remains of a country house dated between 1833 and 1842 by Sir Charles Barry and an orangery of 1808 by Tatham, all situated in a C18 and C19 park by Capability Brown. Although the adjacent Italian gardens have been
	DESIGNATION:	Listed Building grade II*, RPG grade II*, CA	successfully restored, the existing Grade II* structures remain at risk.
	CONDITION:	Very bad	
	OCCUPANCY:	Vacant/not in use	
© Historic England Archive	PRIORITY CATEGORY:	A (A)	
	OWNER TYPE:	Commercial company	
	LIST ENTRY NUMBER:	1190243	Contact: Louisa Moore 0777 043 5511

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В implemented.
- C Slow decay; no solution agreed.
- D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use)

use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site
 - Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

HERITAGE AT RISK 2023 / MIDLANDS / STAFFORD / STAFFORDSHIRE MOORLANDS

SITE NAME:	Moated site in Reynold's Orchard, Eccleshall		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1011051
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Animal burrowing - extensive	NEW ENTRY?:	No
OWNER TYPE:	Commercial company	CONTACT:	Jez Bretherton 0121 625 6855
SITE NAME:	Multivallate hillfort at Bury Bank, Stone Rural		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1008548
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nick Carter 0121 625 6860
SITE NAME:	Stafford Town Centre		
DESIGNATION:	Conservation Area, 80 LBs, part in SM	NEW ENTRY?:	No
CONDITION:	Poor	TREND:	No significant change
VULNERABILITY:	Low	CONTACT:	Alan Taylor (LPA) 01785 619439
SITE NAME:	Walk Mill, Eccleshall		
DESIGNATION:	Conservation Area, LB grade II	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	Deteriorating significantly
VULNERABILITY:	Medium	CONTACT:	Alan Taylor (LPA) 01785 619439

STAFFORDSHIRE MOORLANDS

	SITE NAME:	Biddulph Old Hall, Biddulph	Substantial remains of a mansion constructed in the 1580s		
	DESIGNATION:	Scheduled Monument	for Francis Biddulph. It came under siege by the Parliamentarians in 1643 when the east range was		
	CONDITION:	Fair	destroyed and the house fired. The tower was repaired in 2010 with the aid of Historic England grant funding.		
	OCCUPANCY:	Occupied/in use	Historic England is continuing discussions with the owner on the management and consolidation of the monument.		
	PRIORITY CATEGORY:	C (C)	on the management and consolidation of the monument. Applications have been made to provide new public access		
9	OWNER TYPE:	Private	to the site and secure its long-term future		
the second	LIST ENTRY NUMBER:	1014688	Contact: Nick Carter 0121 625 6860		

© Historic England



© Historic England

	SITE NAME:	Prospect Tower and attached wing, Knypersley, Biddulph	Built in 1828 by John Bateman as a gamekeeper's house and eye catcher on the Knypersley Hall estate landscape,
hA	DESIGNATION:	Listed Building grade II*	this three storey octagonal tower constructed in red sandstone has been disused for more than 25 years and is
	CONDITION:	Poor	in a poor state of repair. The reoccupation of the building is limited by the presence of bats. An options appraisal for
	OCCUPANCY:	Vacant/not in use	the building has been completed, which makes
	PRIORITY CATEGORY:	C (C)	recommendations for its future use.
	OWNER TYPE:	Local authority	
	LIST ENTRY NUMBER:	1037810	Contact: Imogen Newcombe 07387 524030

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В implemented.
- C Slow decay; no solution agreed.
- D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA LB LPA NP RPG SM
- Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument
- UA Unitary Authority WHS World Heritage Site

HERITAGE AT RISK 2023 / MIDLANDS / STAFFORDSHIRE MOORLANDS

	SITE NAME:	Alton Towers and attached garden walls and gatehouse, Alton Park, Farley	Country house, walls and gatehouse, c.1810, set in early C19 valley gardens. Derelict when listed. A complete condition survey was undertaken and emergency work
ALL TIME	DESIGNATION:	Listed Building grade II*, RPG grade I, CA	completed. The superb Pugin designed Banqueting Hall stained glass windows have been repaired and reinstated and are looking marvellous. A Conservation Management
	CONDITION:	Poor	Plan for the whole site has been prepared and a phased programme of works is ongoing to a number of buildings
I, EI C	OCCUPANCY:	Vacant/not in use	and structures within the Historic Park and Garden.
and the second s	PRIORITY CATEGORY:	C (C)	Discussions regarding further uses for the hall are taking place.
© Historic England Archive	OWNER TYPE:	Commercial company	
	LIST ENTRY NUMBER:	1374685	Contact: Louisa Moore 0777 043 5511
	SITE NAME:	The Gazebo west of Whitehough, Ipstones	An early C18 gazebo in the grounds of the C17 farmhouse at Whitehough. Stone repairs are complete and further
	DESIGNATION:	Listed Building grade II*	repair works are on-going by the owner to convert the building for garden storage.
	CONDITION:	Fair	
	OCCUPANCY:	Vacant/not in use	
	PRIORITY CATEGORY:	D (D)	
The second	OWNER TYPE:	Private	
© Historic England	LIST ENTRY NUMBER:	1374612	Contact: Louisa Moore 0777 043 5511
	SITE NAME:	The Wheldon School Michael Hutchinson Residential Centre (former Church of St Agnes), Hollinsclough, Staffordshire Moorlands	This C18 barn, converted to a combined church, school and schoolhouse in C19, was closed circa 1960 and made into a residential field study centre in 1974 for which it continued to be used until relatively recently. Internal flooding in 2018 has made the building uninhabitable.
	DESIGNATION:	Listed Building grade II*, CA	Crown reduction to a large tree close to the school was undertaken in 2019 and assorted works to ensure that the

© Histor

ric England	

CONDITION:

OCCUPANCY:

OWNER TYPE:

PRIORITY CATEGORY:

LIST ENTRY NUMBER:

1252469

Hutchinson Residential Centre (former Church of St Agnes), Hollinsclough, Staffordshire Moorlands	and schoolhouse in CI9, was closed circa 1960 and made into a residential field study centre in 1974 for which it continued to be used until relatively recently. Internal flooding in 2018 has made the building uninhabitable.
Listed Building grade II*, CA	Crown reduction to a large tree close to the school was undertaken in 2019 and assorted works to ensure that the
Poor	building remained weatherproof and structurally stable were carried out in spring 2021. The building was sold by
Vacant/not in use	auction in March 2023 and the new owner is looking to
D (C)	convert it for use as a family dwelling.
Educational (state sector)	

Contact: John Tiernan 0121 625 6839

SITE NAME:	The Butter Cross, 650m west of Lowerhouse Farm, Cheddleton			
DESIGNATION:	Scheduled Monument LIST ENTRY NUMBER: 1012665			
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Stable	
PRINCIPAL VULNERABILITY:	Visitor erosion - moderate	NEW ENTRY?:	No	
OWNER TYPE:	Private	Private CONTACT: Nic		
SITE NAME:	Dieu-la-Cres Abbey (remains of), Leek			
DESIGNATION:	Scheduled Monument, 2 LBs LIST ENTRY NUMBER: 1006107		1006107	
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining	
PRINCIPAL VULNERABILITY:	Stock erosion - moderate	NEW ENTRY?:	No	
OWNER TYPE:	Private CONTACT:		Imogen Newcombe 07387 524030	
SITE NAME:	Alton and Farley, Staffordshire Moorlands, Alton / [Denstone / Farley /	Ramshorn	
DESIGNATION:	Conservation Area, 100 LBs, part in RPG grade I, 3 _{NEW ENTRY?} . No		No	
CONDITION:	Poor	Poor TREND: Deteriorating		
VULNERABILITY:	Low CONTACT: Emily Holland (LPA) 0758		Emily Holland (LPA) 07581044981	

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no А

Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В implemented.

C Slow decay; no solution agreed.

use).

D Slow decay: solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use)

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA LB

- LB LPA NP RPG SM
- Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

UA Unitary Authority WHS World Heritage Site

HERITAGE AT RISK 2023 / MIDLANDS / STAFFORDSHIRE MOORLANDS / TAMWORTH / STOKE-ON-TRENT, CITY OF (UA)

SITE NAME:	Cheadle		
DESIGNATION:	Conservation Area, 50 LBs	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	Deteriorating
VULNERABILITY:	Low	CONTACT:	Emily Holland (LPA) 07581044981

TAMWORTH

With the second seco	SITE NAME:	Deanery wall, Lower Gungate, Tamworth	A CI4 masonry wall which was part of St Editha's Deanery. A Historic England engineer has inspected the three
	DESIGNATION:	Scheduled Monument and Listed Buildings - 2 grade II, 3 LBs, CA	surviving sections of wall, parts of which are in urgent need of maintenance and repair. The removal of plant growth, repointing and resetting of stones to wall tops are all
	CONDITION:	Poor	required. As a boundary wall, the ownership is uncertain, and liability for repair unclear.
	OCCUPANCY:	N/A	
	PRIORITY CATEGORY:	C (C)	
	OWNER TYPE:	Unknown	
	LIST ENTRY NUMBER:	1006059 and 1197033; 1207833	Contact: Imogen Newcombe 07387 524030

STOKE-ON-TRENT, CITY OF (UA)

ic Ergland	SITE NAME:	Former Wedgwood Institute (Public Library), Queen Street, Burslem	This art school, gallery and library complex was built in 1869 and constructed in brick and terracotta with an ornamented facade. The long term aspiration for this
	DESIGNATION:	Listed Building grade II*, CA	derelict building is to bring it back into use. A first phase repairs to re-roof the front range and carry out other assorted works was finished in autumn 2016. A new use for the building needs to be secured, and a strategy put i place to protect the building from further deterioration a undertake the next phase of repairs.
	CONDITION:	Poor	
	OCCUPANCY:	Part occupied/part in use	
	PRIORITY CATEGORY:	C (C)	
	OWNER TYPE:	Charity (heritage)	
	LIST ENTRY NUMBER:	1195840	Contact: Louisa Moore 0777 043 5511

	SITE NAME:	Bethesda Methodist Chapel, Albion Street, Hanley	This former Methodist chapel was built in the C19; it is known as the 'Cathedral of the Potteries' and its interior is
	DESIGNATION:	Listed Building grade II*, CA	practically intact. The Historic Chapels Trust has completed external repairs with the help of grants from
	CONDITION:	Fair	Historic England and the National Lottery Heritage Fund: other minor repair works have been undertaken with
	OCCUPANCY:	Vacant/not in use	support from The Friends group. Works to refurbish and install toilets within the detached single storey vestry block
	PRIORITY CATEGORY:	F (F)	were completed in 2019. The Trust is continually looking at
	OWNER TYPE:	Charity (heritage)	various options to increase the use of the building.
land	LIST ENTRY NUMBER:	1195821	Contact: John Tiernan 0121 625 6839

© Historic Engla

© Historic England

© Historic



-	SITE NAME:	Bottle oven and factory, Price and Kensington Teapot Works, Newcastle Street, Longport	This early C19 pottery complex contains a repaired bottle oven but is now practically derelict and mostly unoccupied. The roadside building range was demolished in November
-	DESIGNATION:	Listed Building grade II*, CA	2019. The site has been subject to fires, heritage crime, and dumping of rubbish. Historic England has offered technical
ALC: NO	CONDITION:	Very bad	support and advice to Stoke City Council, and latterly to parties interested in acquiring the site. A planning
	OCCUPANCY:	Part occupied/part in use	application has been submitted for various roadside works
	PRIORITY CATEGORY:	A (A)	and car park use. Urgent works are required to stabilise the buildings whilst a long-term solution is found for the
4°''	OWNER TYPE:	Commercial company	site.
	LIST ENTRY NUMBER:	1290799	Contact: Ben Robinson 07823 327796

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В implemented.
- C Slow decay; no solution agreed.

 D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA LB LPA NP RPG SM
- Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument
- UA Unitary Authority WHS World Heritage Site

	SITE NAME:	Chatterley Whitfield Colliery, Biddulph Road, Stoke-on-Trent	Large redundant C19-C20 colliery in need of major repair and regeneration. The site includes 15 scheduled structures	
2 100	DESIGNATION:	Scheduled Monument	and five listed buildings. A heritage based regeneration	
	CONDITION:	Very bad	ogramme was started based on a masterplan but a long rm solution still needs to be agreed. The City Council	
	OCCUPANCY:	Vacant/not in use	are continuing to explore longer term proposals which include reuse of the site.	
	PRIORITY CATEGORY:	A (A)		
	OWNER TYPE:	Local authority		
Historic England	LIST ENTRY NUMBER:	, 1015947	Contact: Bill Klemperer 0121 625 6847	
	SITE NAME:	Chatterley Whitfield: pithead baths complex (18-21), Biddulph Road, Stoke-on-Trent	Originally opened in the 1860s, Chatterley Whitfield became the first mine in Britain to draw more than a million tons of coal in a year in 1937. The pithead baths and	
	DESIGNATION:	Listed Building grade II*	canteen were erected at this time and are of interest as an example of large-scale provision for miners in the early	
	CONDITION:	Very bad	C20. On the closure of the mine, the buildings were used to accommodate a museum which has since closed. The	
and the second second	OCCUPANCY:	Vacant/not in use	whole colliery site is now vacant and these buildings are in	
	PRIORITY CATEGORY:	A (A)	very poor condition. The City Council are continuing to explore longer term proposals which include reuse of the	
	OWNER TYPE:	Local authority	site.	
) Historic England	LIST ENTRY NUMBER:	1260223	Contact: Bill Klemperer 0121 625 6847	
	SITE NAME:	Mausoleum, Stone Road, Trentham	A mausoleum built for the Dukes of Sutherland around 1808 and set opposite one of the entrances to Trentham	
	DESIGNATION:	Listed Building grade I, CA	Park. A package of urgent roof repairs were carried out with funding from Historic England and the Local Authority	
	CONDITION:	Fair	Further repairs to doors and the rear window have also	
	OCCUPANCY:	N/A	been completed in recent years. The fabric is now generall sound, with additional repairs scheduled for summer 2023.	
The second second	PRIORITY CATEGORY:	F (F)		
	OWNER TYPE:	Religious organisation		
) Historic England	LIST ENTRY NUMBER:	1210451	Contact: Imogen Newcombe 07387 524030	
	SITE NAME:	Longton Central Methodist Hall	Longton Central Methodist Hall was developed from an	
	DESIGNATION:	Listed Place of Worship grade II, CA	1842 chapel that was altered in the late C19 and completed in 1933. The building retains much of its high- quality interior including its large assembly hall with a galler	
	CONDITION:	Poor	and lantern supported on slender fluted columns with a panelled coffered ceiling. Assorted structural repairs,	
	PRIORITY CATEGORY:	A (New entry)	improvements to previous fabric repairs, replacement of	
MANDERTIN	OWNER TYPE:	Religious organisation	defective rainwater goods and renewal of roof coverings are all required to address water ingress and associated	
	LIST ENTRY NUMBER:	1472087	damage to roof construction, wall and ceiling surface finishes and decorations.	
) Historic England			Contact: John Tiernan 0121 625 6839	
	SITE NAME:	Church of St John the Baptist, Cross Hill, Burslem	This church was largely rebuilt in 1717 but retains its medieval tower. Non-breathable paint on the nave	
	DESIGNATION:	Listed Place of Worship grade II	external walls is trapping moisture causing significant levels of damp internally and the deterioration of the outer brick	
1 1 A A A	CONDITION:	Poor	face. Outbreaks of dry rot have occurred in the past and re-roofing with inappropriate and heavy concrete tiles on	
	PRIORITY CATEGORY:	C (C)	the hipped nave roof is leading to structural problems. The	
	OWNER TYPE:	Religious organisation	building has multiple fabric defects and has been subjected to heritage crime. Protracted negotiations to lease this	
	OWNER TYPE: LIST ENTRY NUMBER:	()	building has multiple fabric defects and has been subjected to heritage crime. Protracted negotiations to lease this place of worship to the New Testament Church of God have yet to be concluded.	

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed.
 C Slow decay; no solution agreed.

- D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site
 - Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

HERITAGE AT RISK 2023 / MIDLANDS / STOKE-ON-TRENT, CITY OF (UA)

where	SITE NAME:	Church of St Mark, Broad Street, Stoke-on-Trent	This Commissioners church was built c1830 and consists of a nave with galleries and a west tower; the chancel was
ARE	DESIGNATION:	Listed Place of Worship grade II	added in 1868. The tower clock stage is subdivided by blind pointed panels with engaged shafts secured by ferrous
	CONDITION:	Poor	metal fixings and several of these have failed and fallen to the ground. Holding repairs to secure defective plaster
	PRIORITY CATEGORY:	F (D)	ceilings above the galleries were carried out in 2017 and
And And	OWNER TYPE:	Religious organisation	water ingress is suspected to be the cause of the problem. A National Lottery Heritage Fund delivery grant was
R BI	LIST ENTRY NUMBER:	1220134	awarded in December 2021 and repair works are due to be completed by the end of 2022.
			be completed by the end of 2022.

Contact: John Tiernan 0121 625 6839

© Historic England



SITE NAME:	Church of St John, Newcastle Road, Stoke-on-Trent	This C19 church was enlarged to its present size in 1908 and consists of a nave and chancel with a north porch,
DESIGNATION:	Listed Place of Worship grade II	south aisle, south east chapel, vestry and a south west tower with a broached spire. The church was affected by a
CONDITION:	Very bad	fire in April 2022 which resulted in damage to the nave and chancel roofs together with the loss of glazing to the
PRIORITY CATEGORY:	F (F)	chancel east window. All the interior was contaminated by
OWNER TYPE:	Religious organisation	the effects of combustion. The church has been secured and the damage assessed by the insurer's loss adjuster. A
LIST ENTRY NUMBER:	1220810	Faculty is in progress and roof repairs are anticipated to commence in summer 2023.

© Historic England

SITE NAME:

SITE NAME: DESIGNATION: CONDITION: VULNERABILITY:

SITE NAME: DESIGNATION: CONDITION: VULNERABILITY:

SITE NAME: DESIGNATION: CONDITION:

VULNERABILITY:

SITE NAME:

DESIGNATION:

CONDITION:

VULNERABILITY:

DESIGNATION: CONDITION: VULNERABILITY:

- 61d	1220010	commence in sur	nmer 2023.
		Contact: John Tie	ernan 0121 625 6839
	Caldon Canal, Stoke-on-Trent, Endon and Stanley		
	Conservation Area, 2 LBs, part in RPG grade II*, part in SM	NEW ENTRY ?:	No
	Very bad	TREND:	Improving
	Medium	CONTACT:	Jon Goodwin (LPA) 01782 232597
	Longton Town Centre, Longton		
	Conservation Area, 17 LBs	NEW ENTRY?:	No
	Very bad	TREND:	Improving
	Medium	CONTACT:	Jon Goodwin (LPA) 01782 232597
	Newcastle Street, Middleport		
	Conservation Area, LB grade II	NEW ENTRY?:	No
	Poor	TREND:	No significant change
	High	CONTACT:	Jon Goodwin (LPA) 01782 232597
	Stoke Town, Stoke		
	Conservation Area, 17 LBs, SM	NEW ENTRY?:	No

TREND:

CONTACT:

NEW ENTRY?

TREND:

CONTACT:

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no А

- solution agreed. Immediate risk of further rapid в deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.

Slow decay; solution agreed but F not yet implemented.

Trent & Mersey Canal, Stoke-on-Trent, Barlaston

Conservation Area, 20 LBs, part in SM

Very bad

Medium

Very bad

Medium

D

Е

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

No significant change

No

Improving

Jon Goodwin (LPA) 01782 232597

Jon Goodwin (LPA) 01782 232597

- CA
- LB LPA
- Conservation Area Listed Building Local Planning Authority National Park NP RPG
 - Registered Park and Garden Scheduled Monument
- SM
- UA Unitary Authority WHS World Heritage Site

SITE NAME:

DESIGNATION:

CONDITION:

OCCUPANCY:

PRIORITY CATEGORY:

TELFORD AND WREKIN (UA) Situated within the historic industrial site of the Granville SITE NAME Site of pumping engine at Country Park nature reserve. Includes C19 standing, buried Muxton Bridge colliery, Donnington and Muxton and earthwork remains of the former rotative beam pumping engine, used for draining coal workings at Muxton Bridge Colliery. The condition of the engine house is very DESIGNATION: Scheduled Monument poor with loose mortar joints and cracking causing CONDITION: Very bad dislodged brickwork, which associated efflorescence, spalling and iron-jacking. There is extreme vegetation and OCCUPANCY: Vacant/not in use scrub surrounding the engine. Detritus has built up within PRIORITY CATEGORY: A (A) the shafts. Telford and Wrekin Council are keen to engage and prioritise assessment. OWNER TYPE: Local authority © Historic England LIST ENTRY NUMBER: 1018468 Contact: Imogen Newcombe 07387 524030



SITE NAME:	Gatehouse to former Caynton Manor, Edgmond	of a historic manorial complex. The building's upper roon have elaborate decorative plasterwork friezes and an
DESIGNATION:	Listed Building grade II*	have elaborate decorative plasterwork friezes and an overmantle featuring the arms of the Yonge family with the
CONDITION:	Poor	date 1635. Little is known of the building's original cont
OCCUPANCY:	Vacant/not in use	farm related activities for many years. The building is
PRIORITY CATEGORY:	A (A)	is compromised by the close proximity of a C19 barn and
OWNER TYPE:	Private	other later additions. The gatehouse was listed grade II* in October 2018.
LIST ENTRY NUMBER:	1459113	Contact: John Tiernan 0121 625 6839

© Historic England



© Historic England



OWNER TYPE:	Charity (heritage)	
LIST ENTRY NUMBER:	1293325	Contact: Louisa Moore 0777 043 5511
SITE NAME:	Charlton Castle, Wrockwardine	A medieval moated site which is very overgrown and has
DESIGNATION:	Scheduled Monument	several uprooted trees damaging the earthworks. There are some elements of standing masonry exposed. The site
CONDITION:	Very bad	needs an assessment of condition and the development of an appropriate management regime.
OCCUPANCY:	N/A	an appropriate management regime.
PRIORITY CATEGORY:	C (C)	



© Historic England

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- Slow decay; no solution agreed. С
- Slow decay; solution agreed but F not yet implemented.

D

Е

- Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use)
- Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.
- NOTE Last year's priority category is shown in brackets (otherwise. New Entry is noted).

ABBREVIATIONS

- Conservation Area Listed Building
- LB I PA
- Local Planning Authority National Park NP
- Registered Park and Garden Scheduled Monument RPG

- SM ΪA
- Unitary Authority World Heritage Site ŴĤS



SITE NAME:Church of St Peter, Church Road, St. Georges and PriorsleeDESIGNATION:Listed Place of Worship grade IICONDITION:PoorPRIORITY CATEGORY:A (A)OWNER TYPE:Religious organisationLIST ENTRY NUMBER:1033297		
CONDITION:PoorPRIORITY CATEGORY:A (A)OWNER TYPE:Religious organisation	SITE NAME:	Church of St Peter, Church Road, St. Georges and Priorslee
PRIORITY CATEGORY: A (A) OWNER TYPE: Religious organisation	DESIGNATION:	Listed Place of Worship grade II
OWNER TYPE: Religious organisation	CONDITION:	Poor
0 0	PRIORITY CATEGORY:	A (A)
LIST ENTRY NUMBER: 1033297	OWNER TYPE:	Religious organisation
	LIST ENTRY NUMBER:	1033297

Private

1019649

Severn Wharf Building

The Gorge

WHS

Poor

B (B)

(Premises of Ironbridge Gorge Museum Trust), the Wharfage,

Listed Building grade II*, CA,

Part occupied/part in use

The Church of St Peter was designed by Francis Halley of Shifnal and built between 1825 - 1827 to replace a C12 chapel. It consists of a nave and west tower to which the chancel was added in 1903. The church is constructed in brindle brickwork with stone dressings and has slatecovered roofs which now require stripping and relaying. Concealed ferrous metal cramps have severely disrupted the masonry to the tower bell lights resulting in section of stone becoming detached. The vestry has settled and rotated away from the chancel wall. Closure procedures were started in 2022.

Large former warehouse now Museum of the Gorge on

openings.The four parallel pitches of plain clay tile roof

have valleys and parapet gutters that leak. Valley gutters

showing decay with structural implications. An Historic

England Repair Grant has developed a solution. Works are

have been overlaid with successive layers of gutter materials that pond and leak. Wall plates below are

due to be carried out over the next year.

the north bank of the River Severn. Mid C19 of red brick with yellow brick dressings in Gothick style. Castellated parapets with pinnacles and buttresses and pointed arched

Contact: John Tiernan 0121 625 6839

Contact: Jez Bretherton 0121 625 6855

HERITAGE AT RISK 2023 / MIDLANDS / TELFORD AND WREKIN (UA) / NORTH WARWICKSHIRE

A.	SITE NAME:	Church of St Peter, Wrockwardine	This C12 cruciform church has a nave and chancel, transepts and a crossing tower with later medieval chapels
JACK.	DESIGNATION:	Listed Place of Worship grade I, CA	added to the north and south sides of the chancel. Subjected to numerous campaigns of alteration and repair over time with prominent structural reinforcement in the
	CONDITION: Poor form of angle buttresses to the tow	form of angle buttresses to the tower, a National Lottery Heritage Fund Grant for Places of Worship funded re-	
	PRIORITY CATEGORY:	D (D)	roofing and high-level masonry repairs to the crossing
	OWNER TYPE:	Religious organisation	tower which were completed in 2018. All the remaining plain clay tile roofs and cast-iron rainwater goods are still in
	LIST ENTRY NUMBER:	1030939	urgent need of repair and renewal.
istoric England			Contact: John Tiernan 0121 625 6839

© His

SITE NAME:	Site of pumping engine at Muxton Bridge colliery, I	Donnington and Mu	xton
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1018468
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Other	NEW ENTRY ?:	Yes
OWNER TYPE:	Local authority	CONTACT:	Imogen Newcombe 07387 524030
SITE NAME:	Canal aqueduct over River Tern, Rodington		
DESIGNATION:	Scheduled Monument, LB grade I	LIST ENTRY NUMBER:	1006275
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Jez Bretherton 0121 625 6855
site name:	Moated site and a fishpond 160 metres and 280 metres an	etres south of The	Farm, Charlton, Wrockwardine
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1019649
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Jez Bretherton 0121 625 6855

WARWICKSHIRE

NORTH WARWICKSHIRE

SITE NAME:



© Historic England

Merevale Abbey, a Cistercian monastery, associated water control features and industrial remains Scheduled Monument, 6 LBs, part in RPG grade II* CONDITION: Poor OCCUPANCY: N/A PRIORITY CATEGORY: C (C) OWNER TYPE: Private LIST ENTRY NUMBER: 1014682

Mid-C12 Cistercian monastery retaining several visible fragments of major monastic buildings but also earthwork and buried remains which illustrate the development of the monastery. Stonework in the refectory is eroding and needs addressing through a condition assessment to inform conservation. Historic England is continuing to work with the Estate to address the site.

Contact: Imogen Newcombe 07387 524030

PRIORITI CATEGORIES	PRIORITY	CATEGORIES
---------------------	----------	------------

- Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; В solution agreed but not yet implemented.
- C Slow decay; no solution agreed.

Slow decay; solution agreed but F not yet implemented.

D

Е

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA
- LB LPA
- NP RPG
- Conservation Area Listed Building Local Planning Authority National Park
- Registered Park and Garden Scheduled Monument SM
- UA WHS Unitary Authority World Heritage Site

HERITAGE AT RISK 2023 / MIDLANDS / NORTH WARWICKSHIRE

SITE NAME:

DESIGNATION:

CONDITION:

OCCUPANCY:

OWNER TYPE:

SITE NAME:

DESIGNATION:

CONDITION:

OCCUPANCY:

OWNER TYPE:

D

Е

PRIORITY CATEGORY:

LIST ENTRY NUMBER:

PRIORITY CATEGORY:

LIST ENTRY NUMBER:



SITE NAME:	Beech House, 19 Market Street, Atherstone	Town house in the Queen Anne style dated 1708. The interiors are largely unaltered and most of the original
DESIGNATION:	Listed Building grade II*, CA	features are intact. The property has been vacant for several years. A scheme for the repair and refurbishme the building has been agreed following discussions betw the owner and the Local Planning Authority. Recent wo
CONDITION:	Poor	
OCCUPANCY:	Vacant/not in use	undertaken to refurbish the exterior. No site visit has been
PRIORITY CATEGORY:	D (D)	possible this year.
OWNER TYPE:	Commercial company	
LIST ENTRY NUMBER:	1185175	Contact: Rosamund Worrall 0121 625 6893

© Historic England



© Historic England Archive

	SITE NAME:	Hartshill Castle, Castle Road, Hartshill	Motte and bailey castle, converted C14 enclosure castle with remains of C16 farmhouse. Upstanding remains have
	DESIGNATION:	Scheduled Monument and Listed Building grade II	Lapworth Charitable Trust has undertaken consolidation works on the enclosure wall, vegetation management and good steps to reduce vandalism, anti-social behaviour and theft. Further vegetation works are needed and repair and
	CONDITION:	Poor	
	OCCUPANCY:	N/A	
	PRIORITY CATEGORY:	A (A)	consolidation of the C16 remains. Historic England are liaising with the landowners regarding these works and the
14	OWNER TYPE:	Private	on-going maintenance of the site.
	LIST ENTRY NUMBER:	1011197 and 1034748	Contact: Neil Rimmington 07775 550 674



© Historic England

© Historic England



SITE NAME: Maxstoke Priory, Church Road, Maxstoke Scheduled Monument and Listed DESIGNATION: Buildings - 6 grade II*, 2 LBs CONDITION: Poor N/A OCCUPANCY: PRIORITY CATEGORY: A (A) OWNER TYPE: Private, multiple owners 1011195 and 1034822; LIST ENTRY NUMBER 1034823; 1365129; 1034821;

Kingsbury Hall, Kingsbury

part in CA

Vacant/not in use

1116038; 1320105

Middleton Hall, Middleton

Listed Building grade II*

Occupied/in use

Charity (heritage)

Poor

D (D)

1365196

Poor

E (E)

Private

Scheduled Monument and Listed

Buildings - I grade II*; I grade II,

1019978 and 1116550; 1034721

Substantial remains of an early CI4 Augustinian monastery including infirmary, precinct walls and outer gatehouse with attached barn and farmhouse. The buildings are steadily decaying, the granary range is in poor condition and the infirmary structure is propped. Historic England has part funded repairs to the boundary walls and is working with the owners to review the condition of the gatehouse and other sections, looking to address their condition.

A manor house of c. 1500 with late C16 and C18 rebuilding

works undertaken. A new scheme in association with some

conversion of the building was approved and structural

neighbouring development has been applied for which

and early C19 wing. A scheme for the residential

could see the building repaired and in use.

Contact: Rosamund Worrall 0121 625 6893

Contact: Imogen Newcombe 07387 524030

The main C18 house at Middleton hall is located on the west side of an enclosed courtyard which incorporates C14 and C16 buildings with extensive early C19 additions. The house is L-shaped on plan with rendered walls, tiled roofs and moulded eaves cornices, the latter feature concealing a perimeter gutter of variable width. These gutters have been modified over time, built up and repaired with inappropriate materials to the point where urgent repairs are now required. An Historic England repairs grant was awarded in March 2022 and repair works are due to commence in autumn 2023.

Contact: John Tiernan 0121 625 6839

PRIORITY CATEGORIES

© Historic England

Immediate risk of further rapid deterioration or loss of fabric; no

- solution agreed. Immediate risk of further rapid deterioration or loss of fabric: solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but not yet implemented. Under repair or in fair to good

repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use)

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise. New Entry is noted).

- Conservation Area Listed Building
- LB I PA
- Local Planning Authority National Park NP
- RPG Registered Park and Garden Scheduled Monument
- SM
- ΪA Unitary Authority World Heritage Site WHS

HERITAGE AT RISK 2023 / MIDLANDS / NORTH WARWICKSHIRE

	SITE NAME:	Stables range north east of Middleton Hall, Middleton	Originally stables and a lodging block C1570, this building is timber framed with brick infill panels. It consists of a four-
	DESIGNATION:	Listed Building grade II*	bay main range with a two-bay cross wing at the north end and a two-storey gabled porch to the left of the centre.
	CONDITION:	Poor	There is a courtyard of farm buildings to rear. The building is disused and in need of repair to ensure its structural
APPART DE THE THE	OCCUPANCY:	Vacant/not in use	stability and to keep it weatherproof. A Master plan to
	PRIORITY CATEGORY:	D (D)	develop the site as a heritage visitor centre has been produced, repurposing the stable block and adjacent
	OWNER TYPE:	Charity (heritage)	courtyard as the new visitor entrance to the Middleton Hall Estate.
England	LIST ENTRY NUMBER:	1365197	Contact: John Tiernan 0121 625 6839



© Historic Er

© Historic England

and the	SITE NAME:	Grendon Bridge, Polesworth / Grendon	Stone bridge, probably C15 constructed in sandstone. Now in poor condition with parts of the parapet missing. A
40-10	DESIGNATION:	Scheduled Monument and Listed Building grade II*	condition survey is needed to assess the scale of repairs. The owners are exploring funding options regarding its future assessment and repair.
	CONDITION:	Poor	
	OCCUPANCY:	N/A	
	PRIORITY CATEGORY:	C (C)	
	OWNER TYPE:	Private	
	LIST ENTRY NUMBER:	1005756 and 1186247	Contact: Imogen Newcombe 07387 524030



Homestead moat, footbridge and gate piers c. 1686, with SITE NAME: Moat, footbridge and gatepiers to Shustoke Hall Farmhouse, late C18 service wing which is in poor condition. Substantial sections of overgrown walls and buttresses Moat House Lane, Shustoke were previously leaning outwards and required rebuilding. Much of this work has been carried out by the Estate. DESIGNATION: Listed Building grade II* Progress has been made since 2013 with repointing to the CONDITION: Poor moat walls, but further repairs are needed. Historic OCCUPANCY: N/A England is advising on repairs to the remaining sections. PRIORITY CATEGORY: A (A) OWNER TYPE: Private LIST ENTRY NUMBER: 1226189 Contact: Imogen Newcombe 07387 524030

-	SITE NAME:	Alvecote priory and dovecote, Shuttington	The listed and scheduled remains of a C12 Benedictine monastery. The primary structure on site represents the C14 remodelling of the building and has been subject to heritage crime and natural deterioration. An associated
	DESIGNATION:	Scheduled Monument, 2 LBs	
i -	CONDITION:	Poor	medieval dovecote is also affected by issues with its roof covering, water penetration and vandalism. Historic
and the	OCCUPANCY:	N/A	England is encouraging the Local Authority to establish a
to the s	PRIORITY CATEGORY:	C (C)	management plan for the site and carry out repairs to the standing remains of the priory and dovecote.
	OWNER TYPE:	Local authority, multiple owners	
hive	LIST ENTRY NUMBER:	1020623	Contact: Imogen Newcombe 07387 524030

© Historic England Archiv



	SITE NAME:	Church of St Mary, Sheepy Road, Atherstone	Large imposing church constructed in two parts with a central tower. Chancel may date from C12 as an
1	DESIGNATION:	Listed Place of Worship grade II*, CA	independent chapel, and then remodelled c1383 when the nave was added. Older parts are built in rubble. Nave and aisles were rebuilt in 1849 in rubble granite, wagon roof
	CONDITION:	Poor	with moulded braces and purlins. The octagonal tower was part of the original chapel, but was remodelled in the
	PRIORITY CATEGORY:	CATEGORY: C (C) CI3	CI3/CI4. Works to the roof have been completed but
	OWNER TYPE:	Religious organisation	the high level stonework of the tower remains in poor condition and in need of repair.
	LIST ENTRY NUMBER:	1365164	Contact: Imogen Newcombe 07387 524030

© Historic England

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; В solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.

D

Е

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

- CA
- LB LPA
- Conservation Area Listed Building Local Planning Authority National Park NP RPG
- Registered Park and Garden Scheduled Monument
- SM UA WHS
 - Unitary Authority World Heritage Site

A

HERITAGE AT RISK 2023 / MIDLANDS / NORTH WARWICKSHIRE / NUNEATON AND BEDWORTH / RUGBY

SITE NAME:	Merevale Abbey, a Cistercian monastery, associated	d water control fea	tures and industrial remains
DESIGNATION:	Scheduled Monument, 6 LBs, part in RPG grade II*	LIST ENTRY NUMBER:	1014682
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Deterioration - in need of management	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Imogen Newcombe 07387 524030
SITE NAME:	Roman Camp, Mancetter		
DESIGNATION:	Scheduled Monument, part in CA	LIST ENTRY NUMBER:	1005736
CONDITION:	Unknown	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Other	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Imogen Newcombe 07387 524030
SITE NAME:	Alvecote priory and dovecote, Shuttington		
DESIGNATION:	Scheduled Monument, 2 LBs	LIST ENTRY NUMBER:	1020623
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Local authority	CONTACT:	Imogen Newcombe 07387 524030

NUNEATON AND BEDWORTH

	-		
	SITE NAME:	Park Farmhouse, Arbury Park, Nuneaton	Late C15 farmhouse with C16 and C17 alterations, to the north west of Arbury Park. Following a building survey,
	DESIGNATION:	Listed Building grade II*	works were carried out to support and protect the structure while schemes and options for future use were
	CONDITION:	Very bad	considered and discussed by the Estate with Historic
AL STREAM	OCCUPANCY:	Vacant/not in use	covering to help prevent further deterioration of the fragile
	PRIORITY CATEGORY:	A (A)	timber frame.
一 一 一 一 一 一 一 一 一 一 一 一	OWNER TYPE:	Private	
© Historic England	LIST ENTRY NUMBER:	1365048	Contact: Jane Holt 07425732881
© Historic England	CONDITION: OCCUPANCY: PRIORITY CATEGORY: OWNER TYPE:	Very bad Vacant/not in use A (A) Private	structure while schemes and options for future use were considered and discussed by the Estate with Historic England. The estate has installed a protective steel roof covering to help prevent further deterioration of the fragile timber frame.

A MARTIN	SITE NAME:	The Tea House, Arbury Park, Nuneaton	Mid-C18 summerhouse located c.500 metres east north east of Arbury Hall. The Tea House is situated on the
THE H	DESIGNATION:	Listed Building grade II*, RPG grade II*	north east shore of a small lake on the eastern edge of the C18 park. The roof has collapsed and it is in a very bad state of repair and continues to deteriorate. Action is
	CONDITION:	Very bad	needed urgently to halt decay and save what is left of the building.
OCCUPANCY: Vacant/not in use	building.		
	PRIORITY CATEGORY:	A (A)	
	OWNER TYPE:	Private	
toric England	LIST ENTRY NUMBER:	1299615	Contact: Jane Holt 07425732881

RUGBY

© Histo

SITE NAME:	Brandon Castle, Brandon and Bretford		
DESIGNATION:	Scheduled Monument, part in CA	LIST ENTRY NUMBER:	1011371
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Improving
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Commercial company	CONTACT:	Imogen Newcombe 07387 524030

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no А

Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В implemented.

```
C Slow decay; no solution agreed.
```

 D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

- CA LB LPA NP RPG SM
- Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

UA Unitary Authority WHS World Heritage Site

HERITAGE AT RISK 2023 / MIDLANDS / RUGBY

SITE NAME:	Barrow cemetery 400 metres north east of Bretfo	rd, Brandon and Br	etford / King's Newnham
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1005722
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners	CONTACT:	Imogen Newcombe 07387 524030
SITE NAME:	Tripontium Roman Station, Churchover		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1005759
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Metal detecting - unlicensed	NEW ENTRY?:	No
OWNER TYPE:	Commercial company, multiple owners	CONTACT:	Imogen Newcombe 07387 524030
ITE NAME:	Prehistoric circular earthworks, King's Newnham		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1005717
CONDITION:	Unknown	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Imogen Newcombe 07387 524030
ITE NAME:	Prehistoric pit alignment and associated features of Farm, Thurlaston / Church Lawford	n Lawford Heath, a	djacent to the northernmost Blue Bo
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1020937
CONDITION:	Unknown	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Imogen Newcombe 07387 524030
SITE NAME:	Bowl barrow on Lammas Hill, Wolston		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1016885
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
RINCIPAL VULNERABILITY:	Arable clipping	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Imogen Newcombe 07387 524030
ITE NAME:	Bowl barrow 490 metres north west of Abbey Far	m, Wolvey	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1016845
CONDITION:	Unknown	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Imogen Newcombe 07387 524030
SITE NAME:	Bowl barrow 900 metres north of Copston Farm,	Wolvey	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1016846
CONDITION:	Unknown	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Imogen Newcombe 07387 524030
			0

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no А

- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed.
 C Slow decay; no solution agreed.

 D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user lidentified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

HERITAGE AT RISK 2023 / MIDLANDS / RUGBY / STRATFORD-ON-AVON

	SITE NAME:	Ryton House, Ryton-on- Dunsmore	Small Regency landscape surrounding the shell of a grade II listed Regency villa. Late C20 extensions to the villa extend			
	DESIGNATION:	Registered Park and Garden grade II, part in LB grade II	over the gardens. Longstanding lack of regular maintenance has left the boundary belt, historic drive, shrubberies and lakes in poor condition. The setting is compromised by			
	CONDITION:	Generally unsatisfactory with major localised problems	roads and residential development. Its future is uncertain.			
	VULNERABILITY:	High				
The surface has the	TREND:	Declining				
ic England	NEW ENTRY?:	No				
	OWNER TYPE:	Mixed, multiple owners				
	LIST ENTRY NUMBER:	1001343	Contact: Louisa Moore 0777 043 5511			

STRATFORD-ON-AVOI



DN			
	SITE NAME:	St Nicholas' Church, Ettington Park, Ettington	The chapel of St Nicholas was built in the C13 to service the village of Ettington some two miles away. However, the
	DESIGNATION:	Scheduled Monument, LB grade I	building was superceded by a better located church in 1798 and is now partially ruinous. It is the family mausoleum of the Shirley family. The church has suffered from natural
	CONDITION:	Poor	erosion and other threats including birds nesting in the tower, structural decay of standing masonry and other
	OCCUPANCY:	N/A	issues associated with rainwater goods and cementitious
	PRIORITY CATEGORY:	D (D)	repairs. Repair works on the south wall of nave and exclusion of birds from tower completed. Ongoing repair
	OWNER TYPE:	Private	discussions
	LIST ENTRY NUMBER:	1005744	Contact: Imogen Newcombe 07387 524030

© Historic England

© Historia



Nonconformist estate chapel of 1877 by George Ingall for G.F. Muntz of Umberslade Park. The chapel has not been SITE NAME Umberslade Baptist Chapel, Spring Lane, Tanworth-in-Arden used as a place of worship for many years and has been DESIGNATION: Listed Building grade II* acquired by the Historic Chapels Trust. Roof repairs have been carried out and the building is drying out. There is CONDITION: Poor structural movement in the nave walls and north west nave OCCUPANCY: Vacant/not in use window. Holes have appeared in the tiled floor due to collapses into the heating ducts. There is now very bad PRIORITY CATEGORY: C (F) woodworm in the vestry. OWNER TYPE: Charity (heritage) LIST ENTRY NUMBER: Contact: Louisa Moore 0777 043 5511 1382428

© Historic England



DESIGNATION:

CONDITION:

OWNER TYPE:

D

Е

PRIORITY CATEGORY:

LIST ENTRY NUMBER:

© Historic England



SITE NAME:	Roman Catholic Church of St Peter Paul and Elizabeth, Coughton	In 1851-3 the Throckmorton family built a substantial church and presbytery on the edge of their estate, from designs by Charles Hansom. The Throckmorton family has		
DESIGNATION:	Listed Place of Worship grade II*, CA	been at Coughton Court since C15, and the house was a Catholic recusant centre from the 1570s. The terracotta tiled roof appears to be at the end of its life with several		
CONDITION:	Poor	tiles dislodged and damp showing internally. Poor cementitious repairs, some recent, may further erode and		
PRIORITY CATEGORY:	C (C)	damage the limestone.		
OWNER TYPE:	Religious organisation			
LIST ENTRY NUMBER:	1355381	Contact: Louisa Moore 0777 043 5511		
SITE NAME:	Church of St Botolph, Church	Church of medieval origins with some Norman features		

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed. Immediate risk of further rapid В deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.

Lane, Farnborough

Religious organisation

II*, CA

Poor

C (C)

1299775

Listed Place of Worship grade

- Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use)
- Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.
- NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

north-east corner of the north aisle.

Contact: Louisa Moore 0777 043 5511

and a 'Scott spire' dating from 1875. It is built in soft

ironstone and set close to Farnborough Hall. Repairs and

maintenance carried out in the past year have addressed the poor rainwater goods and roof. The high level

stonework remains in poor condition, especially to the

- Conservation Area Listed Building CA
- LB I PA
 - Local Planning Authority National Park NP
 - Registered Park and Garden Scheduled Monument RPG
 - SM
 - UA Unitary Authority WHS World Heritage Site

HERITAGE AT RISK 2023 / MIDLANDS / STRATFORD-ON-AVON

	SITE NAME:	Church of St Giles, Church Lane, Gaydon	Small ironstone ashlar church with moulded cornices, designed by Squirrill of Learnington and dating from 1852.
	DESIGNATION:	Listed Place of Worship grade II	The church is modest in size but is in poor condition externally due to the friability of the Horton Stone. Some
	CONDITION:	Poor	parts of the church are in poor structural condition, especially on the east gable, which has large cracks and the
	PRIORITY CATEGORY:	A (A)	tower and spire give concern. The gutters are also in poor
	OWNER TYPE:	Religious organisation	condition.
	LIST ENTRY NUMBER:	84784	Contact: Louisa Moore 0777 043 5511

© Historic England

	SITE NAME:	Church of St Peter, Warwick Road, Kineton	The prominently located Church of St Peter, Kineton dates from the C13, with alterations from the C14, C15 and
	DESIGNATION:	Listed Place of Worship grade II*, CA	C18. It was remodelled and repaired in 1873-89 but the soft local ironstone has not lasted well. A National Lottery Heritage Fund and Historic England Repair Grant for Places
	CONDITION:	Poor	of Worship awarded in 2012 has repaired the high level and tower's stonework which was in extremely poor
	PRIORITY CATEGORY:	C (C)	condition. Further repairs are needed to the stonework on
	OWNER TYPE:	Religious organisation	the nave's elevations and to the rainwater goods to the nave.
	LIST ENTRY NUMBER:	1381924	Contact: Louisa Moore 0777 043 5511

© Historic England

1	1			
FA	Ň		-	
1	1	1	-	STOR .
		1000		
-	R A	4	III S	

	SITE NAME:	Church of All Saints, Church Road, Ladbroke	C13 and C14 church with C15 additions, extensively restored in 1876 by Gilbert Scott. It has a square tower
	DESIGNATION:	Listed Place of Worship grade I, CA	with spire, constructed in banding of limestone lias and ironstone in square coursed rubble. The tower buttresses are built in ironstone. The church is built in lime lias with
	CONDITION:	Fair	ashlar dressing. Mostly red terracotta tiled roofs. Despite its general fair condition, the stone buttresses to the tower
	PRIORITY CATEGORY:	D (C)	are badly eroded and have open joints. Some of the
	OWNER TYPE:	Religious organisation	stonework around the windows is badly delaminated and stonework at the base of the walls is also poor.
	LIST ENTRY NUMBER:	1035567	Contact: Louisa Moore 0777 043 5511

© Historic England

	SITE NAME:
	DESIGNATION:
INT AND	CONDITION:
THE OWL	PRIORITY CATEGORY:
	OWNER TYPE:
	LIST ENTRY NUMBER:

	Church of St Leonard, Vicarage Lane, Priors Marston	Late C13 origins although the aisle was enlarged in C14. The tower was remodelled or rebuilt in the 1720s and the	
	Listed Place of Worship grade II, CA	chancel in 1863. The walls are built in ironstone, with limestone dressing, coursed rubble and tiled roofs. The stonework on the tower parapet is in very poor condition	
	Poor	because of expanding metal cramps dislodging the stonework and this is now loose. The tracery to the tower	
ŕ:	C (C)	windows also needs replacing as it has fallen in parts. The	
	Religious organisation	church is exploring funding to carry out repairs.	
:	1374950	Contact: Louisa Moore 0777 043 5511	

© Historic England



SITE NAME:	Church of St Peter, Tysoe Road, Radway, Radway	Small parish church built in 1866 to replace a medieval church which was located in a different part of the village of
DESIGNATION:	Listed Place of Worship grade II, CA	Radway, at the base of the Edge Hill battlefield site. The church was built in Gothic Revival style and has a three bay chancel, nave and aisles. It is built in local Hornton
CONDITION:	Poor	ironstone and regularly coursed with terracotta plain tiled roofs. The tower has four stages with string courses, a
PRIORITY CATEGORY:	C (C)	moulded cornice and a broach spire. The roof, which is still
OWNER TYPE:	Religious organisation	original, is in very poor condition because of poor detailing despite maintenance. The condition of the rainwater goods
LIST ENTRY NUMBER:	1184627	is poor.
		Contact: Louisa Moore 0777 043 5511

© Historic England

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В implemented.
- C Slow decay; no solution agreed.

D

Е

Slow decay: solution agreed but F not yet implemented. Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

- CA LB
- LPA NP RPG SM
- Conservation Area Listed Building Local Planning Authority National Park
 - Registered Park and Garden Scheduled Monument

- UA Unitary Authority WHS World Heritage Site

HERITAGE AT RISK 2023 / MIDLANDS / STRATFORD-ON-AVON

	SITE NAME:	Church of St Peter ad Vincula, Ratley and Upton	Coursed rubble ironstone built church built in Decorated style. CI2 chancel and CI3 nave and tower with CI4
	DESIGNATION:	Listed Place of Worship grade II*, CA	south aisle and chapel. Internally the nave has a flat plastered ceiling. The church sits on a sloping site and receives much rainwater run off causing damp to the fabric.
	CONDITION:	Poor	The south aisle roof and rainwater goods have been repaired. The tower vice now has structural problems due
	PRIORITY CATEGORY:	B (C)	to the decay of a supporting beam and a collapse of high
	OWNER TYPE:	Religious organisation	level stonework will happen if not repaired.
	LIST ENTRY NUMBER:	1355550	Contact: Louisa Moore 0777 043 5511
ngland			

© Historic Eng



~	SITE NAME:	Church of St Andrew, Church Street, Temple Grafton	Original Saxon church rebuilt in 1875 by Frederick Preedy in lias and coursed ironstone ashlar with quoined openings.
	DESIGNATION:	Listed Place of Worship grade II, CA	Plain red tiled nave roof with slated north and south aisles roof. The upper part of the porch is the staged belfry, a turret in timber frame with lath and plaster, covered with
	CONDITION:	Poor	oak shakes. The timber frame turret is now in extremely poor condition with open joints and many of the shakes
	PRIORITY CATEGORY:	C (C)	missing. There are also issues with the condition of the roof
	OWNER TYPE:	Religious organisation	finish, rainwater goods and high level stonework.
	LIST ENTRY NUMBER:	1382790	Contact: Louisa Moore 0777 043 5511

© Historic England



	SITE NAME:	Church of St Michael, Church Hill, Warmington	The church dates from the late C12 with additions in the C13 and a mid-C14 north aisle, chancel, vestry and west
	DESIGNATION:	Listed Place of Worship grade I, CA	tower. The church was restored in 1850 and 1876 by Sir GG Scott. It is constructed in coursed local ironstone with ashlar stone tower, spire and dressing, with a terracotta
	CONDITION:	Poor	tiled roof. The roof to the nave is in extremely poor condition and a large number of tiles have slipped. Despite
1	PRIORITY CATEGORY:	A (A)	some repairs carried out in 2017 the south part of the roof
1	OWNER TYPE:	Religious organisation	remains in poor condition, with rain leaking into the interior affecting the supporting timber structure.
1000	LIST ENTRY NUMBER:	1355583	Contact: Louisa Moore 0777 043 5511

© Historic England

SITE NAME:	Oversley Castle, Alcester		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1005750
CONDITION:	Unknown	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Commercial company	CONTACT:	Imogen Newcombe 07387 524030
SITE NAME:	Castle Hill Motte, Brailes		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1018858
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Stock erosion - extensive	NEW ENTRY?:	No
OWNER TYPE:	Commercial company	CONTACT:	Imogen Newcombe 07387 524030
SITE NAME:	Double ditched enclosure east of Thornton Farm,	Ettington	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002990
CONDITION:	Unknown	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Imogen Newcombe 07387 524030

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no А

- Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В implemented.
- C Slow decay; no solution agreed.

 D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.


NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

HERITAGE AT RISK 2023 / MIDLANDS / STRATFORD-ON-AVON / WARWICK

SITE NAME:	Enclosures north of Old Pasture Farm, Hampton L		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1005714
CONDITION:		TREND:	
	Unknown		Unknown
PRINCIPAL VULNERABILITY:	Arable ploughing Private	NEW ENTRY?:	No
owner me.	Filvate	contact.	Imogen Newcombe 07387 524030
SITE NAME:	Rectangular Earthwork on Nebsworth, Ilmington		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1005734
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Animal burrowing - Rabbit - extensive	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Imogen Newcombe 07387 524030
SITE NAME:	Multivallate hillfort on Meon Hill, Quinton		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1011372
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Imogen Newcombe 07387 524030
SITE NAME:	Enclosures 550 metres east of King's Mead, Welles	bourne and Walto	n
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1005716
CONDITION:	Unknown	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Other	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Imogen Newcombe 07387 524030
SITE NAME:	Lower Shuckburgh, Upper and Lower Shuckburgh		
DESIGNATION:	Conservation Area, 8 LBs, part in SM	NEW ENTRY?:	No
CONDITION:	Poor	TREND:	No significant change
VULNERABILITY:	High	CONTACT:	Clare Eynon (LPA) 01789 260326
SITE NAME:	Southam		
DESIGNATION:	Conservation Area, 35 LBs	NEW ENTRY?:	No
CONDITION:	Poor	TREND:	Deteriorating
VULNERABILITY:	High	CONTACT:	Clare Eynon (LPA) 01789 260326

WARWICK

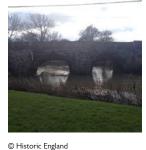

D

Е

use).

SITE NAME:	Hunningham Bridge, Hunningham / Weston under Wetherley
DESIGNATION:	Scheduled Monument, LB grade II
CONDITION:	Good
OCCUPANCY:	N/A
PRIORITY CATEGORY:	F (F)
OWNER TYPE:	Local authority
LIST ENTRY NUMBER:	1005770

Hunningham Bridge is a mid-C17 structure of sandstone ashlar spanning the river Leam and is currently in use as a public highway. The structure has had extensive repairs following two incidents in 2015 which resulted in two demolished sections of the parapet. Unfortunately the bridge has been hit again since these repairs were completed. The bridge remains at risk until traffic calming measures can be reviewed and installed at the site to protect the bridge from further incidents.

Contact: Imogen Newcombe 07387 524030

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; В solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented. Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented. obvious new user (applicable only to buildings capable of beneficial

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA LB
- LPA
- Conservation Area Listed Building Local Planning Authority National Park NP RPG
 - Registered Park and Garden Scheduled Monument
- SM UA WHS
 - Unitary Authority World Heritage Site

HERITAGE AT RISK 2023 / MIDLAN	IDS / WARWICK		
	SITE NAME:	Remains of Old Castle Bridge, Mill Street, Warwick	Remains of a late medieval bridge. Ownership is split three ways. Earlier proposals for stabilisation were very costly
	Designation:	Scheduled Monument and Listed Building grade II*, RPG grade I, CA	and beyond available resources. It has been proposed that ownership should be transferred to a trust who would co- ordinate restoration and funding but this has not progressed. Historic England has advised the owner of the
	CONDITION:	Very bad	southernmost section regarding eradication of Japanese Knotweed in order to facilitate inspection and repair of the
	OCCUPANCY:	N/A	structure. Addressing the Knotweed will take several years
	PRIORITY CATEGORY:	C (C)	
© Historic England Archive	OWNER TYPE:	Mixed, multiple owners	
	LIST ENTRY NUMBER:	1005772 and 1035499	Contact: Imogen Newcombe 07387 524030
	SITE NAME:	Masters House, Warwick	The Leper Hospital of St Michael was founded in the CI2:
A statements	DESIGNATION:	Listed Building grade II*, SM	the Master's House survives and is a timber framed building of C15 date built upon C12 foundations. The timber frame
	CONDITION:	Very bad	and roof covering are in very poor condition and Urgent Works were undertaken by Warwick District Council in
	OCCUPANCY:	Vacant/not in use	2019 to keep the building weatherproof and maintain its
	PRIORITY CATEGORY:	D (B)	structural stability. Warwick District Council subsequently purchased the site and its buildings in 2022 and are looking
	OWNER TYPE:	Private	to facilitate its development with the West Midlands Historic Buildings Trust and a housing provider for
© Historic England Archive	LIST ENTRY NUMBER:	1364850	unsupported social housing. Contact: John Tiernan 0121 625 6839
16.	SITE NAME:	Church of All Saints, Bath Street, Royal Leamington Spa	This is an impressive Church. The design is a Continental Gothic bold and ornate. It was begun in 1843 by Dr. John
M.A.	DESIGNATION:	Listed Place of Worship grade II*, CA	Craig the Vicar with Architect J.C. Jackson. Sir Arthur Blomfield added the West tower and two nave bays. The apse window (1851) has glass by Chance of Birmingham.
	CONDITION:	Poor	The Church has had major repairs undertaken through the years but because it is a large and complicated church
	PRIORITY CATEGORY:	C (C)	major issues have remained like the high level stonework
	OWNER TYPE:	Religious organisation	and the glass of the windows.
	LIST ENTRY NUMBER:	1381145	Contact: Louisa Moore 0777 043 5511
© Historic England			
	SITE NAME:	Church of St Mary including Beauchamp Chapel, Warwick	This parish church was founded as a Collegiate Church in 1123. The nave, aisles, transept and tower were rebuilt by
	DESIGNATION:	Listed Place of Worship grade I, CA	Sir W Wilson after the great fire of 1694, although the chancel dating from the C14 remained. The Beauchamp
Rel de			Chaper is an excellent example of rerpendicular design.
	CONDITION:	Poor	Chapel is an excellent example of Perpendicular design. The church has fan vaulted ceilings and stone carvings. St Many's has undergone much repair in recent years but the
TRA AND	CONDITION: PRIORITY CATEGORY:	Poor C (C)	The church has fan vaulted ceilings and stone carvings. St Mary's has undergone much repair in recent years but the stonework is soft Arden stone and the tower requires
RACT			The church has fan vaulted ceilings and stone carvings. St Mary's has undergone much repair in recent years but the stonework is soft Arden stone and the tower requires urgent repair as it suffers from falling masonry. The
	PRIORITY CATEGORY:	C (C)	The church has fan vaulted ceilings and stone carvings. St Mary's has undergone much repair in recent years but the stonework is soft Arden stone and the tower requires
© Historic England	PRIORITY CATEGORY: OWNER TYPE:	C (C) Religious organisation	The church has fan vaulted ceilings and stone carvings. St Mary's has undergone much repair in recent years but the stonework is soft Arden stone and the tower requires urgent repair as it suffers from falling masonry. The congregation are exploring sources of funding for the
© Historic England	PRIORITY CATEGORY: OWNER TYPE:	C (C) Religious organisation	The church has fan vaulted ceilings and stone carvings. St Mary's has undergone much repair in recent years but the stonework is soft Arden stone and the tower requires urgent repair as it suffers from falling masonry. The congregation are exploring sources of funding for the repairs. Contact: Louisa Moore 0777 043 5511 Parish church in red sandstone ashlar situated in an elevated position with evidence of a C12 church in the north and south walls of the chancel. The red sandstone
© Historic England	PRIORITY CATEGORY: OWNER TYPE: LIST ENTRY NUMBER:	C (C) Religious organisation 1035500 Church of St Michael, Rugby Road, Weston under	The church has fan vaulted ceilings and stone carvings. St Mary's has undergone much repair in recent years but the stonework is soft Arden stone and the tower requires urgent repair as it suffers from falling masonry. The congregation are exploring sources of funding for the repairs. Contact: Louisa Moore 0777 043 5511 Parish church in red sandstone ashlar situated in an elevated position with evidence of a C12 church in the north and south walls of the chancel. The red sandstone stonework is in extremely poor condition at all levels with
© Historic England	PRIORITY CATEGORY: OWNER TYPE: LIST ENTRY NUMBER: SITE NAME:	C (C) Religious organisation 1035500 Church of St Michael, Rugby Road, Weston under Wetherley	The church has fan vaulted ceilings and stone carvings. St Mary's has undergone much repair in recent years but the stonework is soft Arden stone and the tower requires urgent repair as it suffers from falling masonry. The congregation are exploring sources of funding for the repairs. Contact: Louisa Moore 0777 043 5511 Parish church in red sandstone ashlar situated in an elevated position with evidence of a C12 church in the north and south walls of the chancel. The red sandstone stonework is in extremely poor condition at all levels with delamination, open joints and hollow sections, erosion, cracking and inappropriate repairs. Some structural cracks
e Historic England	PRIORITY CATEGORY: OWNER TYPE: LIST ENTRY NUMBER: SITE NAME: DESIGNATION:	C (C) Religious organisation 1035500 Church of St Michael, Rugby Road, Weston under Wetherley Listed Place of Worship grade I	The church has fan vaulted ceilings and stone carvings. St Mary's has undergone much repair in recent years but the stonework is soft Arden stone and the tower requires urgent repair as it suffers from falling masonry. The congregation are exploring sources of funding for the repairs. Contact: Louisa Moore 0777 043 5511 Parish church in red sandstone ashlar situated in an elevated position with evidence of a C12 church in the north and south walls of the chancel. The red sandstone stonework is in extremely poor condition at all levels with delamination, open joints and hollow sections, erosion,
Fistoric England	PRIORITY CATEGORY: OWNER TYPE: LIST ENTRY NUMBER: SITE NAME: DESIGNATION: CONDITION:	C (C) Religious organisation 1035500 Church of St Michael, Rugby Road, Weston under Wetherley Listed Place of Worship grade I Poor	The church has fan vaulted ceilings and stone carvings. St Mary's has undergone much repair in recent years but the stonework is soft Arden stone and the tower requires urgent repair as it suffers from falling masonry. The congregation are exploring sources of funding for the repairs. Contact: Louisa Moore 0777 043 5511 Parish church in red sandstone ashlar situated in an elevated position with evidence of a C12 church in the north and south walls of the chancel. The red sandstone stonework is in extremely poor condition at all levels with delamination, open joints and hollow sections, erosion, cracking and inappropriate repairs. Some structural cracks are present. Deformation on the south elevation appears
Fitteric England	PRIORITY CATEGORY: OWNER TYPE: LIST ENTRY NUMBER: SITE NAME: DESIGNATION: CONDITION: PRIORITY CATEGORY:	C (C) Religious organisation 1035500 Church of St Michael, Rugby Road, Weston under Wetherley Listed Place of Worship grade I Poor A (A)	The church has fan vaulted ceilings and stone carvings. St Mary's has undergone much repair in recent years but the stonework is soft Arden stone and the tower requires urgent repair as it suffers from falling masonry. The congregation are exploring sources of funding for the repairs. Contact: Louisa Moore 0777 043 5511 Parish church in red sandstone ashlar situated in an elevated position with evidence of a C12 church in the north and south walls of the chancel. The red sandstone stonework is in extremely poor condition at all levels with delamination, open joints and hollow sections, erosion, cracking and inappropriate repairs. Some structural cracks are present. Deformation on the south elevation appears

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed.
 C Slow decay; no solution agreed.

 D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site

 - Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

HERITAGE AT RISK 2023 / MIDLANDS / WARWICK

SITE NAME:	Circular ditches enclosures south west of Wiggerla	and Wood Farm, Bi	ishop's Tachbrook
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1003740
CONDITION:	Unknown	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Imogen Newcombe 07387 524030
SITE NAME:	Roman settlement at Glasshouse Wood, Kenilword	th / Ashow	
DESIGNATION:	Scheduled Monument, part in RPG grade II*	LIST ENTRY NUMBER:	1005723
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Digging	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Imogen Newcombe 07387 524030
SITE NAME:	Guy's Cave hermitage and other rock cut chamber	s at Guy's Cliffe, Le	eek Wootton and Guy's Cliffe
DESIGNATION:	Scheduled Monument, LB grade II, RPG grade II	LIST ENTRY NUMBER:	1019129
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Deterioration - in need of management	NEW ENTRY?:	No
OWNER TYPE:	Religious organisation	CONTACT:	Neil Rimmington 07775 550 674
SITE NAME:	Wedgnock Park pale, dam, two watermill sites, brid Farm, Leek Wootton and Guy's Cliffe	dge and hollow way	v 200 metres north east of Goodres
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1013159
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Stock erosion - extensive	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Imogen Newcombe 07387 524030
SITE NAME:	Enclosures 410 metres north east of Sherbourne p	arish church, Sherb	oourne
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1005711
CONDITION:	Unknown	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Imogen Newcombe 07387 524030
SITE NAME:	Warwick Castle (uninhabited parts), Warwick		
DESIGNATION:	Scheduled Monument, part in RPG grade I, CA	LIST ENTRY NUMBER:	1005757
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Visitor erosion - moderate	NEW ENTRY?:	No
OWNER TYPE:	Local authority	CONTACT:	Neil Rimmington 07775 550 674
SITE NAME:	Enclosures and drove road 90 metres south of Mar	nor House Farm, V	Vasperton
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1005712
CONDITION:	Unknown	TREND:	Unknown
	Anable plaughing	NEW ENTRY ?:	No
PRINCIPAL VULNERABILITY:	Arable ploughing		110
PRINCIPAL VULNERABILITY:	Mixed, multiple owners	CONTACT:	Imogen Newcombe 07387 524030

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no А

- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed.
 C Slow decay; no solution agreed.

 D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user lidentified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

128

NEW ENTRY ?:

OWNER TYPE:

LIST ENTRY NUMBER:

No

1001602

Mixed, multiple owners

	SITE NAME:	Stoneleigh Abbey, Ashow / Stoneleigh	Complex multi-phase landscape, incorporating a medieval deer park and work by Repton, Nesfield and Percy Cane.
	DESIGNATION: CONDITION:	Registered Park and Garden grade II*, 30 LBs, 2 SMs, part in CA	The deer park is now a golf course. A business park and residential enclaves have been built within the historic landscape. A programme of restoration of the cascades, bridges and other water features has been undertaken
		Generally satisfactory but with significant localised problems	through the Natural England Stewardship scheme. Oth parts of the historic estate remain vulnerable. The rout HS2 will separate the west and east sections of the
	VULNERABILITY:	High	registered park.
istoric England	TREND:	Improving	
	NEW ENTRY ?:	No	
	OWNER TYPE:	Mixed, multiple owners	
	LIST ENTRY NUMBER:	1000377	Contact: Louisa Moore 0777 043 5511
	LIST ENTRY NUMBER:	1000377	Contact: Louisa Moore 0777 043 5511
	LIST ENTRY NUMBER:	Guy's Cliffe, Warwick / Old Milverton	Picturesque landscape either side of the River Avon. The main house is in a ruinous state. The chapel is now a
		Guy's Cliffe, Warwick / Old	Picturesque landscape either side of the River Avon. The
	SITE NAME:	Guy's Cliffe, Warwick / Old Milverton Registered Park and Garden	Picturesque landscape either side of the River Avon. The main house is in a ruinous state. The chapel is now a Masonic temple. Derelict gardens are periodically cleared by volunteers. Most of the park has been ploughed and th
	SITE NAME: DESIGNATION:	Guy's Cliffe, Warwick / Old Milverton Registered Park and Garden grade II, 9 LBs, SM	Picturesque landscape either side of the River Avon. The main house is in a ruinous state. The chapel is now a Masonic temple. Derelict gardens are periodically cleared by volunteers. Most of the park has been ploughed and th
	SITE NAME: DESIGNATION: CONDITION:	Guy's Cliffe, Warwick / Old Milverton Registered Park and Garden grade II, 9 LBs, SM Extensive significant problems	Picturesque landscape either side of the River Avon. The main house is in a ruinous state. The chapel is now a Masonic temple. Derelict gardens are periodically cleared by volunteers. Most of the park has been ploughed and th

© Historic England

WEST MIDLANDS

BIRMINGHAM

	SITE NAME:	Birmingham Midland Institute, 9 Margaret Street B3 3BU	Built in 18998-9 as the Birmingham Library (a private member's library) by F. Barry Peacock of architects
	DESIGNATION:	Listed Building grade II*, CA	Cossins, Peacock and Bewlay. Red brick, two storey building, plus basement and attic, with stone dressing and
	CONDITION:	Poor	green stone tiled roof built in Jacobean. Two end gables reflect the neighbouring School of Art. Original Entrance
	OCCUPANCY:	Occupied/in use	hall and staircase have been retained altered interior is
	PRIORITY CATEGORY:	C (C)	accommodating a concert hall, a basement auditorium and an extension in 95 Cornwall St. The roof and rainwater
	OWNER TYPE:	Charity (non-heritage)	goods are in very poor condition affecting the internal plasterwork with loss of fabric.
© Historic England	LIST ENTRY NUMBER:	343095	Contact: Cristina Gardiner 0121 625 6850
	SITE NAME:	Highbury Hall, Yew Tree Road, Birmingham	Highbury Hall was built in 1879 as the family home of Joseph Chamberlain and designed by local architect JH
	DESIGNATION:	Listed Building grade II*, RPG grade II	Chamberlain. It is a large and ornate brick and stone house surrounded by landscaped gardens. The interior of the house is elaborate and uses a variety of different materials.
	CONDITION:	Poor	Currently the ground floor is used for events, but the upper two floors are vacant. The Main Hall and Northern
	OCCUPANCY:	Part occupied/part in use	Range roofs were repaired in 2020. The Highbury Trust
	PRIORITY CATEGORY:	C(C)	has received Stage I for an NLHF grant for repair and

© Historic England

Contact: Cristina Gardiner 0121 625 6850

redevelopment of the hall.

Contact: Louisa Moore 0777 043 5511

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В implemented.
- C Slow decay; no solution agreed.

PRIORITY CATEGORY:

LIST ENTRY NUMBER:

OWNER TYPE:

C (C)

1076076

Local authority

 D Slow decay: solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA LB LPA NP RPG SM
- Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument
- UA Unitary Authority WHS World Heritage Site

HERITAGE AT	RISK 2023 /	MIDLANDS /	BIRMINGHAM

I		in the second
	THE P	
		E

© Historic England


© Historic England

ľ	SITE NAME:	Methodist Central Hall,	A substantial building of 1903-4 by E. and J.A. Harper in red	
	LIST ENTRY NUMBER:	1343086	Contact: Louisa Moore 0777 043 5511	
- and	OWNER TYPE:	Local authority		
	PRIORITY CATEGORY:	F (F)		
	OCCUPANCY:	Vacant/not in use	an end-user for the building.	
	CONDITION:	Fair	Renovation by a partnership including HS2 began in 2021 but was paused in 2022 due to concerns over the lack of	
	DESIGNATION:	Listed Building grade I	for more than a decade. Repairs to the roof have been undertaken, and the building is now secure and watertight.	
	SITE NAME:	British Rail Goods Office (Curzon Street Station), Birmingham	Terminus of the London to Birmingham railway designed by Philip Hardwick. Built in 1837-8 in the Ionic style. The building is owned by the City Council and has been vacant	

	SITE NAME:	Methodist Central Hall, Corporation Street, Birmingham	A substantial building of 1903-4 by E. and J.A. Harper in r brick and terracotta. Ground floor has various retail uses otherwise entirely vacant. Permission was granted in 201 for hotel use but was never implemented. The site was purchased by new owners in early 2022. An application for
TIL	DESIGNATION:	Listed Building grade II*, CA	
TEPET	CONDITION:	Poor	conversion into several uses has been submitted to Birmingham City Council. Its condition has deteriorated
N AG W L	OCCUPANCY:	Part occupied/part in use	following recent storms. Roof repairs have recently been
HE R.	PRIORITY CATEGORY:	D (D)	undertaken by the new owners, and the building is currently secure and weathertight.
	OWNER TYPE:	Commercial company	,
	LIST ENTRY NUMBER:	1075607	Contact: Rosamund Worrall 0121 625 6893



© Historic England

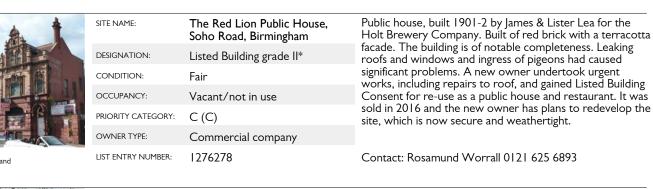

SITE NAME:	Perrott's Folly, Waterworks Road, Edgbaston	Built in 1758 by John Perrott as a folly adjacent to his house (long demolished). A six storey structure with circular stair
DESIGNATION:	Listed Building grade II*	tower attached. Adjoining waterworks tower said to be inspiration for Tolkien's 'The Two Towers'. Repairs
CONDITION:	Poor	addressing structural issues were completed some years ago and in 2021 a Toilet was added to improve the
OCCUPANCY:	Part occupied/part in use	usability of the space by visitors' groups. The structure is
PRIORITY CATEGORY:	B (B)	structurally stable but the roof and the ornate plaster ceiling on the top of the tower and the needs repairing
OWNER TYPE:	Other not for profit group	from the considerable damaged caused by rainwater penetration.
LIST ENTRY NUMBER:	1076123	Contact: Cristina Gardiner 0121 625 6850

© Historic England



SITE NAME:	303 Icknield Street, Hockley	Built in 1883, by Martin and Chamberlain, The building was the Headmaster's house attached to Icknield Street School
DESIGNATION:	Listed Building grade II*	(List No. 1076315) one of the Birmingham Board Schools.
CONDITION:	Very bad	The domestic brick and terracotta building, with a tiled roof underwent unauthorised work which was halted. The
OCCUPANCY:	Vacant/not in use	building is currently empty, in very poor condition and
PRIORITY CATEGORY:	A (A)	suffering on-going rapid deterioration.
OWNER TYPE:	Local authority, multiple owners	
LIST ENTRY NUMBER:	1291556	Contact: Cristina Gardiner 0121 625 6850

© Historic England

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; В solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.

D

Е

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA
- LB LPA
- Conservation Area Listed Building Local Planning Authority National Park NP
- RPG Registered Park and Garden Scheduled Monument
- SM
- UA WHS Unitary Authority World Heritage Site

HERITAGE AT RISK 2023 / MIDLANDS / BIRMINGHAM

	SITE NAME:	Public Baths, Moseley	Municipal baths with lavish terracotta decoration and
	DESIGNATION:	Listed Building grade II*	complete interiors opened in 1907 as an addition to the Free Library (1895). Following repair of the Gala Pool roof,
	CONDITION:	Poor	Historic England gave a substantial grant for repair of the Boardroom roof & front facade in conjunction with
	OCCUPANCY:	Part occupied/part in use	Birmingham City Council and the World Monuments Fund
II TOUL	PRIORITY CATEGORY:	A (A)	which was completed in 2022. Some areas, such as the slipper baths are still in a poor condition. Plans for
	OWNER TYPE:	Local authority	reconfiguration, with more swimming and incorporation of the library into the scheme are underway, supported by
	LIST ENTRY NUMBER:	1076274	the Levelling Up Fund.
			Contact: Louisa Moore 0777 043 5511

© Historic England

m

	SITE NAME:	100 Sampson Road, Sparkhill	Built in 1901 as the vicarage to St Agatha's Church in
1	DESIGNATION:	Listed Building grade II*	Sparkbrook and designed in an Arts and Crafts style by local Birmingham architect, W.H. Bidlake. Formerly
	CONDITION:	Fair	converted to flats by a housing association, the building is now in private ownership but has been subject to heritage
Ilh.d	OCCUPANCY:	Part occupied/part in use	crime and is now suffering from dry rot and isolated
STIC	PRIORITY CATEGORY:	E (E)	structural issues. Localised repairs have been carried out but there is a longstanding lack of regular maintenance with
	OWNER TYPE:	Private	missing tiles, decaying windows and other issues continuing.
	LIST ENTRY NUMBER:	1076179	Contact: Rosamund Worrall 0121 625 6893

© Historic England



	SITE NAME:	Holy Church of the New Testament, 11-13 Oughton Road, Birmingham, B12 0DF and Friends Institute 220 Moseley Road, Birmingham	The building was commissioned by Richard Cadbury, designed by Ewan and James Harper it was completed in 1897. It contained to the front (Moseley Road) the Friends Institute with a coffee room a reading room, 37 classrooms for adult education and Sunday school and a large lecture
	DESIGNATION:	Listed Place of Worship grade II*	room for 400 people on the first floor. To the rear (Oughton Street) the building houses a large hall with 2000
	CONDITION:	Poor	worshippers' capacity with a gymnasium hall. The hall is now the Holy Church of the New testament; its roof and
	PRIORITY CATEGORY:	C (C)	rainwater goods are in poor condition.
	OWNER TYPE:	Religious organisation	
	LIST ENTRY NUMBER:	1418995	Contact: Cristina Gardiner 0121 625 6850

SITE NAME:	Singers Hill Synagogue, Blucher Street, Birmingham	Large building constructed in 1856 by Yeoville Thomason, in neo-classical Romanesque style in red bricks with yellow stone dressing. Symmetrical composition to the street elevation with a portico and central tympanum with a rose stained-glass window, all recesses between two symmetrical 2 storey projecting wings. Impressive interior, 7 bays long with balconies behind and a superimposed
DESIGNATION:	Listed Place of Worship grade II*	
CONDITION:	Poor	
PRIORITY CATEGORY:	C (New entry)	
OWNER TYPE:	Religious organisation	Gibbs' style order. The Ark is in the vaulted apse. The condition of the roof has deteriorated in parts, leaking onto
LIST ENTRY NUMBER:	1075712	the interior and some of the flat roofs need replacing.

Contact: Cristina Gardiner 0121 625 6850

SITE NAME:	Edward Road Baptist Church, Edward Road, Birmingham	This is an example of the Birmingham Terracotta School's work which combines Romanesque and Perpendicular details. There is evidence of damp at high level, the roof needs attention, the gutters need cleaning and the joints to brick and terracotta blocks are badly eroded.
DESIGNATION:	Listed Place of Worship grade II	
CONDITION:	Poor	
PRIORITY CATEGORY:	C (C)	
OWNER TYPE:	Religious organisation	
LIST ENTRY NUMBER:	1343405	Contact: Cristina Gardiner 0121 625 6850
	DESIGNATION: CONDITION: PRIORITY CATEGORY: OWNER TYPE:	Edward Road, BirminghamDESIGNATION:Listed Place of Worship grade IICONDITION:PoorPRIORITY CATEGORY:C (C)OWNER TYPE:Religious organisation

© Historic England

1

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В implemented.
- C Slow decay; no solution agreed.
- D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA LB LPA NP RPG SM
- Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument
- UA Unitary Authority WHS World Heritage Site

HERITAGE AT RISK 2023	/ MIDLANDS / BIRMINGHAM

HERITAGE AT RISK 2023 / MIDLANDS / BIRMINGHAM				
	SITE NAME:	Parish Church of All Saints (formerly St. Aidan), Herbert Road B10, Small Heath, Birmingham	Designed by TF Proud in 1893, this church is an example of local red bricks and buff terracotta, designed in the Perpendicular style with a lofty nave and clearstory windows. Two further bays and the apsidal baptistery were	
	DESIGNATION:	Listed Place of Worship grade II*	added in 1898. The nave north roof is in poor condition with many slipped tiles. Rainwater goods are also in poor	
THE AS THE	CONDITION:	Poor	condition. The building suffers from dampness through, walls and columns show the presence of salt efflorescence,	
	PRIORITY CATEGORY:	D (D)	past cementicious repairs have compounded moisture	
	OWNER TYPE:	Religious organisation	retention. The church has revceived a grant for the reainwatergoods completed by Autumn 2021.	
© Historic England	LIST ENTRY NUMBER:	1343050	Contact: Cristina Gardiner 0121 625 6850	
	SITE NAME:	Church of St Benedict, Hob Moor Road, Birmingham	Good example of a Byzantine revival Church, 1909, by Nichol and Nichol of Birmingham. It is a substantial church	
	DESIGNATION:	Listed Place of Worship grade II	built in red brick and stone dressing and a plain tile roof. It has a basilica plan and the aisles and clearstories have	
Artent	CONDITION:	Poor	parapets. The apse, with battered buttresses and a dome	
	PRIORITY CATEGORY:	C (C)	roof, complements the overall good design of the church. The church is in poor condition: the high-level brickwork,	
	OWNER TYPE:	Religious organisation	due to leaking parapets gutters, has open joints and damp patches. The stonework is also badly eroded throughout.	
	LIST ENTRY NUMBER:	1076300	The ashfelted dome and barrel roofs have also come to the end of their life.	
© Historic England			Contact: Cristina Gardiner 0121 625 6850	
	SITE NAME:	Church of St Michael, St Michael's Road, Birmingham	Large church on Soho Hill dating from 1855 by W. Bourne. Built in red Hollington stone with sandstone features and	
	DESIGNATION:	Listed Place of Worship grade II, CA	string courses all fairly badly eroded. Nave roof is in poor condition causing rain water entry due to dislodged roof tiles especially on the s/w corner, the south aisle roof is in very poor condition. There is rain staining internally at junction between Lady Chapel and a turret. Rain water goods in poor condition throughout. There are cracks in the masonry and some of the buttresses; pointing at high level is badly eroded. Glass missing from leaded windows	
	CONDITION:	Very bad		
	PRIORITY CATEGORY:	B (B)		
	OWNER TYPE:	Religious organisation		
© Historic England	LIST ENTRY NUMBER:	1076210	Cold internally.	
			Contact: Cristina Gardiner 0121 625 6850	
	SITE NAME:	Church of St Paul, St Paul's Square, Birmingham	Classical design by Roger Eykyn of Wolverhampton and built in 1777-9 although the upper part of the Spire and	
	DESIGNATION:	Listed Place of Worship grade I, CA	tower was added in 1822-3 by Frances Goodwin. The church sits on the corner of the then Newhall estate and was given by Charles Colmore. 'Bilston Rag' stone with	
	CONDITION:	Poor	rusticated quoins and Gibbs-style surrounds. The interior is classical. The church is suffering from severe issues from	
	PRIORITY CATEGORY:	D (D)	leaking parapet gutters and rain water entry which has	
(二)。且,一种里特	OWNER TYPE:	Religious organisation	damaged the interior plasterwork. The condition of the rainwater goods is also poor; there is shaling stonework	
	LIST ENTRY NUMBER:	1220815	and vegetation at high level.	
© Historic England			Contact: Cristina Gardiner 0121 625 6850	
	SITE NAME:	Church of St Nicolas, The Green, Birmingham	Large sandstone Church of Norman origins with nave, aisles chancel and south porch. Its outstanding feature is	
	DESIGNATION:	Listed Place of Worship grade I, CA	the C15 spire and tower in 4 stages which is a local landmark. The Church has several urgent issues especially because it is built in soft sandstone and the stonework.	
	CONDITION:	Poor	Repairs to the tower's stonework has been completed.	
	PRIORITY CATEGORY:	D (D)		
	OWNER TYPE:	Religious organisation		
Historic England	LIST ENTRY NUMBER:	1075549	Contact: Cristina Gardiner 0121 625 6850	
© Historic England				

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no А

- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed.
 C Slow decay; no solution agreed.

 D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

HERITAGE AT RISK 2023 / MIDLANDS / BIRMINGHAM

	SITE NAME:	Parish Church of St Peter and St Paul, Witton Lane, Birmingham	The original Anglican church dates from 1084, although nothing survives. The current large church dates from		
1 A Junior	DESIGNATION:	Listed Place of Worship grade II*, CA	1879-90, the west tower from cr. C15, repaired in 1776. The south porch by J. A. Chatwin was added in 1908. The church is built in soft Hollington sandstone, which is very		
ANA	CONDITION:	Poor	poor in places with open joints. The spire weight and t need addressing, as do the rainwater goods throughou		
	PRIORITY CATEGORY:	C (C)	Internally the timber block flooring is subject to rot and		
	OWNER TYPE:	Religious organisation	insect infestation and need replacing.		
	LIST ENTRY NUMBER:	1290008	Contact: Cristina Gardiner 0121 625 6850		
ngland					

© Historic England



SITE NAME:	lcknield Street School, Icknield Street, Hockley	Large Birmingham Board School designed in 1883 by Martin and Chamberlain. The building is partly occupied on
DESIGNATION:	Listed Place of Worship grade II*	the ground floor as a Hindu temple for the purpose of worship and community use; the upper floors are vacant.
CONDITION:	Very bad	The building is in poor condition generally: the steep slate roofs and valley gutters leak to the spaces below and the
PRIORITY CATEGORY:	A (A)	rainwater goods are in poor condition resulting in
OWNER TYPE:	Local authority, multiple owners	rainwater entry affecting both roof and walls. Negotiations between the owners, the Council, and the tenants are on-
LIST ENTRY NUMBER:	1076315	going and essential surveys have taken place.
		Contact: Cristina Gardiner 0121 625 6850

© Historic England

SITE NAME:	Kent's Moat			
DESIGNATION:	Scheduled Monument		LIST ENTRY NUMBER:	1020538
CONDITION:	Generally satisfactory but with significant localised problems		TREND:	Declining
PRINCIPAL VULNERABILITY:	Deterioration - in need of management		NEW ENTRY?:	No
OWNER TYPE:	Local authority		CONTACT:	Imogen Newcombe 07387 524030
	SITE NAME:	Highbury Hall	Gardens and landscaped grounds of 1879 by Edward Milner associated with a contemporary villa built for Jose Chamberlain. Greater part of grounds a public park since early C20. The condition of the park and gardens has declined significantly. Original built landscape features and water features are in poor condition. Disrupted drainage causing erosion and waterlogging problems. A successful phase of repair and restoration work has been undertake with Historic England and National Lottery Heritage Fund support. A further grant from NLHF is supporting project development.	
	DESIGNATION:	Registered Park and Garden grade II, LB grade II*		
	CONDITION:	Generally unsatisfactory with major localised problems		
	VULNERABILITY:	Medium		
	TREND:	Improving		
© Historic England	NEW ENTRY?:	No		
	OWNER TYPE:	Local authority, multiple owners		
	LIST ENTRY NUMBER:	1001203	Contact: Louisa	Moore 0777 043 5511

SITE NAME:	Austin Village		
DESIGNATION:	Conservation Area	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	Deteriorating significantly
VULNERABILITY:	Medium	CONTACT:	Chris Patrick (LPA) 0121 3033910
SITE NAME:	Barnsley Road		
SITE NAME: DESIGNATION:	Barnsley Road Conservation Area, 4 LBs	NEW ENTRY?:	No
		NEW ENTRY?: TREND:	No Deteriorating significantly
DESIGNATION:	Conservation Area, 4 LBs		

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no А

Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В implemented.

C Slow decay; no solution agreed.

 D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user lacttified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site
 - Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

HERITAGE AT RISK 2023 / MIDLANDS / BIRMINGHAM / COVENTRY

IEIGITAGE AT RISK 2023 /			
SITE NAME:	Digbeth / Deritend		
DESIGNATION:	Conservation Area, 12 LBs	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	Deteriorating
VULNERABILITY:	High	CONTACT:	Julie Shaduwa (LPA) 0121 3034527
SITE NAME:	Four Oaks, Sutton Coldfield		
DESIGNATION:	Conservation Area, 28 LBs, part in RPG grade II, part in SM	NEW ENTRY?:	No
CONDITION:	Poor	TREND:	Deteriorating
VULNERABILITY:	Medium	CONTACT:	Chris Patrick (LPA) 0121 3033910
SITE NAME:	Lozells and Soho Hill		
DESIGNATION:	Conservation Area, 38 LBs	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	Deteriorating significantly
VULNERABILITY:	High	CONTACT:	Chris Patrick (LPA) 0121 3033910
SITE NAME:	School Road		
DESIGNATION:	Conservation Area, 2 LBs	NEW ENTRY?:	No
CONDITION:	Poor	TREND:	Deteriorating
VULNERABILITY:	Low	CONTACT:	Julie Shaduwa (LPA) 0121 3034527
SITE NAME:	Steelhouse		
DESIGNATION:	Conservation Area, 9 LBs	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	Improving
VULNERABILITY:	Medium	CONTACT:	Chris Patrick (LPA) 0121 3033910
SITE NAME:	Warwick Bar		
DESIGNATION:	Conservation Area, 7 LBs	NEW ENTRY ?:	No
CONDITION:	Poor	TREND:	Deteriorating
VULNERABILITY:	High	CONTACT:	Julie Shaduwa (LPA) 0121 3034527

COVENTRY

D

Е

use).

SITE NAME:	Numbers 36 and 37 and archway in between (Whitefriars Gate), Much Park Street
DESIGNATION:	Listed Building grade II*
CONDITION:	Poor
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	F (D)
OWNER TYPE:	Local authority
LIST ENTRY NUMBER:	1087114

This CI4 postern gatehouse of the Carmelite Friary has a clay tile roof and sandstone walls with later repairs in brickwork. The building was subject to heritage crime in 2008 and later repaired: it has remained vacant since then and is slowly deteriorating. The continuing threat of heritage crime, assorted masonry repairs and renewal of defective floor timbers above the archway are all issues to be addressed. A Repair Grant for Heritage at Risk to address structural and fabric repairs is progressing and will be completed in July 2023.

© Coventry HER 2014

Contact: Cristina Gardiner 0121 625 6850

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; В solution agreed but not yet implemented.
- C Slow decay; no solution agreed.

Slow decay; solution agreed but F not yet implemented.

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA
- LB LPA
- Conservation Area Listed Building Local Planning Authority National Park
- NP RPG Registered Park and Garden Scheduled Monument
- SM
- UA Unitary Authority WHS World Heritage Site

HERITAGE AT RISK 2023 / MIDLANDS / COVENTRY

	SITE NAME:	Basement on site of Old Star Inn, Earl Street, Coventry	Late medieval cellar of an inn now incorporated in the Civic Centre. Significant erosion of the sandstone took place as a
	DESIGNATION:	Listed Building grade II*	result of water damage. The stone vault was propped in 2008 and damaged stonework repaired. The buildings
	CONDITION:	Fair	above (with the exception of the recently listed former architects' offices) have been demolished. No site
	OCCUPANCY:	Vacant/not in use	inspection has been possible this year.
	PRIORITY CATEGORY:	D (D)	
196	OWNER TYPE:	Local authority	
	LIST ENTRY NUMBER:	1115642	Contact: Cristina Gardiner 0121 625 6850

© Historic England

© Historic England



	SITE NAME:	Nonconformist Chapel to the Cemetery, London Road, Coventry	This cemetery was designed by Joseph Paxton in 1843 and opened in 1847. The Nonconformist Chapel located at the southern end of the cemetery is part of that design but
	DESIGNATION:	Listed Building grade II*, RPG grade I, CA	attributed by the VCH to George Taylor. The Chapel is configured as a Greek temple with a portico entrance and flanking open pavilions but is currently disused and in a
	CONDITION:	Fair	vulnerable condition. The Historic Coventry Trust has plans for the cemetery to become part of a Heritage Park
- 100	OCCUPANCY:	Vacant/not in use	and the chapel to be converted for office use. A grant
	PRIORITY CATEGORY:	F (D)	application to Historic England for roof and other fabric repairs was completed in March 2023.
	OWNER TYPE:	Local authority	
	LIST ENTRY NUMBER:	1076624	Contact: Cristina Gardiner 0121 625 6850



SITE NAME: Church of St Mark and The church of St Mark was built in 1869 and consists of a boundary walls to Stoney clerestoried nave with aisles, a chancel, north porch and south vestry: the west end of the north aisle also has a tall Stanton Lane and Bird Street bell-cote. A church hall extension was added to the south DESIGNATION: Listed Place of Worship grade II side in 1962. Following closure in 1973, the church was internally remodelled and converted to a hospital CONDITION: Poor outpatient's department. Now relicensed and re-ordered PRIORITY CATEGORY: C (C) for public worship, it has a catalogue of building fabric defects that require urgent attention including reroofing OWNER TYPE: Religious organisation works, the renewal of rainwater goods, drainage and assorted high-level masonry repairs. LIST ENTRY NUMBER: 1104904 Contact: Cristina Gardiner 0121 625 6850

~	SITE NAME:	Church of St John the Baptist, Fleet Street, Coventry	The church of St John the Baptist is located at the head of Spon Street in the city centre. Built in the mid-C14, it was a
	DESIGNATION:	Listed Place of Worship grade I, CA	collegiate church and is largely Perpendicular in appearance with a crossing tower, transepts, clerestories to nave and chancel and aisles. Changes of plan are visible in several
TRADIT A ANTONI	CONDITION:	Poor	places together with alterations to the fabric. The red sandstone used in its construction is of variable quality and
	PRIORITY CATEGORY:	D (C)	its repair and maintenance is an on-going issue, in
	OWNER TYPE:	Religious organisation	particular, the condition of the nave clerestory. Defective transept roof coverings will also require renewal in the
	LIST ENTRY NUMBER:	1342889	future.
istoric England			Contact: Cristina Gardiner 0121 625 6850

© Hist

© Historic England

SITE NAME:	Allesley Castle		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1005907
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Deterioration - in need of management	NEW ENTRY?:	No
OWNER TYPE:	Local authority	CONTACT:	Neil Rimmington 07775 550 674

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no А

- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; В solution agreed but not yet implemented.
- C Slow decay; no solution agreed.

Slow decay; solution agreed but F not yet implemented.

D

Е

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA
- LB LPA
- Conservation Area Listed Building Local Planning Authority National Park NP
- RPG Registered Park and Garden Scheduled Monument
- SM
- UA WHS Unitary Authority World Heritage Site

HERITAGE AT RISK 2023 / MIDLANDS / COVENTRY / DUDLEY

A FRONT	SITE NAME:	Stoney Road Allotments	A group of mid and late C19 detached urban pleasure
COVENTR	DESIGNATION:	Registered Park and Garden grade II*, 5 LBs	gardens retaining a nationally significant group of C19 and early C20 summerhouses and associated structures. The site is still actively used as allotments and tenanted by the
	CONDITION:	Generally unsatisfactory with major localised problems	Stoney Road Gardens Association (SRGA). The summer houses are the principal elements at risk, not being maintained since listing in 2001. A conservation
END/NEW	VULNERABILITY:	Medium	management plan was produced in 2018. Grant from the
11月21月1日月1日	TREND:	Declining	National Lottery Heritage Fund has funded a condition survey and feasibility study. A Historic England grant made
11377月1月1日日日日	NEW ENTRY?:	No	in 2023 for professional fees & consolidation work.
© Historic England	OWNER TYPE:	Local authority	
	LIST ENTRY NUMBER:	1001494	Contact: Louisa Moore 0777 043 5511

SITE NAME:	Lady Herbert's Garden, Coventry		
DESIGNATION:	Conservation Area, 9 LBs, RPG grade II, 2 SMs	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	Deteriorating significantly
VULNERABILITY:	Low	CONTACT:	Coventry City Council Planning (LPA) 02476831109
SITE NAME:	London Road, Coventry		
DESIGNATION:	Conservation Area, 10 LBs, part in RPG grade I, part in SM	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	Improving
VULNERABILITY:	Low	CONTACT:	Coventry City Council Planning (LPA) 02476831109
SITE NAME:	Naul's Mill, Coventry		
DESIGNATION:	Conservation Area, 2 LBs	NEW ENTRY?:	No
CONDITION:	Poor	TREND:	Deteriorating
VULNERABILITY:	Low	CONTACT:	Coventry City Council Planning (LPA) 02476831109

DUDLEY

	SITE NAME:	Fan House and Chimney at the Former New Hawne Colliery	Single storey coal pit fan house built in 1865 in red bricks with white bricks dressings and a slate roof. The fan house
	DESIGNATION:	Listed Building grade II*	is a rare survival of a building containing a Guibal fan and is unique because it provides the earliest surviving example of
	CONDITION:	Very bad	large-scale induced ventilation applied to a Black Country colliery. The Winding Engine House (List Entry No.
	OCCUPANCY:	Vacant/not in use	1063765) and grade II Office. Workshop, and Store Blocks
and the second	PRIORITY CATEGORY:	A (New entry)	(List Entry No. 1359614), which together form the New Hawne Colliery complex. All in poor condition.
	OWNER TYPE:	Commercial company, multiple owners	
	LIST ENTRY NUMBER:	1063766	Contact: Cristina Gardiner 0121 625 6850



© From Letter dated 25/05/2023

SITE NAME:	Holbeache House, Holbeache Lane	Two storey brick building with Dutch Gablesand terracotta tiled roofs from circa 1600 but largely re-faced in
DESIGNATION:	Listed Building grade II*	CI9. The house is associated with the Gunpowder Plot and the last refuge of Stephen Littleton and other
CONDITION:	conspirators. Roberts Catesby was ki	conspirators. Roberts Catesby was killed and other arrested there. It is currently vacant and in very poor
OCCUPANCY:	Vacant/not in use	condition.
PRIORITY CATEGORY:	C (New entry)	
OWNER TYPE:	Commercial company	
LIST ENTRY NUMBER:	1228293	Contact: Cristina Gardiner 0121 625 6850

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no А

© Dudley Metropolitan Borough Council

- Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В implemented.
- C Slow decay; no solution agreed.

 D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

HERITAGE AT RISK 2023 / MIDLANDS / DUDLEY

	SITE NAME:	Wordsley Manor, Meadowfields Close	Small, late 18C, red brick mansion of symmetrical proportions, 3 storey high. The central part of the facade, a
日常常意	DESIGNATION:	Listed Building grade II*	three windows bay, projects slightly; it is surmounted by a central pediment on a dentilled course and a central round
	CONDITION:	Poor	window. The facade has five windows in the overall width and equal windows on the ground and first floors, with a
Total and	OCCUPANCY:	Occupied/in use	stone cill band. Entrance has a small portico on Tuscan
	PRIORITY CATEGORY:	F (New entry)	columns. The roof to the main house has been repaired and part of the east wing in now structurally sound but
	OWNER TYPE:	Private	there is additional work to be carried out to both west wing to the house interior.
gland	LIST ENTRY NUMBER:	1228358	Contact: Cristina Gardiner 0121 625 6850


© Historic Engla

© Historic England

SITE NAME:	Triangular Crane, Bumble Hole Boat Yard, Dudley	C19 triangular boat crane in very poor condition. Historic England funded a report on the condition and repair of the
DESIGNATION:	Scheduled Monument, CA	monument in 1997. An application for Historic England funding was made but later withdrawn as no match funding
CONDITION:	Very bad	was available for the repairs. The crane collapsed in 2002 and sections of structure remained stored in the yard. A
OCCUPANCY:	N/A	joint initiative between Historic England, the Canal moved
PRIORITY CATEGORY:	A (A)	the remains to secure storage and options of its reinstatement as a fixed crane are being investigated.
OWNER TYPE:	Private	
LIST ENTRY NUMBER:	1005884	Contact: Nick Carter 0121 625 6860
-	DESIGNATION: CONDITION: OCCUPANCY: PRIORITY CATEGORY: OWNER TYPE:	Boat Yard, DudleyDESIGNATION:Scheduled Monument, CACONDITION:Very badOCCUPANCY:N/APRIORITY CATEGORY:A (A)OWNER TYPE:Private

Situated in the centre of Dudley, this red brick church Church of St Edmund, Castle SITE NAME: Street, Dudley (known locally as 'bottom church') was built in the Palladian style in the 1720s. Repair to the tower funded by the Listed Place of Worship grade National Lottery Heritage Fund have been completed but DESIGNATION: II*, CA issues with the shallow tiled roofs of the nave and its stone parapets remain. The roof rain water drainage is also in CONDITION Poor fairly poor condition. PRIORITY CATEGORY: D (D) OWNER TYPE: Religious organisation LIST ENTRY NUMBER: 1287455 Contact: Cristina Gardiner 0121 625 6850

© Historic England

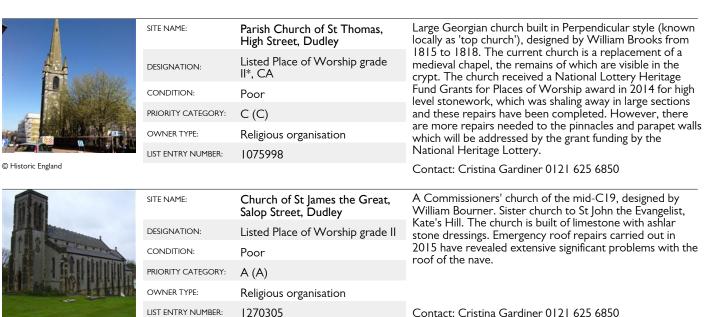

© Historic England

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed. Immediate risk of further rapid В deterioration or loss of fabric: solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.

D

Е

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use)

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise. New Entry is noted).

ABBREVIATIONS

WHS

- Conservation Area Listed Building CA
- LB I PA
- Local Planning Authority National Park NP
- RPG
- Registered Park and Garden Scheduled Monument SM
- ÍΙΑ
 - Unitary Authority World Heritage Site

HERITAGE AT RISK 2023 / MIDLANDS / DUDLEY / SANDWELL

SITE NAME:	Dudley Castle		
DESIGNATION:	Scheduled Monument, 6 LBs, CA	LIST ENTRY NUMBER:	1014042
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Improving
PRINCIPAL VULNERABILITY:	Visitor erosion - moderate	NEW ENTRY?:	No
OWNER TYPE:	Local authority	CONTACT:	Nick Carter 0121 625 6860
SITE NAME:	Brierley Hill High Street		
DESIGNATION:	Conservation Area, 4 LBs	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	Improving
VULNERABILITY:	Low	CONTACT:	Jayne Pilkington, CMIFA, IHBC (LPA) 01384 814168
SITE NAME:	Stourbridge Branch Canal (Canal Street)		
DESIGNATION:	Conservation Area, 4 LBs	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	Improving
VULNERABILITY:	Low	CONTACT:	Jayne Pilkington, CMIFA, IHBC (LPA) 01384 814168
SITE NAME:	Wollaston		
DESIGNATION:	Conservation Area, 4 LBs	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	Deteriorating
VULNERABILITY:	Medium	CONTACT:	Jayne Pilkington, CMIFA, IHBC (LPA) 01384814168
SITE NAME:	Wordsley Church		
DESIGNATION:	Conservation Area, 4 LBs	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	Deteriorating
VULNERABILITY:	Medium	CONTACT:	Jayne Pilkington, CMIFA, IHBC (LPA) 01384 814168

SANDWELL

	SITE NAME:	Oak House, Oak Road, West Bromwitch, Sandwell. B70 8HJ	Timber frame house, now museum, late C16. Two storeys with attic, with three jettied gables with oriel windows on
	DESIGNATION:	Listed Building grade II*	both floors. Jettied and gabled porch and an early C17 prospect tower on the roof. Brick additions to the south
	CONDITION:	Poor	west and rear of the building with twin Dutch gables and terracotta tiled roof. The building was altered significantly
	OCCUPANCY:	Occupied/in use	during Victorian times and ongoing repairs have not been
	PRIORITY CATEGORY	B (New entry)	sympathetic to the historic fabric and create ongoing issues and water penetration. There are structural issues to the
	OWNER TYPE:	Local authority	porch which is leaning outwardly and the diagonal tie beam to the s/w corner.
gland	LIST ENTRY NUMBER:	1228226	Contact: Cristina Gardiner 0121 625 6850

© Historic Engla



SITE NAME:	Soho Foundry, Foundry Lane, Smethwick	Foundry built in 1795: the world's first integrated steam engine manufactory, established by Boulton & Watt.
DESIGNATION:	Listed Building grade II*, SM	Historic England and the local authority grant aided a temporary roof to stabilise the structure in 2009. That roof
CONDITION:	Poor	is still protecting the core historic building. A local trust is in discussion with the owners to take on the ownership.
OCCUPANCY:	Vacant/not in use	
PRIORITY CATEGORY:	C (C)	
OWNER TYPE:	Commercial company	
LIST ENTRY NUMBER:	1268451	Contact: Cristina Gardiner 0121 625 6850

© Historic England Archive

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В implemented.
- C Slow decay; no solution agreed.

 D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site
 - Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

a faile a	SITE NAME:	Waterloo Hotel, Shireland Road, Smethwick	Kendrick for loca	otel was built in 1907 by Wood and I brewers, Mitchells & Butler, in the		
	DESIGNATION:	Listed Building grade II*, CA	baroque style wi	th terracotta dressings. This is a near le of an Edwardian showpiece pub and		
	CONDITION:	Very bad	commercial hote	l, which retains many interior features		
	OCCUPANCY:	Occupied/in use	floors have been	including the ornately tiled basement grill room. The upper floors have been converted into flats and are partially		
	PRIORITY CATEGORY:	B (C)	occupied. Negleo leaking rainwater	ct of the ground floor and basement, goods, broken window panes and the		
	OWNER TYPE:	Commercial company	poor condition c	of joinery and basement railings put the		
© Historic England	LIST ENTRY NUMBER:	1261644	building at risk. Contact: Cristina Gardiner 0121 625 6850			
	SITE NAME:	Church of St Matthew and St. Chads, Windmill Lane, Smethwick	Church by Joseph James, 1855. Sandstone rubble with some limestone dressing and tiled roof. Central nave w clear storey, north and south isles and north and south			
	DESIGNATION:	Listed Place of Worship grade II		ne base and timber porches. The church cel, north vestry and south organ chamber		
St. Martine -	CONDITION:	Poor	and at the west e	end there is a central buttress between 2- dows. The church has a gabled bellcote.		
	PRIORITY CATEGORY:	D (New entry)	The condition of	the stonework is in very poor condition		
	OWNER TYPE:	Religious organisation	due to inappropi dry rot, vandalisr	riate past repair. The porches suffer from n and antisocial behaviour.		
	LIST ENTRY NUMBER:	1229553	, Contact: Cristina	a Gardiner 0121 625 6850		
© Historic England						
SITE NAME:	Chances Glasswo	orks, Smethwick				
DESIGNATION:	Scheduled Monur	ment, 5 LBs, CA	LIST ENTRY NUMBER:	1021387		
CONDITION:	Generally unsatist problems	factory with major localised	TREND:	Declining		
PRINCIPAL VULNERABILITY:	Deterioration - ir	need of management	NEW ENTRY?:	No		
OWNER TYPE:	Commercial com	pany, multiple owners	CONTACT:	Nick Carter 0121 625 6860		
SITE NAME:	High Street, Wes	st Bromwich, Black Country				
DESIGNATION:	Conservation Are	ea, II LBs	NEW ENTRY?:	No		
CONDITION:	Very bad		TREND:	No significant change		
	Low		CONTACT:	Mark Stretton (LPA) 0121 569 4033		
VULNERABILITY:						
VULNERABILITY:	Market Place, W	ednesbury, Black Country				
	Market Place, We Conservation Are		NEW ENTRY?:	No		
SITE NAME:			NEW ENTRY?: TREND:	No Improving		

SOLIHULL



SITE NAME:	Walford Hall Farmhouse, Solihull Road, Hampton in Arden	Grade II* listed C15 hall with cross wing, altered in C16 by extending it upwards to provide a first floor. Two storeys with pitched gabled roof with red terracotta tiles finish.
DESIGNATION:	Listed Building grade II*	Timber framed with later brick infills on red sandstone base and foundations. Two large brick chimneys each with 3
CONDITION:	Very bad	star-shaped flues and elaborate capping. Flush casement windows, 1:2:1 with very fine astragals protected by
OCCUPANCY:	Vacant/not in use	boarding. The farmhouse is surrounded by a group of
PRIORITY CATEGORY:	A (A)	agricultural buildings part of the listing. In very poor condition despite having undergone emergency repairs to
OWNER TYPE:	Commercial company	patch up the roofs.
LIST ENTRY NUMBER:	1342830	Contact: Cristina Gardiner 0121 625 6850

PRIORITY CATEGORIES

A Immediate risk of further rapid deterioration or loss of fabric; no

- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed.
 C Slow decay; no solution agreed.

 D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user lidentified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site
 - Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

HERITAGE AT RISK 2023 / MIDLA	NDS / WALSALL			
WALSALL				
	SITE NAME:	Church of St Matthew, Church Hill, Walsall	Its soaring spire is a local landmark and its Bath stone	
	DESIGNATION:	Listed Place of Worship grade II*, CA	facades stand out in the street scene. The style of the church is predominantly Perpendicular, but C13 rema survive in the crypt. Repairs to the Welsh slated nave	minantly Perpendicular, but CI3 remains
	CONDITION:	Poor	north aisle and r	north transept are needed. There is a need
VI-PARA	PRIORITY CATEGORY:	В (В)	for repairs to the parapet gutters, cast iron gutters and downpipes; high level stonework and the large cast iron	
	OWNER TYPE: Religious organisation		windows throughout the church.	
	LIST ENTRY NUMBER:	1116151	Contact: Cristina Gardiner 0121 625 6850	
© Historic England				
	SITE NAME:	Life and Light Mission Church (former Trinity Methodist Church), Union Street, Willenhall	Built as a Methodist church in the 1860s, this large rendered church is in the Classical style, with round windows and pilasters, making it prominent on the s frontage. A National Lottery Heritage Fund and Hist	
TRACTOR	DESIGNATION:	Listed Place of Worship grade II, CA	received but on	Grants for Places of Worship award was ly project development work was render is loose in many areas allowing
	CONDITION:	Poor	water to enter t	
	PRIORITY CATEGORY:	A (A)		
© Historic England	OWNER TYPE:	Religious organisation		
- 0	LIST ENTRY NUMBER:	1077170	Contact: Cristin	a Gardiner 0121 625 6850
SITE NAME:	Bloxwich High St	reet		
DESIGNATION:	Conservation Are	ea	NEW ENTRY?:	No
CONDITION:	Very bad		TREND:	No significant change
VULNERABILITY:	Low		CONTACT:	Walsall Council Planning (LPA) 01922650000
SITE NAME:	Bradford Street,	Walsall		
DESIGNATION:	Conservation Area, 5 LBs		NEW ENTRY ?:	No
CONDITION:	Very bad		TREND:	Deteriorating
VULNERABILITY:	Medium		CONTACT:	Walsall Council Planning (LPA) 01922650000
SITE NAME:	Bridge Street, W	alsall		
DESIGNATION:	Conservation Are		NEW ENTRY ?:	No
CONDITION:	Very bad		TREND:	Improving
VULNERABILITY:	Low		CONTACT:	Walsall Council Planning (LPA) 01922650000
SITE NAME:	Caldmore Green	, Walsall		
DESIGNATION:	Conservation Are	,	NEW ENTRY ?:	No
CONDITION:	Very bad	5	TREND:	No significant change
VULNERABILITY:	Low		CONTACT:	Walsall Council Planning (LPA) 01922650000
SITE NAME:	Church Hill, Wal	sall		
DESIGNATION:		ea, 17 LBs, RPG grade II*	NEW ENTRY?:	No
CONDITION:	Very bad	Ŭ	TREND:	Improving
VULNERABILITY:	Low		CONTACT:	Walsall Council Planning (LPA) 01922650000

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no А

- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented. В
- C Slow decay; no solution agreed.

 D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

HERITAGE AT RISK 2023 / MIDLANDS / WALSALL / WOLVERHAMPTON, CITY OF

SITE NAME:	Elmore Green, Bloxwich		
DESIGNATION:	Conservation Area, 3 LBs, SM	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	No significant change
VULNERABILITY:	Low	CONTACT:	Walsall Council Planning (LPA) 01922650000

WALSALL / SANDWELL

88	SITE NAME:	Great Barr Hall, Walsall	Parkland and pleasure grounds, partly by Humphry Repton
	DESIGNATION:	Registered Park and Garden grade II, 3 LBs, part in CA	and John Nash. Much of the historic park was built over as a hospital in C20, in turn replaced by a modern housing estate. Due to longstanding lack of regular maintenance,
	CONDITION:	Extensive significant problems	the pleasure grounds and planting around the lakes are now completely overgrown. The banks of the lakes are
ALL PROPERTY SAME	VULNERABILITY:	High	being eroded, though repairs to some outfalls and spillways
Second States	TREND:	Declining	were carried out in 2017. Proposals for conversion of the hall to a hotel and new housing in the park have been
	NEW ENTRY?:	No	refused, and the house and associated land were put up for sale in 2021.
© Historic England	OWNER TYPE:	Private, multiple owners	
	LIST ENTRY NUMBER:	1001202	Contact: Louisa Moore 0777 043 5511

WOLVERHAMPTON, CITY OF

	SITE NAME:	The Greyhound and Punchbowl Inn (formerly Stow Heath Manor House), High Street, Bilston	Mid-C16 manor house, restored in the 1930s. Of timber framed construction, strengthened with concrete skin in the 1930s. Now suffering from complex structural problems to the supporting concrete frame, which require
	DESIGNATION:	Listed Building grade II*	a long term solution.
	CONDITION:	Very bad	
	OCCUPANCY:	Occupied/in use	
	PRIORITY CATEGORY:	C (C)	
© Historic England	OWNER TYPE:	Commercial company	
	LIST ENTRY NUMBER:	1201819	Contact: Cristina Gardiner 0121 625 6850
	SITE NAME:	St Luke, Blakenhall	Gothic Revival church by GT Robinson of Learnington in
	DESIGNATION:	Listed Building grade II*	polychromatic brickwork erected in 1860. The decorated spire is a local landmark in the Blakenhall area. Closed as a shure in 2017 the building is power in use on an entire sector.

	DESIGNATION:	Listed Building grade II*	spire is a local landmark in the Blakenhall area. Closed as a
	CONDITION:	Poor	church in 2017 the building is now in use as an antiques centre. Rainwater goods remain in poor condition with
	OCCUPANCY:	Occupied/in use	leaks affecting the brickwork and wall structure. Most roofs
	PRIORITY CATEGORY:	C (C)	show evidence of slipped or broken slates with the abutment of the north aisle with the nave being a particula
	OWNER TYPE:	Commercial company	problem, the reainwater goods are poor and the walls are extremely damp with loss of plaster.
	LIST ENTRY NUMBER:	1293038	Contact: Cristina Gardiner 0121 625 6850

© Historic England



-	SITE NAME:	Church of St Leonard, Church Street, Wolverhampton	This church was built in 1825 to designs by Francis Goodwin, and restored in the 1880s by Ewan Christian. It
DESI	DESIGNATION:	Listed Place of Worship grade II	is in the neoclassical style, finished in render with round headed windows and an octagonal tower. The interior has
A	CONDITION:	Poor	decorative plaster ceilings and balconies. The church was repairedLeaking parapet gutters are affecting the render
1	PRIORITY CATEGORY:	E (E)	externally and the plaster internally.
	OWNER TYPE:	Religious organisation	
	LIST ENTRY NUMBER:	1282492	Contact: Cristina Gardiner 0121 625 6850

© Historic England

PRIORITY CATEGORIES

- A Immediate risk of further rapid deterioration or loss of fabric; no
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В implemented.
- C Slow decay; no solution agreed.

 D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA LB
- LB LPA NP RPG SM
- Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument
- UA Unitary Authority WHS World Heritage Site
- 141

HERITAGE AT RISK 2023 / MIDLANDS / WOLVERHAMPTON, CITY OF

	SITE NAME:	Methodist Church, Darlington Street, Wolverhampton	Large Methodist Church dating from 1900-01 by Arthur Marshall, built on a previous church. Classical baroque style
	DESIGNATION:	Listed Place of Worship grade II*	built in brick and ashlar ground floor and dressings stone. Symmetrical facade with pediment and two stone towers
	CONDITION:	Poor	and a large central cupola covered in copper over the r hall with 3-bay tunnel vaults with groin vaulted aisles an semi-circular balcony. The church complex has undergo
	PRIORITY CATEGORY:	C (C)	
	OWNER TYPE:	Religious organisation	many alterations although it also retains many original features. The roof and rainwater goods are in poor
	LIST ENTRY NUMBER:	1201807	condition and ongoing lack of maintenance.
			Contact: Cristina Gardiner 0121 625 6850

© Historic England

I a	SITE NAME:	Catholic Church of St Mary and St John, Snow Hill,	Roman Catholic Church built 1851-5 by Charles Hansom and extended 1879-80. Built in ashlar stone with a slate
toric England			Contact: Cristina Gardiner 0121 625 6850
	LIST ENTRY NUMBER:	1282500	comprehensive repair is needed.
	OWNER TYPE:	Religious organisation	water ingress meant the building was closed until the source of the leaks was repaired. Subsequently
	PRIORITY CATEGORY:	C (C)	that leaks do not disturb the asbestos below. Previous
	CONDITION:	Poor	intact. The church was originally lined with asbestos, which is still in place. The roof and gutters are in need of repair so
1111	DESIGNATION:	Listed Place of Worship grade II	for the statue of St Martin by Donald Potter on the west facade above the entrance. The interior is remarkably
	SITE NAME:	Church of St Martin and attached cloister and vicarage, Dixon Street, Wolverhampton	Church, cloister and vicarage built 1938-9 by Lavander and Twentyman. Brick Modernist church with pantile roofs, coped gables and parapets. The elevations are plain except

	SITE NAME:	Catholic Church of St Mary and St John, Snow Hill, Wolverhampton	Roman Catholic Church built 1851-5 by Charles Hansom and extended 1879-80. Built in ashlar stone with a slate roof, it has an apsidal chancel and French Gothic treatment.
	DESIGNATION:	Listed Place of Worship grade II*	Repairs to the south side of the nave were carried out under a National Lottery Heritage Fund Grant for Places of
	CONDITION:	Poor	Worship in 2016. However, the north side also requires the same work to the high level stonework, gutters and
	PRIORITY CATEGORY:	C (C)	rain water pipes.
	OWNER TYPE:	Religious organisation	
	LIST ENTRY NUMBER:	1208140	Contact: Cristina Gardiner 0121 625 6850

© Historic England

© Histo

SITE NAME:	Bilston Canal Corridor		
DESIGNATION:	Conservation Area	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	No significant change
VULNERABILITY:	Low	CONTACT:	James Holliday (LPA) 01902555622
SITE NAME:	Bilston Town Centre		
DESIGNATION:	Conservation Area	NEW ENTRY ?:	No
CONDITION:	Very bad	TREND:	Deteriorating
VULNERABILITY:	Low	CONTACT:	James Holliday (LPA) 01902555622
SITE NAME:	Bushbury Hill		
DESIGNATION:	Conservation Area	NEW ENTRY ?:	No
CONDITION:	Very bad	TREND:	Deteriorating
VULNERABILITY:	Medium	CONTACT:	James Holliday (LPA) 01902555622
SITE NAME:			
SITE NAME:	Cleveland Road		
DESIGNATION:	Conservation Area	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	Improving
VULNERABILITY:	High	CONTACT:	James Holliday (LPA) 01902555622

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no А

Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В implemented.

```
C Slow decay; no solution agreed.
```

 D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

- CA LB LPA NP RPG SM
- Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

UA Unitary Authority WHS World Heritage Site

HERITAGE AT RISK 2023 / MIDLANDS / WOLVERHAMPTON, CITY OF / DUDLEY / BROMSGROVE

SITE NAME:	Park		
DESIGNATION:	Conservation Area	NEW ENTRY ?:	No
CONDITION:	Poor	TREND:	Deteriorating
VULNERABILITY:	Medium	CONTACT:	James Holliday (LPA) 01902555622
SITE NAME:	Springfield Brewery		
DESIGNATION:	Conservation Area	NEW ENTRY ?:	No
CONDITION:	Very bad	TREND:	Improving significantly
VULNERABILITY:	High	CONTACT:	James Holliday (LPA) 01902555622
SITE NAME:	The Oaks (Merridale Road)		
DESIGNATION:	Conservation Area	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	Improving
VULNERABILITY:	High	CONTACT:	James Holliday (LPA) 01902555622
SITE NAME:	Union Mill		
DESIGNATION:	Conservation Area	NEW ENTRY ?:	No
CONDITION:	Very bad	TREND:	Improving
VULNERABILITY:	High	CONTACT:	James Holliday (LPA) 01902555622
SITE NAME:	Worcester Street		
DESIGNATION:	Conservation Area	NEW ENTRY ?:	No
CONDITION:	Very bad	TREND:	Deteriorating
VULNERABILITY:	Medium	CONTACT:	James Holliday (LPA) 01902555622

WEST MIDLANDS / WORCESTERSHIRE

Е

use).

DUDLEY / BROMSGROVE

SITE NAME:	Wychbury Camp (see also Bromsgrove, Worcestershire), Hagley		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1005900
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Deterioration - in need of management	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners	CONTACT:	Nick Carter 0121 625 6860

WORCESTERSHIRE

BROMSGROVE



Temple of Theseus, Hagley Hall, Hagley
Listed Building grade I, RPG grade I
Poor
N/A
C (C)
Private
1348599

Doric temple of 1758 designed by James 'Athenian' Stewart. It stands in a grade I registered park and garden 800 metres north of Hagley Hall. It is separated from the rest of the estate by the A456. This relatively isolated location has rendered it vulnerable to vandalism so security fencing has been erected. Discussions continue with the owner on a strategy to secure the future of the building. A new, permanent visitor centre on the estate gained planning permission in 2014. Construction of the main building has not yet started; a temporary visitor centre was given consent in 2021.

Contact: Louisa Moore 0777 043 5511

PRIORITY CATEGORIES

© Historic England

- Immediate risk of further rapid deterioration or loss of fabric; no А
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; В solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- D Slow decay; solution agreed but F not yet implemented.

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA
- LB LPA
- Conservation Area Listed Building Local Planning Authority National Park NP RPG
 - Registered Park and Garden Scheduled Monument
- SM
- UA Unitary Authority WHS World Heritage Site

HERITAGE AT RISK 2023 / MIDLA	NDS / BROMSGROVE		
	SITE NAME:	Hewell Grange, Tutnall and Cobley	Grand red sandstone former country house designed by architects Bodley & Garner in 1884-91 for Lord and Lady
A BAR	DESIGNATION:	Listed Building grade I, RPG grade II*, CA	Windsor, later the Earl and Countess of Plymouth. Celebrated as one of the most important late 19th century country houses in England, with an accomplished blend of
A HIGH A	CONDITION:	Fair	architectural styles. From 1946 the house was used by HM Prison Service as a borstal, and latterly as an open prison to
	OCCUPANCY:	Vacant/not in use	HMP Hewell until its closure in autumn 2020. The site was
	PRIORITY CATEGORY:	C (C)	placed on the market in early 2022. Historic England are working closely with the Ministry of Justice to secure its
	OWNER TYPE:	Government or agency	sustainable future use.
© Historic England	LIST ENTRY NUMBER:	1100160	Contact: Steven McLeish 0121 625 6884
	SITE NAME:	Church of St John the Baptist, St Johns Street, Bromsgrove	Large grade 1 urban church ina large churchyard near t centre of Bromsgrove. Much stonework repair is being
	DESIGNATION:	Listed Place of Worship grade I, 2 CAs	reported as urgent by the inspecting church architect, especially the spire.
JA MULA NELLI	CONDITION:	Poor	
	PRIORITY CATEGORY:	C (C)	
	OWNER TYPE:	Religious organisation	
	LIST ENTRY NUMBER:	1100363	Contact: Louisa Moore 0777 043 5511
© Historic England			
	SITE NAME:	Church of St Laurence, Bear Hill, Alvechurch, Alvechurch	Large parish church. Mostly rebuilt between 1860 and 1861 by W Butterfield retaining only a C15 tower which was
H MA	DESIGNATION:	Listed Place of Worship grade II*, CA	rémodelled in 1676. Badly eróded sandstone is affected by damp, especially on the north side and in the tower. Rainwater goods are in poor condition and the leaded
and the little	CONDITION:	Poor	windows are also deteriorating. The church was awarded a National Lottery Heritage Fund Grant for Places of
	PRIORITY CATEGORY:	D (D)	Worship in February 2017 to fund repairs which has
and the second second	OWNER TYPE:	Religious organisation	addressed most of the faults.
	LIST ENTRY NUMBER:	1100225	Contact: Louisa Moore 0777 043 5511
© Historic England			

	SITE NAME:	Christ Church, Catshill, Catshill and North Marlbrook	Large suburban parish church. Nave and west tower built in 1838 by Harvey Eginton and the east end of chancel and
	DESIGNATION:	Listed Place of Worship grade II	flanking chapels rébuilt by JA Chatwin in 1887, mostly in the Early English style. Red sandstone ashlar with slate
	CONDITION:	Poor	roofs. The sandstone is heavily eroded with harmful vegetation growth. Many leaks have sprung from the faili
FI-1- FALL	PRIORITY CATEGORY:	A (A)	parapet gutters.
	OWNER TYPE:	Religious organisation	
	LIST ENTRY NUMBER:	1099541	Contact: Louisa Moore 0777 043 5511

© Historic England

© Historic England

SITE NAME:	Hewell Grange, Bentley Pauncefoot / Tutnall and Cobley	Multi-phase landscape, including work influenced by 'Capability' Brown and Humphry Repton. Another period
DESIGNATION:	Registered Park and Garden grade II*, 23 LBs, part in CA	of activity took place towards the end of C19 when the current house was built. Post-war development by the Prison Service has had a major impact on the legibility of
CONDITION:	Extensive significant problems	the design. A management plan and partnership with the County Gardens Trust has led to renewed interest in and
VULNERABILITY:	High	care for the designed landscape, including restoration of
TREND:	Stable	key features. Following closure in autumn 2020, Historic England is working closely with the Ministry of Justice to
NEW ENTRY ?:	No	secure its sustainable future use.
OWNER TYPE:	Mixed, multiple owners	
LIST ENTRY NUMBER:	1000886	Contact: Louisa Moore 0777 043 5511

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed.
 C Slow decay; no solution agreed.

- D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user lidentified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site
 - Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

HERITAGE AT RISK 2023 / MIDLANDS / BROMSGROVE / MALVERN HILLS

SITE NAME:	Bromsgrove Town Centre, Centred on the High Street/Worcester Road,		
DESIGNATION:	Conservation Area, 53 LBs	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	Improving
VULNERABILITY:	Low	CONTACT:	Mary Worsfold (LPA) 01527 881329

MALVERN HILLS

	SITE NAME:	Stone Farmhouse and attached Hop Kiln, Bromyard Road, Broadwas	C15 timber framed farmhouse which originated as a cruck framed hall house and was enlarged in the C16 and C19. There is a late C19 brick hop kiln attached on the rear
	DESIGNATION:	Listed Building grade II*	gable. The building has a medieval roof and timber framing. The condition of the hop kiln roof is very bad. The house
	CONDITION:	Very bad	roof tiling is very bad in places. Some major work has been completed to repair and replace sections of the timber
	OCCUPANCY:	Occupied/in use	frame, reinstating a gable end. A more comprehensive
	PRIORITY CATEGORY:	B (B)	repair scheme is being prepared.
	OWNER TYPE:	Private	
	LIST ENTRY NUMBER:	1082977	Contact: Steven McLeish 0121 625 6884



	SITE NAME:	Chapel and Cloister at the Convent of the Holy Name, Ranelagh Road, Malvern	Former chapel designed by Comper & Bucknell in 1891-3 which forms part of a complex of buildings associated with the former Convent of the Holy Name. The building has
	DESIGNATION:	Listed Building grade II*, CA	been redundant for some years following the closure of the convent. The site is subject to applications for residential
	CONDITION:	Poor	redevelopment, however the chapel is suffering from blocked gutters and poor roofs. The future of the chapel
	OCCUPANCY:	Vacant/not in use	will be an integral part of any successful proposal for the
	PRIORITY CATEGORY:	C (C)	redevelopment of the area.
	OWNER TYPE:	Commercial company	
	LIST ENTRY NUMBER:	1082736	Contact: Steven McLeish 0121 625 6884

© Historic England

© Historic England



A A A A A A A A A A A A A A A A A A A	SITE NAME:	Church of St Mary, Church End, Hanley Castle	Large rural parish church. Largely CI4 nave and north aisle with CI7 rebuilt tower and east end. Interior is from the	
	DESIGNATION:	Listed Place of Worship grade II*, CA	1858 restoration. The tiled roofs of the nave and south porches need renewal. The sandstone ashlar needs localised repair.	
	CONDITION:	Poor		
	PRIORITY CATEGORY:	C (C)		
	OWNER TYPE:	Religious organisation		
	LIST ENTRY NUMBER:	1349232	Contact: Louisa Moore 0777 043 5511	

© Historic England Archive



Large medieval church of the Benedictine Priory, founded SITE NAME: Priory Church of St Mary and St in 1085, it is now a large parish church that dominates the Michael, Church Street, Malvern centre of Malvern. It has the largest display of C15 stained Listed Place of Worship grade I, glass in England as well as rich furnishings and finishes. DESIGNATION: CA Overall in fair condition but there is a major problem with the stained glass which needs urgent repair. Other CONDITION: Very bad problems are the high level stonework of the tower and the high level masonry to south windows. The parish are PRIORITY CATEGORY: C (C) undertaking a pilot project to repair the stained glass and OWNER TYPE: Religious organisation surrounding fabric to inform a major project of repairs and improved facilities. LIST ENTRY NUMBER: 1082794 Contact: Louisa Moore 0777 043 5511

© Historic England

В

PR	IORITY CATEGORIES		
А	Immediate risk of further rapid	D	Slow d

deterioration or loss of fabric; no solution agreed. Immediate risk of further rapid Е deterioration or loss of fabric; solution agreed but not yet

C Slow decay; no solution agreed.

implemented.

Slow decay; solution agreed but F not yet implemented.

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

ŬA

- CA
- LB LPA
- Conservation Area Listed Building Local Planning Authority National Park NP
- RPG Registered Park and Garden Scheduled Monument
- SM
- Unitary Authority World Heritage Site WHS

HERITAGE AT RISK 2023 / MIDLANDS / MALVERN HILLS

1	SITE NAME:	Church of St John, Mamble, Mamble	Rural parish church in the centre of a village. c1200 origins with C14 and C16 phases. Sandstone rubble with ashlar
	DESIGNATION:	Listed Place of Worship grade I	dressings, brick additions and tiled roofs. Timber bell tower with shingled bell turret. The Blount Chapel on the north
	CONDITION:	Poor	side of the chancel has been roofless for a long time. The bricks are starting to show severe effervescence at high
	PRIORITY CATEGORY:	C (C)	level possibly as a result of the rebuilding of the brick
	OWNER TYPE:	Religious organisation	tile coping of the wall head. Harmful ivy growth is also a problem on the north side of the chapel. Plans for
	LIST ENTRY NUMBER:	1081406	restoration of the chapel have now been developed.
			Contact: Louisa Moore 0777 043 5511

© Historic England Archive

	SITE NAME:	Church of St Peter and St Lawrence, Powick	Large rural church on the edge of a small village. Sandstone ashlar and coursed rubble walls with plain clay roofs.
	DESIGNATION:	Listed Place of Worship grade I, CA	Structural problems at the junctions of the south aisle.and the south transept for which joint and stone cracking is the evidence. This will need monitoring.
	CONDITION:	Fair	
	PRIORITY CATEGORY:	D (D)	
	OWNER TYPE:	Religious organisation	
	LIST ENTRY NUMBER:	1166920	Contact: Louisa Moore 0777 043 5511

© Historic England

× -	SITE NAME:	Church of St Mary, Ripple	Large village centre parish church. Cruciform plan with aisles flanking the nave and a two storey gabled north
	DESIGNATION:	Listed Place of Worship grade I, CA	entrance porch. The tower over the crossing is three stage with a late C18 cap. The stone slate roofs and the tiled
	CONDITION:	Poor	aisle roofs have slipped and are missing tiles. There are are areares of severe stone erosoion and structural cracking at
	PRIORITY CATEGORY:	C (C)	the east end.
	OWNER TYPE:	Religious organisation	
	LIST ENTRY NUMBER:	1349090	Contact: Louisa Moore 0777 043 5511

© Historic England

	SITE NAME:	Stoke Bliss Church, Stoke Bliss	Small parish church with entrance through a south tower
	DESIGNATION:	Listed Place of Worship grade II*	with a squat spire, nave and chancel. Plaster has fallen from the ceiling and interior has had to be cordened off. Other
	CONDITION:	Poor	problems are faults with the tiled roofs, rainwater downpipes and eroded stonework.
	PRIORITY CATEGORY:	D (D)	downpipes and croded stonework.
1	OWNER TYPE:	Religious organisation	
ALL ALL	LIST ENTRY NUMBER:	1179715	Contact: Louisa Moore 0777 043 5511
The second s			

© Historic England

SITE NAME:	Enclosure 110 yards (100 metres) north of St Bartholomew's Church, Grimley			
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1005296	
CONDITION:	Unknown	TREND:	Unknown	
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No	
	Deligious engeniestien	CONTACT:	Imagan Nawaamha 07207 E24020	
OWNER TYPE:	Religious organisation	CONTACT.	Imogen Newcombe 07387 524030	
OWNER TYPE:	Enclosure west of Church Farm, Grimley	CONTACT.	imogen NewCombe 07387 324030	
		LIST ENTRY NUMBER:	1005315	
SITE NAME:	Enclosure west of Church Farm, Grimley		-	
SITE NAME: DESIGNATION:	Enclosure west of Church Farm, Grimley Scheduled Monument	LIST ENTRY NUMBER:	1005315	

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no А

Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В implemented.

C Slow decay; no solution agreed.

 D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

HERITAGE AT RISK 2023 / MIDLANDS / MALVERN HILLS / REDDITCH / WORCESTER

SITE NAME:	Moated site at Earl's Court, Rushwick			
DESIGNATION:	Scheduled Monument		LIST ENTRY NUMBER:	1017229
CONDITION:	Generally unsatisfactory with major localised problems		TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree grow	th	NEW ENTRY ?:	No
OWNER TYPE:	Other not for profit group		CONTACT:	Rachel Jordan 0121 625 6854
	SITE NAME:	Witley Court, Great Witley / Hillhampton / Little Witley	Pre-eminent C19 landscape in multiple ownership. Par the registered park and garden are well cared for but t are concerns about intrusive development in the park, of parkland trees and the need for repair and maintena of the historic boundary walls and features. The wider lacks a Conservation Management Plan to inform futur land management and potential development.	
	DESIGNATION:	Registered Park and Garden grade II*, 19 LBs, SM		
	CONDITION:	Generally unsatisfactory with major localised problems		
The A	VULNERABILITY:	High		
	TREND:	Declining		
© Historic England	NEW ENTRY ?:	No		
	OWNER TYPE:	Mixed, multiple owners		
	LIST ENTRY NUMBER:	1000901	Contact: Louisa	Moore 0777 043 5511

REDDITCH

SITE NAME:	Park Wood Camp, Ipsley		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1005334
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Local authority	CONTACT:	Nick Carter 0121 625 6860
SITE NAME:	St Stephens Green Redditch		
DESIGNATION:	Conservation Area	NEW ENTRY?:	No
CONDITION:	Poor	TREND:	Deteriorating
VULNERABILITY:	Medium	CONTACT:	Mary Worsfold (LPA) 01527 881329

WORCESTER



Single section of the medieval city walls. A variety of repair SITE NAME: City walls: section extending 130 feet (40 metres) from the back of No. 27 New Street to and maintenance has taken place along the city walls in the past, and some sections of the wall have been repaired with Historic England grant aid. This section remains at risk Windsor Row and is affected by damaging plant growth. The owner of DESIGNATION: Scheduled Monument, CA part of this stretch undertook beneficial works to remove a lot of this in 2019; although areas outside of their control CONDITION: Poor still needs to be addressed, and more permanent barriers OCCUPANCY: N/A installed. Maintenance works are also is now needed to tackle re-emerging vegetation PRIORITY CATEGORY: C (C) OWNER TYPE: Mixed, multiple owners LIST ENTRY NUMBER: 1005282 Contact: Nick Carter 0121 625 6860

© Historic England

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; В solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.

D

Е

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA
- LB I PA
- Conservation Area Listed Building Local Planning Authority National Park NP RPG
- Registered Park and Garden Scheduled Monument
- SM
- UA Unitary Authority WHS World Heritage Site

HERITAGE AT RISK 2023 / MIDLANDS / WORCESTER / WYCHAVON

	SITE NAME:	Church of St Helen, Fish Street, Worcester	Although its foundation predates that of the Anglo Saxon Diocese of c675, the church of St Helen dates primarily
LING	DESIGNATION:	Listed Place of Worship grade II*, CA	from C15 and consists of a nave and chancel with aisles, a south porch and a west tower. The presence of iron cramps in conjunction with the red sandstone used for
	CONDITION:	Fair	rebuilding in the C19 is causing accelerated deterioration and failure of the facework. A limited scheme of high level
	PRIORITY CATEGORY:	C (C)	masonry repairs funded by a National Lottery Heritage
	OWNER TYPE:	Religious organisation	Fund Grant for Places of Worship was completed in 2019 but masonry repairs to the south aisle and lowest stage of
	LIST ENTRY NUMBER:	1389795	the tower remain to be attended to.
oric England			Contact: Louisa Moore 0777 043 5511

© Histor

SITE NAME:	City walls: section S of The Butts, extending 150ft (50m) between Angel Place and Bath Cottage		
DESIGNATION:	Scheduled Monument and Listed Building grade II, CA	LIST ENTRY NUMBER:	1003777 and 1390185
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Improving
PRINCIPAL VULNERABILITY:	Collapse	NEW ENTRY ?:	No
OWNER TYPE:	Private	CONTACT:	Nick Carter 0121 625 6860
SITE NAME:	Lowesmoor, Worcester		
DESIGNATION:	Conservation Area, 15 LBs	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	Improving
VULNERABILITY:	Medium	CONTACT:	Paul Collins (LPA) 01905 722129

WYCHAVON

	SITE NAME:	31 High Street, Droitwich Spa	CI4 timber framed town house. The front range
	DESIGNATION:	Listed Building grade II*, CA	incorporates historic timber work in the roof and wall frames. C17 extensions to the rear were in very bad
	CONDITION:	Fair	condition with structural failure to the timber frame and walls. Failed rainwater goods and a roof in poor condition
	OCCUPANCY:	Vacant/not in use	let in water into the structure and rotted the frame. A
	PRIORITY CATEGORY:	F (F)	scheme to convert and upgrade for use as an office, retail units and a residential unit has been approved. An Historic
	OWNER TYPE:	Private	England Repair Grant was given in 2017 and basic repairs are complete. It remains at risk until an occupant is found
	LIST ENTRY NUMBER:	1296659	to complete the fit-out.

© Historic England



C15 and earlier remains of the Evesham Abbey buildings SITE NAME: The Almonry, Merstow Green, now converted as a museum, Rubble stone and timber-Evesham frame with Cotswold stone roofs. It is in bad condition due DESIGNATION: Listed Building grade I, CA to the clear signs of structural instability of the timber frame. Much of the stone slate roofing is nearing the end of CONDITION: Very bad its life and the timber frame has developed weaknesses and rot, particularly at sole plate level. The museum is currently OCCUPANCY: Occupied/in use looking to apply for public funding for repairs to the PRIORITY CATEGORY: B(D) building and rejuvenation of the exhibits it holds.following project development work with Cultural Recovery Fund OWNER TYPE: Local authority grant aid. LIST ENTRY NUMBER: 1302722 Contact: Louisa Moore 0777 043 5511

© Historic England



SITE NAME:	Abbot Chyryton wall, Boat Lane, Evesham	Part of the outer precinct wall of Evesham Abbey, built by Abbot William de Chyryton between 1317 and 1344,
DESIGNATION:	Scheduled Monument and Listed Building grade II	which originally extended from the river to the Abbey. Previous consolidation has partially failed due to vandalism. Some parts of wall are still in very bad condition, and wall
CONDITION:	Very bad	footings are diminishing. Discussions are ongoing with associated parties to agree a long term solution.
OCCUPANCY:	N/A	associated parties to agree a long term solution.
PRIORITY CATEGORY:	A (A)	
OWNER TYPE:	Private	
LIST ENTRY NUMBER:	1005501 and 1350435	Contact: Neil Rimmington 07775 550 674

PRIORITY CATEGORIES

© Historic England

- Immediate risk of further rapid deterioration or loss of fabric; no А
- solution agreed. Immediate risk of further rapid deterioration or loss of fabric; В solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented. D Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no Е obvious new user (applicable only to buildings capable of beneficial

use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

Contact: Louisa Moore 0777 043 5511

- Conservation Area Listed Building CA LB
- LPA
- Local Planning Authority National Park NP
- RPG Registered Park and Garden Scheduled Monument

- SM
- UA WHS Unitary Authority World Heritage Site

HERITAGE AT RISK 2023 / MIDLANDS / WYCHAVON

OWNER TYPE:

LIST ENTRY NUMBER:

	SITE NAME:	Westwood House, Westwood	A grand hunting lodge dating from 1612 now converted to	
	DESIGNATION:	Listed Building grade I, RPG grade II	apartments. Square core with added diagonal wings of three and four storeys. Brick with sandstone dressings and very ornate slate covered roofs. There are now growing problems with the wall structure, windows and roof. Som repairs have been carried out but many other areas need	
	CONDITION:	Poor		
PINT IN	OCCUPANCY:	Part occupied/part in use	urgent repairs.	
© Historic England	PRIORITY CATEGORY:	C (C)		
	OWNER TYPE:	Private, multiple owners		
	LIST ENTRY NUMBER:	1173950	Contact: Louisa Moore 0777 043 5511	
ide .	SITE NAME:	Church of St Mary, Church Road, Aston Somerville	Small rural parish church at the edge of a village. Simple plan of chancel, nave, tower and north porch. Stone slate	
	SITE NAME: DESIGNATION:	Church of St Mary, Church Road, Aston Somerville Listed Place of Worship grade I	plan of chancel, nave, tower and north porch. Stone slate roof and limestone ashlar and rubble walls. CI3 with CI4	
11		Road, Aston Somerville	plan of chancel, nave, tower and north porch. Stone slate	

Religious organisation

1214230

© Historic England

	SITE NAME:	Church of St James, Bredicot, Bredicot	Small church in the old rectory garden with three-bay nave/chancel, south porch and bellcote. Walls are lias
	DESIGNATION:	Listed Place of Worship grade II	rubble with ashlar sandstone dressings and tiled roof. Circa 1300 and restored in 1843 by AE Perkins. The sandstone
	CONDITION:	Very bad	of the window masonry is heavily eroded and falling apart and now repaired badly with mortar facings. The north-
	PRIORITY CATEGORY:	A (A)	west buttress has structural movement and the plain clay
	OWNER TYPE:	Religious organisation	tiles on the south pitch are failing
and the	LIST ENTRY NUMBER:	1117084	Contact: Louisa Moore 0777 043 5511

© Historic England

	SITE NAME:	Church of St John the Baptist, Church Walk, Crowle, Crowle	The original medieval church was demolished and rebuilt in the 1880s to designs by Frederick Preedy in the Decorated
	DESIGNATION:	Listed Place of Worship grade II*, CA	style with a tall west tower. The church is constructed from lias limestone rubble with ashlar stone dressings under a plain clay tile roof with decorative ridges. The roof
	CONDITION:	Poor	and rainwater goods are in poor condition and minor repairs are required to the stonework.
	PRIORITY CATEGORY:	C (C)	repairs are required to the stonework.
	OWNER TYPE:	Religious organisation	
	LIST ENTRY NUMBER:	1081275	Contact: Louisa Moore 0777 043 5511

© Historic England



SITE NAME:	Church of St Nicholas, Dormston	Small rural medieval parish church. Simple nave and chancel with a timber framed west tower that received a National
DESIGNATION:	Listed Place of Worship grade I	Lottery Heritage Fund and Historic England Repair Grant for Places of Worship in 2011. Persistent high levels of
CONDITION:	Poor	damp at low level in the nave and north chancel walls are now an urgent problem.
PRIORITY CATEGORY:	C (C)	now an argent problem.
OWNER TYPE:	Religious organisation	
LIST ENTRY NUMBER:	1116851	Contact: Louisa Moore 0777 043 5511

© Historic England

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no А

- Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В implemented.
- C Slow decay; no solution agreed.
- D Slow decay: solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

Contact: Louisa Moore 0777 043 5511

- CA LB
- LPA NP RPG SM
- Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument
- UA Unitary Authority WHS World Heritage Site

HERITAGE AT RISK 2023 / MIDLANDS / WYCHAVON

	SITE NAME:	Church of St Andrew, St Andrew's Street, Droitwich Spa, Droitwich Spa	Large parish church in the centre of Droitwich. Sandstone ashlar with roofs of mixed materials. Nave and chancel flanked by tall aisles, with a truncated integral north tower
A TAM IN	DESIGNATION:	Listed Place of Worship grade I, CA	set in the north range. A parish centre is attached on the south side. Tiled roof and the rainwater system of the north east chapel are leaking, causing decay in the CI5
	CONDITION:	Poor	ceiling below.
	PRIORITY CATEGORY:	C (C)	
	OWNER TYPE:	Religious organisation	
© Historic England	LIST ENTRY NUMBER:	1167974	Contact: Louisa Moore 0777 043 5511



-	SITE NAME:	Church of St Peter, Port Street, Evesham	Large C19 urban church in the Decorated Gothic revival style. It has an assymetrical plan with a large south tower
	DESIGNATION:	Listed Place of Worship grade II, CA	and spire. This spire has shed stone causing some of the churchyard to be roped off.
	CONDITION:	Poor	
	PRIORITY CATEGORY:	C (C)	
-	OWNER TYPE:	Religious organisation	
Net 1	LIST ENTRY NUMBER:	1350073	Contact: Louisa Moore 0777 043 5511

© HE staff copyright

	SITE NAME:	Church of Saint Mary and All Saints, Hampton Lovett	Large rural parish church in an isolated large churchyard. Nave, chancel south tower and north chapel. Sandstone
	DESIGNATION:	Listed Place of Worship grade I	ashlar walls with a tiled roof. C12 core with C14 additions. Two recent grant aided phases repaired the roofs. The
	CONDITION:	Poor	stonework is now the issue with severely eroded sandstone dressings and open joints at their worst on the
	PRIORITY CATEGORY:	C (New entry)	tower.
	OWNER TYPE:	Religious organisation	
	LIST ENTRY NUMBER:	1215375	Contact: Louisa Moore 0777 043 5511

© Historic England

	SITE NAME:	Church of St Nicholas, Middle Littleton, North and Middle Littleton	Small Anglican parish church. C13 origins, C15 tower upper stages. Early C16 battlemented S chapel. Heavily restored by Preedy 1876 with new nave N wall and
	DESIGNATION:	Listed Place of Worship grade II*, CA	chancel. Lias stone walling with ashlar dressings and plain tiled roofs. Mostly in fair condition but the tiled roofs the stonework need repair. Falls of stone from the tower are
	CONDITION:	Poor	the most recent manifestation
	PRIORITY CATEGORY:	D (D)	
1 1 3 m	OWNER TYPE:	Religious organisation	
© Historic England	LIST ENTRY NUMBER:	1303224	Contact: Louisa Moore 0777 043 5511
	SITE NAME:	Church of St John the Baptist, Wickhamford	Small rural church 13th century origins with 17th century rebuilding and 20th century restorations. Simple plan of
	DESIGNATION:	Listed Place of Worship grade I, CA	west tower, nave and lower east chancel. The cotswold stone roof slate has slips and falls with the whole roof has reach the end of its life. This has caused plaster falls in the
	CONDITION:	Poor	chancel which has been netted.

© Historic England

PRIORITY CATEGORY: D (D) OWNER TYPE: Religious organisation LIST ENTRY NUMBER: Contact: Louisa Moore 0777 043 5511 1287774

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В implemented.
- C Slow decay; no solution agreed.

 D Slow decay: solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA LB LPA NP RPG SM
- Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument
- UA Unitary Authority WHS World Heritage Site

HERITAGE AT RISK 2023 / MIDLANDS / WYCHAVON

SITE NAME:	Enclosures north	east of Fernhill Farm, Charlton / (Cropthorne	
DESIGNATION:	Scheduled Monu	ment	LIST ENTRY NUMBER:	1005286
CONDITION:	Unknown		TREND:	Unknown
PRINCIPAL VULNERABILITY:	Arable ploughing		NEW ENTRY?:	No
OWNER TYPE:	Private		CONTACT:	Imogen Newcombe 07387 524030
SITE NAME:	Settlement site N	Settlement site NNE of Fernhill Farm, Charlton / Cr		
DESIGNATION:	Scheduled Monument		LIST ENTRY NUMBER:	1005287
CONDITION:	Generally unsatis problems	factory with major localised	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Arable ploughing		NEW ENTRY?:	No
OWNER TYPE:	Private		CONTACT:	Imogen Newcombe 07387 524030
SITE NAME:	Evesham Abbey	(remains of), Evesham		
DESIGNATION:	Scheduled Monu	ment, 2 LBs, CA	LIST ENTRY NUMBER:	1005297
CONDITION:	Generally unsatisfactory with major localised problems		TREND:	Improving
PRINCIPAL VULNERABILITY:	Deterioration - ir	n need of management	NEW ENTRY?:	No
OWNER TYPE:	Local authority		CONTACT:	Neil Rimmington 07775 550 674
SITE NAME:	Settlement site n	orth of Spring Hill, Fladbury		
DESIGNATION:	Scheduled Monument		LIST ENTRY NUMBER:	1005352
CONDITION:	Unknown		TREND:	Unknown
PRINCIPAL VULNERABILITY:	Arable ploughing		NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners		CONTACT:	Imogen Newcombe 07387 524030
SITE NAME:	Moated site 120	metres south east of Huntingdrop	Farm, Hanbury	
DESIGNATION:	Scheduled Monu	ment	LIST ENTRY NUMBER:	1017311
CONDITION:	Extensive significa	ant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Deterioration - ir	n need of management	NEW ENTRY?:	No
OWNER TYPE:	Private		CONTACT:	Imogen Newcombe 07387 524030
	SITE NAME:	Westwood Park, Ombersley / Westwood / Doverdale / Droitwich Spa / Hampton Lovett	imposing hunting park changes and vast majority of t	7 garden and park associated with an lodge, later a house. Some garden and d additions of C18 to early C20 date. The he park is in intensive cultivation and
	DESIGNATION:	Registered Park and Garden grade II, 10 LBs	development in t	and trees. There is some post-war the vicinity of the main house. Resident d expansion of a business park affect
	CONDITION:	Generally unsatisfactory with major localised problems		ly to the north and east.
	VULNERABILITY:	High		
) Historic England	TREND:	Stable		
	NEW ENTRY?:	No		
	OWNER TYPE:	Mixed, multiple owners		
		1000000		

PRIORITY CATEGORIES

- Immediate risk of further rapid deterioration or loss of fabric; no А
- Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В
- implemented. C Slow decay; no solution agreed.

1000899

LIST ENTRY NUMBER:

 D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

Contact: Louisa Moore 0777 043 5511

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site
 - Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

WYRE FOREST




SITE NAME:	Severn Bridge including Flanking Arches and Balustrade, Bewdley	Bridge over the river Severn, 1798 by Thomas Telford. Mostly sandstone forming three arches over river, two
DESIGNATION:	Listed Building grade I, CA	towpath arches on south bank, 14 arches on north bank extending about 50 metres to south east; balustrades on
CONDITION:	Poor	river part of stone, cast iron on land. The stone balustrade is suffering extensive stone erosion as are the flanking piers.
OCCUPANCY:	N/A	The cast iron is rusting badly. There have been incidents of
PRIORITY CATEGORY:	C (C)	traffic impact damage to the balustrades.
OWNER TYPE:	Local authority	
LIST ENTRY NUMBER:	1100000	Contact: Louisa Moore 0777 043 5511

© Historic England



	SITE NAME:	Churchill Forge, Churchill Lane, Churchill, Churchill and Blakedown	Early C19 hand forge building that made spades and shovels, comprising three brick buildings, two water wheels, a dam and large mill pond. The forge is still in
	DESIGNATION:	Scheduled Monument and Listed Buildings - 3 grade II, part in CA	working order and is managed by the Churchill Forge Trust. The Trust are continuously progressing maintenance and conservation tasks within the site and have recently
	CONDITION:	Very bad	completed comprehensive repair works to the spillway weir. They are exploring options to better understand the
	OCCUPANCY:	Part occupied/part in use	conservation management needs of the buildings within the
	PRIORITY CATEGORY:	B (B)	site, and opportunities for future funding.
	OWNER TYPE:	Private, multiple owners	
	LIST ENTRY NUMBER:	1005274 and 1348320; 1100650; 1100651	Contact: Nick Carter 0121 625 6860

© Historic England

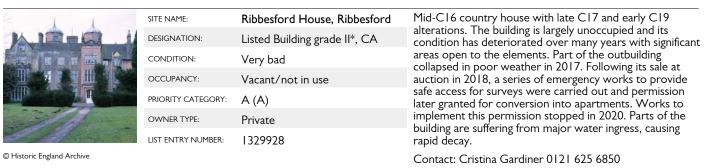



	SITE NAME:	Church of St George, Coventry Street, Kidderminster, Kidderminster	Georgian Gothic church with elaborate gable buttresses and tower with turret and pinnacles, by Francis Goodwin, 1821- 24. The roof was destroyed by fire in 1922 but
1	DESIGNATION:	Listed Place of Worship grade II*	rebuilt, and the church was remodelled by Giles Gilbert Scott in 1923-25. At the west end the roof from this work
	CONDITION:	Fair	is now leaking at both side valley gutters buta comprehensive access system has been installed that
	PRIORITY CATEGORY:	C (C)	enables the PCC maintenance team to keep well on top of
	OWNER TYPE:	Religious organisation	the faults as their symptoms occur.
	LIST ENTRY NUMBER:	1100088	Contact: Louisa Moore 0777 043 5511

© Historic England

SITE NAME:	Gilgal, Stourport-on-Severn, East of Stourport Town Centre, Stourport-on-Severn			
DESIGNATION:	Conservation Area, 4 LBs	NEW ENTRY?:	No	
CONDITION:	Very bad	TREND:	Deteriorating significantly	
VULNERABILITY:	Medium	CONTACT:	Planning Department (LPA) 01562 732928	

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no А

D

Е

- solution agreed. Immediate risk of further rapid В deterioration or loss of fabric; solution agreed but not yet implemented.
- C Slow decay; no solution agreed.
- Slow decay; solution agreed but F not yet implemented.

Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

- CA
- LB LPA
- Conservation Area Listed Building Local Planning Authority National Park NP
- RPG Registered Park and Garden Scheduled Monument
- SM UA WHS

Unitary Authority World Heritage Site

HERITAGE AT RISK 2023 / MIDLANDS / WYRE FOREST

SITE NAME:	NAME: Green Street, Kidderminster, Town centre, Kidderminster				
DESIGNATION:	Conservation Area, 3 LBs	NEW ENTRY?:	No		
CONDITION:	Poor	TREND:	Deteriorating		
VULNERABILITY:	Low	CONTACT:	Planning Department (LPA) 01562 732928		
SITE NAME: Bibbesford 2 miles south of Bewdley, Bibbesford					
SITE NAME:	Ribbesford 2 miles south of Bewdley Ribbesford				
SITE NAME: DESIGNATION:	Ribbesford, 2 miles south of Bewdley, Ribbesford	NEW ENTRY?:	Νο		
	Ribbesford, 2 miles south of Bewdley, Ribbesford Conservation Area, 7 LBs Very bad	NEW ENTRY?: TREND:	No Deteriorating		

PRIORITY CATEGORIES

Immediate risk of further rapid deterioration or loss of fabric; no А

- Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet В
- implemented. C Slow decay; no solution agreed.

 D Slow decay; solution agreed but F not yet implemented.
 E Under repair or in fair to good repair, but no user lidentified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use) use).

Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).

- CA Conservation Area LB Listed Building LPA Local Planning Authon NP National Park RPG Registered Park and 0 SM Scheduled Monumen UA Unitary Authority WHS World Heritage Site Conservation Area Listed Building Local Planning Authority National Park Registered Park and Garden Scheduled Monument

This document is one in a series of regional registers produced as part of Historic England's national Heritage at Risk programme. The registers for other regions and previous Heritage at Risk publications can be found at historicengland.org.uk/advice/heritage-at-risk/ registers-and-publications/ More information about Historic England's Heritage at Risk programme can be found at historicengland.org.uk/advice/heritage-at-risk/

Heritage at Risk Published November 2023 4th Floor, Cannon Bridge House 25 Dowgate Hill London EC4R 2YA © Copyright Historic England 2023 Product code: HE0082



Midlands Register 2023