

Heritage at **Risk**



Historic England

**North East & Yorkshire
Register 2023**

Contents

The Register	III
Criteria	III
Key statistics	VI
Key to the Entries	VII
Entries on the Register by local planning authority	IX
County Durham (UA)	I
Northumberland (UA)	10
Northumberland (NP)	26
<i>Tees Valley</i>	31
Darlington (UA)	31
Hartlepool (UA)	32
Middlesbrough (UA)	33
North York Moors (NP)	33
Redcar and Cleveland (UA)	33
Stockton-on-Tees (UA)	35
<i>Tyne and Wear</i>	36
Gateshead	36
Newcastle upon Tyne	37
North Tyneside	41
South Tyneside	41
Sunderland	42
East Riding of Yorkshire (UA)	44
Kingston upon Hull, City of (UA)	59
North Yorkshire Council (UA)	59
North York Moors (NP)	84
Yorkshire Dales (NP)	91
<i>South Yorkshire</i>	94
Barnsley	94
Doncaster	97
Peak District (NP)	100
Rotherham	101
Sheffield	103
<i>West Yorkshire</i>	107
Bradford	107
Calderdale	111
Kirklees	115
Leeds	119
Wakefield	124
York (UA)	127

THE REGISTER

The Heritage at Risk Register includes historic buildings and sites that are at risk of loss through neglect, decay or development, or are vulnerable to becoming so. It includes all types of designated heritage assets, including Conservation Areas, which are designated and assessed by Local Planning Authorities.

The aim of the Register is to focus attention on those places in greatest need. Historic England, in partnership with others, is able to help tackle heritage at risk. We work with owners, friends groups, developers and other stakeholders to find imaginative solutions for historic places and sites at risk across England.

More information about our role, the advice and funding available, and useful publications and guidance is available on our [website](#).

Criteria for inclusion on the Register

RISK ASSESSMENTS

Heritage assets included on the Register are assessed according to the nature of the site. This can be through on-site checks and/or desk-based assessments. The risk assessment methodologies outlined below are based on the different factors which can threaten the different types of heritage assets and lead to them becoming at risk.

BUILDINGS AND STRUCTURES

To be considered for inclusion on the Register, buildings or structures must be listed on the National Heritage List for England; and in secular (non-worship) use. And be either:

- a grade I or II* listed building, or
- a grade II listed building in London, or
- a structural scheduled monument with upstanding remains.

Buildings or structures are assessed on the basis of condition and, where applicable, occupancy (or use) reflecting the fact that a building which is occupied is generally less vulnerable than one that is not.

Occupancy (or use) is assessed as 'vacant', 'part-occupied', 'occupied', 'not applicable', or occasionally, 'unknown'.

Many structures fall into the 'not applicable' category, for example: ruins, walls, gates, headstones or boundary stones.

Condition is assessed as 'very bad', 'poor', 'fair' or 'good'. The condition of buildings or structures on the Register is typically very bad or poor, but can be fair or, very occasionally, good. This reflects the fact that some buildings or structures are vulnerable because they are empty, underused or face redundancy without a new use to secure their future.

A few buildings remain on the Register in good condition whilst solutions are being implemented as a reminder of the need for monitoring, and to ensure that repair and re-use are seen through to completion.

Buildings or structures are removed from the Register when they are fully repaired/consolidated, and their future secured either through occupation and use, or through the adoption of appropriate management.

PLACES OF WORSHIP

To be considered for inclusion on the Register, places of worship must be listed grade I, grade II* or grade II on the National Heritage List for England and be used as a public place of worship at least six times a year.

The method used to assess whether a place of worship is at risk is essentially the same as that used to assess other historic buildings or structures (as outlined above), with one important difference: the criterion as to whether a building is occupied is not used as by their nature, places of worship are in use. Places of worship will be assessed as at risk and added to the Register if their condition is assessed to be very bad or poor.

It is often the case that only part of a church building, e.g. the tower or one of the aisles, is in very bad or poor condition, and it then becomes a matter of professional judgement whether this puts the whole building at risk. Usually if a major or a very significant element of a church is considered to be at risk then the judgement is made that the whole building is at risk and it is included in the Register.

Once on the Register, places of worship can move through the condition categories (e.g. from very bad to poor, to fair, even to good) as repairs are implemented and the condition improves, until they are fully repaired and can be removed from the Register. This means that there are some places of worship in good condition on the Register but with outstanding issues still to be resolved at the time when they were assessed.

ARCHAEOLOGY

To be considered for inclusion on the Register, archaeological sites must be designated as scheduled monuments on the National Heritage List for England.

Archaeology assessments cover scheduled earthworks and buried archaeology.

The risk assessment is based on their condition and vulnerability, the trend in their condition, and their likely future vulnerability. A site's condition is expressed in terms of the scale and severity of adverse effects on it, ranging from 'extensive significant problems' to 'minor localised problems'. The trend will also be recorded as 'improving', 'stable', 'declining' or 'unknown'.

Archaeological entries are removed from the Register once sufficient progress has been made to address the identified issues, and a significant reduction in the level of risk has been demonstrated.

PARKS AND GARDENS

To be considered for inclusion on the Register, parks and gardens must be designated as grade I, grade II* or grade II on the National Heritage List for England. Parks and gardens are assessed in terms of their condition and vulnerability, the trend in their condition, and their likely future vulnerability. Steps being taken by owners to address problems are also taken into consideration.

Parks and gardens assessed as being at risk are typically affected by development and neglect. They have frequently been altered by development or are faced with major change. The original function of these landscapes has often changed and divided ownership leads to the loss of their cohesive historic design.

Park and garden entries are removed from the Register once steps have been taken to address issues and positive progress is being made.

BATTLEFIELDS

To be considered for inclusion on the Register, battlefields must be included on the National Heritage List for England. Battlefields deemed to be at risk of loss of cultural significance are included on the Register.

Each battlefield is assessed against four key criteria:

- Landscape readability – is it possible to understand the context of the battle?
- Landscape features – are hedgerows, walls and trees which had a significant impact on the battle still in place?
- Archaeological integrity – is the archaeology of the battle being disturbed?
- Ambiance – are activities such as development having a negative impact on the setting of the site?

Current condition, future vulnerability and trend are all taken into account.

Battlefields are removed from the Register either when damaging activities cease/are managed, or when threats recede due to effective planning.

WRECK SITES

To be considered for inclusion on the Register, wrecks must be designated as protected wreck sites on the National Heritage List for England.

Wreck sites are assessed based on their condition and vulnerability, the trend in their condition, and their likely future vulnerability.

Wrecks are considered to be at risk if there is a significant likelihood of loss or further loss of historical, archaeological or artistic significance from it within the foreseeable future.

Wrecks are vulnerable to both environmental and human impacts. Risks that contribute to inclusion on the Register range from unauthorised access to erosion and fishing damage. The monitoring process ensures that the significance of the site is identified and maintained.

Wrecks are removed from the Register once an appropriate management and monitoring regime is operational.

CONSERVATION AREAS

Once a year Historic England asks every local authority in England to consider the state of its conservation areas and fill in (and update as appropriate) risk assessment questionnaires for those that cause concern or are believed to no longer be at risk.

Conservation areas that are deteriorating or are in very bad or poor condition and not expected to

change significantly in the next three years are defined as being at risk.

Categories for condition, vulnerability and trend are included for each conservation area on the Heritage at Risk Register.

The approach taken to assess conservation areas at risk has been refined since the first survey in 2008/2009. Conservation areas identified as at risk in 2009 but not reassessed since using the revised methodology are included on the Register but with limited information.

Conservation area entries are removed from the Register once issues have been identified, plans put in place to address them, and positive progress is being made.

Key Heritage at Risk

Statistics for North East & Yorkshire 2023

There are 785 entries on the HAR Register for 2023 in the North East & Yorkshire, 2 more than on the previous Register for 2022.

BUILDINGS AND STRUCTURES

- Of the 22,519 grade I and II* listed buildings and structures (excluding places of worship) in England, 765 (3.4%) are on the Register. Of the 2,535 grade I and II* listed secular buildings and structures in the North East & Yorkshire, 114 (4.5%) are on the Register. The North East & Yorkshire also has 2 grade I or II* listed secular buildings on the Register which form part of a listed place of worship but are in secular use.
- In addition to this, of the 3,992 scheduled monuments in the North East & Yorkshire, 58 (1.5%) are on the Register assessed as structural scheduled monuments (i.e. using the buildings or structures methodology).
- 3 building or structure entries (including structural scheduled monuments) have been removed from the previous North East & Yorkshire Register (2022) for positive reasons and one has been added.

PLACES OF WORSHIP

- Of the 14,797 listed places of worship (of all grades) in England, 943 (6.4%) are on the Register. Of the 1,816 listed places of worship in the North East & Yorkshire 81 (4.5%) are on the Register.
- 4 places of worship entries have been removed from the previous North East & Yorkshire Register (2022) for positive reasons and 2 have been added.

ARCHAEOLOGY

- Of the 19,954 scheduled monuments in England, 1,916 (9.6%) are on the Register assessed as archaeology. Of the 3,992 scheduled monuments in the North East & Yorkshire, 430 (10.8%) are on the Register assessed as archaeology.
- 5 archaeology entries have been removed from the previous North East & Yorkshire Register (2022) for positive reasons, and 15 have been added.

PARKS AND GARDENS

- Of the 1,701 registered parks and gardens in England 104 (6.1%) are on the Register. Of the 182 registered parks and gardens in the North East & Yorkshire, 16 (8.8%) are on the Register.
- 2 parks and gardens entries have been removed for positive reasons and one has been added to the previous North East & Yorkshire Register (2022).

BATTLEFIELDS

- Of the 47 registered battlefields in England, 3 (6.4%) are on the Register. Of the 13 registered battlefields in the North East & Yorkshire, 3 (23.1%) are on the Register.
- No battlefields entries have been removed for positive reasons or added to the previous North East & Yorkshire Register (2022).

WRECK SITES

- Of the 57 protected wreck sites around England's coast, 4 (7.0%) are on the Register. None of the 3 protected wreck sites in the North East & Yorkshire are on the Register.

CONSERVATION AREAS

- Of the 9,907 conservation areas in England, 483 (4.9%) are on the Register. Of the 1,189 conservation areas in North East & Yorkshire 81 (6.8%) are on the Register.
- 4 conservation areas have been removed from the previous North East & Yorkshire Register (2022) for positive reasons and one has been added.

HISTORIC ENGLAND FUNDING

- £1.41 million in grant was spent on 18 entries (including conservation areas) on the North East & Yorkshire Register during 2022/23. (This figure includes funding for Heritage Action Zones and for Partnership Schemes in Conservation Areas. It does not include regional capacity building grants or funding for High Street Heritage Action Zones.)

Risk assessments of heritage assets are based on the nature of the site. Buildings and structures include structural scheduled monuments and listed buildings (excluding listed places of worship); archaeology assessments include earthworks and buried archaeology. Please note that some sites may have more than one entry under different risk assessment methodologies, for example if a site has more than one listing for its different elements or if it consists of both buried and structural remains.

2023 HAR data as at 4pm 29 June 2023

2022 HAR data as at 11am 11 July 2022

Key to the entries

The Register includes the following risk assessment types:

- Building or structure (for grade I and II* listed Buildings, grade II listed buildings in London and structural scheduled monuments)
- Place of worship (for grade I, II* and II listed buildings)
- Archaeology (for scheduled monuments – earthworks and buried archaeology)
- Park and garden (for Registered parks and gardens)
- Battlefield (for Registered battlefields)
- Wreck site (for Protected wreck sites)
- Conservation area (for conservation areas)

(Please note not all assessment types appear in each of the regional registers.)

ORDER OF ENTRIES

Please refer to the 'Contents' page to see the order that the Planning Authorities are presented in.

Please note that Unitary Authorities are ordered under their own names and may not appear in the same section as the other planning authorities in their ceremonial (or former) county.

Sites that straddle more than one local planning authority are included under the lead authority.

Within each planning authority, entries are grouped by risk assessment type in the following order:

- Buildings or structures
- Places of worship
- Archaeology
- Parks and gardens
- Battlefields
- Wreck sites
- Conservation areas

Within each risk assessment type, entries are ordered alphabetically by parish, locality and street/site name (except for conservation areas and protected wreck sites which are ordered by site name only).

DESIGNATION/LISTING

The principal designation/listing type is noted for each entry:

- Listed Building (LB) grade I, II* or II
- Scheduled Monument (SM)
- Registered Park and Garden (RPG) grade I, II* or II
- Registered Battlefield (RB)
- Protected Wreck Site (PWS)
- Conservation Area (CA)

Any other listing types that also apply to the site are also noted (e.g. location within a World Heritage Site (WHS); where a LB or SM is sited within a CA or RPG; or where a CA contains many LBs or SMs).

If an entry is dual designated on the National Heritage List for England (i.e. it is both a listed building and a scheduled monument) the two designations will be joined with an 'and' (e.g. 'Scheduled Monument and Listed Building grade I').

The National Heritage List Entry Number is included for all entries (except conservation areas). If a site has dual list entries, all relevant List Entry Numbers are noted.

CONDITION

For buildings (including places of worship), condition is graded as: 'very bad', 'poor', 'fair' and 'good'.

For sites that cover areas (scheduled monuments – archaeology assessments, parks and gardens, battlefields and wreck sites) one overall condition category is recorded. The category may relate only to the part of the site or monument that is at risk and not the whole site:

- extensive significant problems
- generally unsatisfactory with major localised problems
- generally satisfactory but with significant localised problems
- generally satisfactory but with minor localised problems
- optimal
- unknown (noted for a number of scheduled monuments that are below-ground and where their condition cannot be established)

For conservation areas, condition is categorised as: 'very bad', 'poor', 'fair' and 'optimal'.

If a site has suffered from heritage crime it is noted in the summary. Heritage crime is defined as any offence which harms the heritage asset or its setting and includes arson, graffiti, lead theft and vandalism.

OCCUPANCY/USE

For buildings (excluding places of worship) that can be occupied or have a use, the main vulnerability is vacancy or under-use.

Occupancy (or use) is noted as follows:

- vacant (or not in use)
- part occupied (part in use)
- occupied (in use)
- unknown
- not applicable (for structural scheduled monuments)

VULNERABILITY

Principal vulnerability is noted for archaeology assessments and may relate only to the part of the site that is at risk:

- animal burrowing
- arable ploughing
- coastal erosion
- collapse
- deterioration – in need of management
- scrub/tree growth
- visitor erosion

For parks and gardens, battlefields, wreck sites and conservation areas, vulnerability is noted as 'high', 'medium' or 'low'.

PRIORITY CATEGORY

Priority for action is assessed on a scale of A to F, where 'A' is the highest priority for a site which is deteriorating rapidly with no solution to secure its future, and 'F' is the lowest priority.

For buildings and structures and places of worship the following priority categories are used as an indication of trend and as a means of prioritising action:

- A Immediate risk of further rapid deterioration or loss of fabric; no solution agreed
- B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented
- C Slow decay; no solution agreed
- D Slow decay; solution agreed but not yet implemented
- E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use)
- F Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented

For battlefields and wreck sites the following priority categories are used as a means of prioritising action:

- A No action/strategy identified or agreed (where trend is declining or unknown)
- B Action/strategy agreed but not yet implemented (where trend is declining or unknown)
- C No action/strategy identified or agreed (where trend is stable or improving)
- D Action/strategy agreed but not yet implemented (where trend is stable or improving)
- E Monitoring as appropriate (any trend)
- F Action implemented/strategy underway/scheme in progress (any trend)

The priority category for the previous year for the entry is given in brackets, otherwise 'New entry' is noted.

'New entry – re-assessed' indicates an existing site on the Register that has been re-assessed using a different risk assessment methodology and is included on this year's Register under the new assessment type.

TREND

Trend for archaeology entries, parks and gardens, battlefields and wreck sites may relate only to the part of the site that is at risk and is categorised as:

- declining
- stable
- improving
- unknown

For conservation areas trend is categorised as:

- deteriorating
- deteriorating significantly
- no significant change
- improving
- improving significantly
- unknown

OWNERSHIP

A principal ownership category is given for each entry, and if sites are in divided ownership, a 'multiple' ownership category is noted.

CONTACT

This is the member of the Historic England local team who acts as a first point of contact for the case, and to whom enquiries should be addressed.

For conservation areas, the contact is the conservation/planning officer at the relevant local planning authority (indicated by 'LPA').

ABBREVIATIONS

CA	Conservation Area
HE	Historic England
NLHF	National Lottery Heritage Fund
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
PWS	Protected Wreck Site
RB	Registered Battlefield
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

Entries on the Register by local planning authority

Local planning authority	Building and structure entries	Place of worship entries	Archaeology entries	Park and garden entries	Battlefield entries	Wreck site entries	Conservation area entries
COUNTY DURHAM (UA)							
County Durham (UA)	22	4	19	1	0	0	5
NORTHUMBERLAND (UA)							
Northumberland (UA)	28	3	66	2	0	0	5
NORTHUMBERLAND (NP)							
Northumberland (NP)	0	0	32	0	0	0	0
TEES VALLEY							
Darlington (UA)	2	1	0	0	0	0	2
Hartlepool (UA)	0	2	2	0	0	0	4
Middlesbrough (UA)	0	0	0	0	0	0	2
North York Moors (NP)	0	0	1	0	0	0	0
Redcar and Cleveland (UA)	4	1	4	1	0	0	2
Stockton-on-Tees (UA)	2	0	0	0	0	0	0
TYNE AND WEAR							
Gateshead	4	1	3	0	0	0	1
Newcastle upon Tyne	5	6	2	2	0	0	0
Northumberland (UA) / Newcastle upon Tyne [†]	0	0	1	0	0	0	0
Newcastle upon Tyne / Gateshead [†]	0	0	0	0	1	0	0
North Tyneside	0	1	0	0	0	0	2
South Tyneside	1	2	0	0	0	0	3
Sunderland	2	3	1	0	0	0	3
Sunderland / Gateshead [†]	1	0	0	0	0	0	0
EAST RIDING OF YORKSHIRE (UA)							
East Riding of Yorkshire (UA)	4	7	90	2	0	0	2
KINGSTON UPON HULL, CITY OF (UA)							
Kingston upon Hull, City of (UA)	0	0	0	0	0	0	2
NORTH YORKSHIRE COUNCIL (UA)							
North Yorkshire Council (UA)	27	9	110	3	1	0	8
NORTH YORK MOORS (NP)							
North York Moors (NP)	4	0	38	0	0	0	0
YORKSHIRE DALES (NP)							
Yorkshire Dales (NP)	7	1	9	0	0	0	3
SOUTH YORKSHIRE							
Barnsley	5	2	4	1	0	0	1
Barnsley / Rotherham [†]	0	0	1	0	0	0	0
Doncaster	2	7	9	0	0	0	7
Peak District (NP)	0	0	3	0	0	0	0
Rotherham	4	0	7	0	0	0	3
Sheffield	7	4	6	1	0	0	3
WEST YORKSHIRE							
Bradford	5	7	2	1	0	0	11
Bradford / Kirklees / Leeds [†]	0	0	0	0	1	0	0
Calderdale	12	5	5	0	0	0	2
Kirklees	8	9	3	0	0	0	4
Leeds	11	4	5	2	0	0	5
Leeds / North Yorkshire Council (UA) [†]	0	0	2	0	0	0	0
Wakefield	6	1	5	0	0	0	1
YORK (UA)							
York (UA)	1	1	0	0	0	0	0

Local planning authority	Building and structure entries	Place of worship entries	Archaeology entries	Park and garden entries	Battlefield entries	Wreck site entries	Conservation area entries
TOTAL	174	81	430	16	3	0	81

† Sites that cross local planning authority boundaries

COUNTY DURHAM (UA)



© Historic England

SITE NAME:	Brancepeth Castle, Brancepeth
DESIGNATION:	Listed Building grade I, RPG grade II, CA
CONDITION:	Poor
OCCUPANCY:	Part occupied/part in use
PRIORITY CATEGORY:	E (D)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	1159012

Brancepeth Castle is a medieval fortress, greatly enlarged in the C19 by architects John Paterson and (later) Anthony Salvin. It was occupied by the army during World War II and then by glassware makers, J A Joblings. Parts of the building are currently occupied while others are used for events. Urgent repair works were completed in 2018. CRF grants have allowed repairs to sash windows in the Billiard Room and Constable Tower and renewed the roof coverings to the Grand Stair and Entrance Hall, Russell Tower and Junction Rooms. Some roof areas still remain at risk.

Contact: Maria Carballeira 0191 4031650



© Historic England

SITE NAME:	Hedleyhill Colliery coke works, 500 metres south west of Hazlet House, Brandon and Byshttles / Hedleyhope
DESIGNATION:	Scheduled Monument
CONDITION:	Very bad
OCCUPANCY:	N/A
PRIORITY CATEGORY:	A (A)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	1018230

C18-C19 lines of brick-built coke ovens. Many bricks have been dislodged by livestock sheltering within the ovens. Livestock has also eroded the grassy banks between each oven and established tree growth occurs along the entire structure.

Contact: Tom Gledhill 0191 4031623



© Historic England

SITE NAME:	No.4, and castle wall incorporated, North Bailey, City of Durham
DESIGNATION:	Listed Building grade II*, CA
CONDITION:	Poor
OCCUPANCY:	Occupied/in use
PRIORITY CATEGORY:	B (B)
OWNER TYPE:	Charity (non-heritage)
LIST ENTRY NUMBER:	1121421

The castle walls in this section are of varying periods, from the medieval through to modern repair. The walls are in a poor condition, with open joints, eroding foundations and structural cracks. Management of the walls is impeded by difficulty of access. A Historic England grant towards project development was completed in 2019 and a detailed scheme for repair has been prepared. Funding for repairs currently being sought.

Contact: Sara Rushton 0191 4031642



© Historic England

SITE NAME:	Durham Prison Officers' Club, ('The Tithe Barn'), Hallgarth Street, Durham, City of Durham
DESIGNATION:	Listed Building grade II*, CA
CONDITION:	Fair
OCCUPANCY:	Occupied/in use
PRIORITY CATEGORY:	D (D)
OWNER TYPE:	Government or agency
LIST ENTRY NUMBER:	1120616

C15 granary building, erroneously known as 'The Tithe Barn', forming part of an important group of medieval farm buildings. The building lies outside the secure perimeter of the adjoining prison and is used as part of the Prison Officers' Club. The roof, stonework and close-studded upper floor require attention. Repointing of the barn has been completed but further works are required, particularly to the granary.

Contact: Maria Carballeira 0191 4031650

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.
- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site



© Historic England

SITE NAME:	Prebends Bridge, Durham and Framwellgate, City of Durham
DESIGNATION:	Scheduled Monument and Listed Building grade I, CA, WHS
CONDITION:	Poor
OCCUPANCY:	Occupied/in use
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1002337 and 1121354

Bridge over the River Wear designed in 1772-8 by George Nicholson for the Dean and Chapter of Durham Cathedral. A programme of remedial works, part-funded by Historic England, was completed in 2011-12. Consent for repair of flagstones and kerbing and investigation of drainage issues was granted in June 2023. Part of balustrade protected by Heras fencing still awaits a repair strategy.

Contact: Lee McFarlane 0191 4031659



© Niven Architects

SITE NAME:	Castle Wall, behind 3, North Bailey, Durham and Framwellgate, City of Durham
DESIGNATION:	Listed Building grade I, CA
CONDITION:	Very bad
OCCUPANCY:	N/A
PRIORITY CATEGORY:	B (B)
OWNER TYPE:	Charity (non-heritage)
LIST ENTRY NUMBER:	1322845

C12 castle wall with base of angle tower. Consists of coursed squared sandstone. Suffering from progressive collapse of wall face and the core requires urgent attention to avoid further substantial failure. A Historic England grant towards project development was completed in 2019 and a detailed scheme for repair has been prepared. Funding for repairs currently being sought.

Contact: Sara Rushton 0191 4031642



© Historic England

SITE NAME:	Coke ovens at Inkerman Farm, Cornsay / Tow Law
DESIGNATION:	Scheduled Monument
CONDITION:	Poor
OCCUPANCY:	N/A
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	1018228

Post-medieval beehive coke ovens. The management of the site was reviewed in 1998 with the involvement of Tow Law Town Council, which had a local heritage initiative. Historic England grant-aided the consolidation works, excavation and recording of finds. The initial repair programme is complete and half of the site is now open to the public. However, consolidation of the rest of the site is still required.

Contact: Tom Gledhill 0191 4031623



© Historic England

SITE NAME:	Church, 50 metres north east of Croxdale Hall, Croxdale Hall, Croxdale and Hett
DESIGNATION:	Scheduled Monument and Listed Buildings - I grade I; I grade II, RPG grade II*, CA
CONDITION:	Fair
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	D (D)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	1019820 and 1120740; 1120741

Medieval former church with nave dating back to late C11 and chancel to late C12, on the Croxdale Estate. Altered in later centuries but Norman south doorway contains the original door with iron hinges. Planning approval was granted in 2021 for change of use to a civil wedding venue and repair works were undertaken with a grant from the Covid-19 Emergency Heritage at Risk Response Fund (roof abutments; masonry repair; lime washing and repairs to the ceiling). There are still unresolved damp issues currently being investigated.

Contact: Maria Carballeira 0191 4031650



© Historic England

SITE NAME:	Ushaw Home Farm, main block and wall attached, Esh
DESIGNATION:	Listed Building grade II*
CONDITION:	Poor
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	A (A)
OWNER TYPE:	Charity (non-heritage)
LIST ENTRY NUMBER:	1185963

Part of a planned farm, constructed 1851-2 to designs by Joseph Hansom. Of three storeys, the main range is built into the bankside so that the lower two floors have ground level access. Two attached side wings and a projecting central bay create an E-shaped plan. Many original internal features survive. There is general deterioration to most external elements, including missing or displaced verge stones to some gable ends, defective rainwater goods and cracking to masonry walls. Many areas of slipped or displaced roof slates are allowing the ingress of rainwater.

Contact: Maria Carballeira 0191 4031650

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
C Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
 Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site



© Historic England

SITE NAME:	Former Junior Seminary Chapel of St Aloysius, Ushaw College, Ushaw, Esh
DESIGNATION:	Listed Building grade II*
CONDITION:	Very bad
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	A (A)
OWNER TYPE:	Charity (non-heritage)
LIST ENTRY NUMBER:	1299434

Former Roman Catholic junior seminary chapel of 1857-9 by Edward W Pugin in the Gothic Revival style. Temporary urgent repairs were undertaken at the end of 2015 to stop significant water ingress caused by heritage crime. Discussions are in progress to define an economically viable strategy for the site as a whole and to ensure the early completion of a substantive phase of permanent repairs to the chapel.

Contact: Maria Carballeira 0191 4031650

SITE NAME:	Medieval chapel at Harbour House Farm, Plawsworth, Kimblesworth and Plawsworth
DESIGNATION:	Scheduled Monument and Listed Building grade II
CONDITION:	Poor
OCCUPANCY:	N/A
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	1002325 and 1120959

Former chapel. A rare survival of a private manorial chapel dating to the C13-C14. A buttress was built in 2008 to support the leaning southern wall; however, further consolidation and repointing work is required.

Contact: Tom Gledhill 0191 4031623



© Historic England

SITE NAME:	Lamb Bridge, Lambton Park, North Lodge / Bournmoor
DESIGNATION:	Listed Building grade II*, RPG grade II
CONDITION:	Poor
OCCUPANCY:	N/A
PRIORITY CATEGORY:	D (B)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	1120952

Ashlar sandstone bridge over the River Wear. Built in 1819 by Ignatius Bonomi for John Lambton, first Earl of Durham. The bridge has structural distortions that are causing concern about its stability. Some works have been undertaken, including on-going structural monitoring. A substantive repair programme has yet to be undertaken but options are now being explored to help secure the long-term future of the various historic buildings and structures on the estate.

Contact: Maria Carballeira 0191 4031650



© Historic England

SITE NAME:	Church of St Mary, Rokeby, Rokeby
DESIGNATION:	Listed Building grade II*, RPG grade II*
CONDITION:	Fair
OCCUPANCY:	Part occupied/part in use
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	1121673

Former parish church, consecrated in 1778 with the chancel added in 1877. It stands on high ground within Rokeby Park (Registered grade II*) and just 30 metres from the A66. The building has been subject to multiple instances of heritage crime leading to water ingress issues, which have now been resolved for the short-term.

Contact: Maria Carballeira 0191 4031650



© Historic England

SITE NAME:	Gateway, Mortham Tower, Rokeby
DESIGNATION:	Listed Building grade I, RPG grade II*
CONDITION:	Poor
OCCUPANCY:	N/A
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	1160832

Late medieval gateway to grade I medieval fortified manor house, set within landscaped Rokeby Park (Registered grade II*). There is structural movement in the gateway. A support scaffold has been installed due to safety concerns. The flanking courtyard walls are also showing signs of deterioration with some invasive plant growth.

Contact: Maria Carballeira 0191 4031650

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
C Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
 Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site



© Historic England

SITE NAME:	Coal Drops, 110 metres east of Soho Engine Shed, Soho, Shildon
DESIGNATION:	Listed Building grade II*, CA
CONDITION:	Fair
OCCUPANCY:	N/A
PRIORITY CATEGORY:	F (F)
OWNER TYPE:	Local authority
LIST ENTRY NUMBER:	1160320

Built 1846, a very early, rarely surviving, facility for refuelling steam locomotives. It might originally have operated entirely using gravity, potentially influencing the design of mid-C19 coal staites and later marshalling yards where gravity was also used in place of shunting with horses or locomotives. Built for the pioneering and internationally influential Stockton & Darlington Railway. The Coal Drops have suffered from structural movement and the stonework is eroded and open-jointed. Repairs are being carried out by Durham County Council, supported by a Levelling-Up Grant.

Contact: Giles Proctor 01904 601981




© Historic England Archive

SITE NAME:	Sherburn House Bridge, Shincliffe
DESIGNATION:	Scheduled Monument, CA
CONDITION:	Very bad
OCCUPANCY:	N/A
PRIORITY CATEGORY:	A (A)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	1002341

Medieval stone bridge dating from 1335 but upper part rebuilt at unknown later date. Tree growth and water ingress has started to push out masonry, as evidenced by pronounced gaps running throughout the structure. Drainage channels empty adjacent to the bridge abutments and this compounds the ongoing erosion.

Contact: Tom Gledhill 0191 4031623

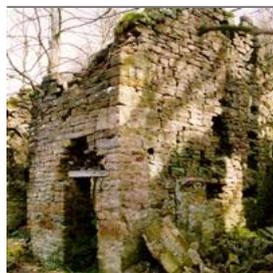

© Historic England

SITE NAME:	Brandon Walls lead mine, Stanhope
DESIGNATION:	Scheduled Monument
CONDITION:	Poor
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	1015831

Mid-C19 lead mining complex situated on the east bank of the Rookhope Burn. The site was abandoned around 1903 and some elements of the complex are now in need of conservation action.

Contact: Tom Gledhill 0191 4031623



© Historic England

SITE NAME:	Middle Level lead mine, Greenlaws, Daddry Shield, Stanhope
DESIGNATION:	Scheduled Monument and Listed Buildings - 6 grade II
CONDITION:	Very bad
OCCUPANCY:	N/A
PRIORITY CATEGORY:	A (A)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	1015828 and 1231495; 1231496; 1231634; 1231675; 1278086; 1278087

C18 and C19 lead mine suffering from extensive flood damage and erosion problems. A Conservation Management Plan has been prepared. Funding to deliver the necessary repair works has yet to be identified.

Contact: Tom Gledhill 0191 4031623



© Historic England

SITE NAME:	Westgate Primitive Methodist Chapel, Westgate, Stanhope
DESIGNATION:	Listed Building grade II*, CA
CONDITION:	Fair
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	C (E)
OWNER TYPE:	Charity (heritage)
LIST ENTRY NUMBER:	1232510

Former Primitive Methodist chapel, with attached schoolroom, constructed in 1871 to the design of George Race Junior & Atkinson, incorporating parts of an earlier C19 chapel. Investigative works and urgent repairs, part-funded by Historic England, were completed in 2013. An updated condition assessment and conservation statement have been prepared to help inform a management plan. Urgent roof repairs were carried out in 2017 with funding from Historic England. Recent storm damage has highlighted challenges with the monitoring and maintenance regime. There is currently no viable use identified.

Contact: Tom Gledhill 0191 4031623

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.
- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site



© Historic England Archive

SITE NAME:	Clock Tower, Windlestone Hall, Windlestone Park, Windlestone
DESIGNATION:	Listed Building grade II*, RPG grade II, CA
CONDITION:	Poor
OCCUPANCY:	N/A
PRIORITY CATEGORY:	D (C)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	1160369

Early C19 clock tower and stables gateway by Ignatius Bonomi. The cupola was repaired with a Historic England grant in 1989, but stonework repairs and general maintenance are now needed. The clock faces have been removed.

Contact: Martin Lowe 0191 4031653



© Historic England

SITE NAME:	Windlestone Hall, Windlestone Park, Windlestone
DESIGNATION:	Listed Building grade II*, RPG grade II, CA
CONDITION:	Poor
OCCUPANCY:	Part occupied/part in use
PRIORITY CATEGORY:	F (F)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	1160327

Large house, circa 1835, by Ignatius Bonomi for Sir Robert Johnson Eden. Surrounded by gardens and parkland and a cluster of estate buildings, including stables. Roof repairs undertaken and further repair underway with an end use identified.

Contact: Martin Lowe 0191 4031653



© Historic England Archive

SITE NAME:	Harperley Working Camp, World War II Prisoner of War camp at Craigside, Wolsingham
DESIGNATION:	Scheduled Monument
CONDITION:	Very bad
OCCUPANCY:	Part occupied/part in use
PRIORITY CATEGORY:	A (A)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	1020730

A very rare surviving example of a World War II Prisoner of War camp. Used by both German and Italian prisoners of war. 85% of original buildings are in roofed condition and wall paintings and internal fittings have also survived. Following a series of investigative surveys, a programme of conservation works, funded by Historic England, commenced in 2011. A second phase of work to the canteen and theatre was completed in 2013. Discussions continue with the owner to agree a programme of work to maintain the site subject to agreeing details and securing funding.

Contact: Lee McFarlane 0191 4031659



© Historic England

SITE NAME:	Christ Church, Church Street, Consett
DESIGNATION:	Listed Place of Worship grade II
CONDITION:	Poor
PRIORITY CATEGORY:	B (B)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1242728

Christ Church was built in 1866 in a distinctive neo-Norman style. It has a squat west tower and semicircular chancel. The tower is in need of a comprehensive programme of repairs due to open cracks, voids and eroded pointing.

Contact: Maria Carballeira 0191 4031650



© Historic England

SITE NAME:	Church of St Ives, Leadgate, Consett
DESIGNATION:	Listed Place of Worship grade II
CONDITION:	Very bad
PRIORITY CATEGORY:	B (B)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1240559

A large stone church of 1865-8 by the architect, Charles Hodgson Fowler. Roofing works were completed in 2017 with a Listed Places of Worship Roof Repairs Grant. There is structural movement at the east end of the building, together with open joints and deep pockets of stone erosion to other areas of external walling. Investigatory works have been undertaken and funding options are being explored for urgent repairs.

Contact: Maria Carballeira 0191 4031650

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.
- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site



© Historic England

SITE NAME:	Church of St Anne, Market Place, Bishop Auckland
DESIGNATION:	Listed Place of Worship grade II, CA
CONDITION:	Poor
PRIORITY CATEGORY:	A (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1292201

Church of 1846-8 by William Thompson, on the site of a medieval chapel. Tall aisled nave with clerestory windows, gabled south porch and distinctive west belfry. Chancel with organ chamber and vestry. A first phase of repairs to the north roof slopes was completed in 2015 with funding from the National Lottery Heritage Fund and Historic England. Urgent repairs are required to the south roof slopes and high-level masonry. An Energy Needs Assessment and Options Appraisal have been completed with grant funding from Durham County Council and Historic England.

Contact: Maria Carballeira 0191 4031650



© Historic England

SITE NAME:	Church of St Mary, Town End, Middleton in Teesdale
DESIGNATION:	Listed Place of Worship grade II, CA
CONDITION:	Poor
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1322768

The present church was built in 1878 on the site of an earlier building. Repair works to defective gutters and downpipes, together with leaking gable coping stones and other roof details, were completed in 2018 to stop water ingress into the fabric. Internal lighting has been renewed but redecoration has not been completed due to the discovery of a major outbreak of dry rot to the floor. Discussions are underway to agree a repair and use strategy that will guarantee the long-term future of the building; funding options are being explored.

Contact: Maria Carballeira 0191 4031650

SITE NAME:	Derwentcote steel cementation furnace, iron finery forge and drift coal mine		
DESIGNATION:	Scheduled Monument, LB grade I	LIST ENTRY NUMBER:	1015522
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Collapse	NEW ENTRY?:	No
OWNER TYPE:	English Heritage	CONTACT:	Tom Gledhill 0191 4031623

SITE NAME:	Barnard Castle: ringwork, shell keep castle, chapel and dovecote, Barnard Castle		
DESIGNATION:	Scheduled Monument, 2 LBs, CA	LIST ENTRY NUMBER:	1007505
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Deterioration - in need of management	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners	CONTACT:	Tom Gledhill 0191 4031623

SITE NAME:	Ring cairn 350 metres east of Haythwaite, Barningham Moor, Barningham		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1017424
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Bracken	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Tom Gledhill 0191 4031623

SITE NAME:	Grange and chapel, Bear Park, Bearpark		
DESIGNATION:	Scheduled Monument, LB grade II	LIST ENTRY NUMBER:	1002346
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Vandalism	NEW ENTRY?:	No
OWNER TYPE:	Local authority	CONTACT:	Tom Gledhill 0191 4031623

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.
- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

SITE NAME:	Stockton & Darlington Railway: Etherley Inclines, Summit And Upper Sections, Etherley		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1480892
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Improving
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	Yes
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Lee McFarlane 0191 4031659
SITE NAME:	Stockton & Darlington Railway: Lower Section Of The Southern Etherley Incline, Etherley		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1480894
CONDITION:	Extensive significant problems	TREND:	Improving
PRINCIPAL VULNERABILITY:	Collapse	NEW ENTRY?:	Yes
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Lee McFarlane 0191 4031659
SITE NAME:	Stockton & Darlington Railway: Belts Gill embankment, lower part of the northern Etherley Incline, Etherley		
DESIGNATION:	Scheduled Monument and Listed Buildings - 2 grade II, part in CA	LIST ENTRY NUMBER:	1002315 and 1159141; 1160402
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Improving
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Lee McFarlane 0191 4031659
SITE NAME:	Stockton & Darlington Railway: Route Alongside The River Gaunless, Etherley / West Auckland		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1480897
CONDITION:	Extensive significant problems	TREND:	Improving
PRINCIPAL VULNERABILITY:	Collapse	NEW ENTRY?:	Yes
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Lee McFarlane 0191 4031659
SITE NAME:	Enclosures and industrial workings on Cockfield Fell, Evenwood and Barony / Lynesack and Softley / Cockfield		
DESIGNATION:	Scheduled Monument, 2 CAs	LIST ENTRY NUMBER:	1002314
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Collapse	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Lee McFarlane 0191 4031659
SITE NAME:	Roman period native settlement at Calf Holm, immediately west of Dine Holm Scar, Forest and Frith		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1019162
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Tom Gledhill 0191 4031623
SITE NAME:	Roman period native settlement and a bloomery 160 metres north west of Bleabeck Force, Holwick		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1017120
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Tom Gledhill 0191 4031623

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
C Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
 Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

SITE NAME:	Two Romano-British hut circles and three shielings on Holwick Scars, 250 metres south of Hungry Hall, Holwick		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1019455
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Bracken	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Tom Gledhill 0191 4031623
SITE NAME:	Lanchester Roman fort (Longovicium), Lanchester		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002361
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Tom Gledhill 0191 4031623
SITE NAME:	Area of carved bedrock, 120 metres south of The Rigg, Lartington		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1018253
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Natural erosion - extensive	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Tom Gledhill 0191 4031623
SITE NAME:	Carved bedrock with cups and grooves, 170 metres south east of The Rigg, Lartington		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1018251
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Natural erosion - extensive	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Tom Gledhill 0191 4031623
SITE NAME:	Cup, ring and groove-marked rock 170 metres south west of West Loups's, Cotherstone Moor, Lartington		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1016595
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Natural erosion - moderate	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Tom Gledhill 0191 4031623
SITE NAME:	Four areas of carving on a rock outcrop 200 metres south west of The Rigg, Lartington		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1018250
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Natural erosion - extensive	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Tom Gledhill 0191 4031623
SITE NAME:	Stockton & Darlington Railway: Brusselton Inclines, Shildon		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1480914
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Improving
PRINCIPAL VULNERABILITY:	Collapse	NEW ENTRY?:	Yes
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Lee McFarlane 0191 4031659

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.
- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

SITE NAME:	Park Level lead mine with ore works on Killhope Burn, Stanhope		
DESIGNATION:	Scheduled Monument, 5 LBs	LIST ENTRY NUMBER:	1015853
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Deterioration - in need of management	NEW ENTRY?:	No
OWNER TYPE:	Local authority	CONTACT:	Tom Gledhill 0191 4031623



© Historic England

SITE NAME:	Croxdale Hall, Croxdale and Hett / City of Durham	A late C18 walled garden accompanying a country house, set in parkland of early to mid-C18 origin. The walled garden and lakes were designed by Lewis Kennedy. Croxdale Hall has been the seat of the Salvin family since the C15. Maintenance of the gardens has reduced in recent years and the water bodies are in poor and deteriorating condition. The notable 'cranked' walls flanking the orangery are in an advanced state of decay. Historic England has carried out recent research into the significance of the walled garden.
DESIGNATION:	Registered Park and Garden grade II*, 17 LBs, 2 SMs, part in CA	
CONDITION:	Generally unsatisfactory with major localised problems	
VULNERABILITY:	Medium	
TREND:	Declining	
NEW ENTRY?:	No	
OWNER TYPE:	Private	
LIST ENTRY NUMBER:	1001271	Contact: Tom Gledhill 0191 4031623

SITE NAME:	Annfield Plain, Stanley		
DESIGNATION:	Conservation Area, 2 LBs	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	No significant change
VULNERABILITY:	High	CONTACT:	David Sparkes (LPA) 03000 267125

SITE NAME:	Bishop Auckland		
DESIGNATION:	Conservation Area, 73 LBs, part in RPG grade II*, 2 SMs	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	Improving significantly
VULNERABILITY:	Medium	CONTACT:	David Sparkes (LPA) 03000 267125

SITE NAME:	Cockfield, Langleydale and Shotton / Lynesack and Softley / Cockfield / Evenwood and Barony		
DESIGNATION:	Conservation Area, 10 LBs, part in SM	NEW ENTRY?:	No
CONDITION:	Poor	TREND:	No significant change
VULNERABILITY:	High	CONTACT:	David Sparkes (LPA) 03000 267125

SITE NAME:	Seaham		
DESIGNATION:	Conservation Area, 9 LBs	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	Improving
VULNERABILITY:	Medium	CONTACT:	David Sparkes (LPA) 03000 267125

SITE NAME:	Windlestone Park, Spennymoor / Windlestone		
DESIGNATION:	Conservation Area, 17 LBs, part in RPG grade II	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	No significant change
VULNERABILITY:	High	CONTACT:	David Sparkes (LPA) 03000 267125

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.
- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

NORTHUMBERLAND (UA)



© Historic England

SITE NAME:	Adderstone Hall, Adderstone with Lucker
DESIGNATION:	Listed Building grade II*
CONDITION:	Poor
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	1370965

C19 classical style country house by William Burn. Main hall with five bays to main elevations, three bays to side. Lower service wing to north-west and adjoining service yard. At main house, failed roof coverings and rainwater disposal systems are causing widespread water ingress at wall-head level, leading to possible masonry instability. The service range roof has slipped slates and rainwater goods are missing. The service yard has a pronounced movement crack. There are overall issues of longstanding lack of regular maintenance and external joinery is in disrepair.

Contact: Martin Lowe 0191 4031653



© Historic England

SITE NAME:	Akeld Bastle and attached walling to south, Akeld
DESIGNATION:	Listed Building grade II*
CONDITION:	Poor
OCCUPANCY:	Unknown
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Commercial company
LIST ENTRY NUMBER:	1042370

Late-medieval bastle, with random rubble walls over one metre thick and a tunnel vault on the first floor. The original doorway in the west wall has a chamfered surround with drawbar holes. The upper storey appears to have been rebuilt in the C16 or C17 and incorporates a dovecote with five stone alighting ledges in the north gable. The Welsh slate roof is in poor condition and has a hole caused by the adjacent ash tree.

Contact: Sara Rushton 0191 4031642



© Historic England

SITE NAME:	Holmslinn lead mine, 200 metres south east of Holmes, Sinderhope, Allendale
DESIGNATION:	Scheduled Monument and Listed Building grade II
CONDITION:	Very bad
OCCUPANCY:	N/A
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	1015848 and 1154939

A series of standing and buried remains of one of four mine shafts in the East Allen valley. The shaft, 70 metres deep, was dug in 1855. The tower base enclosing the shaft, the engine bed and wheel pit (Listed grade II) are being damaged by tree roots. Parts of the wheel pit collapsed in 2011. A broad repair solution has been agreed, and a Management Plan prepared, with support from Natural England. Funding has yet to be identified for the necessary works.

Contact: Sara Rushton 0191 4031642



© Historic England

SITE NAME:	Bondgate Tower, Bondgate Within, Alnwick
DESIGNATION:	Scheduled Monument and Listed Building grade I, CA
CONDITION:	Very bad
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	A (A)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	1006597 and 1041513

The east gate of the former town wall, built circa 1450 by the 2nd Earl of Northumberland. Consists of a recessed central portal between two projecting semi-octagonal towers. The main defects relate to damage from high-sided vehicles passing through the central portal. Further impact of a similar nature could cause a serious collapse. Discussions are ongoing with owner and Northumberland County Council regarding proposed traffic management.

Contact: Lee McFarlane 0191 4031659



© Historic England

SITE NAME:	General Lambert's House, 31 and 33, Narrowgate, Alnwick
DESIGNATION:	Listed Building grade II*, CA
CONDITION:	Poor
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	D (F)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	1041425

Early C19 re-fronting of two C18 townhouses. Much of the original interior detailing is still present. The owner has consent to convert the building to a new use. Urgent repair works were completed in 2021 with a grant from Historic England (structural underpinning; re-roofing and high-level masonry). External joinery is in poor condition, and there is masonry spalling and delamination.

Contact: Maria Carballeira 0191 4031650

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
C Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
 Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site



© Historic England

SITE NAME:	Woodhorn Colliery, east & west shaft head gear and Walker fan house, Ashington
DESIGNATION:	Scheduled Monument, 2 LBs
CONDITION:	Poor
OCCUPANCY:	Part occupied/part in use
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Local authority
LIST ENTRY NUMBER:	1016976

The first colliery shaft was sunk in 1894. Production stopped in 1981 and the site opened as a museum in 1989. Repairs were completed to the east shaft head gear and enclosing structure in 2014. Significant corrosion has reappeared and the enclosing structure is leaking. The roof to the adjoining Walker Fan House is also leaking and the steelwork to the west shaft head gear is corroding and in need of repair. Consent was granted in late 2022 for roof and internal repairs to Walker Motor Room, Walker Fan Room and Capell Fan House. Discussions about the head gear are on-going.

Contact: Lee McFarlane 0191 4031659



© Historic England

SITE NAME:	Little Swinburne Tower, Little Swinburne, Chollerton
DESIGNATION:	Scheduled Monument and Listed Building grade II
CONDITION:	Very bad
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	B (B)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	1011412 and 1044908

Remote C15 tower house in a poor state of repair. Part of Little Swinburne shrunken medieval village. Surrounded by fallen masonry and in need of urgent attention to prevent further falls. A repair scheme has been identified but has yet to be implemented.

Contact: Sara Rushton 0191 4031642



© Historic England

SITE NAME:	Walker's Pottery, Corbridge
DESIGNATION:	Scheduled Monument and Listed Buildings - 2 grade II*, 2 LBs
CONDITION:	Poor
OCCUPANCY:	N/A
PRIORITY CATEGORY:	A (A)
OWNER TYPE:	Mixed, multiple owners
LIST ENTRY NUMBER:	1006441 and 1370576; 1155212

The site includes the standing and buried remains of a post-medieval pottery. The two bottle kilns were repaired through Historic England grant-aid in 2016. Following a change in ownership, there have been very positive steps taken to improve the management and condition of the site. A number of structures have been repaired or consolidated. Work is on-going to address other at-risk structures on the site.

Contact: Sara Rushton 0191 4031642



© Historic England

SITE NAME:	Twizel medieval tower house and folly, Twizel, Duddo
DESIGNATION:	Scheduled Monument and Listed Building grade II*, part in RPG grade II*
CONDITION:	Very bad
OCCUPANCY:	N/A
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	1018445 and 1042168

The present building incorporates the remains of a medieval tower house which continued to be developed and added to into the C19. Much of the C19 structure was demolished and the building, which was once five storeys high, now stands to three storeys. The site has been subject to longstanding lack of regular maintenance. It shows signs of structural instability, including substantial vertical cracks around many of the arches and window openings. A measured survey has been completed.

Contact: Sara Rushton 0191 4031642



© Historic England

SITE NAME:	Twizel Bridge, Duddo / Cornhill-on-Tweed
DESIGNATION:	Scheduled Monument, LB grade II*, RPG grade II*
CONDITION:	Poor
OCCUPANCY:	N/A
PRIORITY CATEGORY:	A (A)
OWNER TYPE:	Local authority
LIST ENTRY NUMBER:	1020743

Remains of a medieval single-span bridge of early C16 date, spanning the River Till near Twizel Castle. The bridge retains its medieval appearance and character and has been the subject of some repairs, probably in the C18, but no major strengthening works. It was by-passed by a modern road bridge to the south in the 1980s. The eastern abutment is leaning to the south and has structural issues. In 2017-18 conservation re-pointing was done to the arch, parapets and abutments. Works to repair the leaning eastern abutments has not yet progressed.

Contact: Lee McFarlane 0191 4031659

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
C Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
 Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site



© Historic England

SITE NAME:	Ford Colliery, Ford
DESIGNATION:	Scheduled Monument and Listed Building grade II
CONDITION:	Poor
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	D (D)
OWNER TYPE:	Charity (non-heritage)
LIST ENTRY NUMBER:	1020746 and 1154125

Monument including above and below ground remains of Ford Colliery. The colliery worked from at least the mid-C17 through to 1919. The site includes the engine house chimney which was repaired in 2008-9. A condition survey has been prepared for the engine house and pit head. A programme of archaeological recording and borehole investigations has informed the preparation of a full repair scheme, funded by Historic England. The repair scheme now needs to be implemented to enable public access to these structures.

Contact: Sara Rushton 0191 4031642




© Historic England

SITE NAME:	Pair of bastles, north-west of the Green at Chesterwood, Haydon Bridge, Haydon
DESIGNATION:	Scheduled Monument and Listed Buildings - 3 grade II
CONDITION:	Very bad
OCCUPANCY:	N/A
PRIORITY CATEGORY:	A (A)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	1006432 and 1042501; 1154494; 1154518

The site consists of the scheduled remains of four defended farmhouses dating from between 1575 and 1650. Those to the south and west of the Green have recently been repaired and converted to residential use. The pair to the far north-west of the Green are not actively used and are deteriorating. There are areas of loose, unstable and open-jointed stone walling and a bulge on the west gable. The tin roof of the eastern bastle had to be dismantled due to health and safety concerns during periods of high winds.

Contact: Maria Carballeira 0191 4031650

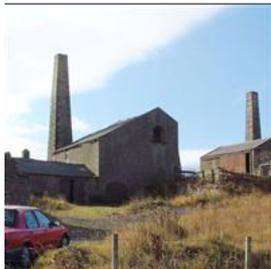

© Historic England

SITE NAME:	Stublick Colliery beam engine house, Haydon
DESIGNATION:	Listed Building grade II*, SM
CONDITION:	Poor
OCCUPANCY:	N/A
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	1370425

The beam engine house is part of the Stublick Colliery site, the finest group of early C19 colliery buildings in the region. Although other grade II* buildings on the site are in fair condition, the engine house is in urgent need of repair. The ground around the colliery buildings was scheduled in November 2003.

Contact: Sara Rushton 0191 4031642



© Historic England

SITE NAME:	Crawley Tower (with cottage inside), Crawley, Hedgeley
DESIGNATION:	Listed Building grade II*
CONDITION:	Poor
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	1057698

Remains of an early C14 tower house, with a C18 cottage built inside when the ruins were altered to form an eye-catcher on the Shawdon Estate. Constructed of massive squared stone; the cottage has a slate roof. The interior is now gutted and contains structural propping. The tower is vacant with no identified use, although the adjacent buildings form part of a working farm. A budget for project development work has been identified.

Contact: Sara Rushton 0191 4031642



© Historic England

SITE NAME:	Bastle, 100 metres south west of Ray Cottages, Kirkwhelpington
DESIGNATION:	Scheduled Monument
CONDITION:	Poor
OCCUPANCY:	N/A
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	1011107

Ruined medieval defended farmhouse, situated in the grounds of Ray Castle, with 1.4 metres thick stone walls standing to a maximum height of 2.2 metres. Recent clearance of mature vegetation has reduced the risk of disturbance, although some areas of loose, displaced or unstable stones remain. Discussions are underway to help establish a planned maintenance and repair regime for the site.

Contact: Tom Gledhill 0191 4031623

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.
- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site



© Historic England

SITE NAME:	Capheaton tiler, Mirlaw House, Kirkwhelpington
DESIGNATION:	Scheduled Monument
CONDITION:	Poor
OCCUPANCY:	N/A
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	1006418

Tilery built for the Kirkharle Estate c1800. Masonry and the brick vaults are in a poor condition due to invasive vegetation and loss of fabric. Vegetation control would help secure its long-term future.

Contact: Sara Rushton 0191 4031642



© Historic England

SITE NAME:	Barmoor Castle, Barmoor, Lowick
DESIGNATION:	Listed Building grade II*
CONDITION:	Very bad
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	B (B)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	1156023

Country house of 1801 that incorporates earlier masonry. The building received grant-aid towards repairs in 1986 but further deterioration has occurred. A grant was offered by Historic England in 2011 towards a package of project development works. That work, which included the preparation of a conservation plan and condition survey, is helping to inform discussions about the site's future.

Contact: Martin Lowe 0191 4031653



© Northumberland Council

SITE NAME:	Pithead baths at Lynemouth Colliery, Lynemouth
DESIGNATION:	Listed Building grade II*
CONDITION:	Very bad
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	A (A)
OWNER TYPE:	Commercial company
LIST ENTRY NUMBER:	1156081

Pithead baths of 1938 by FG Frizzell in Modern Movement style. Vacant for over twenty years and previously subject to vandalism. Site around the building now used reducing the likelihood of vandalism but no plans for the re-use of the building at present.

Contact: Martin Lowe 0191 4031653



© Historic England

SITE NAME:	Mitford Castle, Mitford
DESIGNATION:	Scheduled Monument and Listed Buildings - 5 grade I
CONDITION:	Poor
OCCUPANCY:	N/A
PRIORITY CATEGORY:	D (D)
OWNER TYPE:	Commercial company
LIST ENTRY NUMBER:	1017318 and 1370755; 1042645; 1370756; 1042647; 1042646

Late C11 motte and bailey castle converted to a shell keep in the C12. The five-sided keep of the C13 includes a C12 curtain wall, curtain wall structures and mid-C12 chapel. It is now a roofless ruin but capable of consolidation. Grant-aided photographic recording for the castle is now complete. Historic England offered grants towards three phases of the repair programme, the first two of which are now complete.

Contact: Sara Rushton 0191 4031642



© Historic England

SITE NAME:	Church of St Mary, Woodhorn, Newbiggin by the Sea
DESIGNATION:	Listed Building grade I
CONDITION:	Poor
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Local authority
LIST ENTRY NUMBER:	1304471

Former parish church with surviving pre-Conquest elements. Significant rebuilding work took place throughout the C12 and C13 before a major rebuild was carried out in 1843-4 by B & J Green architects. The church closed as a place of worship in 1972 and was subsequently used as a museum and workspace for artists. Structural movement has been identified in some parts of the building and other repairs are required.

Contact: Maria Carballeira 0191 4031650

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.
- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site



© Historic England

SITE NAME:	Hydraulic silo, 70 metres east of Cragend Farmhouse, Rothbury
DESIGNATION:	Listed Building grade II*
CONDITION:	Poor
OCCUPANCY:	N/A
PRIORITY CATEGORY:	C (D)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	1153196

Experimental hydraulic silo by Lord Armstrong. Linear plan comprising a rectangular silage bay on each side of a taller cross-gabled centre. The interior contains a hydraulic engine and turbine. Repairs were completed to the roof of the central section. A further phase of works in 2019 with funding from Historic Houses provided safe access to all levels within the tower, which led to the update of the Historic Building Recording in 2020. Repair and consolidation works are still needed to the machinery within the roof spaces above the silage bays and their supporting timber structure.

Contact: Maria Carballeira 0191 4031650



© Historic England

SITE NAME:	North west pillbox, Fort House, A193 (east side of), Hartley, Seaton Sluice, Seaton Valley
DESIGNATION:	Listed Building grade II*
CONDITION:	Poor
OCCUPANCY:	N/A
PRIORITY CATEGORY:	D (D)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	1041329

Pillbox or defensible latrine, circa 1917. Rare survival as part of a World War I fort. Suffering from structural problems and lack of maintenance. A repair scheme has been drawn up with funding from Historic England which has informed an updated structural report in April 2019. Proposals for the repair and reuse of the pillbox are well advanced.

Contact: Maria Carballeira 0191 4031650



© Northumberland Council

SITE NAME:	Water tank, Fort House, A193 (east side), Hartley, Seaton Sluice, Seaton Valley
DESIGNATION:	Listed Building grade II*
CONDITION:	Poor
OCCUPANCY:	Part occupied/part in use
PRIORITY CATEGORY:	D (D)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	1303566

Water tank incorporating former ablutions building, built circa 1917 and a rare survival of part of a World War I fort. Suffering from structural problems and lack of maintenance. A repair scheme has been drawn up with funding from Historic England which has informed an updated structural report in April 2019. Proposals for the repair and reuse of the water tank are well advanced.

Contact: Maria Carballeira 0191 4031650



© Historic England

SITE NAME:	Mausoleum, east of Seaton Delaval Hall, Seaton Delaval, Seaton Valley
DESIGNATION:	Listed Building grade II*, RPG grade II*, CA
CONDITION:	Poor
OCCUPANCY:	N/A
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Charity (heritage)
LIST ENTRY NUMBER:	1154937

Mausoleum of 1766; the focal point of a walk to the east of the Hall, overlooking parkland to the south. The Hall was built 1718-29 by Vanbrugh, with early C18 landscaping incorporating earlier and later features. The mausoleum is roofless and has been subjected to graffiti and vandalism in the past. Recent consolidation and repair work to both the building and surrounding ha-ha walls have reduced deterioration and anti-social behaviour significantly.

Contact: Maria Carballeira 0191 4031650



© Historic England

SITE NAME:	Simonburn Castle, Castle Lane, Simonburn
DESIGNATION:	Scheduled Monument and Listed Building grade II
CONDITION:	Very bad
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	A (A)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	1012414 and 1302543

C13 tower house with C18 Gothick style additions to create a folly. The basement vault has suffered some collapse and there is damaging vegetation growth. The building is in need of urgent repair. A Management Agreement was established with the owner to clear some of the vegetation.

Contact: Sara Rushton 0191 4031642

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
C Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
 Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site



© Historic England

SITE NAME:	Cocklaw Tower, East Cocklaw, Wall
DESIGNATION:	Scheduled Monument and Listed Building grade I, WHS
CONDITION:	Poor
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	D (D)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	1006602 and 1156641

C14 tower containing wall paintings of probable C16 date. The tower is roofless, with self-seeded shrubs in the wall tops and over the first floor barrel-vaulting. Areas of the wall tops are vulnerable and there has been a partial collapse of the vaulting. The wall paintings show recent loss and are highly vulnerable, but have been subject to detailed archaeological recording.

Contact: Mike Collins 0191 4031632



© Historic England Archive

SITE NAME:	Entrance gates to Hartford Hall, Hartford Bridge, West Bedlington
DESIGNATION:	Listed Building grade II*
CONDITION:	Very bad
OCCUPANCY:	N/A
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Unknown
LIST ENTRY NUMBER:	1041381

Gates made by the Coalbrookdale Company and exhibited at the Vienna Exhibition of 1873. Historic England offered grant-aid towards the repair of the gates, but that project later stalled when the then owners of the estate went into administration. The gates are now in safe temporary storage. Historic England funded an updated condition assessment in 2014, with cataloguing of all smaller elements in 2017. The second phase of conservation work is complete and all components of the gates are now catalogued and packaged to the highest curatorial standards awaiting conservation repairs.

Contact: Maria Carballeira 0191 4031650



© Historic England

SITE NAME:	Sharpe's Folly, Rothbury, Tosson, Whitton and Tosson
DESIGNATION:	Listed Building grade II*, CA
CONDITION:	Fair
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Commercial company
LIST ENTRY NUMBER:	1154472

Folly, probably 1720s, by Archdeacon Sharpe, Rector of Rothbury. Ashlar round tower c30 feet high. Probably the earliest folly in the county, said to have been built partly to alleviate local unemployment and partly to satisfy the Archdeacon's taste for astronomy. In 2017, Historic England funded a survey report, building work schedule and options appraisal.

Contact: Tom Gledhill 0191 4031623



© Historic England

SITE NAME:	Church of St Cuthbert, Church Street, Haydon
DESIGNATION:	Listed Place of Worship grade II*, CA
CONDITION:	Poor
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1154539

The church was erected in 1796 by the Greenwich Hospital Trustees, to whom the Derwentwater estates passed in the C18. It has an elegant west tower, narrower than the nave, which is topped by a pagoda-like roof. A north transept was added in 1869 to accommodate children from the Shaftoe Trust School. The chancel was enlarged, and other alterations made, in 1898. There is structural movement in the transept and rainwater ingress. A visual structural inspection has been undertaken, but further investigations are required (ground conditions and drainage).

Contact: Maria Carballeira 0191 4031650



© Historic England

SITE NAME:	Haydon Old Church, Old Haydon, Haydon
DESIGNATION:	Listed Place of Worship grade I
CONDITION:	Poor
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1042512

Former parish church, still used for occasional worship, with C12 chancel and C14 south chapel. With a grant from the Covid-19 Emergency Heritage at Risk Response Fund, gutters and rainwater pipes were replaced with appropriately sized cast iron sections; external ground levels were lowered at north and west sides; the drainage system was improved; timber fascia boards were replaced at eaves level; external walls were repointed and water tables re-laid. The stone slated roof is in poor condition and in need of replacement. Discussions are underway about enhancing the building's future use.

Contact: Maria Carballeira 0191 4031650

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.
- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site



© Historic England

SITE NAME:	Church of Our Lady, Seaton Delaval, Seaton Valley
DESIGNATION:	Listed Place of Worship grade I, RPG grade II*, CA
CONDITION:	Poor
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1041317

Originally the private chapel of the Delaval family, the church has a short and tall nave, lower chancel and west porch. It dates from the early-C12 but may incorporate earlier fabric. Structural movement has been monitored since 1998. Some remedial work was completed in 2017 with funding from the National Lottery Heritage Fund Grants for Places of Worship scheme. With a grant from the Covid-19 Emergency Heritage at Risk Response Fund, drains were installed to south and west sides and the doorway repaired. External repointing, particularly to the north wall, is becoming increasingly urgent.

Contact: Maria Carballeira 0191 4031650

SITE NAME:	Defended settlement, 1.05 kilometres north west of North Farm, Adderstone with Lucker		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1006478
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Sara Rushton 0191 4031642

SITE NAME:	Iron Age defended settlement and cultivation terraces 600 metres north east of Brown's Law Cottage, Akeld		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1019139
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Sara Rushton 0191 4031642

SITE NAME:	Haggerston dovecote, Ancroft		
DESIGNATION:	Scheduled Monument, LB grade II	LIST ENTRY NUMBER:	1006570
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Deterioration - in need of management	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Maria Carballeira 0191 4031650

SITE NAME:	Round barrow 520 metres WNW of Quarry Cottage, Bamburgh		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1014503
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Animal burrowing - moderate	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Sara Rushton 0191 4031642

SITE NAME:	Defended settlement and Roman signal station 410 metres south of West Crindledikes, Bardon Mill		
DESIGNATION:	Scheduled Monument, WHS	LIST ENTRY NUMBER:	1018536
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Improving
PRINCIPAL VULNERABILITY:	Bracken	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Mike Collins 0191 4031632

SITE NAME:	Benthall round cairn, Beadnell		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1008430
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Animal burrowing - moderate	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Sara Rushton 0191 4031642

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.
- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

SITE NAME:	St Ebba's chapel and monastic site, Beadnell		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1008563
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Coastal erosion	NEW ENTRY?:	No
OWNER TYPE:	Local authority	CONTACT:	Tom Gledhill 0191 4031623
SITE NAME:	Chester's Hill camps, Belford		
DESIGNATION:	Scheduled Monument, part in CA	LIST ENTRY NUMBER:	1006513
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Sara Rushton 0191 4031642
SITE NAME:	Halidon Hill settlement, Berwick-upon-Tweed		
DESIGNATION:	Scheduled Monument, RB	LIST ENTRY NUMBER:	1003657
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Sara Rushton 0191 4031642
SITE NAME:	Springhill Roman camp, Berwick-upon-Tweed		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1003655
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Sara Rushton 0191 4031642
SITE NAME:	Bewick Hill camp, Bewick		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1006580
CONDITION:	Generally satisfactory but with minor localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Bracken	NEW ENTRY?:	Yes
OWNER TYPE:	Private	CONTACT:	Sara Rushton 0191 4031642
SITE NAME:	Romano-British farmstead, 520 metres north east of Birtley Shields, Birtley		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1009676
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Forestry	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Sara Rushton 0191 4031642
SITE NAME:	Romano-British settlement, 300 metres north of The Heugh, Birtley		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1010045
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Forestry	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Sara Rushton 0191 4031642

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
C Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

SITE NAME:	Tinkler's Dene univallate hillfort, 400 metres north east of Dancing Hall Farm, Callaly		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1011095
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Bracken	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Sara Rushton 0191 4031642

SITE NAME:	Defended settlement, 450 metres NNW of Ferney Chesters, Capheaton		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1011835
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Sara Rushton 0191 4031642

SITE NAME:	Romano-British settlement and Iron Age defended settlement, 550 metres north east of Shaftoe Grange, Capheaton / Wallington Demesne		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1013757
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Sara Rushton 0191 4031642

SITE NAME:	Buttony Wood camp, Horton Moor, Chatton		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1006531
CONDITION:	Extensive significant problems	TREND:	Improving
PRINCIPAL VULNERABILITY:	Bracken	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Sara Rushton 0191 4031642

SITE NAME:	Iron Age defended settlement in Fox Covert, Chatton		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1016246
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Forestry	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Sara Rushton 0191 4031642

SITE NAME:	Simonside camp, Chatton		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002907
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Bracken	NEW ENTRY?:	No
OWNER TYPE:	Commercial company	CONTACT:	Sara Rushton 0191 4031642

SITE NAME:	Two cairn cemeteries west of Willie Law, Chatton / Chillingham		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1006451
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Forestry	NEW ENTRY?:	No
OWNER TYPE:	Government or agency	CONTACT:	Sara Rushton 0191 4031642

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
C Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
 Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

SITE NAME:	Hepburn Crags camp, Chillingham		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1006547
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Sara Rushton 0191 4031642
SITE NAME:	Corbridge (Corstopitum) Roman station, Corbridge / Sandhoe		
DESIGNATION:	Scheduled Monument, LB grade II, part in CA, WHS	LIST ENTRY NUMBER:	1006611
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Mike Collins 0191 4031632
SITE NAME:	Hadrian's Wall and vallum between the track to Portgate Cottage and the field boundary east of milecastle 24 in wall miles 22 and 23, Corbridge / Sandhoe / Wall / Acomb		
DESIGNATION:	Scheduled Monument, WHS	LIST ENTRY NUMBER:	1010626
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners	CONTACT:	Mike Collins 0191 4031632
SITE NAME:	Hadrian's Wall and vallum between the Fence Burn and the track to Portgate Cottage in wall miles 21 and 22, Corbridge / Whittington		
DESIGNATION:	Scheduled Monument, LB grade II, WHS	LIST ENTRY NUMBER:	1010625
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners	CONTACT:	Mike Collins 0191 4031632
SITE NAME:	Cornhill Castle, Cornhill-on-Tweed		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1006508
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Sara Rushton 0191 4031642
SITE NAME:	Enclosed settlement, 620 metres south east of Cornhill Castle, Cornhill-on-Tweed		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1006409
CONDITION:	Extensive significant problems	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Sara Rushton 0191 4031642
SITE NAME:	Heiferlaw defended settlement, 100 metres north of Holywell, Denwick		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1014080
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Forestry	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Sara Rushton 0191 4031642

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
C Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

SITE NAME:	Incised rocks, 500 metres north west of Doddington Dean Wood, Doddington		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1006555
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Natural erosion - extensive	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners	CONTACT:	Sara Rushton 0191 4031642
SITE NAME:	Roughting Linn camp, Doddington		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1006601
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Sara Rushton 0191 4031642
SITE NAME:	The Ringses camp, Doddington Moor, 3/4 mile (1200m) E of Doddington, Doddington		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1006585
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Bracken	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Tom Gledhill 0191 4031623
SITE NAME:	Two camps and cup and ring marked rocks on Dod Law, Doddington		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002946
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Sara Rushton 0191 4031642
SITE NAME:	Enclosure on Fadden Hill, Duddo		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1006437
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Sara Rushton 0191 4031642
SITE NAME:	Iron Age defended settlement in Camp Plantation, 350 metres north west of North Charlton Mill, Eglington		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1017955
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Sara Rushton 0191 4031642
SITE NAME:	Circular enclosure west of Second Linthaugh, Ford		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1006430
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Sara Rushton 0191 4031642

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.
- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

SITE NAME:	Flodden camp, Ford		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1006481
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Sara Rushton 0191 4031642

SITE NAME:	Two incised rocks on Broom Ridge, Hunter's Moor, Ford		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1006554
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Natural erosion - extensive	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Sara Rushton 0191 4031642

SITE NAME:	Round cairn, 220m north of Tom's Crags, Greystead		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1010040
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Forestry	NEW ENTRY?:	No
OWNER TYPE:	Government or agency	CONTACT:	Sara Rushton 0191 4031642

SITE NAME:	Langley Barony lead mines, Haydon Bridge, Haydon		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1006413
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Deterioration - in need of management	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Sara Rushton 0191 4031642

SITE NAME:	Ancient settlement Hunterheugh Crags, Hedgeley		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1006476
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Bracken	NEW ENTRY?:	Yes
OWNER TYPE:	Private	CONTACT:	Tom Gledhill 0191 4031623

SITE NAME:	Defended settlement, 400m west of Titlington Mount, Hedgeley		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1007447
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Bracken	NEW ENTRY?:	Yes
OWNER TYPE:	Government or agency	CONTACT:	Tom Gledhill 0191 4031623

SITE NAME:	Defended settlement, Romano-British settlement and field system, 100 metres south and east of Jenny's Lantern, Hedgeley		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1008839
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Bracken	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Sara Rushton 0191 4031642

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.
- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

SITE NAME:	Medieval farmstead, 500m ENE of Titlington Mount, Hedgeley		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1007451
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Bracken	NEW ENTRY?:	Yes
OWNER TYPE:	Private	CONTACT:	Tom Gledhill 0191 4031623
SITE NAME:	Multivallate defended settlement, 350m north-east of Wood House, Hedgeley		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1007453
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Bracken	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Sara Rushton 0191 4031642
SITE NAME:	Romano-British enclosed settlement on Beanley Moor, 800m south east of Broomhouse, Hedgeley		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1011548
CONDITION:	Extensive significant problems	TREND:	Improving
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Sara Rushton 0191 4031642
SITE NAME:	Romano-British enclosed settlement, 800 metres north west of East Bolton, Hedgeley		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1007446
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Bracken	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Sara Rushton 0191 4031642
SITE NAME:	Romano-British farmstead on Beanley Moor, 500m SSE of Broom House, Hedgeley		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1007452
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Sara Rushton 0191 4031642
SITE NAME:	The Ringses camp, group of burial mounds and two cairns, Beanley Moor, Hedgeley		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1006594
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Sara Rushton 0191 4031642
SITE NAME:	Nafferton castle and tower house, 750 metres east of Nafferton Farm, Horsley		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1018369
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Forestry	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Sara Rushton 0191 4031642

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
C Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

SITE NAME:	Remains of medieval bridge, Chollerford, Humshaugh		
DESIGNATION:	Scheduled Monument, WHS	LIST ENTRY NUMBER:	1006567
CONDITION:	Extensive significant problems	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Other	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Sara Rushton 0191 4031642

SITE NAME:	Round cairn 790 metres west of Smithy Strip, Ilderton		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1016248
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Forestry	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Sara Rushton 0191 4031642

SITE NAME:	Old Fawdon Hill West camp, Ingram		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1006546
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Bracken	NEW ENTRY?:	Yes
OWNER TYPE:	Private	CONTACT:	Tom Gledhill 0191 4031623

SITE NAME:	Bran's Walls Romano-British enclosed settlements, 400m SSE of Kielder Head, Kielder		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1009670
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Bracken	NEW ENTRY?:	No
OWNER TYPE:	Government or agency	CONTACT:	Sara Rushton 0191 4031642

SITE NAME:	Kershope Castle, Kielder		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1018956
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Forestry	NEW ENTRY?:	No
OWNER TYPE:	Government or agency	CONTACT:	Sara Rushton 0191 4031642

SITE NAME:	Romano-British enclosed settlement, 720m north east of Catcleugh, Kielder		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1009669
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Bracken	NEW ENTRY?:	No
OWNER TYPE:	Government or agency	CONTACT:	Sara Rushton 0191 4031642

SITE NAME:	Kyloe camp, Kyloe		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1006479
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Bracken	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Sara Rushton 0191 4031642

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.
- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

SITE NAME:	Earthwork 370 yards (340 metres) east of Low Stead, Lowick		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1006529
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Sara Rushton 0191 4031642
SITE NAME:	Newminster Abbey, Mitford Road, Morpeth		
DESIGNATION:	Scheduled Monument and Listed Building grade II	LIST ENTRY NUMBER:	1006563 and 1155952
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Sara Rushton 0191 4031642
SITE NAME:	Camp in Oakwood, south east of Plenmeller village, Plenmeller with Whitfield		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1006484
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Tom Gledhill 0191 4031623
SITE NAME:	Ellsnook round barrow, 175 metres north east of Heiferlaw Bridge, Rennington		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1006564
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Forestry	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Sara Rushton 0191 4031642
SITE NAME:	Cairn, 900 metres north east of Old Rothbury hillfort, Rothbury		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1008757
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Sara Rushton 0191 4031642
SITE NAME:	Old Rothbury multivallate hillfort and cairnfield, Rothbury		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1011616
CONDITION:	Extensive significant problems	TREND:	Improving
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Sara Rushton 0191 4031642
SITE NAME:	The vallum between Oatens Bank, Harlow Hill, and Whittle Dene Watercourse in wall mile 16, Stamfordham		
DESIGNATION:	Scheduled Monument, WHS	LIST ENTRY NUMBER:	1010621
CONDITION:	Extensive significant problems	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Mike Collins 0191 4031632

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.
- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

SITE NAME:	Hadrian's Wall and vallum between St Oswald's Cottages, east of Brunton Gate and the North Tyne in wall miles 25, 26 and 27, Wall		
DESIGNATION:	Scheduled Monument, WHS	LIST ENTRY NUMBER:	1018581
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Improving
PRINCIPAL VULNERABILITY:	Metal detecting - unlicensed	NEW ENTRY?:	No
OWNER TYPE:	Other	CONTACT:	Mike Collins 0191 4031632
SITE NAME:	Medieval monastic sheep farm (bercaria), 550 metres north east of Whittondean Farm, Whitton and Tosson		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1011292
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Bracken	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Sara Rushton 0191 4031642
SITE NAME:	Two round cairns, 590 metres and 610 metres east of Burn Brae, Whitton and Tosson		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1017197
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners	CONTACT:	Sara Rushton 0191 4031642
SITE NAME:	Low Chibburn medieval preceptory, C16 house and World War II pillbox, Widdrington Village		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1014679
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Deterioration - in need of management	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Sara Rushton 0191 4031642



© Historic England

SITE NAME:	Tillmouth Park, Duddo / Cornhill-on-Tweed
DESIGNATION:	Registered Park and Garden grade II*, 11 LBs, 2 SMs
CONDITION:	Generally unsatisfactory with major localised problems
VULNERABILITY:	High
TREND:	Declining
NEW ENTRY?:	No
OWNER TYPE:	Local authority, multiple owners
LIST ENTRY NUMBER:	1001053

Early and late C19 pleasure grounds and formal gardens. The picturesque walks alongside the River Till, along The Dean and to the 'eye-catcher' Twizel Castle, are masked by natural woodland regeneration. Several other heritage assets situated within the park and garden are in poor condition, including ha-ha walls, garden walls, an ornate Gothick bridge and the Henlaw Tunnel.

Contact: Tom Gledhill 0191 4031623



© Historic England

SITE NAME:	Seaton Delaval, Seaton Valley
DESIGNATION:	Registered Park and Garden grade II*, 20 LBs, part in CA
CONDITION:	Generally satisfactory but with significant localised problems
VULNERABILITY:	Medium
TREND:	Improving
NEW ENTRY?:	No
OWNER TYPE:	Charity (heritage)
LIST ENTRY NUMBER:	1001052

Remains of an early C18 park and garden, partially restored in the 1950s-60s. The house and landscape designs are attributed to Sir John Vanbrugh in 1719. The approach avenue is deteriorating, and woodland regeneration is concealing key landscape features, including earthworks and the mausoleum. A Conservation Management Plan has been produced. The site was awarded a National Lottery Heritage Fund grant in 2016 and major conservation and repair works have now been completed. A Historic England Repair Grant has resulted in repairs to the ha-ha walls and corner bastion enclosing the churchyard.

Contact: Tom Gledhill 0191 4031623

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.
- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

SITE NAME:	Berwick-upon-Tweed		
DESIGNATION:	Conservation Area, 265 LBs, 4 SMs	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	Improving significantly
VULNERABILITY:	Low	CONTACT:	Liz Williams (LPA) 01670 620305
SITE NAME:	Blyth Central, Blyth		
DESIGNATION:	Conservation Area, LB grade II	NEW ENTRY?:	No
CONDITION:	Poor	TREND:	Deteriorating
VULNERABILITY:	Medium	CONTACT:	Sara Rushton (LPA) 01670 620305
SITE NAME:	Hexham		
DESIGNATION:	Conservation Area, 182 LBs, RPG grade I, 2 SMs	NEW ENTRY?:	No
CONDITION:	Poor	TREND:	Deteriorating
VULNERABILITY:	Medium	CONTACT:	Sara Rushton (LPA) 01670 620305
SITE NAME:	Spittal, Berwick-upon-Tweed		
DESIGNATION:	Conservation Area, 7 LBs	NEW ENTRY?:	No
CONDITION:	Poor	TREND:	Deteriorating
VULNERABILITY:	Medium	CONTACT:	Liz Williams (LPA) 01670 620305
SITE NAME:	Twedmouth, Berwick-upon-Tweed		
DESIGNATION:	Conservation Area, 18 LBs, part in SM	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	Deteriorating
VULNERABILITY:	Low	CONTACT:	Liz Williams (LPA) 01670 620305

NORTHUMBERLAND (NP)

SITE NAME:	Glead's Cleugh Iron Age promontory fort, Akeld, Northumberland (UA)		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1014930
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Bracken	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Tom Gledhill 0191 4031623
SITE NAME:	Romano-British farmstead 900 metres north east of triangulation point on Gains Law, Akeld, Northumberland (UA)		
DESIGNATION:	Scheduled Monument, RB	LIST ENTRY NUMBER:	1017381
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Bracken	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Sara Rushton 0191 4031642
SITE NAME:	Two medieval shielings on Akeld Hill, 680m WNW of Gleadscleugh, Akeld, Northumberland (UA)		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1018349
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Bracken	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Tom Gledhill 0191 4031623

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.
- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

SITE NAME:	Unenclosed scooped settlement on the east slope of Harehope Hill, 750 metres south east of High Akeld Cottages, Akeld, Northumberland (UA)		
DESIGNATION:	Scheduled Monument, RB	LIST ENTRY NUMBER:	1014932
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Improving
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Sara Rushton 0191 4031642
SITE NAME:	Enclosures on Meggrim's Knowe, Alnham, Northumberland (UA)		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1006589
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Bracken	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Sara Rushton 0191 4031642
SITE NAME:	Ingram Farm: prehistoric to post-medieval settlement, agricultural and funerary remains, Alnham / Ingram, Northumberland (UA)		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1021382
CONDITION:	Extensive significant problems	TREND:	Improving
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Tom Gledhill 0191 4031623
SITE NAME:	Three cross dykes on Middle Hill, Alwinton, Northumberland (UA)		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1007525
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Forestry	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Sara Rushton 0191 4031642
SITE NAME:	Haltwhistle Burn Roman temporary camps 2 and 3 and area of cord rig cultivation, Haltwhistle, Northumberland (UA)		
DESIGNATION:	Scheduled Monument, WHS	LIST ENTRY NUMBER:	1010946
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Stock erosion - moderate	NEW ENTRY?:	No
OWNER TYPE:	Charity (heritage)	CONTACT:	Mike Collins 0191 4031632
SITE NAME:	Cross dyke, south of Campville, Harbottle, Northumberland (UA)		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1011396
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Government or agency	CONTACT:	Sara Rushton 0191 4031642
SITE NAME:	Hadrian's Wall and associated features between the boundary east of turret 34a and the field boundary west of milecastle 36 in wall miles 34, 35 and 36, Haydon / Simonburn / Bardon Mill, Northumberland (UA)		
DESIGNATION:	Scheduled Monument, WHS	LIST ENTRY NUMBER:	1010964
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Animal burrowing - moderate	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Mike Collins 0191 4031632

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
C Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

SITE NAME:	Shieling, 500 metres south west of Spy Crag, Henshaw, Northumberland (UA)		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1011839
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Sara Rushton 0191 4031642
SITE NAME:	Seatsides I Roman temporary camp and section of the Stanegate Roman road from the west side of the road from Once Brewed to the south side of the B6318, Henshaw / Melkridge / Haltwhistle, Northumberland (UA)		
DESIGNATION:	Scheduled Monument, WHS	LIST ENTRY NUMBER:	1010940
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Stock erosion - moderate	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Mike Collins 0191 4031632
SITE NAME:	C18 water mill at Grasslees, Hepple, Northumberland (UA)		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1006404
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Natural erosion - moderate	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Sara Rushton 0191 4031642
SITE NAME:	Bastle 150 metres south west of Morrelhirst, Hollinghill, Northumberland (UA)		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1018994
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Natural erosion - moderate	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Sara Rushton 0191 4031642
SITE NAME:	Lordenshaw multivallate hillfort, Romano-British settlements, field system, cairnfield, cross dyke, round cairn cemetery, rock art and medieval park pale, Hollinghill / Whitton and Tosson / Hesleyhurst, Northumberland (UA)		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1017196
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Bracken	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Tom Gledhill 0191 4031623
SITE NAME:	Hut circle 320 metres west of Threestoneburn House, Ilderton, Northumberland (UA)		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1019924
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Bracken	NEW ENTRY?:	No
OWNER TYPE:	Government or agency	CONTACT:	Sara Rushton 0191 4031642
SITE NAME:	Ancient settlements on Hartside Hill, Ingram, Northumberland (UA)		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1006539
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Bracken	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Tom Gledhill 0191 4031623

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
C Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

SITE NAME:	Greaves Ash camp, Ingram, Northumberland (UA)		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1006588
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Animal burrowing - moderate	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Sara Rushton 0191 4031642
SITE NAME:	Settlement on south east slope of Ewe Hill, Ingram, Northumberland (UA)		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1002916
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Forestry	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Sara Rushton 0191 4031642
SITE NAME:	Unenclosed hut circle settlement, field system, cairnfield and cord rig cultivation immediately north west of Linhope Spout, Ingram, Northumberland (UA)		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1020247
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Sara Rushton 0191 4031642
SITE NAME:	Roman period native enclosed farmstead 320 metres north west of Southernknowe, Kirknewton, Northumberland (UA)		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1014488
CONDITION:	Generally satisfactory but with minor localised problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Bracken	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Tom Gledhill 0191 4031623
SITE NAME:	Roman period native enclosed farmstead 370 metres WNW of Southernknowe, Kirknewton, Northumberland (UA)		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1014491
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Bracken	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Tom Gledhill 0191 4031623
SITE NAME:	Roman period native enclosed settlement 270 metres ESE of Fleehope, Kirknewton, Northumberland (UA)		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1014501
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Forestry	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Tom Gledhill 0191 4031623
SITE NAME:	Roman period native enclosed settlement and medieval sheiling 165 metres north east of Dunsdale, Kirknewton, Northumberland (UA)		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1014680
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Natural erosion - moderate	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Tom Gledhill 0191 4031623

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.
- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

SITE NAME:	Settlement north of White Law, Kirknewton, Northumberland (UA)		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1006456
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Bracken	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Tom Gledhill 0191 4031623

SITE NAME:	Settlement on the east slope of The Bell, Kirknewton, Northumberland (UA)		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1006465
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Sara Rushton 0191 4031642

SITE NAME:	Settlement, field systems and terraces on the south east slope of Yeavinger Bell, Kirknewton, Northumberland (UA)		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1006460
CONDITION:	Extensive significant problems	TREND:	Improving
PRINCIPAL VULNERABILITY:	Bracken	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Sara Rushton 0191 4031642

SITE NAME:	Three Roman period native settlements and later droveway 750m south west of Torleehouse, Kirknewton, Northumberland (UA)		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1016138
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Bracken	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Tom Gledhill 0191 4031623

SITE NAME:	Romano-British farmstead 850 metres south of Troughend, Otterburn, Northumberland (UA)		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1009380
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Bracken	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Sara Rushton 0191 4031642

SITE NAME:	Fishponds, 450 metres north east of Sewingshields, Simonburn, Northumberland (UA)		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1011081
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Stock erosion - moderate	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Mike Collins 0191 4031632

SITE NAME:	Walwick Fell Roman temporary camp, Warden, Northumberland (UA)		
DESIGNATION:	Scheduled Monument, WHS	LIST ENTRY NUMBER:	1010935
CONDITION:	Extensive significant problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Mike Collins 0191 4031632

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
C Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).


- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
 Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

SITE NAME:	Romano-British farmstead, 175 metres south of Cockpit Well, Whitton and Tosson, Northumberland (UA)		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1009582
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Bracken	NEW ENTRY?:	No
OWNER TYPE:	Commercial company	CONTACT:	Sara Rushton 0191 4031642

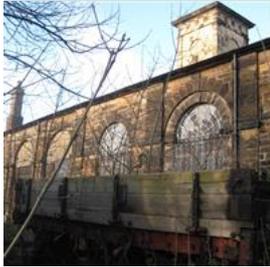TEES VALLEY**DARLINGTON (UA)**

© Historic England

SITE NAME:	Goods Shed at North Road Station, Darlington
DESIGNATION:	Listed Building grade II*, CA
CONDITION:	Fair
OCCUPANCY:	Occupied/in use
PRIORITY CATEGORY:	F (D)
OWNER TYPE:	Local authority
LIST ENTRY NUMBER:	1121262

Built in 1833, the goods shed is an early component of the Stockton & Darlington Railway, the world's first modern railway. Extended in 1839-40, it was the main goods handling facility for the railway. Of a single storey, it consists of two parallel ranges of sandstone with classical detailing. There is some structural movement, particularly to the clock tower. The building is under repair as part of the Railway Heritage Quarter. Fabric repairs to the goods shed are due to be complete in September 2023, although fit-out will continue for some time after.

Contact: Giles Proctor 01904 601981




© Historic England

SITE NAME:	Dovecote, 45 metres east of Manor House, Houghton Bank Lane, Houghton Le Side
DESIGNATION:	Listed Building grade II*
CONDITION:	Poor
OCCUPANCY:	N/A
PRIORITY CATEGORY:	D (D)
OWNER TYPE:	Commercial company
LIST ENTRY NUMBER:	1121194

Dovecote, probably medieval. Disused and requires roof repairs, repointing and removal of vegetation from walls. These works, alongside internal clearance of debris and lime washing of the external stonework, were granted Listed Building Consent in May 2019, as part of a wider scheme for the residential conversion of the farmstead.

Contact: Maria Carballeira 0191 4031650

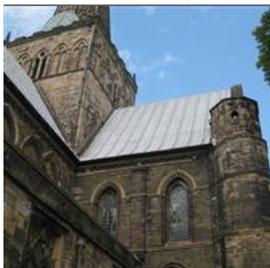

© Historic England

SITE NAME:	Church of St Cuthbert, Market Place, Darlington
DESIGNATION:	Listed Place of Worship grade I, CA
CONDITION:	Fair
PRIORITY CATEGORY:	E (D)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1121280

St Cuthbert's is one of the most important churches in the Early English style of Gothic architecture in the north of England. The nave, transepts and chancel are housed beneath steeply pitched roofs, with covering affected by significant problems. A first phase of roof repairs was undertaken in 2016, followed by a second phase in 2018. Both phases were made possible with funding from the National Lottery Heritage Fund Grants for Places of Worship scheme. A grant from the Church of England's Strategic Development Fund will allow remaining repair works to be undertaken.

Contact: Maria Carballeira 0191 4031650

SITE NAME:	Northgate		
DESIGNATION:	Conservation Area, 15 LBs, part in SM	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	Deteriorating
VULNERABILITY:	Low	CONTACT:	Gaby Rose (LPA) 07824 474 904

SITE NAME:	West End		
DESIGNATION:	Conservation Area, 39 LBs, part in RPG grade II	NEW ENTRY?:	No
CONDITION:	Poor	TREND:	Deteriorating
VULNERABILITY:	Low	CONTACT:	Gaby Rose (LPA) 07824 474 904

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.
- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

HARTLEPOOL (UA)

© Historic England

SITE NAME:	Church of St Mary, Durham Street, Hartlepool, Headland
DESIGNATION:	Listed Place of Worship grade II, CA
CONDITION:	Poor
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1250263

Designed in 1850 by the architect JA Hansom, St Mary's church has a west tower (from which a spire was removed c1945) and a bowed apsidal chancel. The external limestone walls are displaying numerous problems, including multiple vertical fractures at the west end of the building, some pockets of deep erosion, open joints, internal powdering and inappropriate cement repairs which are failing. Funding is being pursued as part of a site-wide strategy that includes the repair of the adjoining Presbytery.

Contact: Maria Carballeira 0191 4031650



© Historic England

SITE NAME:	Church of St Hilda, High Street, Hartlepool Headland, Headland
DESIGNATION:	Listed Place of Worship grade I, CA
CONDITION:	Poor
PRIORITY CATEGORY:	A (A)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1263355

Built on an exposed site near the sea c1200, on the site of a C7 monastery, incorporating the remains of an early C12 church. The church includes Saxon and medieval architectural fragments and has undergone several re-designs, being fully restored between 1925 and 1932. Continued structural movement of the tower; missing roof flashings causing dampness in walls and timber roofs. Masonry decay and clerestory ferramenta severely corroded. The building has been the subject of heritage crime. Funding is being explored after an unsuccessful bid in 2017 to the National Lottery Heritage Fund.

Contact: Maria Carballeira 0191 4031650

SITE NAME:	Low Throston deserted medieval village	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER: 1006765
CONDITION:	Generally satisfactory but with significant localised problems	TREND: Stable
PRINCIPAL VULNERABILITY:	Deterioration - in need of management	NEW ENTRY?: No
OWNER TYPE:	Private	CONTACT: Lee McFarlane 0191 4031659

SITE NAME:	Heugh coastal artillery battery immediately north west of Heugh Lighthouse, Headland	
DESIGNATION:	Scheduled Monument, CA	LIST ENTRY NUMBER: 1020801
CONDITION:	Generally satisfactory but with significant localised problems	TREND: Declining
PRINCIPAL VULNERABILITY:	Deterioration - in need of management	NEW ENTRY?: Yes
OWNER TYPE:	Local authority	CONTACT: Tom Gledhill 0191 4031623

SITE NAME:	Church Street, Hartlepool	
DESIGNATION:	Conservation Area, 18 LBs	NEW ENTRY?: No
CONDITION:	Very bad	TREND: Improving
VULNERABILITY:	Medium	CONTACT: Sarah Scarr (LPA) 01429 523275

SITE NAME:	Headland, Hartlepool, Headland	
DESIGNATION:	Conservation Area, 35 LBs, 2 SMs	NEW ENTRY?: No
CONDITION:	Very bad	TREND: Deteriorating
VULNERABILITY:	High	CONTACT: Sarah Scarr (LPA) 01429 523275

SITE NAME:	Park, Hartlepool	
DESIGNATION:	Conservation Area, 10 LBs, RPG grade II	NEW ENTRY?: No
CONDITION:	Fair	TREND: Deteriorating significantly
VULNERABILITY:	High	CONTACT: Sarah Scarr (LPA) 01429 523275

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.
- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

SITE NAME:	Seaton Carew, Hartlepool		
DESIGNATION:	Conservation Area, 17 LBs	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	Deteriorating
VULNERABILITY:	High	CONTACT:	Sarah Scarr (LPA) 01429 523275

MIDDLESBROUGH (UA)

SITE NAME:	Acklam Hall, Acklam		
DESIGNATION:	Conservation Area, LB grade I	NEW ENTRY?:	No
CONDITION:	Fair	TREND:	Deteriorating
VULNERABILITY:	Medium	CONTACT:	Heather Nelson (LPA) 01642 729116

SITE NAME:	Middlesbrough Historic Quarter		
DESIGNATION:	Conservation Area, 20 LBs	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	Improving
VULNERABILITY:	Low	CONTACT:	Heather Nelson (LPA) 01642 729116

NORTH YORK MOORS (NP)

SITE NAME:	Pinchinthorpe Hall moated site and post medieval gardens, Guisborough, Redcar and Cleveland (UA)		
DESIGNATION:	Scheduled Monument, 2 LBs	LIST ENTRY NUMBER:	1013215
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Gardening	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Tom Gledhill 0191 4031623

REDCAR AND CLEVELAND (UA)

© Historic England

SITE NAME:	Bastion and ha-ha wall, north of Kirkleatham Hall Stables, Kirkleatham, Redcar
DESIGNATION:	Listed Building grade II*, CA
CONDITION:	Very bad
OCCUPANCY:	N/A
PRIORITY CATEGORY:	A (A)
OWNER TYPE:	Local authority
LIST ENTRY NUMBER:	1329608

Early to mid-C18 bastion and adjoining ha-ha. The bastion is badly vandalised and robbed of much stonework. A conservation plan for structures on the Kirkleatham Hall estate was completed in 2008. Some consolidation work, part-funded by Historic England, was carried out on the bastion during 2011-12 but further repairs are required and the ha-ha remains in a very poor condition.

Contact: Martin Lowe 0191 4031653



© Redcar and Cleveland Borough Council

SITE NAME:	Bastion, north west of Kirkleatham Hall Stables, Kirkleatham, Redcar
DESIGNATION:	Listed Building grade II*, CA
CONDITION:	Poor
OCCUPANCY:	N/A
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Local authority
LIST ENTRY NUMBER:	1160124

Mid-C18 bastion. Badly vandalised and robbed of much stonework. A conservation plan for structures on the Kirkleatham Hall estate was completed in 2008. Some urgent repairs, part-funded by Historic England, were carried out during 2011-12 but further works are required to complete the consolidation of the structure.

Contact: Martin Lowe 0191 4031653

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.
- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site



© Historic England Archive

SITE NAME:	Kirkleatham Hall Stables, Kirkleatham, Redcar
DESIGNATION:	Listed Building grade II*, CA
CONDITION:	Good
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	E (E)
OWNER TYPE:	Local authority
LIST ENTRY NUMBER:	1160085

Early-C18 stable block. A conservation plan for structures on the Kirkleatham Hall estate was completed in 2008. The stable block was repaired, part-funded by Historic England grant-aid, during 2011-12 and is now in good condition. The Local Planning Authority has commissioned a detailed feasibility study which will look at potential new uses.

Contact: Martin Lowe 0191 4031653



© Historic England

SITE NAME:	Remains of Kilton Castle, Kilton Thorpe Lane, Kilton, Lockwood
DESIGNATION:	Scheduled Monument and Listed Building grade I
CONDITION:	Very bad
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	A (A)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	1018946 and 1136489

C12-C13 castle ruin occupying a rocky outcrop. The building is in a very bad condition, with vertical cracks in its walls and there is some regeneration of vegetation. There is only limited management by the Estate.

Contact: Tom Gledhill 0191 4031623



© Historic England

SITE NAME:	Christ Church, Coatham Road, Redcar
DESIGNATION:	Listed Place of Worship grade II, CA
CONDITION:	Poor
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1159776

Christ Church was built in 1854 and its soaring spire of sandstone with limestone dressings is a local landmark. The external stonework is subject to advanced weathering and decay; but essential repairs to the spire and the tower were completed in 2020 through the National Lottery Heritage Fund Grants for Places of Worship scheme. The slated roof coverings are reaching the end of their serviceable life, and so far only the roofs to either side of the chancel valley and the north porch roof have been re-roofed. Windows are in disrepair and upper clerestory windows are particularly vulnerable.

Contact: Maria Carballeira 0191 4031650

SITE NAME:	Bowl barrow 1.1km north-west of High Court Green, Guisborough		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1011268
CONDITION:	Generally satisfactory but with minor localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable clipping	NEW ENTRY?:	Yes
OWNER TYPE:	Private	CONTACT:	Tom Gledhill 0191 4031623

SITE NAME:	Bowl barrow, 1 kilometre north west of High Court Green, Guisborough		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1011285
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable clipping	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Tom Gledhill 0191 4031623

SITE NAME:	Eston Nab hill fort, palisaded settlement and beacon, Guisborough		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1011273
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Vandalism	NEW ENTRY?:	No
OWNER TYPE:	Local authority	CONTACT:	Lee McFarlane 0191 4031659

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.
- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

SITE NAME:	Manorial settlement, dovecote and fragment of field system, immediately north of Marske Inn Farm, Saltburn, Marske and New Marske		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1018948
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Stock erosion - moderate	NEW ENTRY?:	No
OWNER TYPE:	Local authority	CONTACT:	Tom Gledhill 0191 4031623



© Historic England

SITE NAME:	Valley Gardens, Saltburn, Skelton and Brotton / Saltburn, Marske and New Marske	Public pleasure grounds developed from 1861 to designs principally by Joseph Newton. Paths and steps have subsided and tree and shrub growth has been allowed to develop unchecked, mainly due to the steeply sloping nature of the site. The Albert Memorial and other structures around the site have suffered from vandalism but are now under repair. Development of a private residence has divided the ownership of the site. An active 'friends group' has been established and a Conservation Management Plan has been produced. Coastal Communities Revival Fund money has been awarded for further works.
DESIGNATION:	Registered Park and Garden grade II, 2 LBs, CA	
CONDITION:	Generally satisfactory but with significant localised problems	
VULNERABILITY:	Medium	
TREND:	Improving	
NEW ENTRY?:	No	
OWNER TYPE:	Local authority, multiple owners	
LIST ENTRY NUMBER:	1001429	Contact: Tom Gledhill 0191 4031623

SITE NAME:	Coatham (formerly Redcar)		
DESIGNATION:	Conservation Area, 5 LBs	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	No significant change
VULNERABILITY:	Medium	CONTACT:	Tim Brown (LPA) 01287 612616

SITE NAME:	Loftus		
DESIGNATION:	Conservation Area, 31 LBs	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	Deteriorating
VULNERABILITY:	Medium	CONTACT:	Tim Brown (LPA) 01287 612616

STOCKTON-ON-TEES (UA)



© Historic England Archive

SITE NAME:	Phosphate rock silo (No. 15), Haverton Hill, Former ICI., Billingham	Reinforced concrete silo of 1928-9. Parabolic cross-section with reinforced concrete arches, with ribs at the ends. Designed by Monnoyer British Construction Ltd, for the storage of phosphate rock imported for the production of fertilizer. This is the earliest surviving example of this type of silo in England.
DESIGNATION:	Listed Building grade II*	
CONDITION:	Poor	
OCCUPANCY:	Vacant/not in use	
PRIORITY CATEGORY:	C (C)	
OWNER TYPE:	Commercial company	
LIST ENTRY NUMBER:	1115821	Contact: Martin Lowe 0191 4031653



© Historic England Archive

SITE NAME:	Ruins of Church of St Thomas a Becket, Durham Road, Grindon and Thorpe Thewles	Ruins of late C12 church that was altered significantly in 1789. Now a roofless, part-collapsed, ruin and consolidation of the remains is required.
DESIGNATION:	Scheduled Monument and Listed Building grade I	
CONDITION:	Very bad	
OCCUPANCY:	Vacant/not in use	
PRIORITY CATEGORY:	A (A)	
OWNER TYPE:	Private	
LIST ENTRY NUMBER:	1017321 and 1329821	Contact: Tom Gledhill 0191 4031623

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.
- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

TYNE AND WEAR

GATESHEAD



© Historic England

SITE NAME:	Dunston Staiths
DESIGNATION:	Scheduled Monument and Listed Building grade II
CONDITION:	Poor
OCCUPANCY:	N/A
PRIORITY CATEGORY:	D (D)
OWNER TYPE:	Charity (heritage)
LIST ENTRY NUMBER:	1005898 and 1248994

Built by North Eastern Railway Company, opened 1893. Closed in 1970s after being the last working staiths on the Tyne. Fire damage in 2003, 2010 and 2020. A conservation plan, condition survey and feasibility study have been produced. Repairs in 2016 funded by National Lottery Heritage Fund and Historic England, also funder of further project development work 2018. Current multi-partnership collaboration to find a long-term solution. Cultural Recovery Fund grant to install temporary access scaffold and other improvements. Community Renewal Fund (2022) enabling further project development.

Contact: Sara Rushton 0191 4031642




© Historic England

SITE NAME:	Gibside Hall, B6314, Gibside Estate, Rowlands Gill, Whickham
DESIGNATION:	Scheduled Monument and Listed Building grade II*, RPG grade I, CA
CONDITION:	Very bad
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	B (B)
OWNER TYPE:	Charity (heritage)
LIST ENTRY NUMBER:	1017224 and 1299730

Large house/hall of 1603-20, enlarged in the C18 and altered in the early C19. Fell into disrepair in the early C20 and now a roofless shell in poor condition. Set in an early to mid-C18 park. Some stabilisation works undertaken but comprehensive approach to consolidation and potential for re-use required.

Contact: Martin Lowe 0191 4031653

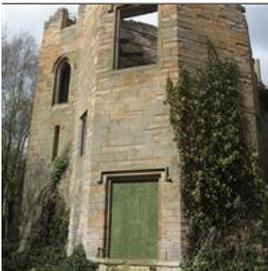

© Historic England

SITE NAME:	Ravensworth Castle (Nash House), Lamesley
DESIGNATION:	Listed Building grade II*, CA
CONDITION:	Very bad
OCCUPANCY:	N/A
PRIORITY CATEGORY:	B (B)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	1025151

Nash house of 1808 for Sir Thomas Liddell, completed by 1846 but now a ruin following extensive demolition in the 1950s. Urgent repairs were completed by the owners in 2015 following a condition survey commissioned by the Local Authority using Historic England grant-aid. An outline scope of works and costings for repair have also been produced. In-principle agreement with the owner to repair all of the designated heritage assets within the castle complex as ruins on a phased basis, beginning with the scheduled medieval remains, a process which began in 2018.

Contact: Mike Collins 0191 4031632



© Historic England

SITE NAME:	Ravensworth Castle, Cross Lane, Lamesley
DESIGNATION:	Scheduled Monument and Listed Building grade II*, LB grade II, CA
CONDITION:	Very bad
OCCUPANCY:	N/A
PRIORITY CATEGORY:	E (D)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	1016975 and 1025190

Medieval castle of which two C14 corner towers and part of its curtain wall survive in poor condition, as well as associated archaeological deposits. A detailed repair scheme for the medieval castle remains began in 2018, with the aim for the repair as a ruin to be undertaken over approximately 5 years.

Contact: Mike Collins 0191 4031632

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.
- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site



© Historic England

SITE NAME:	Church of St Chad, Rawling Road, Gateshead
DESIGNATION:	Listed Place of Worship grade II*
CONDITION:	Poor
PRIORITY CATEGORY:	E (D)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1277841

St Chad's is cruciform in plan with a large octagonal tower at its centre. Designed by the architect William Searle Hicks, it was consecrated in 1903. The slated roof coverings are approaching the end of their serviceable life and there is some water ingress internally. The roofs of the nave and tower were replaced in 2016 through funding from a Listed Places of Worship Roof Repairs Grant, and funding in 2021 from the National Churches Trust allowed further re-roofing works. Funding options are currently being explored for the repair of the remaining roofs.

Contact: Maria Carballeira 0191 4031650

SITE NAME:	Coal mining remains at Dunston Hill	
DESIGNATION:	Scheduled Monument, part in CA	LIST ENTRY NUMBER: 1018227
CONDITION:	Generally satisfactory but with significant localised problems	TREND: Declining
PRINCIPAL VULNERABILITY:	Road construction	NEW ENTRY?: No
OWNER TYPE:	Private	CONTACT: Sara Rushton 0191 4031642

SITE NAME:	Washingwells Roman fort, Whickham	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER: 1018645
CONDITION:	Extensive significant problems	TREND: Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?: No
OWNER TYPE:	Local authority	CONTACT: Sara Rushton 0191 4031642

SITE NAME:	Site of Ravensworth coalmill, 600 metres north east of Ravensworth Castle, Lamesley	
DESIGNATION:	Scheduled Monument, part in CA	LIST ENTRY NUMBER: 1015922
CONDITION:	Generally satisfactory but with significant localised problems	TREND: Unknown
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?: No
OWNER TYPE:	Private	CONTACT: Sara Rushton 0191 4031642

SITE NAME:	Ravensworth, Lamesley	
DESIGNATION:	Conservation Area, 11 LBs, 2 SMs	NEW ENTRY?: No
CONDITION:	Poor	TREND: Deteriorating
VULNERABILITY:	Low	CONTACT: Clare Richardson (LPA) 0191 433 3510

NEWCASTLE UPON TYNE



© Historic England

SITE NAME:	32, Close (The Cooperage)
DESIGNATION:	Listed Building grade II*, CA
CONDITION:	Poor
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Commercial company
LIST ENTRY NUMBER:	1024916

One of a group of late-medieval buildings on the Newcastle upon Tyne waterfront. Sandstone ground floor, supporting timber-framed upper floors. Gabled front of one bay and three storeys, with jettied first and second floors. Originally a merchant house and more recently a public house and restaurant. The building is vacant and deteriorating.

Contact: Maria Carballeira 0191 4031650

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.
- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site



© Historic England

SITE NAME:	The Keelmen's Hospital, City Road, Newcastle upon Tyne
DESIGNATION:	Listed Building grade II*
CONDITION:	Fair
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Local authority
LIST ENTRY NUMBER:	1024902

Almshouses constructed in 1701 for keelmen and keelmen's widows. The building was last used as student accommodation but is now vacant and disused. It was a target for vandalism but the owner has improved security. Options for re-use are being actively explored.

Contact: Martin Lowe 0191 4031653



© Historic England

SITE NAME:	5-13, Grey Street, Newcastle upon Tyne
DESIGNATION:	Listed Building grade II*, CA
CONDITION:	Poor
OCCUPANCY:	Part occupied/part in use
PRIORITY CATEGORY:	D (C)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	1139021

Four-storey shops and houses built circa 1835, probably by John Wardle for Richard Grainger. The property is now largely vacant and roof and rainwater goods in a poor condition with spalling and delamination shown on elevations. Treatment for dry rot currently being considered and plans for re-use formulated but not implemented.

Contact: Martin Lowe 0191 4031653



© Historic England

SITE NAME:	Presbytery attached to St Michael's church, Westmorland Road, Newcastle upon Tyne
DESIGNATION:	Listed Place of Worship grade II*
CONDITION:	Poor
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1024743

A three-storey presbytery, attached to the south-east corner of St Michael's church, with a gabled front, stone walls and slated roofs. The building has not been actively used for some time. Gutters are choked with vegetation, there is some water ingress, and internal cracks adjacent to the end gable wall. Many of the external building elements are deteriorating and in need of a comprehensive programme of repairs. Discussions are underway to agree a repair strategy and long-term sustainable use of the building.

Contact: Maria Carballeira 0191 4031650



© Historic England

SITE NAME:	Woolsington Hall, Woolsington
DESIGNATION:	Listed Building grade II*, RPG grade II
CONDITION:	Very bad
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	F (F)
OWNER TYPE:	Commercial company
LIST ENTRY NUMBER:	1123737

A compact late C17 country house, with later additions. It has service buildings, all set in gardens and parkland. A planning application to convert the building to a five-star hotel and spa was approved by the Local Authority in 2015. The Hall was gutted by a fire in December 2015 and the owners are now carrying out stabilisation and repair works to make the structure wind and weather tight.

Contact: Martin Lowe 0191 4031653



© Minnie Fraser

SITE NAME:	St Lawrence Church, Byker Crescent
DESIGNATION:	Listed Place of Worship grade II*
CONDITION:	Poor
PRIORITY CATEGORY:	C (New entry)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1392166

Built on New Bridge Street in 1847 as a Presbyterian church in Early English Gothic Revival style, from designs by John Dobson. It was rebuilt for Catholic use in Felton Street in 1897, architect W. Lister Newcombe. Only one of the two spires was rebuilt and since the 1970s is part of the Byker Wall Estate. The west gable has a significant bulge externally and the south-west corner of the sanctuary offshoot has subsided causing wall cracks. The site has been secured with heras fencing and monitoring is in place while funding options are explored to deliver a comprehensive programme of repairs.

Contact: Maria Carballeira 0191 4031650

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.
- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site




© Historic England

SITE NAME:	Christ Church (and hall attached), Shieldfield Green, Newcastle upon Tyne
DESIGNATION:	Listed Place of Worship grade II*
CONDITION:	Fair
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1024748

Parish church of 1859-61, by AB Higham, constructed of squared sandstone with ashlar dressings and Welsh slate roofs. Funding, through the National Lottery Heritage Fund and Historic England Repair Grants for Places of Worship scheme, allowed a first phase of roof repairs above the nave and the aisles to be completed in 2015. The roofs above the chancel, the Lady Chapel and the organ chamber are coming to the end of their life and the valley gutter between the nave and the south aisle is not discharging satisfactorily; water ingress is damaging internal plaster work and ceilings.

Contact: Maria Carballeira 0191 4031650

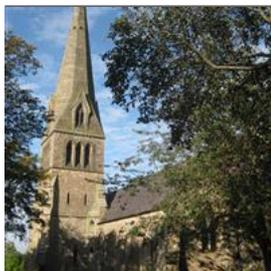


© Historic England

SITE NAME:	Church of St Michael with St Lawrence, Avondale Road, Byker
DESIGNATION:	Listed Place of Worship grade II
CONDITION:	Fair
PRIORITY CATEGORY:	D (D)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1024948

Parish church built in 1862-3 to the design of WL Moffat. A north aisle and vestry were added in 1936. The building has suffered from roof leaks, general dampness and heritage crime. Urgent repairs were completed in 2013. Further funding was awarded in 2017, through the National Lottery Heritage Fund Grants for Places of Worship scheme, for a supplementary phase of repairs to enable the building to dry out. Those repairs were completed and work continues towards developing a project to use the building as a multi-functional community hub.

Contact: Maria Carballeira 0191 4031650

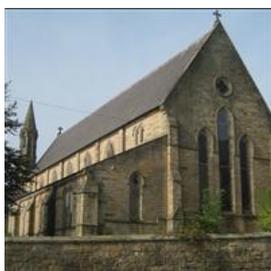

© Historic England

SITE NAME:	Life Transformation Church (former Church of St Paul), Havelock Place, High Elswick
DESIGNATION:	Listed Place of Worship grade II
CONDITION:	Poor
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1024846

Former parish church of 1856-9 designed by John Dobson. Closed in 2006, the church lay vacant and subject to heritage crime. It was taken over by the Life Transformation Ministry in 2009. Funding through the National Lottery Heritage Fund and Historic England Repair Grants for Places of Worship scheme enabled a first phase of urgent repairs to be completed in 2014. Further funding from the National Lottery Heritage Fund Grants for Places of Worship scheme facilitated a second phase of urgent repairs, completed in 2017. Further works are required to secure the site's long-term use.

Contact: Maria Carballeira 0191 4031650



© Historic England

SITE NAME:	Church of St Luke, Claremont Road, Newcastle upon Tyne
DESIGNATION:	Listed Place of Worship grade II, CA
CONDITION:	Fair
PRIORITY CATEGORY:	F (F)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1355224

Completed in 1890 to designs by Oliver & Leeson, St Luke's has a short nave with south porch, paired transepts and a chancel with north vestry and south chapel. It is constructed of red brick with steeply pitched roofs of Welsh slate, stone window surrounds and a west belfry. A scheme of external repairs was completed in 2014 but a recent survey identified a number of areas at roof level that need attention to stop water ingress. Internal repairs are underway to bring the main body of the church back into use. Whilst works are undertaken, the adjoining parish hall is being used for worship.

Contact: Maria Carballeira 0191 4031650



© Historic England

SITE NAME:	Church of St Matthew, Summerhill Street, Newcastle upon Tyne
DESIGNATION:	Listed Place of Worship grade II*, CA
CONDITION:	Fair
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1024757

Built in 1877 by the local architect RJ Johnson, with a striking west tower added in 1895 by Hicks & Charlewood. The church has sandstone walls and a roof of plain clay tiles. The interior is tall and spacious with double aisles on either side of the nave. Funding, through the National Lottery Heritage Fund and Historic England Repair Grants for Places of Worship scheme, enabled the completion of repairs to the nave and chancel roofs, and rainwater pipes, in 2014. Investigative work is required to assess issues affecting high level masonry.

Contact: Maria Carballeira 0191 4031650

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.
- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

SITE NAME:	Dewley Hill round barrow and associated features, 350 metres north west of Dewley Farm		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1018678
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Animal burrowing - extensive	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Sara Rushton 0191 4031642

SITE NAME:	Hadrian's Wall and vallum in wall mile 9, Blucher to Dene House		
DESIGNATION:	Scheduled Monument, WHS	LIST ENTRY NUMBER:	1003790
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners	CONTACT:	Mike Collins 0191 4031632



© Historic England

SITE NAME:	St John's Cemetery, Newcastle upon Tyne	Burial board cemetery of 1857. The twinned northern entrance lodges and ornate joining arch (grade II) are derelict and subsiding, the latter permanently propped. The chapels (grade II) are unused and fenced off although in fair condition. Boundary walls are subsiding. Many monuments are in poor condition, including the Mather Tomb (grade II). Terraces and steps on Miser Hill are in poor condition and overgrown. A 2023 project joint funded by Historic England & Newcastle City Council aims to increase engagement and accessibility and develop proposals for a larger repair project.
DESIGNATION:	Registered Park and Garden grade II, 4 LBs	
CONDITION:	Generally satisfactory but with significant localised problems	
VULNERABILITY:	Medium	
TREND:	Declining	
NEW ENTRY?:	No	
OWNER TYPE:	Local authority	
LIST ENTRY NUMBER:	1000761	Contact: Sara Rushton 0191 4031642



© Historic England

SITE NAME:	Westgate Hill Cemetery, Newcastle upon Tyne	Opened 1829, Westgate Hill is one of the earliest garden cemeteries in England and the earliest in the North East. Despite having lost its chapel, and the original layout being obscured by vegetation, the character of the site remains legible. Current problems include invasive weeds and scrub, vandalism, anti-social behaviour and minimal management. A Conservation Management Plan is now in place for the site and a 12 month project co-funded by Historic England and Newcastle City Council will engage with local communities to create a safe, accessible and used green space.
DESIGNATION:	Registered Park and Garden grade II, 4 LBs, part in CA, WHS	
CONDITION:	Generally unsatisfactory with major localised problems	
VULNERABILITY:	Medium	
TREND:	Declining	
NEW ENTRY?:	No	
OWNER TYPE:	Local authority	
LIST ENTRY NUMBER:	1001680	Contact: Sara Rushton 0191 4031642

NORTHUMBERLAND (UA) / NEWCASTLE UPON TYNE

SITE NAME:	Hadrian's Wall and vallum from Throckley to East Town House, Heddon-on-the-Wall in wall mile 11, Heddon-on-the-Wall		
DESIGNATION:	Scheduled Monument, WHS	LIST ENTRY NUMBER:	1010616
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Improving
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Mike Collins 0191 4031632

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.
- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

NEWCASTLE UPON TYNE / GATESHEAD



© Historic England

SITE NAME:	Battle of Newburn Ford
DESIGNATION:	Registered Battlefield, 6 LBs, 2 CAs
CONDITION:	Generally satisfactory but with significant localised problems
VULNERABILITY:	High
TREND:	Stable
PRIORITY CATEGORY:	B (B)
OWNER TYPE:	Private, multiple owners
LIST ENTRY NUMBER:	1000025

The Battle of Newburn Ford (1640) was the only battle of the Second Bishops' War. The Scottish Army took Newcastle by defeating the English at this river crossing. The Scottish campaign forced Charles I to raise an army against them and, after the loss of Newcastle, to pay them off. This expense meant Charles had to recall Parliament, which proved to be a critical step towards the English Civil War. The battlefield has been subject to piecemeal, peripheral development. A report on the significance of the battlefield is now being used to inform planning decisions. The impact is being monitored.

Contact: Tom Gledhill 0191 4031623

NORTH TYNESIDE



© Historic England

SITE NAME:	Church of Our Lady and St Columba, Wallsend
DESIGNATION:	Listed Place of Worship grade II
CONDITION:	Poor
PRIORITY CATEGORY:	C (New entry)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1431024

Church built in 1957 from designs by Vincent Stienlet in Modern Perpendicular Gothic style, with Scandinavian and Art Deco elements. Reordering by Vincent Stienlet (the younger) in 1968 and 1990. A detailed structural survey has identified widespread failure of the copper covered roofs and parapet gutter linings. These defects are allowing high level water ingress which has caused corrosion of the steel frame and cracks along the narrow square brick pilasters. Funding options are being explored to deliver a comprehensive programme of repairs.

Contact: Maria Carballeira 0191 4031650

SITE NAME:	St Mary's Island, Seaton Valley	NEW ENTRY?:	No
DESIGNATION:	Conservation Area, 2 LBs	TREND:	Deteriorating
CONDITION:	Poor	CONTACT:	Planning Policy (LPA) 0191 6432310
VULNERABILITY:	High		

SITE NAME:	St Peter's, Wallsend	NEW ENTRY?:	No
DESIGNATION:	Conservation Area, 3 LBs	TREND:	Deteriorating
CONDITION:	Very bad	CONTACT:	Planning Policy (LPA) 0191 6432310
VULNERABILITY:	High		

SOUTH TYNESIDE



© Historic England

SITE NAME:	Detached chimney at Cleadon Pumping Station, off Sunnyside Lane
DESIGNATION:	Listed Building grade II*, CA
CONDITION:	Poor
OCCUPANCY:	N/A
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Commercial company
LIST ENTRY NUMBER:	1416041

Large square chimney, detached from boiler house. Built in 1860-2 in Italianate style by Thomas Hawksley. A prominent local landmark and one of a series of pumping stations along the north east coast. A condition survey and schedule of repairs have been prepared with funding from Historic England. Discussions are underway about a first phase of work.

Contact: Maria Carballeira 0191 4031650


PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.
- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

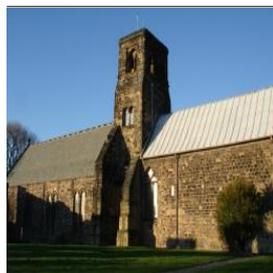

© Historic England

SITE NAME:	Church of St Paul, Church Bank, Jarrow
DESIGNATION:	Listed Place of Worship grade I, CA
CONDITION:	Poor
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1355091

C7 foundation, part of the monastery of St Paul. Formerly two separate churches: eastern Saxon church (now chancel); central tower C9 to C12; western former basilica (now nave), rebuilt in 1782. 1866 alterations and additions of large north aisle and north porch by George Gilbert Scott. Restored in 1972 and roofs repaired in summer 2008. A 2021 structural assessment identified structural defects on the tower. Halting repairs have been undertaken, and netting installed on the SW corner. Discussions are on-going regarding a long-term solution.
Contact: Maria Carballeira 0191 4031650



© Historic England

SITE NAME:	Christ Church, Grange Road West, Jarrow
DESIGNATION:	Listed Place of Worship grade II
CONDITION:	Poor
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1025199

Parish church of 1868 by Johnson and Hicks in the Early English style. It has an aisled nave with steeply pitched slated roofs, a south porch and tall spire. Remedial works have been completed to the tip of the spire: however concerns remain about the deteriorating condition of the tower stonework and the abutment gutter between the tower and chancel roof. Discussions have taken place to identify potential sources of funding for repairs.
Contact: Maria Carballeira 0191 4031650

SITE NAME:	Cleadow, South Tyneside	
DESIGNATION:	Conservation Area, 15 LBs	NEW ENTRY?: No
CONDITION:	Poor	TREND: Deteriorating
VULNERABILITY:	Low	CONTACT: Lucy Routledge (LPA) 0191 424 7592

SITE NAME:	East Boldon, South Tyneside	
DESIGNATION:	Conservation Area, 8 LBs	NEW ENTRY?: No
CONDITION:	Poor	TREND: Deteriorating
VULNERABILITY:	Low	CONTACT: Lucy Routledge (LPA) 0191 424 7592

SITE NAME:	Whitburn, South Tyneside	
DESIGNATION:	Conservation Area, 23 LBs	NEW ENTRY?: No
CONDITION:	Poor	TREND: Deteriorating
VULNERABILITY:	Low	CONTACT: Lucy Routledge (LPA) 0191 424 7592

SUNDERLAND



© Historic England

SITE NAME:	'F' Pit Museum - colliery engine house, Albany Way (East side)
DESIGNATION:	Scheduled Monument and Listed Building grade II
CONDITION:	Poor
OCCUPANCY:	Part occupied/part in use
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Local authority
LIST ENTRY NUMBER:	1018224 and 1025422

'F' Pit was sunk in 1777 with the engine house built in 1926. The pit closed in 1968 and the site was cleared, apart from the engine house and head gear. Representing an example of the winding technology used in the north east coalfield, the building re-opened as a museum in 1976 and continues to open with limited, seasonal, hours. Scheduled Monument Consent was granted in late 2020 for repairs to ensure the building is weatherproof and were mostly completed in 2022. Discussions are on-going regarding further works required.
Contact: Lee McFarlane 0191 4031659

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.
- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

- CA** Conservation Area
- LB** Listed Building
- LPA** Local Planning Authority
- NP** National Park
- RPG** Registered Park and Garden
- SM** Scheduled Monument
- UA** Unitary Authority
- WHS** World Heritage Site



© Historic England

SITE NAME:	Monkwearmouth Station Museum, with screen walls, footbridge and waiting room, Sunderland
DESIGNATION:	Listed Building grade II*
CONDITION:	Fair
OCCUPANCY:	Part occupied/part in use
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Mixed, multiple owners
LIST ENTRY NUMBER:	1209029

Former railway station, built in 1848 with additions of 1879, now a football museum. The site includes the main station building with pedimented portico and screen walls, an attached cast iron footbridge to the rear, and a waiting room and long screen wall to the west platform. There is a maintenance backlog, resulting in decay and some water ingress. A package of urgent repairs has recently been completed, and initial discussions have taken place to try and establish a maintenance regime for the site as a whole.

Contact: Maria Carballeira 0191 4031650



© Historic England

SITE NAME:	Chapel of Light, the former Church of St Columba, Cornhill Road, Sunderland
DESIGNATION:	Listed Place of Worship grade II
CONDITION:	Poor
PRIORITY CATEGORY:	D (D)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1208179

A large red brick church of 1888-90 by the prolific ecclesiastical architect Charles Hodgson Fowler. Italianate in style, it contains a complete scheme of interior decoration by the artist James Eadie-Reid, including a series of wall paintings. The paintings are deteriorating due to water penetration and dampness caused, in part, by defective rainwater gutters and pipes and by the absence of an efficient internal heating system. A strategy for the building's future is being developed.

Contact: Maria Carballeira 0191 4031650



© Historic England

SITE NAME:	Church of Holy Trinity, Usworth
DESIGNATION:	Listed Place of Worship grade II
CONDITION:	Poor
PRIORITY CATEGORY:	D (D)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1025382

Designed by John and Benjamin Green of Newcastle, Holy Trinity church was built in 1831-2. It consists of a wide aisleless nave with bellcote over the west gable and chancel with a south lean-to vestry. The slated roofs of the nave are showing significant signs of reaching the end of their serviceable life (many areas of slipped and patched slating and water leakage internally). The Hall has been re-roofed, but the abutment with the tower is not weathertight. An unsuccessful funding bid for repairs was submitted in 2017 to the National Lottery Heritage Fund Grants for Places of Worship scheme.

Contact: Maria Carballeira 0191 4031650



© Historic England

SITE NAME:	Guru Gobind Singh Gurdwara Sikh Centre (Formerly Christ Church), Ryhope Road, Sunderland
DESIGNATION:	Listed Place of Worship grade II, CA
CONDITION:	Poor
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1209657

Formerly a parish church, built in 1862-4 by James Murray of Coventry. Closed by the Church of England, the building has been acquired by the Sikh community and continues as a place of worship. It contains high quality stained glass. A first phase of urgent repairs, including works to rainwater pipes and gutters, was completed in 2014 with funding from the National Lottery Heritage Fund and Historic England Repair Grants for Places of Worship scheme. The spire is in need of urgent repair and rainwater goods are in need of attention and some repairs.

Contact: Maria Carballeira 0191 4031650

SITE NAME:	Hasting Hill cursus and causewayed enclosure, 600m south of Hasting Hill Farm		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1016977
CONDITION:	Extensive significant problems	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Sara Rushton 0191 4031642

SITE NAME:	Old Sunderland		
DESIGNATION:	Conservation Area, 10 LBs	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	Improving
VULNERABILITY:	Medium	CONTACT:	Mark Taylor (LPA) 0191 5611515

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.
- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

- CA** Conservation Area
- LB** Listed Building
- LPA** Local Planning Authority
- NP** National Park
- RPG** Registered Park and Garden
- SM** Scheduled Monument
- UA** Unitary Authority
- WHS** World Heritage Site

SITE NAME:	Old Sunderland Riverside		
DESIGNATION:	Conservation Area, 11 LBs	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	Improving
VULNERABILITY:	Low	CONTACT:	Mark Taylor (LPA) 0191 5611515

SITE NAME:	Sunniside		
DESIGNATION:	Conservation Area, 45 LBs, part in RPG grade II	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	Improving
VULNERABILITY:	Low	CONTACT:	Mark Taylor (LPA) 0191 5611515

SUNDERLAND / GATESHEAD



© Gateshead Metropolitan Borough Council

SITE NAME:	Bowes Railway, track, wagon shop, hauler houses and associated sheds, structures and incline, Bowes Railway, Lamesley
DESIGNATION:	Scheduled Monument
CONDITION:	Very bad
OCCUPANCY:	Part occupied/part in use
PRIORITY CATEGORY:	B (B)
OWNER TYPE:	Charity (heritage)
LIST ENTRY NUMBER:	1003723

Track and inclined track bed, sheds, hauler houses and associated workshops comprising part of the Bowes Railway, one of the earliest and best preserved examples of a rope haulage system. The site is vulnerable to vandalism and heritage crime. Since 2003, several repair schemes have been undertaken, all part-funded by Historic England. These include repairs to the stone walling of the engineering shop at Springwell, completed in 2017. A condition survey of the track bed and related structures between Blackfell and Blackham Hill hauler houses has been prepared with Historic England funding.

Contact: Sara Rushton 0191 4031642

EAST RIDING OF YORKSHIRE (UA)



© Historic England

SITE NAME:	Boat hoist on south side of south dock, Bridge Street, Goole
DESIGNATION:	Listed Building grade II*, CA
CONDITION:	Poor
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Commercial company
LIST ENTRY NUMBER:	1083214

Boat hoist of c1862 invented by WH Bartholomew to transfer coal from canal compartment boats, known as 'Tom Puddings', into seagoing vessels. The compartment boats were raised hydraulically and tipped to empty their contents down a chute and into the hold of the waiting vessel. There were originally five of these hoists, which were peculiar to Goole; this is the last remaining example. Structural timber and cladding repairs were carried out with funding from Historic England and the owner in 2016. Further phases of work are required to put all timbers and steelwork into good repair.

Contact: Bryan Davies 01904 601867



© Historic England

SITE NAME:	Paull Point Battery, coastal artillery battery and Submarine Mining Establishment, Paull
DESIGNATION:	Scheduled Monument, LB grade II, part in CA
CONDITION:	Very bad
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	A (A)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	1020425

A gun battery was established in 1542 and rebuilt in 1807. The present large complex was built in 1861-4 and remodelled in 1894. It was designed to defend Hull and the Humber. Earthen banks enclose a vast irregular pentagon parallel with the Humber with long brick-built, single-storey barrack blocks on the north side. The buildings are deteriorating, with significant water ingress through the flat roofs and the earthen ramparts are overgrown. The site has recently changed hands.

Contact: Giles Proctor 01904 601981

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.
- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

- CA** Conservation Area
- LB** Listed Building
- LPA** Local Planning Authority
- NP** National Park
- RPG** Registered Park and Garden
- SM** Scheduled Monument
- UA** Unitary Authority
- WHS** World Heritage Site



© Historic England

SITE NAME:	Paull Holme Tower, Thorngumbald Road, Paull
DESIGNATION:	Scheduled Monument and Listed Building grade I
CONDITION:	Fair
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	D (D)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	1007875 and 1366242

Mid-C15 three storey brick tower house in a scheduled moated site, originally part of a larger manorial complex. A unique survival for this region. Restored and reroofed in 1871, but it subsequently became ruinous again. Historic England grant has supported the reinstatement of the roof and the rebuilding of the crenellations. Some further repairs are required to low level brickwork and the ground floor vault.

Contact: Giles Proctor 01904 601981



© Historic England

SITE NAME:	Haltemprice Priory Farmhouse, Abbey Lane, Willerby
DESIGNATION:	Scheduled Monument and Listed Building grade II*
CONDITION:	Fair
OCCUPANCY:	Part occupied/part in use
PRIORITY CATEGORY:	F (B)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	1019825 and 1103364

A farmhouse dating largely from the C17 to C19, incorporating sections of reused medieval and C16 fabric. Following extensive vandalism, it has now been successfully repaired and restored to its original form. Although work is still ongoing to return the building to use as a dwelling, the owners live on site.

Contact: Nicky Brown 01904 601985



© Historic England

SITE NAME:	Church of St Mary, Cowlam Lane, Cowlam, Cottam
DESIGNATION:	Listed Place of Worship grade II
CONDITION:	Poor
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1083789

A small church, incorporating medieval fabric, but restored and rebuilt in 1853, apparently by Miss Sykes of Sledmere House. It has an outstanding Norman font. The church is unusually located in a farmyard. The roofs are in poor condition and the stonework is deteriorating.

Contact: Giles Proctor 01904 601981



© Historic England

SITE NAME:	Church of All Saints, Main Street, Aughton, Ellerton
DESIGNATION:	Listed Place of Worship grade I
CONDITION:	Poor
PRIORITY CATEGORY:	D (D)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1346742

Medieval village church, associated with the Pilgrimage of Grace (1536). Generally in good condition, but with some structural movement to the top of the tower and the chancel arch. Repairs are proposed.

Contact: Giles Proctor 01904 601981



© Historic England

SITE NAME:	Church of St Mary, The Green, Full Sutton
DESIGNATION:	Listed Place of Worship grade II
CONDITION:	Poor
PRIORITY CATEGORY:	D (D)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1083836

A small medieval church extensively rebuilt in 1845 by GT Andrews. The calcareous sandstone of the walls is eroding and the roof is in poor condition. Some repairs have been carried out, but further work is required.

Contact: Giles Proctor 01904 601981


PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.
- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

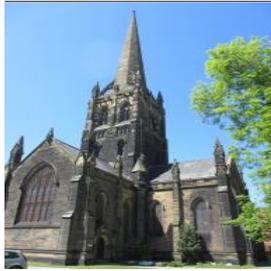

© Historic England

SITE NAME:	Church of St John, Church Street, Goole
DESIGNATION:	Listed Place of Worship grade II, CA
CONDITION:	Fair
PRIORITY CATEGORY:	D (F)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1083215

An early Victorian church, dominating the skyline of Goole. The stonework to the upper part of the central tower is eroding. The chancel roof has been re-covered with a grant from the Covid-19 Emergency Heritage at Risk Response Fund and is now in good condition. The south slope of the nave roof has been re-covered and other repairs have been undertaken. Further reroofing and repairs to the spire are planned. Work has been carried out to increase use of the church by the community.

Contact: Giles Proctor 01904 601981



© Historic England

SITE NAME:	Church of St Augustine, Church Lane, Hedon
DESIGNATION:	Listed Place of Worship grade I, CA
CONDITION:	Poor
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1346568

Large and important medieval church, C13 to C15. The central tower dominates the town. A programme of repairs over the years has addressed many issues, but parts of the building are still in poor repair, including the chancel and south transept roofs and the north transept and nave aisle stonework.

Contact: Giles Proctor 01904 601981



© Historic England

SITE NAME:	Church of St Mary, Church Lane, Hook
DESIGNATION:	Listed Place of Worship grade II*
CONDITION:	Poor
PRIORITY CATEGORY:	D (D)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1160360

Small medieval church. The roof coverings are in poor condition and there is some deterioration of the stonework. A scheme to widen the use of the church has been developed.

Contact: Giles Proctor 01904 601981



© Historic England

SITE NAME:	Church of St Lawrence, High Street, Snaith and Cowick
DESIGNATION:	Listed Place of Worship grade I, CA
CONDITION:	Fair
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1161899

Large parish church incorporating fabric dating to C12 and a C13 tower. A National Lottery Heritage Fund Grants for Places of Worship Repair Grant was accepted in 2018 and repair works to the roofs and high level masonry have been completed. A further phase of work to repair low level masonry is still required.

Contact: Giles Proctor 01904 601981

SITE NAME:	Bewick Hall moated site, Aldbrough	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER: 1007848
CONDITION:	Generally satisfactory but with significant localised problems	TREND: Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?: No
OWNER TYPE:	Private	CONTACT: Nicky Brown 01904 601985

SITE NAME:	Four round barrows 780 metres north east of Littlewood Lodge, Bishop Burton	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER: 1007563
CONDITION:	Extensive significant problems	TREND: Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?: No
OWNER TYPE:	Private	CONTACT: Richard Butterfield 01904 601995

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
C Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
 Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

SITE NAME:	Round barrow 900 metres north east of Littlewood Lodge, Bishop Burton		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1007440
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995

SITE NAME:	Three round barrows 800 metres north east of Littlewood Lodge, Bishop Burton		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1007573
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995

SITE NAME:	Five round barrows 700 metres north east of Littlewood Lodge, Bishop Burton / Newbald		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1007401
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995

SITE NAME:	Round barrow 300 metres south west of Cot Nab Farm, Bishop Wilton		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1008319
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995

SITE NAME:	Round barrow south east of Cot Nab Farm, Bishop Wilton		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1009386
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995

SITE NAME:	Site of Archbishop's moated palace and fishponds, Hall Garth, Bishop Wilton		
DESIGNATION:	Scheduled Monument, part in CA	LIST ENTRY NUMBER:	1009383
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Drainage/dewatering	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985

SITE NAME:	Romano-British villa at Cockle Pits, near Brantingham, Brantingham		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1014736
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995

SITE NAME:	Bowl barrow, 500 metres south of Buckton Barn, Bridlington		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1013624
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
C Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
 Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

SITE NAME:	Bowl barrow, 500 metres SSW of Buckton Barn, Bridlington		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1013623
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985
SITE NAME:	Moated site at North Park Farm, Burstwick		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1008047
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985
SITE NAME:	Bowl barrow 200 metres west of Crest Cottages, Carnaby		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1007733
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985
SITE NAME:	Moated site and two fishponds 80 metres south west of Parkhouse Farm, Cherry Burton		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1007842
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985
SITE NAME:	Round barrow 700 metres north east of Collingwood Farm, Cottam		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1007861
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995
SITE NAME:	Baynard Castle, Cottingham		
DESIGNATION:	Scheduled Monument, LB grade II, CA	LIST ENTRY NUMBER:	1019823
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Drainage/dewatering	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995
SITE NAME:	Money Hill round barrow, Dalton Holme		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1007923
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.
- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

SITE NAME:	Site of deserted village of Grimston, East Garton		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1021241
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Coastal erosion	NEW ENTRY?:	No
OWNER TYPE:	Utility	CONTACT:	Richard Butterfield 01904 601995
SITE NAME:	Motte and bailey castle, fishpond and moated site north and east of Aughton church, Ellerton		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1007973
CONDITION:	Generally satisfactory but with minor localised problems	TREND:	Improving
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995
SITE NAME:	Bowl barrow 150 metres NNE of Towthorpe High Barn, Fimber		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1013702
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995
SITE NAME:	Settlement at Blealands Nook, Fimber / Sledmere / Wetwang		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1005205
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995
SITE NAME:	Round barrow 350 metres south east of Low Farm, Garton		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1007852
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995
SITE NAME:	Round barrow 400 metres south west of Low Farm, Garton		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1007856
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995
SITE NAME:	Round barrow 420 metres south west of Low Farm, Garton		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1007857
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995
SITE NAME:	Round barrow 440 metres south west of Low Farm, Garton		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1007854
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
C Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

SITE NAME:	Round barrow 450 metres south west of Low Farm, Garton		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1007853
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995
SITE NAME:	Round barrow 500 metres south east of Low Farm, Garton		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1008810
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995
SITE NAME:	Round barrow 500 metres south of Low Farm, Garton		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1009394
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995
SITE NAME:	Round barrow 700 metres south of Low Farm, Garton		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1007850
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995
SITE NAME:	Round barrow 700 metres south of Low Farm, Garton		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1007855
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995
SITE NAME:	Round barrow 750 metres south of Low Farm, Garton		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1007851
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995
SITE NAME:	Bowl barrow 550 metres north east of Goodmanham Wold Farm, Goodmanham		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1008933
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985
SITE NAME:	Bowl barrow 550 metres south west of Enthorpe House, Goodmanham		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1008923
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
C Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
 Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

SITE NAME:	Bowl barrow 1000 metres north east of Goodmanham Wold Farm, Goodmanham		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1008934
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985
SITE NAME:	Twelve bowl barrows 800 metres north of Goodmanham Wold Farm, Goodmanham		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1007642
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985
SITE NAME:	Site revealed by aerial photography north west of Argam Cottages, Grindale / Burton Fleming		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1005211
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995
SITE NAME:	Bowl barrow 400 metres NNW of East Greenwick Farm, Huggate		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1014727
CONDITION:	Extensive significant problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995
SITE NAME:	Bowl barrow on Huggate Wold, 840 metres ENE of Watermanhole Reservoir, Huggate		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1013860
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995
SITE NAME:	Round barrow 320 metres south west of High Barn Farm, Huggate		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1012479
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985
SITE NAME:	Round barrow 390 metres south west of High Barn Farm, Huggate		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1012489
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985
SITE NAME:	Sections of linear boundary dyke in Cow Dale Plantation, Rabbit Dale and Oxland Plantation, Huggate		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1015570
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.
- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

SITE NAME:	Two bowl barrows on Huggate Wold, 600 metres north west of Horsedale Plantation, Huggate		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1013855
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995
SITE NAME:	Shaw Fosse moated site, Humbleton		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1007847
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985
SITE NAME:	Nunnery Hill and adjacent earthworks, Little Kelk, Kelk		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1005202
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985
SITE NAME:	Gallows Hill round barrow, Kilham		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1016737
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995
SITE NAME:	Round barrow 350 metres south east of Fordham Farm, Kirby Underdale		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1013165
CONDITION:	Extensive significant problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995
SITE NAME:	Round barrow 850 metres north east of Wayrham Farm, Kirby Underdale		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1008351
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995
SITE NAME:	Round barrow 900 metres north east of Wayrham Farm, Kirby Underdale		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1008362
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995
SITE NAME:	Round barrow south east of South Wold Farm, Kirby Underdale		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1009384
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable clipping	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
C Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

SITE NAME:	Section of linear boundary dyke 390 metres west of South Wold Farm, Kirby Underdale		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1015610
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995
SITE NAME:	Moated site at Metham Hall Farm, Laxton		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1007972
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985
SITE NAME:	Moated site 100 metres north of Parkhouse Farm, Leconfield		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1008292
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985
SITE NAME:	Moated site 550 metres south east of Scarborough Hall, Leconfield		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1016250
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985
SITE NAME:	Moated site of Leconfield Castle, Leconfield		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1007949
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Drainage/dewatering	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985
SITE NAME:	Hayholme moated site, Leven		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1008043
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985
SITE NAME:	Hall Garth motte and bailey, Lockington		
DESIGNATION:	Scheduled Monument, part in CA	LIST ENTRY NUMBER:	1021289
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Dewatering	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.
- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

SITE NAME:	Cleaving Hall moated site, Londesborough		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1007817
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985

SITE NAME:	Bowl barrow 100 metres north east of High Wold Farm, Market Weighton		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1013672
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995

SITE NAME:	Bowl barrow 110 metres east of High Wold Farm, Market Weighton		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1012091
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995

SITE NAME:	Bowl barrow 200 metres south east of High Wold Farm, Market Weighton		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1012092
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995

SITE NAME:	Bowl barrow 320 metres north east of High Wold Farm, Market Weighton		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1012090
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995

SITE NAME:	Bowl barrow 400 metres south of High Wold Farm, Market Weighton		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1012100
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995

SITE NAME:	Bowl barrow 450 metres north east of High Wold Farm, Market Weighton		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1014256
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995

SITE NAME:	Bowl barrow 450 metres north of High Wold Farm, Market Weighton		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1012089
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.
- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

SITE NAME:	Bowl barrow 550 metres north of High Wold Farm, Market Weighton		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1012088
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995

SITE NAME:	Six bowl barrows 300 metres north east of High Wold Farm, Market Weighton		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1007501
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995

SITE NAME:	Four bowl barrows 450 metres south east of High Wold Farm, Market Weighton / Sancton		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1012103
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995

SITE NAME:	Bowl barrow 340 metres south east of Watermanhole Reservoir, Millington		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1013865
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985

SITE NAME:	Dane's Graves, Nafferton / Kilham		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1005230
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Dumping	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995

SITE NAME:	Five round barrows 750 metres south east of Newbald Lodge, Newbald		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1007325
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995

SITE NAME:	Round barrow 400 metres south west of Newbald Lodge, Newbald		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1011654
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995

SITE NAME:	Round barrow 620 metres south east of Newbald Lodge, Newbald		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1007323
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.
- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

SITE NAME:	Round barrow 700 metres north east of Littlewood Lodge, Newbald		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1007353
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995

SITE NAME:	Paull Point Battery, coastal artillery battery and Submarine Mining Establishment, Paull		
DESIGNATION:	Scheduled Monument, LB grade II, part in CA	LIST ENTRY NUMBER:	1020425
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Coastal erosion	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Giles Proctor 01904 601981

SITE NAME:	Roman villa site, Rudston		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1005222
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995

SITE NAME:	Rudston Beacon and round barrows to east, Rudston		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1005231
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995

SITE NAME:	Round barrow 550 metres south west of Hessleskew, Sancton		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1007725
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995

SITE NAME:	Skipsea Castle: 11th century motte and bailey castle and inland harbour, Skipsea		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1011212
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Drainage/dewatering	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985

SITE NAME:	Moated site, fishponds and associated earthworks at Manor House, Skirpenbeck		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1015614
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Drainage/dewatering	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985

SITE NAME:	Round barrow 1300 metres east of Life Hill, Sledmere		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1007858
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
C Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
 Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

SITE NAME:	Round barrow 1400 metres east of Life Hill, Sledmere		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1007859
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995

SITE NAME:	Round barrow 1650 metres east of Life Hill, Sledmere		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1007860
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995

SITE NAME:	Linear earthwork running from the head of Warren Dale towards Sledmere Field Farm and associated settlement site, Sledmere / Wetwang / Garton		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1007736
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners	CONTACT:	Richard Butterfield 01904 601995

SITE NAME:	Moated site at St Lois Farm, Sutton upon Derwent		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1007818
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Drainage/dewatering	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985

SITE NAME:	Bowl barrow 210 metres south east of Blanch Farm, Warter		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1013456
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985

SITE NAME:	Section of linear boundary dyke between Sylvan Dale and Warren Farm, north west of Coldwold Farm, Warter		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1016191
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable clipping	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985

SITE NAME:	Two bowl barrows 300 metres south east of Blanch Farm, Warter		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1013458
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
C Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
 Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

SITE NAME:	Haltemprice Augustinian priory, Willerby		
DESIGNATION:	Scheduled Monument and Listed Building grade II*	LIST ENTRY NUMBER:	1019825 and 1103364
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985

SITE NAME:	Bowl barrow 580 metres west of High Fordon Farm, Wold Newton		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1007743
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995

SITE NAME:	Bowl barrow 600 metres west of High Fordon Farm, Wold Newton		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1007742
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995



© Historic England

SITE NAME:	Thwaite Hall, Cottingham	Grounds of a villa developed mainly in the 1870s-80s, but modified in the mid-C20 to provide accommodation for the University College of Hull. Well-wooded grounds, the adjacent botanical garden still well maintained. Problems with flood damage in 2007 and drainage problems are affecting mature planting and lawns around the lake. Buildings on site are currently occupied. Development proposals for conversion and additional housing have been submitted to the local planning authority.
DESIGNATION:	Registered Park and Garden grade II, CA	
CONDITION:	Generally satisfactory but with significant localised problems	
VULNERABILITY:	High	
TREND:	Declining	
NEW ENTRY?:	No	
OWNER TYPE:	Private	
LIST ENTRY NUMBER:	1000137	Contact: Giles Proctor 01904 601981



© Historic England

SITE NAME:	Londesborough Park, Londesborough	Gardens laid out in the late C17 wholly or partly by Robert Hooke for the first Lord Burlington, with alterations and additions by the third Lord Burlington in the early to mid-C18. Park with avenues of early C18 date, park has earlier origins. Kitchen garden of 1730-5 with cascades and entrances aligned with parkland avenues. Extensive parkland requiring more detailed study of historic development of the planting design, key avenues and vistas. Structures in walled garden in state of deterioration. The west gates have been repaired and some management of the avenue has been carried out.
DESIGNATION:	Registered Park and Garden grade II*, 5 LBs, part in CA	
CONDITION:	Generally satisfactory but with significant localised problems	
VULNERABILITY:	High	
TREND:	Improving	
NEW ENTRY?:	No	
OWNER TYPE:	Private, multiple owners	
LIST ENTRY NUMBER:	1000924	Contact: Giles Proctor 01904 601981

SITE NAME:	Bridlington Quay, Bridlington, Bridlington		
DESIGNATION:	Conservation Area, 19 LBs	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	Improving
VULNERABILITY:	Low	CONTACT:	Stephen Devey (LPA) 01482 393710

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.
- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

SITE NAME:	Goole, East Riding of Yorkshire, Goole		
DESIGNATION:	Conservation Area, 12 LBs	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	Deteriorating significantly
VULNERABILITY:	Low	CONTACT:	Stephen Devey (LPA) 01482 393710

KINGSTON UPON HULL, CITY OF (UA)

SITE NAME:	Beverley Road, Hull		
DESIGNATION:	Conservation Area, 12 LBs	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	Improving
VULNERABILITY:	Low	CONTACT:	Stephen Walker (LPA) 01482 612124

SITE NAME:	St Andrew's Dock, Hull		
DESIGNATION:	Conservation Area, LB grade II	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	No significant change
VULNERABILITY:	Low	CONTACT:	Stephen Walker (LPA) 01482 612124

NORTH YORKSHIRE COUNCIL (UA)



© Historic England

SITE NAME:	Church of St Mary, Harlow Terrace, Harrogate
DESIGNATION:	Listed Building grade II*, CA
CONDITION:	Very bad
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Commercial company
LIST ENTRY NUMBER:	1149482

Former church built c1916 by Sir Walter Tapper in C14 style. Deterioration of the stone has occurred from an early date. The mineral felt to the aisle roofs is leaking. Proposals to convert the church to a new use are being developed and Historic England has given advice.

Contact: Giles Proctor 01904 601981




© Historic England

SITE NAME:	Lime Kilns, A170, Allerston
DESIGNATION:	Scheduled Monument and Listed Building grade II
CONDITION:	Fair
OCCUPANCY:	N/A
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	1021084 and 1206153

Bank of four lime kilns c1800. For Sir George Osbaldeston. Situated in woodland. These are in a poor state of repair. Some parts are starting to collapse. Section 17 Management Agreement works to remove damaging trees completed.

Contact: Richard Butterfield 01904 601995

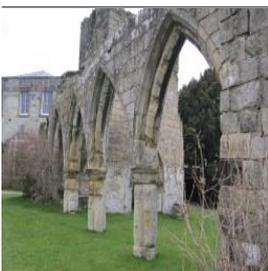

© Historic England

SITE NAME:	Old church, Birdsall
DESIGNATION:	Scheduled Monument, LB grade II
CONDITION:	Poor
OCCUPANCY:	N/A
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	1004881

Ruined church adjacent to country house. C12 chancel arch, C14 arcade, 1601 datestone on tower probably resited, C18 window inserted on west front. Some repair work has recently been carried out to the tower. Further work is needed to the south arcade and impost moulding on Norman chancel arch.

Contact: Giles Proctor 01904 601981

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.
- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

- CA** Conservation Area
- LB** Listed Building
- LPA** Local Planning Authority
- NP** National Park
- RPG** Registered Park and Garden
- SM** Scheduled Monument
- UA** Unitary Authority
- WHS** World Heritage Site



© Historic England Archive

SITE NAME:	The Old Gatehouse (occupied part), Jervaulx Park, East Witton
DESIGNATION:	Listed Building grade I, SM
CONDITION:	Very bad
OCCUPANCY:	Part occupied/part in use
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	1318555

The house, known as the Old Gatehouse, was probably constructed from reused medieval masonry in the C19, on medieval foundations. Part of the building is occupied and being repaired but the western end is ruinous and in need of repair. This entry relates to the occupied part of the Gatehouse.

Contact: Nicky Brown 01904 601985



© Historic England Archive

SITE NAME:	The Old Gatehouse (unoccupied part), Jervaulx Park, East Witton
DESIGNATION:	Scheduled Monument and Listed Buildings - I grade I; I grade II, LB grade I
CONDITION:	Very bad
OCCUPANCY:	Part occupied/part in use
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	1020493 and 1130961; 1130962

The house, known as the Old Gatehouse, was probably constructed from re-used medieval masonry in the C19, on medieval foundations and it is occupied and in fair repair. The western end of the house is built into in situ medieval fabric, which is ruinous and in need of repair. This entry relates to the non-occupied ruins of the Gatehouse.

Contact: Nicky Brown 01904 601985



© Historic England

SITE NAME:	Wall of cascade approximately 100 metres north of Ebberston Hall, A170, Ebberston and Yedingham
DESIGNATION:	Listed Building grade II*, RPG grade II*
CONDITION:	Poor
OCCUPANCY:	N/A
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	1315781

Rubble stone cascade within a water garden of c1718, situated in the narrow valley of Kirk Dale approximately 100 metres to the north of the Hall by Colen Campbell. Forms the middle cascade of the three in the water garden. The cascade leaks severely and the pond does not hold water.

Contact: Giles Proctor 01904 601981



© Historic England

SITE NAME:	Wall of cascade approximately 50 metres north of Ebberston Hall, A170, Ebberston and Yedingham
DESIGNATION:	Listed Building grade II*, RPG grade II*
CONDITION:	Fair
OCCUPANCY:	N/A
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	1206196

Stepped cascade within a water garden of c1718, situated in the narrow valley of Kirk Dale circa 50 metres to the north of the Hall by Colen Campbell. Forms the lower cascade of the three in the water garden. Although the pond holds water, the cascade is very mossy, concealing its condition.

Contact: Giles Proctor 01904 601981

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.
- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

- CA** Conservation Area
- LB** Listed Building
- LPA** Local Planning Authority
- NP** National Park
- RPG** Registered Park and Garden
- SM** Scheduled Monument
- UA** Unitary Authority
- WHS** World Heritage Site



© Historic England

SITE NAME:	Grotto and Icehouse, Forcett
DESIGNATION:	Listed Building grade II*, RPG grade II
CONDITION:	Poor
OCCUPANCY:	N/A
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	I157748

A late C18 Grotto and Icehouse, constructed of cyclopean dry-stone masonry forming three roundish arches. It stands at the head of the lake in Forcett Park. The stonework is eroding and stones are becoming loose. The estate has recently changed hands.

Contact: Giles Proctor 01904 601981



© Historic England

SITE NAME:	Walled garden gate piers to Central North South Lane, Henderskelfe
DESIGNATION:	Listed Building grade II*, RPG grade I
CONDITION:	Poor
OCCUPANCY:	N/A
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	I173032

Pairs of monumental gate piers crossing the walled garden at Castle Howard, probably by Vanbrugh. The stonework is suffering from the effects of rusting iron cramps and frost damage. A strategy for the estate's buildings is under development.

Contact: Giles Proctor 01904 601981



© Historic England Archive

SITE NAME:	The Mausoleum and bastion wall with gates and railings, Kirk Hill, Castle Howard Estate, Henderskelfe
DESIGNATION:	Listed Building grade I, RPG grade I
CONDITION:	Poor
OCCUPANCY:	N/A
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	I149010

Mausoleum by Hawksmoor, from 1729 to 1742, modelled on the tomb of Metella. Situated on a bluff circa 1.2 kilometres east of the mansion and visible from the Temple Terrace and the Temple of the Four Winds, both south east of the mansion. The columns were repaired with a grant in the 1980s. The entablature and bastions continue to decay; much of the damage is due to rusting cramps. The staircase balustrade is collapsing. A condition survey has been completed and the repair of the Mausoleum is under discussion.

Contact: Giles Proctor 01904 601981



© Historic England

SITE NAME:	Walls to walled garden with gates and corner piers, Castle Howard Estate, Henderskelfe
DESIGNATION:	Listed Building grade I, RPG grade I
CONDITION:	Poor
OCCUPANCY:	N/A
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	I296425

Walls to the walled garden, early C18 by Sir John Vanbrugh. The brick walls are in fair condition, but the calcareous sandstone piers are decaying, largely due to corrosion of iron cramps. They need extensive repair. A strategy for the estate's buildings is under development. One pier has recently been repaired following vehicle damage and will be a model for the rest.

Contact: Giles Proctor 01904 601981

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.
- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

- CA** Conservation Area
- LB** Listed Building
- LPA** Local Planning Authority
- NP** National Park
- RPG** Registered Park and Garden
- SM** Scheduled Monument
- UA** Unitary Authority
- WHS** World Heritage Site



© Historic England

SITE NAME:	Chapel to Huddleston Hall (now barn), west of house, Laith Staid Lane, Huddleston with Newthorpe
DESIGNATION:	Listed Building grade II*
CONDITION:	Fair
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	1167970

Former chapel with C15 origins, with C16 rebuilding to the east and later alterations. The building is disused and the roof coverings are in need of repair, resulting in water ingress to the interior.

Contact: Giles Proctor 01904 601981



© Historic England

SITE NAME:	Huddleston Hall, Laith Staid Lane, Huddleston with Newthorpe
DESIGNATION:	Listed Building grade II*
CONDITION:	Poor
OCCUPANCY:	Part occupied/part in use
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	1167923

Late C16 manor house, now used as a farmhouse. The roofs are in poor condition resulting in water ingress to the interior, and there is some decaying stonework. Some urgently required repairs have been carried out to the roofs.

Contact: Giles Proctor 01904 601981




© Historic England

SITE NAME:	Stables to Huddleston Hall, south east of house, Laith Staid Lane, Huddleston with Newthorpe
DESIGNATION:	Listed Building grade II*
CONDITION:	Fair
OCCUPANCY:	Part occupied/part in use
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	1167953

Stables of the late C16 with C19 additions and alterations. The roof coverings have some missing tiles.

Contact: Giles Proctor 01904 601981

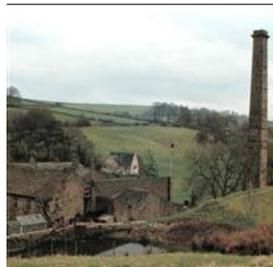

© Historic England Archive

SITE NAME:	Dale End Mill, Lothersdale
DESIGNATION:	Listed Building grade II*, part in CA
CONDITION:	Poor
OCCUPANCY:	Part occupied/part in use
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	1132272

Mill dating from 1795 with later extensions and alterations. The waterwheel of 1861, which is in very poor condition, is considered to be the largest internal wheel in England. The roofs of the mill are deteriorating and the base of the mill chimney is in poor condition. Grant-aid for drawings and specifications has been awarded to repair the roof and stabilise the wheel. This work is currently underway.

Contact: Bryan Davies 01904 601867



© Historic England

SITE NAME:	Screen wall, north west of Malton Lodge, Old Maltongate, Malton
DESIGNATION:	Listed Building grade II*, SM, CA
CONDITION:	Very bad
OCCUPANCY:	N/A
PRIORITY CATEGORY:	A (A)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	1219922

Courtyard wall c1604, part of the screen wall to the outer forecourt of the former mansion of Lord Eure, the remains of which are now known as Malton Lodge. Very heavily decayed and potentially unstable. Historic England has surveyed the wall and is assessing its stability.

Contact: Giles Proctor 01904 601981

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
C Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
 Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site



© Historic England

SITE NAME:	West Lodge, Thornton Stud, Newsham Road, Newsham with Breckenbrough
DESIGNATION:	Listed Building grade II*
CONDITION:	Poor
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	1150821

Late C18 lodge and entrance gateway. Some roof repairs were undertaken in spring 2014. Further work is needed in order to return the lodge to use.

Contact: Giles Proctor 01904 601981



© Historic England Archive

SITE NAME:	Ravensworth Castle and park wall, The Green, Ravensworth
DESIGNATION:	Scheduled Monument and Listed Building grade I, part in CA
CONDITION:	Poor
OCCUPANCY:	N/A
PRIORITY CATEGORY:	B (A)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	1013087 and 1166522

Late C14, small roofless keep/gate tower and ruins of ancillary buildings, together with impressive water defences later adapted to form water gardens. Much repointing and consolidation is needed to all the surviving structures. Significant parts of the standing remains, including the gate tower, are now at risk. Project Development for a Repair scheme is complete and tenders have been obtained.

Contact: Nicky Brown 01904 601985



SITE NAME:	Old Grandstand, Richmond
DESIGNATION:	Listed Building grade II*, CA
CONDITION:	Poor
OCCUPANCY:	N/A
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Commercial company
LIST ENTRY NUMBER:	1131277

A rare example of a C18 racecourse grandstand, built in 1776, probably to the design of Carr of York. The racecourse was closed in 1891. The Grandstand became derelict after WWII. It was partially demolished in 1970. Ruins cleared and stonework sorted 1989. The Racecourse is now a conservation area. A feasibility study has recently been produced for the owners.

Contact: Giles Proctor 01904 601981



© Selby District Council

SITE NAME:	Abbot's Staith Buildings, Water Lane, Selby
DESIGNATION:	Scheduled Monument and Listed Building grade II*, CA
CONDITION:	Poor
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	1004181 and 1167663

C15 or early C16, two storey 'H' shaped plan warehouse built for Selby Abbey. Mainly of magnesium limestone ashlar with some brick, under a modern roof. The building is in poor condition, Historic England supported the cost of some repairs to the roof in 2019. The building is currently for sale.

Contact: Jane Jackson 01904 601880



© Historic England

SITE NAME:	Sheriff Hutton Castle, Main Street, Sheriff Hutton
DESIGNATION:	Scheduled Monument and Listed Building grade II*, part in CA
CONDITION:	Fair
OCCUPANCY:	Part occupied/part in use
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Other not for profit group
LIST ENTRY NUMBER:	1019593 and 1149592

Ruinous castle begun in 1382 by John, Lord Neville, with C15 gatehouse inserted. Vulnerable to weathering. The north east tower has been repaired with the support of Historic England, which has also funded emergency works to south west tower. The castle is in a relatively stable condition and the site is currently used for weddings and other functions.

Contact: Giles Proctor 01904 601981

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.
- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

- CA** Conservation Area
- LB** Listed Building
- LPA** Local Planning Authority
- NP** National Park
- RPG** Registered Park and Garden
- SM** Scheduled Monument
- UA** Unitary Authority
- WHS** World Heritage Site



© Historic England

SITE NAME:	Slingsby Castle, Slingsby
DESIGNATION:	Scheduled Monument and Listed Building grade II, part in CA
CONDITION:	Very bad
OCCUPANCY:	N/A
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	1004178 and 1149761

C16 Great House built on the site of a medieval castle. Ruinous, but surviving up to the eaves in height. In need of urgent consolidation; the site is deteriorating as a result of natural erosion and some vandalism.

Contact: Nicky Brown 01904 601985



© Historic England

SITE NAME:	Snape Castle, Snape with Thorp
DESIGNATION:	Scheduled Monument and Listed Building grade I, RPG grade II, part in CA
CONDITION:	Very bad
OCCUPANCY:	Part occupied/part in use
PRIORITY CATEGORY:	A (A)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	1004908 and 1190147

Castle dated to c1430, with additions and alterations in the C16 and C18. It is comprised of extensive ruins, including some vaulted rooms and two towers. The rear ranges are in a poor condition. The upper parts of the towers are particularly unstable. Much repointing is required elsewhere. The front range is divided into two dwellings.

Contact: Nicky Brown 01904 601985



© Historic England

SITE NAME:	St Martins Priory Ruins, A6136, St. Martin's
DESIGNATION:	Scheduled Monument and Listed Building grade I, CA
CONDITION:	Poor
OCCUPANCY:	N/A
PRIORITY CATEGORY:	A (A)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	1012995 and 1131548

The ruins of a small medieval monastic house, of C12 (possibly earlier) and C15. Part of a church, small gate tower and the ruined walls of other buildings also remain. Extensive consolidation and repointing work is required.

Contact: Nicky Brown 01904 601985




© Historic England

SITE NAME:	Keld Heads lead smelting mill and mine complex, Preston-under-Scar, Wensley / Preston-under-Scar
DESIGNATION:	Scheduled Monument and Listed Buildings - 2 grade II
CONDITION:	Very bad
OCCUPANCY:	N/A
PRIORITY CATEGORY:	D (D)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	1014763 and 1179229; 1130869

The mine complex displays a wide range of features associated with lead exploitation and processing. The site has been mined since the C12 but the present complex dates from C18 and C19. Invasive vegetation is being removed by the owners and some repairs have been carried out to the structures. Further work is necessary.

Contact: Giles Proctor 01904 601981

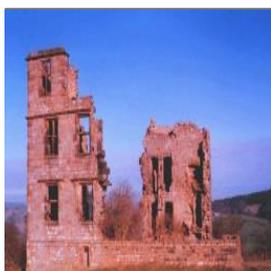

© Historic England

SITE NAME:	Dob Park Lodge, Dob Park Lane, Weston
DESIGNATION:	Scheduled Monument
CONDITION:	Poor
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	D (D)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	1015630

Ruins of a C17 park lodge, now a roofless structure three storeys high. Historic England has grant-aided emergency works. Proposals to restore and convert it into a dwelling were approved by Harrogate Borough Council on 8th January 2019. The scheme would consolidate the existing fabric and new additions would partially reconstruct the original design. Plans are currently on hold.

Contact: Giles Proctor 01904 601981

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
C Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
 Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site



© Historic England

SITE NAME:	15 St Hildas Terrace, Whitby
DESIGNATION:	Listed Building grade II*, CA
CONDITION:	Very bad
OCCUPANCY:	Part occupied/part in use
PRIORITY CATEGORY:	A (A)
OWNER TYPE:	Private, multiple owners
LIST ENTRY NUMBER:	1253878

Pair of late C18 houses, three storeys, designed to look like a single mansion with a central pediment and columned porch. Brick with stone dressings and Adamish details. Part of a fine terrace of houses. Number 15 has been declining for some years and is now in very poor condition. The local authority has been in contact with the owner. It should be noted that although the listing covers numbers 15 and 16, number 16 is not at risk.

Contact: Giles Proctor 01904 601981




© Historic England

SITE NAME:	Church of St Helen, Church Lane, Amotherby
DESIGNATION:	Listed Place of Worship grade II
CONDITION:	Poor
PRIORITY CATEGORY:	D (F)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1149153

Partly medieval church, extensively restored by George Fowler Jones between 1870 and 1872. Decay to medieval west tower, west end of north aisle and east end. Repairs have been undertaken to the lower masonry, roof and windows. Fundraising is underway for repairs to the east end.

Contact: Giles Proctor 01904 601981

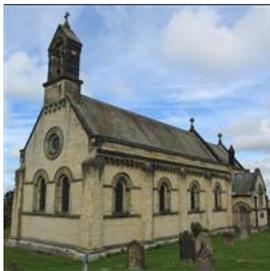


© Historic England

SITE NAME:	Church of St Michael, Main Street, Barton-le-Street
DESIGNATION:	Listed Place of Worship grade I, CA
CONDITION:	Poor
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1148993

Church dating to 1871, but incorporating C12 fabric. Constructed from sandstone ashlar with a slate roof. The church is well maintained and in a good condition internally. However, externally the roof ridges are loose, a number of slates are missing and some of the stonework is severely eroded. The rainwater goods need attention.

Contact: Giles Proctor 01904 601981

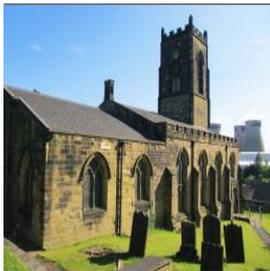

© Historic England

SITE NAME:	Church of St Edward, Church Street, Brotherton
DESIGNATION:	Listed Place of Worship grade II
CONDITION:	Poor
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1132452

Church of 1842 by Pritchett of York, of sandstone with cast iron windows. Some of the stonework is suffering from extensive erosion, particularly to the tower and the south elevation. A first phase of work to repair the tower, funded by the National Lottery Heritage Fund Grants for Places of Worship scheme, was completed in 2018. A further phase of work is required to repair the parapets.

Contact: Bryan Davies 01904 601867



© Historic England

SITE NAME:	Church of St John the Evangelist, Main Street, Dalton
DESIGNATION:	Listed Place of Worship grade II*
CONDITION:	Poor
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1150818

Church by William Butterfield, 1868. Exterior of stone and slate, but elaborate interior of coloured brick and tile. Morris glass. The rainwater goods are in poor repair and some of the stonework is in need of repointing.

Contact: Giles Proctor 01904 601981

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.
- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

- CA** Conservation Area
- LB** Listed Building
- LPA** Local Planning Authority
- NP** National Park
- RPG** Registered Park and Garden
- SM** Scheduled Monument
- UA** Unitary Authority
- WHS** World Heritage Site



© Historic England

SITE NAME:	Church of St Wilfrid, Great Langton
DESIGNATION:	Listed Place of Worship grade II
CONDITION:	Very bad
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1315473

Small medieval country church of roughcast cobble under a slate roof. The roof is in poor condition and the roughcast is deteriorating.

Contact: Giles Proctor 01904 601981



© Historic England

SITE NAME:	Church of the Holy Trinity, Main Street, Rathmell
DESIGNATION:	Listed Place of Worship grade II
CONDITION:	Fair
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1317050

Mid-C19 church with chancel and vestry added in 1883. Constructed from slobbered rubble with squared dressings and slate roof. Located in small, isolated village, but maintained in regular use. A National Lottery Heritage Fund Grant for Places of Worship has supported the first phase of repair to the lower roofs, but further works to the tower are required.

Contact: Giles Proctor 01904 601981



© Historic England

SITE NAME:	Church of St Martin, Town Street, Scampston
DESIGNATION:	Listed Place of Worship grade II
CONDITION:	Fair
PRIORITY CATEGORY:	F (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1315719

Small village church from 1845 to 1846 by GT Andrews, with fittings from 1906 to 1914 by Temple Moore. The bellcote has been recently repaired. There is some deterioration of the slating to the south roof slopes.

Contact: Giles Proctor 01904 601981



© Historic England

SITE NAME:	Glaisdale Head Methodist Church and walls, Glaisdale, North Yorkshire Council (UA)
DESIGNATION:	Listed Place of Worship grade II
CONDITION:	Poor
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1148582

Small Georgian Methodist chapel in a moorland setting. Gothic sash windows and original benches. The roof covering is deteriorating and the interior is damp - the chapel is built into the hillside. A condition survey has recently been completed and it is hoped that this will lead onto repair.

Contact: Giles Proctor 01904 601981



© Historic England

SITE NAME:	Church of St Giles, Village Street, Lockton, North Yorkshire Council (UA)
DESIGNATION:	Listed Place of Worship grade II*, CA
CONDITION:	Poor
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1260741

Medieval church at the centre of a moorland village. Generally well maintained, but significant repair needed to the tower. The drainage needs to be overhauled.

Contact: Giles Proctor 01904 601981

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.
- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

SITE NAME:	Round barrow 460 metres south of Oliver's Mount Farm		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1021233
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995

SITE NAME:	Three barrows at Seamer Beacon and the ruins of Baron Albert's Tower		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1008486
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Local authority	CONTACT:	Richard Butterfield 01904 601995

SITE NAME:	St Andrew's College and moat, 440 metres north east of College Farm, Acaster Selby		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1017457
CONDITION:	Generally satisfactory but with minor localised problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Animal burrowing - moderate	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985

SITE NAME:	Round barrow 250 metres NNE of Easthorpe Cottages, Amotherby		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1014566
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995

SITE NAME:	Round barrow 310 metres NNE of Easthorpe Lodge, Amotherby		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1014565
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995

SITE NAME:	Mote Hill: a moated site, two fishponds and part of an adjacent field system 500 metres west of Nun Appleton Hall, Appleton Roebuck		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1008229
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Drainage/dewatering	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985

SITE NAME:	Section of Scots Dyke linear boundary 150 metres ENE of Olliver, Aske		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1013780
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable clipping	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.
- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

SITE NAME:	Cairnfield, enclosures, boulder walling, hollow way and carved rocks towards edge of Snowden Carr centred at 370 metres south east of Crag House, Askwith		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1014304
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Bracken	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995
SITE NAME:	Medieval moated grange 160 metres south east of The Grange, Balk		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1015920
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Drainage/dewatering	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985
SITE NAME:	Iron Age settlement, Barton-le-Street		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1003666
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985
SITE NAME:	Pockley Gates round barrow 600 metres west of Beadlam Grange, Beadlam		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1019341
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995
SITE NAME:	Lime kilns 400 metres south west of Furlands, Borrowby / Kepwick		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1021190
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Improving
PRINCIPAL VULNERABILITY:	Deterioration - in need of management	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995
SITE NAME:	Round barrow 300 metres west of Quarry House, Brandsby-cum-Stearsby		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1013602
CONDITION:	Extensive significant problems	TREND:	Improving
PRINCIPAL VULNERABILITY:	Bracken	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995
SITE NAME:	St Giles medieval hospital, post-medieval farmstead and Iron Age occupation site immediately north of St Giles Farm, Brough with St. Giles		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1021210
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Natural erosion - extensive	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.
- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

SITE NAME:	Cataractonium Roman forts and town, Brough with St. Giles / Catterick / Brompton-on-Swale		
DESIGNATION:	Scheduled Monument, LB grade II	LIST ENTRY NUMBER:	1021181
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Vehicle damage/erosion - extensive	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995

SITE NAME:	Hedon Howe tumulus, Burythorpe		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1005487
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995

SITE NAME:	Bossall Hall: a quadrangular castle, Buttercrambe with Bossall		
DESIGNATION:	Scheduled Monument, LB grade II	LIST ENTRY NUMBER:	1008016
CONDITION:	Generally satisfactory but with minor localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Drainage/dewatering	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985

SITE NAME:	Catterton Hall moated site and adjacent building platform, Catterton		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1017456
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Drainage/dewatering	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985

SITE NAME:	Cawthorne medieval settlement remains 150 metres north east of West Cawthorne, Cropton		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1018951
CONDITION:	Generally satisfactory but with minor localised problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Stock erosion - localised/limited	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985

SITE NAME:	Round barrow 350 metres north west of Hen Flatts, Cropton		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1018408
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995

SITE NAME:	Round barrow 550 metres north of High Nova Farm, Cropton		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1015440
CONDITION:	Extensive significant problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.
- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

SITE NAME:	Medieval settlement of Dalton upon Tees and associated field system, Dalton-on-Tees		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1019724
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Permitted development	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995
SITE NAME:	Moated site immediately south of Danby Wiske church, Danby Wiske with Lazenby		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1020346
CONDITION:	Generally satisfactory but with minor localised problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Gardening	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995
SITE NAME:	Deighton moated site, Deighton		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004099
CONDITION:	Generally satisfactory but with minor localised problems	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Drainage/dewatering	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985
SITE NAME:	Castle Hill moated site, 350 metres south of St Peter and St Paul's Church, Drax		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1017455
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Drainage/dewatering	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985
SITE NAME:	Bowl barrow 920 metres north of Betton Farm, East Ayton		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1008129
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995
SITE NAME:	Two moated sites, the site of a dovecote and further associated features 120 metres north west and 180 metres north of The Old Hall, East Layton / Carkin		
DESIGNATION:	Scheduled Monument, part in CA	LIST ENTRY NUMBER:	1021039
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Drainage/dewatering	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985
SITE NAME:	Long barrow 630 metres north west of Scamridge Farm, Ebberston and Yedingham / Allerston		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1020832
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable clipping	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
C Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
 Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

SITE NAME:	Roman signal station, Carr Naze, Filey		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004187
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Coastal erosion	NEW ENTRY?:	No
OWNER TYPE:	Local authority	CONTACT:	Nicky Brown 01904 601985

SITE NAME:	Round barrow on Flixton Wold, Folkton		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004113
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985

SITE NAME:	Round barrow on Flotmanby Brow, Folkton		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004096
CONDITION:	Unknown	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985

SITE NAME:	Round barrow south of Long Plantation, Folkton		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004539
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985

SITE NAME:	Boythorpe settlement site, Foxholes		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004059
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985

SITE NAME:	Settlement site at Butterwick, Foxholes		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004047
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985

SITE NAME:	Round barrow 350 metres NNE of High Baxtonhowe, Fryton		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1013681
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995

SITE NAME:	Round barrow 350 metres north east of Hollin Hill, Fryton		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1013690
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Improving
PRINCIPAL VULNERABILITY:	Forestry	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
C Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
 Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

SITE NAME:	Round barrow 400 metres north east of Hollin Hill, Fryton		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1013691
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Improving
PRINCIPAL VULNERABILITY:	Forestry	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995
SITE NAME:	Round barrow 800 metres north east of High Baxtonhowe, Fryton		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1013688
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Improving
PRINCIPAL VULNERABILITY:	Forestry	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995
SITE NAME:	Round barrow 450 metres south west of Coney Hill Farm, Gilling East		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1014082
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995
SITE NAME:	Round barrow 500 metres SSW of Coney Hill Farm, Gilling East		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1014083
CONDITION:	Extensive significant problems	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Arable clipping	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995
SITE NAME:	Round barrow 530 metres NNW of Maidensworth Farm, Grimstone		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1013599
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Improving
PRINCIPAL VULNERABILITY:	Bracken	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995
SITE NAME:	Round barrow 400 metres SSW of Low Gaterley Cottages, Henderskelfe		
DESIGNATION:	Scheduled Monument, RPG grade I	LIST ENTRY NUMBER:	1013694
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Improving
PRINCIPAL VULNERABILITY:	Forestry	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995
SITE NAME:	East Heselton Brow barrow group: a bowl barrow 1,300 metres east of Manor Wold Farm, Heselton		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1011579
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
C Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
 Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

SITE NAME:	New Bield round barrow and ringwork, Heselton		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004105
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985

SITE NAME:	Round barrow 250 metres ENE of High Baxtonhowe, Hovingham / Fryton		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1013682
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Improving
PRINCIPAL VULNERABILITY:	Animal burrowing - Rabbit - localised/limited	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995

SITE NAME:	Round barrow south of Grange Farm, Hunmanby		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004093
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985

SITE NAME:	Medieval village of Hunton and field system, Hunton		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1018380
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Permitted development	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995

SITE NAME:	Henge monument 300 metres north of Nunwick, Hutton Conyers		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1012724
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985

SITE NAME:	Hutton Hall (site of), Hutton Conyers		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004074
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Drainage/dewatering	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985

SITE NAME:	Round barrow in Harland's Plantation, Hutton Conyers		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1009785
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Forestry	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
C Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
 Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

SITE NAME:	Moated site known as Vivers Hill Castle, 300 metres north east of the parish church, Kirkbymoorside		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1015811
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995
SITE NAME:	Starfits round barrow, 450 metres north east of Starfits House, Kirkbymoorside		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1015810
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985
SITE NAME:	Three bowl barrows 200 metres west of Belle Vue Farm, Luttons		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1011514
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995
SITE NAME:	Medieval monastic fishponds immediately east of Park House, Markington with Wallerthwaite		
DESIGNATION:	Scheduled Monument, WHS	LIST ENTRY NUMBER:	1018691
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Vehicle damage/erosion - extensive	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985
SITE NAME:	Section of Scots Dyke linear boundary east of Langdale Rush, Melsonby		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1014240
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995
SITE NAME:	William's Hill, Middleham		
DESIGNATION:	Scheduled Monument, part in CA	LIST ENTRY NUMBER:	1004907
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Stock erosion - extensive	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995
SITE NAME:	Middleton Heights round barrow, Middleton		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1003258
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
C Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

SITE NAME:	Scurff Hall moated site, Newland		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1017485
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Drainage/dewatering	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985
SITE NAME:	Black Howe round barrow, Newton		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1019777
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Improving
PRINCIPAL VULNERABILITY:	Bracken	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995
SITE NAME:	Toulston medieval village, manor house site and early garden earthworks, Newton Kyme cum Toulston		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1017922
CONDITION:	Generally satisfactory but with minor localised problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Permitted development	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985
SITE NAME:	Two Roman forts, two Roman camps, vicus, Iron Age enclosure, Bronze Age barrows and Neolithic henge monument west of Newton Kyme, Newton Kyme cum Toulston		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1017693
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985
SITE NAME:	Howe Hill motte and bailey castle, North Deighton		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1015541
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Animal burrowing - Badger - extensive	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985
SITE NAME:	Section of cross ridge dyke and earthworks in Roman Plantation, Oulston Moor, Oulston		
DESIGNATION:	Scheduled Monument, part in RPG grade II	LIST ENTRY NUMBER:	1013438
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Improving
PRINCIPAL VULNERABILITY:	Bracken	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995
SITE NAME:	Round barrow 400 metres north east of Haugh Rigg, Pickering		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1019778
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
C Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

SITE NAME:	Round barrow 570 metres south of Saintoft Grange, Pickering		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1020115
CONDITION:	Extensive significant problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995
SITE NAME:	Round barrow 600 metres SSW of Saintoft Grange, Pickering		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1020114
CONDITION:	Extensive significant problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995
SITE NAME:	Danes Hills square barrow cemetery, 300 metres south of Adamson Farm, Riccall / Skipwith		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1018603
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985
SITE NAME:	Section of Scots Dyke linear boundary and portion of field system 100 metres east of Whitefields Farm, Richmond / Easby		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1013777
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Permitted development	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995
SITE NAME:	Iron Age barrow cemetery, East Field, Rillington		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004072
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Metal detecting - unlicensed	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985
SITE NAME:	Paradise Lodge moated site and grange of the Prior of Bolton, Ryther cum Ossendyke		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1008225
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Drainage/dewatering	NEW ENTRY?:	No
OWNER TYPE:	Local authority	CONTACT:	Nicky Brown 01904 601985
SITE NAME:	Moated site and ridge and furrow cultivation 230 metres south east of Manor Farm, Sackleton		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1015491
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.
- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

SITE NAME:	Round barrow on Knaption Brow, Scampston		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004109
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985
SITE NAME:	Part of Leppington medieval village, a moated site and site of the former parish church of St Helen, Scrayingham		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1011515
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Vehicle damage/erosion - moderate	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985
SITE NAME:	Section of linear earthwork on Seamer Moor Hill, Seamer		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1008135
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Bracken	NEW ENTRY?:	No
OWNER TYPE:	Government or agency	CONTACT:	Richard Butterfield 01904 601995
SITE NAME:	Star Carr Early Mesolithic settlement site, 960 metres NNW of Woodhouse Farm, Seamer		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1401425
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Drainage/dewatering	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985
SITE NAME:	Thorpe Hall moated monastic grange, Selby		
DESIGNATION:	Scheduled Monument, LB grade II	LIST ENTRY NUMBER:	1017460
CONDITION:	Generally satisfactory but with minor localised problems	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Drainage/dewatering	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985
SITE NAME:	Round barrow north east of Lawson's Wold Barn, Sherburn		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1003140
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985
SITE NAME:	Danes Hills square barrow cemetery on Crook Moor, Skipwith		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1016619
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.
- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

SITE NAME:	Moated site and fishpond 140 metres south of St Helen's Church, Skipwith		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1015543
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Improving
PRINCIPAL VULNERABILITY:	Drainage/dewatering	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985
SITE NAME:	Round barrow on Skipwith Common, 800 metres south east of Adamson Farm, Skipwith		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1018604
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985
SITE NAME:	Round barrow on Skipwith Common, 810 metres south of Skipwith Church, Skipwith		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1018601
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985
SITE NAME:	Round barrow on Skipwith Common, 830 metres south east of Adamson Farm, Skipwith		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1018605
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985
SITE NAME:	Iron Age barrow cemetery, Slingsby		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004067
CONDITION:	Extensive significant problems	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995
SITE NAME:	Steeton Hall medieval magnate's residence and manorial centre, South Milford		
DESIGNATION:	Scheduled Monument, 3 LBs	LIST ENTRY NUMBER:	1015504
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Permitted development	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985
SITE NAME:	Section of the Scots Dyke linear boundary 225 metres south of St Martin's Priory, St. Martin's		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1018143
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Dumping	NEW ENTRY?:	No
OWNER TYPE:	Local authority	CONTACT:	Richard Butterfield 01904 601995

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
C Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

SITE NAME:	A moated site 100 metres east of St Mary Magdalene's Church, Thirsk		
DESIGNATION:	Scheduled Monument, CA	LIST ENTRY NUMBER:	1008179
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Drainage/dewatering	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985

SITE NAME:	Barrow west of Bradeham Farm, Thixendale		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004170
CONDITION:	Extensive significant problems	TREND:	Improving
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985

SITE NAME:	Hanging Grimston barrow group: a bowl barrow 300 metres east of Stone Sleights Farm, Thixendale		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1007906
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995

SITE NAME:	Hanging Grimston barrow group: a bowl barrow 650 metres south west of Thixendale Grange, Thixendale		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1008481
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995

SITE NAME:	Hanging Grimston barrow group: a long barrow 400 metres east of Wold Farm, incorporating part of a prehistoric linear boundary, Thixendale		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1007922
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995

SITE NAME:	Hanging Grimston barrow group: four bowl barrows and part of a cross dyke 600 metres SSW of Thixendale Grange, Thixendale		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1008484
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995

SITE NAME:	Hanging Grimston barrow group: four bowl barrows on Uncleby Stoop, Thixendale		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1008474
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
C Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
 Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

SITE NAME:	Hanging Grimston barrow group: three bowl barrows 600 metres south west of Thixendale Grange, Thixendale		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1008483
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995

SITE NAME:	Round barrow south east of Gill's Farm, Thixendale		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004537
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995

SITE NAME:	Round barrows south of Gill's Farm, Thixendale		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004149
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995

SITE NAME:	Round barrows south west of Riggs Farm, Thixendale		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004554
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995

SITE NAME:	Round barrow known as Gospel Hill, 80 metres south west of Pasture House, Thornton Watlass		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1018922
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Arable clipping	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995

SITE NAME:	Maiden Bower and Cock Lodge: a motte and bailey castle, moated site, windmill mound and associated linear outwork, Topcliffe		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1011612
CONDITION:	Generally satisfactory but with minor localised problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Vehicle damage/erosion - moderate	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995

SITE NAME:	Round barrow east of Weaverthorpe Ling, Weaverthorpe		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004098
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

SITE NAME:	Section of linear earthwork in Pasture Plantation, Weaverthorpe		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1007864
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Dumping	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995
SITE NAME:	Round barrows on Wharram Percy Wold, Wharram		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004127
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995
SITE NAME:	Bowl barrow 800 metres west of High Fordon Farm, Willerby		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1007744
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985
SITE NAME:	Bowl barrow 1100 metres west of High Fordon Farm, Willerby		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1007745
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985
SITE NAME:	Prior Moor round barrow, Willerby		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004106
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985
SITE NAME:	Round barrow south east of Willerby Wold House, Willerby		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004112
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985
SITE NAME:	Round barrow west of Willerby Wold House, Willerby		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004107
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985
SITE NAME:	Wilton Hall moated site 250 metres south of Manor Farm, Wilton		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1021269
CONDITION:	Generally satisfactory but with minor localised problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Drainage/dewatering	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
C Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

SITE NAME:	Round barrow on Rabbit Hill, 120 metres north of High Park House, Winton, Stank and Hallikeld		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1020353
CONDITION:	Unknown	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Arable clipping	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995

SITE NAME:	Round barrow 330yds (300 metres) NNW of Ladyhills, Wintringham		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1003135
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985

SITE NAME:	Two round barrows on Yearsley Moor 550 metres south west of High Lions' Lodge, Yearsley		
DESIGNATION:	Scheduled Monument, RPG grade II	LIST ENTRY NUMBER:	1013449
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Forestry	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995



© Historic England

SITE NAME:	Allerton Park, Allerton Mauleverer with Hopperton / Flaxby	Mid-C19 terraced gardens which provide the setting for a country house, surrounded by parkland which was enlarged in the 1720s and reworked in the 1770s. C20 woodland planting has significantly changed the character of the historic landscape. The parkland buildings and follies have recently been repaired and management of the planting has improved. Some further work is required to the bridge over the decoy pond and to the iron park fencing.
DESIGNATION:	Registered Park and Garden grade II, 19 LBs	
CONDITION:	Generally satisfactory but with minor localised problems	
VULNERABILITY:	Medium	
TREND:	Improving	
NEW ENTRY?:	No	
OWNER TYPE:	Mixed, multiple owners	
LIST ENTRY NUMBER:	1000402	



© Historic England

SITE NAME:	Ebberston Hall, Ebberston and Yedingham	Gardens with water features (c1718) integral to the design of Ebberston Hall and views of the wider landscape from it. Stepped cascade water features (Listed grade II*) are in need of consolidation and repair.
DESIGNATION:	Registered Park and Garden grade II*, 5 LBs, 2 SMs	
CONDITION:	Generally satisfactory but with significant localised problems	
VULNERABILITY:	Medium	
TREND:	Declining	
NEW ENTRY?:	No	
OWNER TYPE:	Private	
LIST ENTRY NUMBER:	1001062	

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.
- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site



© Historic England

SITE NAME:	Swinton Castle, Swinton with Warthermarske
DESIGNATION:	Registered Park and Garden grade II*, 6 LBs
CONDITION:	Generally satisfactory but with significant localised problems
VULNERABILITY:	Medium
TREND:	Improving
NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners
LIST ENTRY NUMBER:	1001074

Gardens and extensive pleasure grounds with grottos, rustic bridges and rockwork laid out between 1796 and c1820 under the direction of Adam Mickel the second and others for Sir William Danby, incorporating lakes and landscaping of c1760. The park probably has C17 or earlier origins. A significant proportion of the tree cover has reached maturity and beyond. Some structures are in poor condition and need maintenance and repair. Some of the water bodies have recently been de-silted.

Contact: Giles Proctor 01904 601981



© Battlefields Trust

SITE NAME:	Battle of Boroughbridge, Boroughbridge / Langthorpe / Milby
DESIGNATION:	Registered Battlefield, LB grade II, part in CA
CONDITION:	Generally satisfactory but with significant localised problems
VULNERABILITY:	Medium
TREND:	Stable
PRIORITY CATEGORY:	D (D)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	1000003

Thomas Earl of Lancaster's 1322 revolt against Edward II ended with defeat as his army attempted to retreat north and cross the River Ure. Much of the battlefield lies under modern Boroughbridge and there is further pressure for expansion north of the river.

Contact: Keith Emerick 01904 601988

SITE NAME:	Cayton	NEW ENTRY?:	No
DESIGNATION:	Conservation Area, 2 LBs	TREND:	Deteriorating
CONDITION:	Poor	CONTACT:	North Yorkshire Council Planning Department (LPA) 03001 312131
VULNERABILITY:	High		

SITE NAME:	Dean Road / Manor Road Cemetery	NEW ENTRY?:	No
DESIGNATION:	Conservation Area, part in RPG grade II	TREND:	Improving
CONDITION:	Very bad	CONTACT:	North Yorkshire Council Planning Department (LPA) 03001 312131
VULNERABILITY:	Medium		

SITE NAME:	Falsgrave	NEW ENTRY?:	No
DESIGNATION:	Conservation Area, 22 LBs	TREND:	Deteriorating
CONDITION:	Fair	CONTACT:	North Yorkshire Council Planning Department (LPA) 03001 312131
VULNERABILITY:	Medium		

SITE NAME:	Flixton, Folkton	NEW ENTRY?:	No
DESIGNATION:	Conservation Area, 5 LBs	TREND:	Deteriorating
CONDITION:	Poor	CONTACT:	North Yorkshire Council Planning Department (LPA) 03001 312131
VULNERABILITY:	High		

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.
- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

- CA** Conservation Area
- LB** Listed Building
- LPA** Local Planning Authority
- NP** National Park
- RPG** Registered Park and Garden
- SM** Scheduled Monument
- UA** Unitary Authority
- WHS** World Heritage Site

SITE NAME:	Newsham		
DESIGNATION:	Conservation Area, 11 LBs	NEW ENTRY?:	No
CONDITION:	Poor	TREND:	Deteriorating
VULNERABILITY:	High	CONTACT:	North Yorkshire Council Planning Department (LPA) 03001 312131

SITE NAME:	Scarborough		
DESIGNATION:	Conservation Area, 273 LBs, 2 RPGs, 2 SMs	NEW ENTRY?:	No
CONDITION:	Poor	TREND:	Deteriorating
VULNERABILITY:	High	CONTACT:	North Yorkshire Council Planning Department (LPA) 03001 312131

SITE NAME:	Selby, Armoury Road and Brook Street, Selby, Selby		
DESIGNATION:	Conservation Area, LB grade II	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	No significant change
VULNERABILITY:	High	CONTACT:	Anne Sims (LPA) 03001 312131

SITE NAME:	Selby, Millgate, Selby, Selby		
DESIGNATION:	Conservation Area, 11 LBs	NEW ENTRY?:	No
CONDITION:	Poor	TREND:	No significant change
VULNERABILITY:	High	CONTACT:	Anne Sims (LPA) 03001 312131

NORTH YORK MOORS (NP)



© Historic England

SITE NAME:	Arden Mill, Nr. Main Lane, Hawnby, North Yorkshire Council (UA)
DESIGNATION:	Listed Building grade II*
CONDITION:	Poor
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	D (C)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	1391800

Early C18 water-powered corn mill, containing original - mainly timber - machinery, with some C19 cast iron replacements. Damaged in floods in 2007; holding repairs undertaken, timber machinery now in need of stabilisation. A condition survey has been carried out and some repairs are planned.

Contact: Richard Butterfield 01904 601995



© Historic England

SITE NAME:	Rosedale East Mines: South 'Stone' kilns and North 'Iron' kilns, Rosedale East Side, North Yorkshire Council (UA)
DESIGNATION:	Scheduled Monument
CONDITION:	Fair
OCCUPANCY:	N/A
PRIORITY CATEGORY:	D (F)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	1018981

South 'Stone' kilns; massive rectangular stone structure 90 metres long. Part of the C19 iron mining complex at Rosedale East. Recent major collapse in several places. North 'Iron' kilns; also a rectangular stone structure 90 metres long, partly constructed with wrought iron plates which were removed following abandonment. Recent collapse. Project Development was carried out as part of a project called This Exploited Land, an initiative of the North York Moors National Park. Unfortunately, repairs have not gone ahead, but it is hoped to identify funding.

Contact: Richard Butterfield 01904 601995

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.
- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site




© Historic England Archive

SITE NAME:	Ruins of Whorlton Castle Undercroft, Castle Bank, Whorlton, North Yorkshire Council (UA)
DESIGNATION:	Scheduled Monument and Listed Buildings - 2 grade I; 1 grade II*, part in CA
CONDITION:	Good
OCCUPANCY:	N/A
PRIORITY CATEGORY:	C (D)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	1007641 and 1151332; 1294328; 1189310

C14 castle. Parts of two vaulted chambers remain. Repairs have been carried out with the support of the Culture Recovery Fund. Management of the site needs to be improved in the hope that this will help to avert further vandalism.

Contact: Giles Proctor 01904 601981

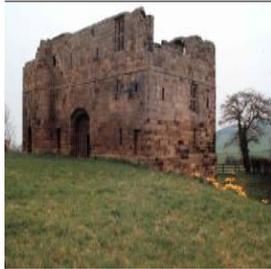

© Historic England Archive

SITE NAME:	Whorlton Castle Gatehouse, Castle Bank, Whorlton, North Yorkshire Council (UA)
DESIGNATION:	Scheduled Monument and Listed Buildings - 2 grade I; 1 grade II*, part in CA
CONDITION:	Good
OCCUPANCY:	N/A
PRIORITY CATEGORY:	C (D)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	1007641 and 1151332; 1294328; 1189310

Shell remains of a late C14 gatehouse, which was altered in the C16. Repairs have been carried out with the support of the Culture Recovery Fund. The management of the site needs to be improved in the hope that this will help to avert further vandalism.

Contact: Giles Proctor 01904 601981

SITE NAME:	Two round barrows on Low Common, Appleton-le-Moors, North Yorkshire Council (UA)		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1003660
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable clipping	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995

SITE NAME:	Round barrow 550 metres east of Cam House, Bilsdale Midcable, North Yorkshire Council (UA)		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1012488
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Other	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995

SITE NAME:	Pit alignment forming part of the Cleave Dyke system 1000 metres north west of Dialstone Farm, Boltby, North Yorkshire Council (UA)		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1010345
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.
- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

SITE NAME:	Pit alignment, part of the Cleave Dyke prehistoric boundary system and round barrow 450 metres south east of High Paradise, Boltby, North Yorkshire Council (UA)		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1015576
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995
SITE NAME:	Round barrow 650 metres east of South Woods, Boltby, North Yorkshire Council (UA)		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1010343
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995
SITE NAME:	Regular aggregate field system on Troutdale Moor, 470 metres north west of Rock House Farm, Broxa-cum-Troutdale, North Yorkshire Council (UA)		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1020839
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995
SITE NAME:	Byland Moor round cairns, Byland with Wass, North Yorkshire Council (UA)		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1003144
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995
SITE NAME:	Blackpark medieval farmstead 140 metres south of Blackpark Lodge, Cropton, North Yorkshire Council (UA)		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1018595
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Bracken	NEW ENTRY?:	No
OWNER TYPE:	Private, multiple owners	CONTACT:	Richard Butterfield 01904 601995
SITE NAME:	Cropton Hall Garth: a motte and bailey castle including later medieval manor house, a medieval trackway and a pond, Cropton, North Yorkshire Council (UA)		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1011624
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Animal burrowing - moderate	NEW ENTRY?:	Yes
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985
SITE NAME:	One of four round barrows known as Robin Hood's Butts and adjacent enclosed Bronze Age urnfield, 530 metres north east of Black Beck Swang, Danby, North Yorkshire Council (UA)		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1020349
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Bracken	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
C Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
 Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

SITE NAME:	Round barrow on Wheeldale Moor, 1150 metres west of Wheeldale Lodge, Egton, North Yorkshire Council (UA)		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1021256
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Vandalism	NEW ENTRY?:	Yes
OWNER TYPE:	Crown	CONTACT:	Nicky Brown 01904 601985
SITE NAME:	Round cairn on Skivick Crag, 380 metres south west of Wheeldale Lodge, Egton, North Yorkshire Council (UA)		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1021258
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Bracken	NEW ENTRY?:	No
OWNER TYPE:	Other	CONTACT:	Richard Butterfield 01904 601995
SITE NAME:	Round barrows and entrenchments on Egton High Moor, Egton / Glaisdale, North Yorkshire Council (UA)		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004167
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Bracken	NEW ENTRY?:	Yes
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985
SITE NAME:	Fyling medieval deer park wall section, Fylingdales, North Yorkshire Council (UA)		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1015542
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Improving
PRINCIPAL VULNERABILITY:	Collapse	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995
SITE NAME:	Great Ayton Moor cairn cemetery and earthworks, Great Ayton, North Yorkshire Council (UA)		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004102
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Visitor erosion - moderate	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995
SITE NAME:	Round barrow in Springwood Heights Plantation, 220 metres north west of Springwood Cottage, Hackness, North Yorkshire Council (UA)		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1019620
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Animal burrowing - moderate	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995
SITE NAME:	Round barrow 150 metres north east of Silver Hill Farm, Hawnby, North Yorkshire Council (UA)		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1016052
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable clipping	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
C Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
 Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

SITE NAME:	Round barrow 500 metres east of Silver Hill Farm, Hawnby, North Yorkshire Council (UA)		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1016066
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable clipping	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995
SITE NAME:	Two round barrows east of Wild Middle Gill, Hawnby, North Yorkshire Council (UA)		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1008514
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Bracken	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995
SITE NAME:	Section of the Cleave Dyke system known as Hesketh Dike and Silver Hill round barrow, Hawnby / Old Byland and Scawton / Boltby, North Yorkshire Council (UA)		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1015575
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable clipping	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995
SITE NAME:	Moated site at Low Laithes Farm, Whitby Laithes, Hawsker-cum-Stainsacre, North Yorkshire Council (UA)		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1020402
CONDITION:	Generally satisfactory but with minor localised problems	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Dewatering	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995
SITE NAME:	Saltwick Nab alum quarries, Hawsker-cum-Stainsacre, North Yorkshire Council (UA)		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1017779
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Coastal erosion	NEW ENTRY?:	No
OWNER TYPE:	Charity (heritage)	CONTACT:	Richard Butterfield 01904 601995
SITE NAME:	Roppa South Cross on Carr Cote Ridge 100 metres WSW of Piethorn, Helmsley, North Yorkshire Council (UA)		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1011746
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Collapse	NEW ENTRY?:	Yes
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985
SITE NAME:	Round barrow immediately south of California Belt, 190 metres east of Fox Head, Hutton Buscel, North Yorkshire Council (UA)		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1017158
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
C Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

SITE NAME:	Round barrow 480 metres east of Yorkshire Gliding Club, Kilburn High and Low, North Yorkshire Council (UA)		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1014564
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995
SITE NAME:	Cross dyke on Saltergate Brow, 750 metres south east of Barr Farm, Lockton, North Yorkshire Council (UA)		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1021166
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Stock erosion - moderate	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995
SITE NAME:	Cross dyke centred 480 metres south of Fox and Rabbit Farm, Lockton / Thornton-le-Dale, North Yorkshire Council (UA)		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1021170
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Bracken	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Richard Butterfield 01904 601995
SITE NAME:	Round barrow on Brockrigg, 400 metres east of Brockrigg Farm, Lythe, North Yorkshire Council (UA)		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1016539
CONDITION:	Extensive significant problems	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995
SITE NAME:	Medieval lordly residence immediately west of Church Farm, Old Byland and Scawton, North Yorkshire Council (UA)		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1020313
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Other	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995
SITE NAME:	Four round barrows 875 metres north west of High Blansby, Pickering, North Yorkshire Council (UA)		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1020818
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable clipping	NEW ENTRY?:	No
OWNER TYPE:	Crown	CONTACT:	Richard Butterfield 01904 601995
SITE NAME:	Linear boundary earthwork 370 metres east of Oscar Park Farm, Rievaulx, North Yorkshire Council (UA)		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1019340
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
C Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
 Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

SITE NAME:	Round barrow 920 metres south west of Silpho Brow Farm, Silpho, North Yorkshire Council (UA)		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1019626
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995
SITE NAME:	Prehistoric linear boundary and associated features including a medieval monastic grange, north, east and south east of Moorsome Farm, Snainton / Brompton, North Yorkshire Council (UA)		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1020836
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Animal burrowing - Other - extensive	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995
SITE NAME:	Pry Rigg round barrows, Sproxton, North Yorkshire Council (UA)		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004086
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995
SITE NAME:	Medieval dyke known as War Dike, Staintondale, North Yorkshire Council (UA)		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1020118
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Bracken	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995
SITE NAME:	The Thieves' Dikes: prehistoric linear boundaries and associated features, Suffield-cum-Everley / Silpho, North Yorkshire Council (UA)		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1019627
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Improving
PRINCIPAL VULNERABILITY:	Arable clipping	NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners	CONTACT:	Richard Butterfield 01904 601995
SITE NAME:	Northern of two round barrows known as Row Howes, 640 metres south east of East Moor Farm, Wykeham, North Yorkshire Council (UA)		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1019369
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable clipping	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995
SITE NAME:	Southern of two round barrows known as Row Howes, 680 metres south east of East Moor Farm, Wykeham, North Yorkshire Council (UA)		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1019370
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable clipping	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
C Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

YORKSHIRE DALES (NP)



© Historic England

SITE NAME:	Nappa Hall, Askrigg, North Yorkshire Council (UA)
DESIGNATION:	Listed Building grade I
CONDITION:	Poor
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	D (D)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	I157398

A fortified manor house built in 1459 for James Metcalf. A wing was added in C17. Most of the medieval portion has not been occupied for some years. The roof of the west tower has leaked and the floor is in a rotten and dangerous state. The roof coverings over the great hall and the south east wing are in poor condition, although some repairs have been undertaken and further works are proposed by the owner. Proposals for the repair and reuse of the hall have received Listed Building Consent.

Contact: Giles Proctor 01904 601981



© YDNP

SITE NAME:	Low Whita (Bells) Farm (East), Grinton, North Yorkshire Council (UA)
DESIGNATION:	Listed Building grade II*, CA
CONDITION:	Poor
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	D (D)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	I463837

Remarkable survival of multiple pre-1700 dwellings formed by the subdivision of an earlier farmstead. Alterations made to the buildings, particularly through the C18 and C19, illustrate changing vernacular construction and architecture over time. Evidence of a mid-C19 butter factory, a rare survival of a vernacular, small-scale commercial dairy. The buildings have been disused for some years and are in poor condition, although a scheme for reoccupation has been approved and details to meet planning conditions have been submitted. The building has recently changed ownership.

Contact: Giles Proctor 01904 601981



© YDNPA

SITE NAME:	Low Whita (Bells) Farm (West), Grinton, North Yorkshire Council (UA)
DESIGNATION:	Listed Building grade II*, CA
CONDITION:	Poor
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	F (D)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	I462332

Remarkable survival of multiple pre-1700 dwellings formed by the subdivision of an earlier farmstead. Alterations made to the buildings through the C17 and C18 illustrate changing vernacular construction and architecture over time. The survival of features such as the 1680 inscribed lintel and daisy-wheel marks, which are likely to be apotropaic symbols from around 1700, are of interest. The buildings have been unoccupied for many years and are in poor condition. A scheme for reoccupation as a dwelling has been approved and work has started on site.

Contact: Giles Proctor 01904 601981



© Historic England

SITE NAME:	Lodge Hall, Ingman Lodge Road, Selside, Horton in Ribblesdale, North Yorkshire Council (UA)
DESIGNATION:	Listed Building grade II*
CONDITION:	Poor
OCCUPANCY:	Part occupied/part in use
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	I289489

Farmhouse dated 1687. Structural cracks to main (east) front and bulge on north side. Roof leaks, with attendant decay. Integral part of a working farm.

Contact: Giles Proctor 01904 601981

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.
- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

	SITE NAME:	Swardale Gill Lime Kilns, Swardale, Crosby Garrett, Westmorland and Furness Council (UA)	Remains of a major mid-C19 lime production centre, with two kilns and related engine house and railway structures. The right-hand wall of the furnace is bulging and there are problems with the stability of the retaining walls of the railway embankments. The site is included in the National Lottery Heritage Funded Westmorland Dales Landscape Project and consolidation work has started on site.
	DESIGNATION:	Scheduled Monument and Listed Building grade II	
	CONDITION:	Poor	
	OCCUPANCY:	N/A	
	PRIORITY CATEGORY:	F (D)	
	OWNER TYPE:	Charity (heritage)	
	LIST ENTRY NUMBER:	1021107 and 1145018	

	SITE NAME:	High Hall Farmhouse including cartshed, Dent, Westmorland and Furness Council (UA)	C17 farmhouse once owned by Richard Trotter, who led the Dent 'statesmen' to purchase the manor of Dent from the crown in 1670. Part occupied, partially derelict and collapsing.
	DESIGNATION:	Listed Building grade II*	
	CONDITION:	Very bad	
	OCCUPANCY:	Part occupied/part in use	
	PRIORITY CATEGORY:	A (A)	
	OWNER TYPE:	Private	
	LIST ENTRY NUMBER:	1383893	

	SITE NAME:	Lammerside Castle, Wharton, Westmorland and Furness Council (UA)	C14 ruined castle of two storeys and with vaulted cellars. Collapse of facing stone and rubble core has been caused by frost action, root action and stock. Mature trees are growing out of the walls. Deterioration has accelerated during the past couple of years. Requires major consolidation works. Historic England are in discussions with the Yorkshire Dales National Park Authority to look into funding opportunities to undertake recording and consolidation.
	DESIGNATION:	Scheduled Monument and Listed Building grade II	
	CONDITION:	Very bad	
	OCCUPANCY:	N/A	
	PRIORITY CATEGORY:	A (A)	
	OWNER TYPE:	Private	
	LIST ENTRY NUMBER:	1019580 and 1145017	

	SITE NAME:	Church of Holy Trinity, Melbecks, North Yorkshire Council (UA)	A small early C19 church, set in Swaledale. Grant-aided repairs to the windows, under the National Lottery Heritage Fund Grants for Places of Worship scheme, were completed in 2016. The west wall continues to suffer from severe water penetration and a scheme for repair has been approved. Tenders are significantly above estimate and the parish is now considering how it might fund some of the work.	
	DESIGNATION:	Listed Place of Worship grade II		
	CONDITION:	Fair		
	PRIORITY CATEGORY:	D (C)		
	OWNER TYPE:	Religious organisation		
	LIST ENTRY NUMBER:	1318631		Contact: Giles Proctor 01904 601981

SITE NAME:	Large univallate hillfort on Ingleborough Hill, Clapham cum Newby / Ingleton, North Yorkshire Council (UA)	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER: 1008876
CONDITION:	Generally unsatisfactory with major localised problems	TREND: Declining
PRINCIPAL VULNERABILITY:	Visitor erosion - extensive	NEW ENTRY?: No
OWNER TYPE:	Private	CONTACT: Nicky Brown 01904 601985

PRIORITY CATEGORIES			ABBREVIATIONS		
A Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.	D Slow decay; solution agreed but not yet implemented.	F Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.	NOTE Last year's priority category is shown in brackets (otherwise, New Entry is noted).	CA Conservation Area	LB Listed Building
B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.	E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).			LPA Local Planning Authority	NP National Park
C Slow decay; no solution agreed.				RPG Registered Park and Garden	SM Scheduled Monument
				UA Unitary Authority	WHS World Heritage Site

SITE NAME:	Kinsey Cave, Giggleswick Scar, Giggleswick, North Yorkshire Council (UA)		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1010295
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Animal burrowing - Badger - extensive	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985
SITE NAME:	Grinton ore hearth lead smelt mill, flue, fuel store and associated earthworks, Grinton, North Yorkshire Council (UA)		
DESIGNATION:	Scheduled Monument, 3 LBs	LIST ENTRY NUMBER:	1016203
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Collapse	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Richard Butterfield 01904 601995
SITE NAME:	Unenclosed prehistoric hut circle settlement and associated field system and cremation cemetery at Blea Gill, Hebden, North Yorkshire Council (UA)		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1018689
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Bracken	NEW ENTRY?:	No
OWNER TYPE:	Commercial company, multiple owners	CONTACT:	Nicky Brown 01904 601985
SITE NAME:	Meal Bank Quarry Hoffmann kiln, quarry and lime works, Ingleton, North Yorkshire Council (UA)		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1020889
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Collapse	NEW ENTRY?:	No
OWNER TYPE:	Local authority	CONTACT:	Richard Butterfield 01904 601995
SITE NAME:	Marrick ore hearth lead smelting, Marske / Marrick, North Yorkshire Council (UA)		
DESIGNATION:	Scheduled Monument, 2 LBs	LIST ENTRY NUMBER:	1015824
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Improving
PRINCIPAL VULNERABILITY:	Dumping	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985
SITE NAME:	Bowl barrow 20 metres east of Ravens' Gill, Crosby Ravensworth, Westmorland and Furness Council (UA)		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1007603
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Stock erosion - extensive	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985
SITE NAME:	Medieval shieling south of Cow Green, Crosby Ravensworth, Westmorland and Furness Council (UA)		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1007596
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Vehicle damage/erosion - extensive	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.
- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

SITE NAME:	Lammerside Castle medieval tower house, Wharton, Westmorland and Furness Council (UA)		
DESIGNATION:	Scheduled Monument and Listed Building grade II	LIST ENTRY NUMBER:	1019580 and 1145017
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Collapse	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985

SITE NAME:	Farfield Mill (Sedbergh), Sedbergh, Westmorland and Furness Council (UA)		
DESIGNATION:	Conservation Area, 2 LBs	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	Deteriorating
VULNERABILITY:	Low	CONTACT:	Miles Johnson (LPA) 01969 652361

SITE NAME:	Littondale barns and walls, Horton in Ribblesdale / Kettlewell with Starbotton / Litton / Arncliffe / Conistone with Kilnsey / Halton Gill / Hawkswick, North Yorkshire Council (UA)		
DESIGNATION:	Conservation Area, 58 LBs, 3 SMs	NEW ENTRY?:	No
CONDITION:	Poor	TREND:	Deteriorating
VULNERABILITY:	Medium	CONTACT:	Miles Johnson (LPA) 01969 652361

SITE NAME:	Swaledale and Arkengarthdale barns and walls, Muker / Reeth, Fremington and Healaugh / Arkengarthdale / Ellerton Abbey / Grinton / Marrick / Melbecks, North Yorkshire Council (UA)		
DESIGNATION:	Conservation Area, 138 LBs, 9 SMs	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	Deteriorating
VULNERABILITY:	Low	CONTACT:	Miles Johnson (LPA) 01969 652361

SOUTH YORKSHIRE

BARNSELEY



© Historic England

SITE NAME:	Grimethorpe Hall, Brierley Road
DESIGNATION:	Listed Building grade II*
CONDITION:	Very bad
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	A (A)
OWNER TYPE:	Crown
LIST ENTRY NUMBER:	1151202

House (c1670, altered in C18, C19 and C20), which requires extensive repairs. The setting has been eroded by the construction of housing to the west. Following the dissolution of the company that owned the property, it has become subject to escheat to the Crown. The building has been subject to heritage crime. The majority of openings are blocked up, the roof is now failing with significant water ingress. Discussions are being undertaken with the local community regarding its possible future use.

Contact: Bryan Davies 01904 601867



© Historic England

SITE NAME:	Low Mill furnace, Cawthorne
DESIGNATION:	Scheduled Monument
CONDITION:	Poor
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	1004793

A small, rural, ironworks. The remains of the conical blast furnace are attached to a single-storey building with arched cart entrances to each side. The blast furnace supports a heavy growth of self-set trees and brambles. The stone-slatted roof of the attached building is deteriorating. Plans for reuse have been discussed with the owner.

Contact: Giles Proctor 01904 601981

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.
- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site



© Historic England

SITE NAME:	Knabbe's Hall, Nabs Lane, Silkstone
DESIGNATION:	Listed Building grade II*
CONDITION:	Poor
OCCUPANCY:	Part occupied/part in use
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	1314749

Large C17 farmhouse which retains many original features. The existing building probably incorporates elements of an earlier house and was rebuilt for William Wood, an ironmaster at nearby Wortley Forge, and his wife Elizabeth. It is now in need of repair and maintenance to address issues of water ingress and structural movement affecting the historic fabric.

Contact: Bryan Davies 01904 601867



© Stephen Elliott, Purcell Miller Tritton

SITE NAME:	Gun Room, Wentworth Castle, Stainborough
DESIGNATION:	Listed Building grade II*, RPG grade I, CA
CONDITION:	Fair
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	E (E)
OWNER TYPE:	Local authority
LIST ENTRY NUMBER:	1151066

Probably built as a banqueting house or a bath-house, the interior has exceptionally fine plasterwork. It was used as a gun room in the C19. Repairs to the walls and temporary repairs to the roof were completed in 2007, but a further phase of conservation is required to the interior which is in very poor condition. The management of the site has been taken over by the National Trust and some further repairs to the exterior are proposed.

Contact: Giles Proctor 01904 601981



© Historic England

SITE NAME:	Low Forge, Wortley / Hunsheaf
DESIGNATION:	Scheduled Monument
CONDITION:	Poor
OCCUPANCY:	N/A
PRIORITY CATEGORY:	D (D)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	1020626

Roofless remains of an early C18 water-powered iron forge, including waterwheel and tilt-hammer, associated wheelraces, forge and bloomery building; in need of repair. Tree and scrub clearance undertaken. Solution agreed for repair of masonry.

Contact: Nicky Brown 01904 601985



© Historic England

SITE NAME:	Church of St Peter including attached wall and gateway to south west, Brinckman Street
DESIGNATION:	Listed Place of Worship grade II*
CONDITION:	Poor
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1314984

Church and attached wall and gateway, 1893 to 1910 by Temple Moore. In generally good order; nave appears to have been reslated. Slates to chancel roof appear to be in poor condition and there is salting brickwork to the Lady Chapel. Some recent repairs to the windows.

Contact: Bryan Davies 01904 601867



© Historic England

SITE NAME:	Church of St Helen, High Street, Thurnscoe
DESIGNATION:	Listed Place of Worship grade II
CONDITION:	Poor
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1151168

Victorian church with Georgian tower, the rest rebuilt in 1887. Clay tiled roofs to nave and south east corner are failing and need to be regularly overhauled. Eroded stonework to porch.

Contact: Giles Proctor 01904 601981

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.
- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

- CA** Conservation Area
- LB** Listed Building
- LPA** Local Planning Authority
- NP** National Park
- RPG** Registered Park and Garden
- SM** Scheduled Monument
- UA** Unitary Authority
- WHS** World Heritage Site

SITE NAME:	East Gawber Hall colliery fanhouse, 800 metres north east of Croft Farm		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1017748
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Collapse	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985

SITE NAME:	Heavy anti-aircraft gunsite 330 metres south east of Lowfield Farm		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1019872
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985

SITE NAME:	Romano-British settlements at Finkle Street, Wortley		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004801
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985

SITE NAME:	Water powered bloomery, iron forge and rolling mill at Low Forge, Wortley / Hunsheff		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1020626
CONDITION:	Extensive significant problems	TREND:	Stable
PRINCIPAL VULNERABILITY:	Collapse	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985



© Historic England

SITE NAME:	Cannon Hall, Cawthorne / High Hoyland
DESIGNATION:	Registered Park and Garden grade II, 15 LBs, part in CA
CONDITION:	Generally satisfactory but with significant localised problems
VULNERABILITY:	Medium
TREND:	Declining
NEW ENTRY?:	Yes
OWNER TYPE:	Local authority
LIST ENTRY NUMBER:	1001159

The kitchen garden at Cannon Hall has seen substantial excellent conservation and repair work in recent years. However a large section of the kitchen garden wall is now at risk of imminent collapse preventing enjoyment of the walled garden circular pathway and endangering some of the historic pear trees. Preliminary work has been undertaken to develop a proposed repair and rebuild methodology.

Contact: Bryan Davies 01904 601867

SITE NAME:	Worsbrough		
DESIGNATION:	Conservation Area, 9 LBs	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	Deteriorating
VULNERABILITY:	Low	CONTACT:	Tony Wiles (LPA) 01226 772576

BARNSELEY / ROTHERHAM

SITE NAME:	The Former Elsecar Ironworks, Wentworth		
DESIGNATION:	Scheduled Monument, 3 LBs, part in CA	LIST ENTRY NUMBER:	1465668
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Collapse	NEW ENTRY?:	No
OWNER TYPE:	Local authority	CONTACT:	Nicky Brown 01904 601985

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.
- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

DONCASTER



© Historic England

SITE NAME:	Moat Hall ruins, Braithwell
DESIGNATION:	Scheduled Monument, LB grade II
CONDITION:	Very bad
OCCUPANCY:	N/A
PRIORITY CATEGORY:	B (B)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	1012461

Ruins of medieval monastic grange and post-medieval dwelling, consisting of arched doorway and low walls. In bad repair. Programme of works agreed with the owner.

Contact: Nicky Brown 01904 601985



© Historic England

SITE NAME:	Stable to Hickleton Hall including the Stable Cottage and attached walls and gate piers, Hickleton Hall, Hickleton
DESIGNATION:	Listed Building grade II*, RPG grade II, CA
CONDITION:	Poor
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	D (D)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	1151659

Mid-C18 stable block, now store and house with attached walls and gate piers. Possibly by James Paine, who designed Hickleton Hall, between 1745 and 1748, for Godfrey Wentworth. The stable block stands to the north of the Hall. Some repairs have been carried out to the stonework. A planning application for conversion to residential units has been agreed, but the building has recently changed hands.

Contact: Giles Proctor 01904 601981



© Historic England

SITE NAME:	Church of St Peter, Warmsworth Road
DESIGNATION:	Listed Place of Worship grade II
CONDITION:	Fair
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1096038

Known as 'The White Church'. Consecrated in 1942 and mentioned in a wartime broadcast from Berlin by the notorious 'Lord Haw Haw'. Designed by Brundell & Faran of Doncaster, built by PP Taylor. Painted and rendered brick with brick dressings and blue/green glazed pantile roofs. Broad nave with porch to west and domed chancel to east with flanking Lady Chapel to the north east and vestry to the south east. All windows have metal casements with brick cills. Steel-framed windows in poor condition and some deterioration to the concrete floor structure. Repairs are planned.

Contact: Giles Proctor 01904 601981



© Historic England

SITE NAME:	Church of St George, Church Lane, Doncaster
DESIGNATION:	Listed Place of Worship grade I, CA
CONDITION:	Poor
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1151447

Major Victorian church by Sir George Gilbert Scott, replacing the medieval parish church which was destroyed by fire. Several phases of repair undertaken, but further work required to stonework, including to the central tower.

Contact: Giles Proctor 01904 601981



© Historic England

SITE NAME:	Church of All Saints, Central Avenue, Adwick Le Street
DESIGNATION:	Listed Place of Worship grade II, CA
CONDITION:	Fair
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1151514

Early C20 brick church, designed in the Romanesque style by WH Wood for Charles Thellusson of Brodsworth Hall, who gifted the church to the parish upon its consecration in 1913. The church forms a key focal point in the Woodlands Colliery Model Village. Roofs and rainwater goods are in poor condition. Repairs to the south elevation were completed in 2018 with funding from the National Lottery Heritage Fund Grants for Places of Worship scheme and other repairs have recently been undertaken. Further repairs are still required.

Contact: Bryan Davies 01904 601867

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
C Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
 Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site



© St Lawrence PCC

SITE NAME:	Church of St Lawrence, Station Road, Hatfield
DESIGNATION:	Listed Place of Worship grade I, CA
CONDITION:	Poor
PRIORITY CATEGORY:	F (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1192628

Norman church of C12 origin with C13 arcades, the rest mostly C15. Altered in 1872 by Thomas Jackson and restoration in 1882 by Edwin Dolby. Repairs are being carried out to the window tracery.

Contact: Bryan Davies 01904 601867



© Historic England

SITE NAME:	Church of St Helen, Church Lane, Marr
DESIGNATION:	Listed Place of Worship grade I, CA
CONDITION:	Poor
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1192644

Church of C12 origin. West tower added and rest remodelled C13 to early C14. South porch, tower parapet and spire added in C15. The church is constructed from rubble limestone with stone slate roofs. Roof coverings, rainwater goods, window tracery and masonry are in poor condition with failing temporary repairs. Some maintenance has been carried out.

Contact: Bryan Davies 01904 601867



© Historic England

SITE NAME:	Church of St Mary Magdalene, High Street, Norton
DESIGNATION:	Listed Place of Worship grade I, CA
CONDITION:	Poor
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1151464

Large Perpendicular church of cruciform plan with embattled west tower and nave parapets. Elements of the structure date to the C12, with C13, C14 and C15 additions. The restored C12 west door has shafts to a four-order round arch, scalloped capitals and zig-zag ornament. Roofs, rainwater goods and masonry are in poor condition, but repairs are planned.

Contact: Bryan Davies 01904 601867



© Historic England

SITE NAME:	Church of All Saints, Stockbridge Lane, Owston
DESIGNATION:	Listed Place of Worship grade I, CA
CONDITION:	Poor
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1192336

Fine medieval village church adjacent to Owston Hall. C12 west tower and north aisle, C14 south aisle and C15 clerestory. C14 chancel, restored by Sir GG Scott, containing important monuments by Chantrey. Medieval rood screen. The nave and aisle roofs are in poor condition and water penetration is damaging internal plasterwork. The stone roof of the south porch is leaking.

Contact: Giles Proctor 01904 601981

SITE NAME:	Castle Hills motte and bailey castle, Langthwaite, Adwick le Street	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER: 1013654
CONDITION:	Generally unsatisfactory with major localised problems	TREND: Declining
PRINCIPAL VULNERABILITY:	Vehicle damage/erosion - extensive	NEW ENTRY?: No
OWNER TYPE:	Private	CONTACT: Nicky Brown 01904 601985

SITE NAME:	Moat Hills moated site, Bentley	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER: 1013655
CONDITION:	Generally unsatisfactory with major localised problems	TREND: Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?: No
OWNER TYPE:	Private	CONTACT: Nicky Brown 01904 601985

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.
- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

SITE NAME:	Moat Hall moated site and site of external ancillary buildings, Braithwell		
DESIGNATION:	Scheduled Monument, LB grade II	LIST ENTRY NUMBER:	1012461
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Improving
PRINCIPAL VULNERABILITY:	Collapse	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985
SITE NAME:	Roman potteries 300yds (270 metres) north east of Rossington Bridge, Cantley / Rossington		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004787
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Other	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985
SITE NAME:	Lindholme Neolithic Timber Trackway And Platform, Hatfield		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1443481
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Dewatering	NEW ENTRY?:	No
OWNER TYPE:	Government or agency	CONTACT:	Nicky Brown 01904 601985
SITE NAME:	Earthworks on Sutton Common, Norton		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004816
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Drainage/dewatering	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985
SITE NAME:	Thorpe in Balne moated site, chapel and fishpond, Thorpe in Balne		
DESIGNATION:	Scheduled Monument, LB grade II*	LIST ENTRY NUMBER:	1012111
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Drainage/dewatering	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985
SITE NAME:	Site of the Saxon church of Dadesley, 670 metres south west of Dadsley Wells Farm, Tickhill		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1016947
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Animal burrowing - Badger - extensive	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985
SITE NAME:	Tickhill Castle, Tickhill		
DESIGNATION:	Scheduled Monument, CA	LIST ENTRY NUMBER:	1004828
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Collapse	NEW ENTRY?:	No
OWNER TYPE:	Crown	CONTACT:	Nicky Brown 01904 601985

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
C Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
 Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

SITE NAME:	Hatfield High Street, Hatfield		
DESIGNATION:	Conservation Area, 12 LBs	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	No significant change
VULNERABILITY:	Medium	CONTACT:	Malcolm Thomas (LPA) 01302 735199

SITE NAME:	Marr		
DESIGNATION:	Conservation Area, 6 LBs	NEW ENTRY?:	No
CONDITION:	Poor	TREND:	Deteriorating
VULNERABILITY:	Medium	CONTACT:	Malcolm Thomas (LPA) 01302 735199

SITE NAME:	Mexborough, Mexborough		
DESIGNATION:	Conservation Area	NEW ENTRY?:	No
CONDITION:	Poor	TREND:	Deteriorating
VULNERABILITY:	High	CONTACT:	Malcolm Thomas (LPA) 01302 735199

SITE NAME:	St George's, Doncaster		
DESIGNATION:	Conservation Area, 2 LBs, SM	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	No significant change
VULNERABILITY:	Medium	CONTACT:	Malcolm Thomas (LPA) 01302 735199

SITE NAME:	Thorne Central, Thorne, Thorne		
DESIGNATION:	Conservation Area, 14 LBs, SM	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	Improving
VULNERABILITY:	Low	CONTACT:	Malcolm Thomas (LPA) 01302 735199

SITE NAME:	Thorne Road, Doncaster		
DESIGNATION:	Conservation Area, LB grade II	NEW ENTRY?:	No
CONDITION:	Poor	TREND:	Deteriorating
VULNERABILITY:	Low	CONTACT:	Malcolm Thomas (LPA) 01302 735199

SITE NAME:	Woodlands		
DESIGNATION:	Conservation Area, 26 LBs	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	Deteriorating
VULNERABILITY:	Medium	CONTACT:	Malcolm Thomas (LPA) 01302 735199

PEAK DISTRICT (NP)

SITE NAME:	Bailey Hill motte and bailey castle, High Bradfield, Bradfield, Sheffield		
DESIGNATION:	Scheduled Monument, part in CA	LIST ENTRY NUMBER:	1013217
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Improving
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985

SITE NAME:	Castle Hill motte and bailey castle, High Bradfield, Bradfield, Sheffield		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1017612
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Animal burrowing - moderate	NEW ENTRY?:	No
OWNER TYPE:	Local authority	CONTACT:	Nicky Brown 01904 601985

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
C Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
 Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

- CA** Conservation Area
LB Listed Building
LPA Local Planning Authority
NP National Park
RPG Registered Park and Garden
SM Scheduled Monument
UA Unitary Authority
WHS World Heritage Site

SITE NAME:	Cowell Flat prehistoric field system, 350 metres south east of Mortimer House, Bradfield, Sheffield		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1017833
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Local authority	CONTACT:	Nicky Brown 01904 601985

ROTHERHAM



© Historic England

SITE NAME:	Rockingham Kiln (Swinton Pottery)
DESIGNATION:	Listed Building grade II*, SM
CONDITION:	Fair
OCCUPANCY:	N/A
PRIORITY CATEGORY:	D (D)
OWNER TYPE:	Local authority
LIST ENTRY NUMBER:	1314614

Bottle kiln built in 1815, named to commemorate the Battle of Waterloo. The kiln is the principal surviving element of the celebrated Rockingham Porcelain Factory, which was financed by the Earl Fitzwilliam and named after his uncle the Marquis of Rockingham. The upper part is open jointed with some woody plant growth. Historic England has supported Project Development with grant and it is intended to go out to tender for the repairs.

Contact: Giles Proctor 01904 601981



© Historic England

SITE NAME:	Thorpe Salvin Old Hall (ruins of), Ladyfield Road, Thorpe Salvin
DESIGNATION:	Scheduled Monument and Listed Buildings - 2 grade II*, CA
CONDITION:	Poor
OCCUPANCY:	N/A
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	1004788 and 1286372; 1314668

Gatehouse and imposing three-storey south facade of mid-C16 stone-built mansion built by Henry Sanford (died 1582) standing in an open courtyard. The masonry is in need of consolidation and some vegetation growth is present which needs to be managed.

Contact: Nicky Brown 01904 601985



© Historic England

SITE NAME:	Stable block and riding school, Wentworth Woodhouse, Wentworth
DESIGNATION:	Listed Building grade I, RPG grade II*
CONDITION:	Poor
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	F (F)
OWNER TYPE:	Charity (heritage)
LIST ENTRY NUMBER:	1203779

Monumental stable block and riding school, built in 1768 to the design of John Carr of York, to the north west of the house. Now the property of the Wentworth Woodhouse Preservation Trust. The roof coverings are deteriorating and there is erosion to the stonework, particularly inside the courtyard. The Riding School has been reroofed. Project Development work leading to reuse is complete and an initial phase of work is underway, supported by Levelling Up and Historic England grants. The 1960s college buildings to the west of the site have been demolished, revealing the original buildings.

Contact: Giles Proctor 01904 601981



© Historic England

SITE NAME:	Wentworth Woodhouse, Wentworth
DESIGNATION:	Listed Building grade I, RPG grade II*
CONDITION:	Poor
OCCUPANCY:	Part occupied/part in use
PRIORITY CATEGORY:	F (F)
OWNER TYPE:	Charity (heritage)
LIST ENTRY NUMBER:	1132769

One of the largest historic houses in England. Built for the 1st Marquess of Rockingham, the Baroque West Front in 1725 -35 and the 606-foot-wide Palladian East Front in 1734 - 50, the latter designed by Henry Flitcroft. The house was further enlarged by John Carr in 1782 - 84. The house now belongs to the Wentworth Woodhouse Preservation Trust. North Wing in deteriorating condition and West Front in poor repair. Most of the East Front has been reroofed. Further Historic England grant has supported repairs to the end pavilions and the north west wing. Repairs continue across the site.

Contact: Giles Proctor 01904 601981

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.
- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

SITE NAME:	Kimberworth motte and bailey castle		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1013469
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Dumping	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985
SITE NAME:	Roman Ridge: section 110yds (100 metres) long, 450yds (410 metres) NNE of Kimberworth Park Farm		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004835
CONDITION:	Generally satisfactory but with minor localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985
SITE NAME:	Roman Ridge: section 400yds (370 metres) long from Hill Top Lane to Little Common Lane		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004808
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Visitor erosion - moderate	NEW ENTRY?:	No
OWNER TYPE:	Local authority	CONTACT:	Nicky Brown 01904 601985
SITE NAME:	Roman Ridge: section 400yds (370 metres) long in Wath Wood		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004811
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Vehicle damage/erosion - moderate	NEW ENTRY?:	No
OWNER TYPE:	Local authority	CONTACT:	Nicky Brown 01904 601985
SITE NAME:	Roman Ridge: south east of Hill Top (section 700yds (660 metres) long, Meadowhall Road to Hill Top)		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004807
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Deterioration - in need of management	NEW ENTRY?:	No
OWNER TYPE:	Local authority	CONTACT:	Nicky Brown 01904 601985
SITE NAME:	Roman Ridge: section 400yds (370 metres) long south of Abdy Farm, Wentworth		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004810
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable clipping	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985
SITE NAME:	Roman Ridge: section 500yds (460 metres) long, north of Dog Kennel Pond, Wentworth Park, Wentworth		
DESIGNATION:	Scheduled Monument, RPG grade II*	LIST ENTRY NUMBER:	1004832
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Stock erosion - extensive	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
C Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
 Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

SITE NAME:	Doncaster Road, Rotherham Town Centre		
DESIGNATION:	Conservation Area, 2 LBs	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	Deteriorating significantly
VULNERABILITY:	Low	CONTACT:	Jonathan Bell (LPA) 01709 823811

SITE NAME:	Rotherham Town Centre		
DESIGNATION:	Conservation Area, 20 LBs, part in SM	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	Improving significantly
VULNERABILITY:	Low	CONTACT:	Jonathan Bell (LPA) 01709 823811

SITE NAME:	Wales, Rotherham South, Wales		
DESIGNATION:	Conservation Area, 6 LBs	NEW ENTRY?:	No
CONDITION:	Poor	TREND:	Deteriorating
VULNERABILITY:	Low	CONTACT:	Jonathan Bell (LPA) 01709 823811

SHEFFIELD



SITE NAME:	Beehive Works, Milton Street
DESIGNATION:	Listed Building grade II*
CONDITION:	Poor
OCCUPANCY:	Part occupied/part in use
PRIORITY CATEGORY:	D (D)
OWNER TYPE:	Commercial company
LIST ENTRY NUMBER:	1271239

Purpose-built cutlery works, constructed in phases between the late 1850s, or early 1860s, and c1890. Much of the site has been repaired and is in use as offices, workshops and other commercial operations. The four-storey workshop range to the rear of the second courtyard is only partially occupied and its vacant upper floors are in poor condition having suffered structural movement and water ingress over a prolonged period. Project Development, supported by Historic England grant, is complete and the future of the whole site is being considered.

Contact: Giles Proctor 01904 601981



SITE NAME:	Cementation furnace, Hoyle Street
DESIGNATION:	Scheduled Monument, LB grade II, CA
CONDITION:	Poor
OCCUPANCY:	N/A
PRIORITY CATEGORY:	C (D)
OWNER TYPE:	Commercial company
LIST ENTRY NUMBER:	1004791

Late C19 cementation furnace, brick with wrought iron reinforcement. Conical tower topped with a square flue with an iron flap damper. The sole, intact, survivor of an industrial building once widespread in Sheffield, it remained in use until 1952. The furnace is deteriorating and woody vegetation is growing from the brickwork.

Contact: Giles Proctor 01904 601981



SITE NAME:	Globe Works, Penistone Road
DESIGNATION:	Listed Building grade II*, CA
CONDITION:	Fair
OCCUPANCY:	Part occupied/part in use
PRIORITY CATEGORY:	D (F)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	1271128

Dating to 1825, with later C19 workshop ranges, this is Sheffield's earliest known surviving example of a purpose-built cutlery and edge tool works retaining both its front display range and workshop ranges. It incorporates four hand forges and the only known remaining example of urban back-to-back grinding hulls. The front range of this complex is occupied and in good condition. Some of the rear ranges have been repaired and reoccupied. One range is still derelict and in poor condition, but a scheme of repair and conversion has been approved.

Contact: Giles Proctor 01904 601981

© Historic England

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.
- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

- CA** Conservation Area
- LB** Listed Building
- LPA** Local Planning Authority
- NP** National Park
- RPG** Registered Park and Garden
- SM** Scheduled Monument
- UA** Unitary Authority
- WHS** World Heritage Site



© Historic England

SITE NAME:	Park Hill, Talbot Street, Park Hill, Duke Street, Park Hill, south Street
DESIGNATION:	Listed Building grade II*
CONDITION:	Poor
OCCUPANCY:	Part occupied/part in use
PRIORITY CATEGORY:	F (F)
OWNER TYPE:	Commercial company
LIST ENTRY NUMBER:	1246881

1957- 60 innovative flats development by the City Architect's Department under JL Womersley, designed by Jack Lynn and Ivor Smith, part of post-war slum clearance. Exposed concrete frame grid to elevations with brick infill panels. Combines one and two storey units with 'streets in the sky' deck access. Laid out in four cranked ranges to take advantage of the sunlight and views. three of five phases completed, Phase four and five have planning consent and are seeking funding.

Contact: Bryan Davies 01904 601867



© Elden Minns and Co. Ltd

SITE NAME:	Bower Spring Cementation Furnace
DESIGNATION:	Scheduled Monument, CA
CONDITION:	Poor
OCCUPANCY:	N/A
PRIORITY CATEGORY:	A (A)
OWNER TYPE:	Charity (heritage)
LIST ENTRY NUMBER:	1004795

Remains of two early C19 brick-built cementation furnaces, with parts of the cone-shaped superstructures incorporated in a boundary wall. Very rare survivals of once common furnaces used for early methods of mass producing steel.

Contact: Nicky Brown 01904 601985



© Historic England

SITE NAME:	Old Hall Farmhouse, Broughtholmlee Lane, Bradfield
DESIGNATION:	Listed Building grade II*, CA
CONDITION:	Very bad
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	B (B)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	1132870

C15 yeoman house with cruck frame dating to 1484. The original timber framed dwelling was encased in local gritstone in C17 and a two-storey stone extension was added to the west of the original house. In late-C17 a stone parlour block was added to the east. The farmhouse is in very poor condition but has received Planning Permission and Listed Building Consent for a scheme of repair and conversion.

Contact: Bryan Davies 01904 601867



© Historic England

SITE NAME:	Loxley United Reformed Church, Loxley Road, Bradfield
DESIGNATION:	Listed Building grade II*
CONDITION:	Very bad
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	A (A)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	1314565

Former United Reformed church of 1787, closed in 1994. The building was gutted by fire in August 2016 and is now a shell. Works have been undertaken to stabilise the walls and to restrict access. Restoration and reuse is under discussion.

Contact: Giles Proctor 01904 601981



© Historic England

SITE NAME:	Seventh Day Adventist Church adjoining school and boundary wall, Andover Street
DESIGNATION:	Listed Place of Worship grade II
CONDITION:	Poor
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1246453

Gothic Revival Victorian chapel, now Seventh Day Adventist Church, dating to 1865 by William Hill of Leeds for the Methodist New Connexion and school dated 1862. Rock-faced stone with ashlar dressings and steep pitched gabled and hipped slate roofs with coped gables. Roofs and rainwater goods in poor condition.

Contact: Bryan Davies 01904 601867

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.
- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site



© Historic England

SITE NAME:	Church of St Mary, Howard Road, Sheffield
DESIGNATION:	Listed Place of Worship grade II
CONDITION:	Poor
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1270449

Parish church in the Gothic Revival style dating to 1869, with vestry added in 1928. High-level roof coverings and rainwater goods were repaired with grant offered under National Lottery Heritage Fund and Historic England's former Repair Grants for Places of Worship scheme. North and south aisle roofs remain in poor condition. An unsuccessful application to National Lottery Heritage Fund's former Grants for Places of Worship scheme was made in 2017.

Contact: Bryan Davies 01904 601867



© Historic England

SITE NAME:	Church of St Catherine, Richmond Road, Sheffield
DESIGNATION:	Listed Place of Worship grade II
CONDITION:	Fair
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1375535

Built in 1959, a Basil Spence design concurrent with Coventry Cathedral. Cracks have appeared in the bell tower, allowing water ingress into the structure and rust jacking. The tower's piers are starting to significantly split and pull apart. The copper flat roof design original to the build date has now failed in numerous places leading to water ingress and damage to the interior. The water ingress within the roof structure has damaged what we believe is the strammit board, rendering it non-structural. Consequently, access to this roof has restricted maintenance.

Contact: Bryan Davies 01904 601867



© Historic England

SITE NAME:	Church of St Paul, Wordsworth Avenue, Sheffield
DESIGNATION:	Listed Place of Worship grade II*
CONDITION:	Poor
PRIORITY CATEGORY:	A (A)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1376605

1960s church by Sir Basil Spence. Some repairs, grant-aided under the National Lottery Heritage Fund and Historic England's former Repair Grants for Places of Worship scheme, have been completed to the body of the church but further extensive repair is needed to the concrete cloisters which extend from the front.

Contact: Bryan Davies 01904 601867

SITE NAME:	Roman Ridge: section 600yds (550 metres) long between Jenkin Lane (now Road) and Tylers Street		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004806
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Visitor erosion - moderate	NEW ENTRY?:	No
OWNER TYPE:	Local authority	CONTACT:	Nicky Brown 01904 601985

SITE NAME:	Bower Spring cementation furnace		
DESIGNATION:	Scheduled Monument, CA	LIST ENTRY NUMBER:	1004795
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Deterioration - in need of management	NEW ENTRY?:	No
OWNER TYPE:	Charity (heritage)	CONTACT:	Nicky Brown 01904 601985

SITE NAME:	Little Matlock rolling mill immediately south and east of Olive Terrace, Bradfield		
DESIGNATION:	Scheduled Monument, LB grade II*	LIST ENTRY NUMBER:	1019857
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Other	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
C Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
 Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

SITE NAME:	Handlands Romano-British settlement, 460 metres south west of Woodseats Farm, Ecclesfield		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1017835
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Visitor erosion - extensive	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985

SITE NAME:	Willow Garth moated site and fishpond, Ecclesfield		
DESIGNATION:	Scheduled Monument, CA	LIST ENTRY NUMBER:	1012477
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Improving
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985

SITE NAME:	Iron Age and Roman quern workings on Wharncliffe Rocks, Stocksbridge		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1004802
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Bracken	NEW ENTRY?:	No
OWNER TYPE:	Government or agency	CONTACT:	Nicky Brown 01904 601985



© Historic England

SITE NAME:	Oakes Park, Sheffield	Gardens and pleasure grounds with early to mid-C18 origins, an early C19 terrace and parkland probably dating from the early C19. Park and gardens compromised by multiple uses, condition of park is poor and listed structures in very poor condition.
DESIGNATION:	Registered Park and Garden grade II, 9 LBs	
CONDITION:	Extensive significant problems	
VULNERABILITY:	High	
TREND:	Declining	
NEW ENTRY?:	No	
OWNER TYPE:	Mixed, multiple owners	Contact: Bryan Davies 01904 601867
LIST ENTRY NUMBER:	1001160	

SITE NAME:	Furnace Hill, Sheffield		
DESIGNATION:	Conservation Area, 7 LBs, 2 SMs	NEW ENTRY?:	No
CONDITION:	Poor	TREND:	Deteriorating
VULNERABILITY:	Medium	CONTACT:	Neall Bower (LPA) 07880 413976

SITE NAME:	Hillsborough Park		
DESIGNATION:	Conservation Area, 9 LBs	NEW ENTRY?:	No
CONDITION:	Poor	TREND:	Deteriorating
VULNERABILITY:	Low	CONTACT:	Neall Bower (LPA) 07880 413976

SITE NAME:	Well Meadow		
DESIGNATION:	Conservation Area, 7 LBs	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	Improving
VULNERABILITY:	Low	CONTACT:	Neall Bower (LPA) 07880 413976

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.
- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

WEST YORKSHIRE

BRADFORD



© Historic England

SITE NAME: **Feversham Street First School, Feversham Street**

DESIGNATION: Listed Building grade II*

CONDITION: Poor

OCCUPANCY: Part occupied/part in use

PRIORITY CATEGORY: C (C)

OWNER TYPE: Private

LIST ENTRY NUMBER: 1133162

Gothic Revival style school of 1873 commissioned by the Bradford School Board in response to the 1870 Elementary Education Act and designed by Lockwood and Mawson. This school later became the first mixed Higher Elementary Board School in England. It closed as a school in 1993 and its condition has subsequently deteriorated. Roofs are in very poor condition.

Contact: Bryan Davies 01904 601867



© Historic England

SITE NAME: **Manningham Mill (ancillary buildings and boiler house), Heaton Street, Heaton**

DESIGNATION: Listed Building grade II*, CA

CONDITION: Fair

OCCUPANCY: Part occupied/part in use

PRIORITY CATEGORY: F (F)

OWNER TYPE: Commercial company

LIST ENTRY NUMBER: 1314426

Silk mill with boiler house, chimney and warehouse. 1870 to 1873 with later additions. Partial scheme of residential and office conversion complete. A Project Development Grant for Heritage at Risk was awarded by Historic England to develop a scheme to retain and repair the imposing perimeter wall. Accepted in 2019. Some repairs to the walls have been undertaken with steel propping. A costed masterplan is complete with new use proposed, structural and architectural treatment to the walls has been drawn up. The perimeter walls are still vulnerable.

Contact: Bryan Davies 01904 601867



© Historic England

SITE NAME: **Leventhorpe Hall, 1289 and 1291, Thornton Road, Lower Grange**

DESIGNATION: Listed Building grade II*

CONDITION: Poor

OCCUPANCY: Vacant/not in use

PRIORITY CATEGORY: D (D)

OWNER TYPE: Commercial company

LIST ENTRY NUMBER: 1133692

Late C17 house with C19 additions. Roof structure intact but at risk of further decay and eventual collapse. Main walls, despite significant areas of movement are capable of repair. All the windows require replacement. The Hall forms part of a group of historic buildings that includes two grade II listed barns. A new owner has secured Planning Permission and Listed Building Consent for alterations to bring the property back into use supported by the construction of 26 new houses as Enabling Development on adjacent land within the Green Belt.

Contact: Bryan Davies 01904 601867



© Historic England

SITE NAME: **Dalton Mills, all attached buildings and yard surface, Dalton Lane, Keighley**

DESIGNATION: Listed Building grade II*

CONDITION: Very bad

OCCUPANCY: Part occupied/part in use


PRIORITY CATEGORY: A (A)

OWNER TYPE: Private

LIST ENTRY NUMBER: 1134129

Worsted mill built between 1866 and 1877 for J&J Craven. The site comprises three multi-storey mills: Tower Mill (not at risk), Genappe Mill and New Mill. There are also several ancillary buildings, chimney and intact surviving machinery. Genappe Mill was subject to an extensive fire in March 2022 which resulted in collapse of the internal roof and floor structure with perimeter walls now free-standing.

Contact: Richard Butterfield 01904 601995

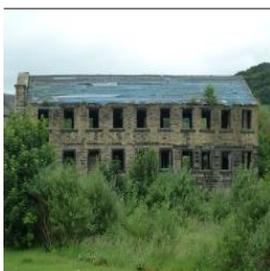

© Historic England

SITE NAME: **Mill Building at Low Mills, Low Mill Lane, Keighley**

DESIGNATION: Listed Building grade II*

CONDITION: Very bad

OCCUPANCY: Vacant/not in use

PRIORITY CATEGORY: A (A)

OWNER TYPE: Commercial company

LIST ENTRY NUMBER: 1200162

Late C18. Early cotton mill, adjacent to supermarket and car park. Discussions underway with new owner regarding potential reuse and development.

Contact: Nicky Brown 01904 601985

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
C Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
 Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

- CA** Conservation Area
LB Listed Building
LPA Local Planning Authority
NP National Park
RPG Registered Park and Garden
SM Scheduled Monument
UA Unitary Authority
WHS World Heritage Site



© Historic England

SITE NAME:	Bradford Synagogue (Reform), Bowland Street
DESIGNATION:	Listed Place of Worship grade II*
CONDITION:	Fair
PRIORITY CATEGORY:	F (F)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1227613

Synagogue of 1880 to 1881 in the Moorish revival style by Francis and Thomas Healey. The principal elevation is of gold and red banded ashlar with bracketed eaves and an ornate pierced parapet. It has a central raised panel with a Hebrew inscription beneath the cresting incorporating the Star of David. Repair works to the roofs and rainwater goods were carried out in 2015 with funding from the National Lottery Heritage Fund's former Grants for Places of Worship scheme. An outbreak of dry rot has been treated and the building is being monitored to ensure that it does not recur.

Contact: Bryan Davies 01904 601867



© Historic England

SITE NAME:	Church of St John, Wakefield Road
DESIGNATION:	Listed Place of Worship grade II
CONDITION:	Poor
PRIORITY CATEGORY:	D (D)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1314137

Dating to 1842, this church was built at the expense of the Bowling Iron Company. The architects, RH and S Sharpe of York, were assisted by Fred Stott, works engineer at the Bowling Foundry, as its construction made extensive use of iron. The chancel and transept roofs have been re-covered, but the remaining roofs need attention. The rainwater goods and cast iron windows are in poor condition. The parish are fundraising for further work.

Contact: Bryan Davies 01904 601867



© Historic England

SITE NAME:	Church of St Saviour, Ings Way, Fairweather Green
DESIGNATION:	Listed Place of Worship grade II
CONDITION:	Fair
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1392312

Church of 1966 with attached hall of 1971, both designed by architect George Pace. Characterised by asymmetric arrangement of roofs, exposed structure and juxtaposition of materials, this is a complete and largely unaltered example of Pace's work. Repair works to the roof were carried out in 2016 with funding from the National Lottery Heritage Fund's former Grants for Places of Worship scheme. A further phase of work is required to repair the windows.

Contact: Bryan Davies 01904 601867



© Historic England

SITE NAME:	Church of St Paul and St Jude, Church Street
DESIGNATION:	Listed Place of Worship grade II, CA
CONDITION:	Poor
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1133216

Large church with prominent spire and crossing tower dating from 1847 to 1848 by architects Mallinson and Healy. Repairs were carried out in 2016 to the tower and spire and the chancel and north transept roofs with funding from the National Lottery Heritage Fund's former Grants for Places of Worship scheme. Further phases of repair are required to put the roofs of the nave, south transept, choir vestry and aisles into good condition. A Faculty has been granted for some repairs to the north porch.

Contact: Bryan Davies 01904 601867



© Historic England

SITE NAME:	Church of St James, Haworth Road Crossroads, Haworth, Cross Roads and Stanbury
DESIGNATION:	Listed Place of Worship grade II
CONDITION:	Poor
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1266785

Parish church of 1909 to 1910 designed by JB Bailey & Son of Keighley. The building comprises nave with north and south aisles; chancel with organ chamber, vestry and sacristy and a north west porch which was to have formed the lowest stage of a tower that was never built. Aisle windows incorporate modern stained glass. Aisle roofs, rainwater goods and clerestory windows were repaired in 2016 with funding from the National Lottery Heritage Fund's former Grants for Places of Worship scheme. High-level roofs have subsequently deteriorated and require a further phase of repair.

Contact: Bryan Davies 01904 601867

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.
- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site



© Historic England

SITE NAME:	Church of St Paul, Kirkgate, Shipley
DESIGNATION:	Listed Place of Worship grade II
CONDITION:	Fair
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1133546

Commissioners' Church of 1823 to 1825 designed in the Perpendicular style by John Oates of Halifax. Roofs, rainwater goods, high-level masonry and glazing were in poor condition. Repair works to the south slope of the nave were carried out in 2015 with funding from the National Lottery Heritage Fund's former Grants for Places of Worship scheme. A second National Lottery Heritage Fund grant was accepted in 2017 and repairs to the north slope of the nave were completed in 2018. A final phase of work to repair the chancel is planned.

Contact: Giles Proctor 01904 601981



© Historic England

SITE NAME:	Church of St Stephen, Donisthorpe Street, Trident
DESIGNATION:	Listed Place of Worship grade II
CONDITION:	Fair
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1133174

Victorian city church by Mallinson and Healey, 1859-60. Grant-aided repair works to the north, east and south elevations have now been completed with funding from both the National Lottery Heritage Fund and Historic England's former Repair Grants for Places of Worship scheme and National Lottery Heritage Fund's former Grants for Places of Worship scheme. Internal repairs including the installation of a new heating system have recently been undertaken. Repairs to the west elevation and tower are still required.

Contact: Bryan Davies 01904 601867

SITE NAME:	Twelve Apostles stone circle, Burley Moor, Burley	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER: 1011763
CONDITION:	Generally unsatisfactory with major localised problems	TREND: Declining
PRINCIPAL VULNERABILITY:	Visitor erosion - extensive	NEW ENTRY?: No
OWNER TYPE:	Private	CONTACT: Nicky Brown 01904 601985

SITE NAME:	Late prehistoric enclosed settlement known as Catstones Ring on Catstones Hill, Cullingworth	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER: 1018240
CONDITION:	Generally unsatisfactory with major localised problems	TREND: Declining
PRINCIPAL VULNERABILITY:	Bracken	NEW ENTRY?: No
OWNER TYPE:	Private	CONTACT: Nicky Brown 01904 601985



© Historic England

SITE NAME:	Whinburn, Keighley
DESIGNATION:	Registered Park and Garden grade II, 3 LBs
CONDITION:	Generally unsatisfactory with major localised problems
VULNERABILITY:	High
TREND:	Declining
NEW ENTRY?:	No
OWNER TYPE:	Private
LIST ENTRY NUMBER:	1001643

Gardens and pleasure grounds belonging to Whinburn Lodge partly laid out c1897 with additional formal landscaping and features dating from 1912 to 1938, with some design work in the latter period by TH Mawson and Son. The gardens are overgrown and its buildings and structures are in need of repair. The house has fine Edwardian interiors. The property is currently for sale.

Contact: Giles Proctor 01904 601981

SITE NAME:	Apsley Crescent, Manningham, Bradford	
DESIGNATION:	Conservation Area, 15 LBs	NEW ENTRY?: No
CONDITION:	Poor	TREND: Deteriorating
VULNERABILITY:	Low	CONTACT: Jon Ackroyd (LPA) 01274 433952

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.
- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

SITE NAME:	Devonshire Park and Cliffe Castle, Keighley, Keighley		
DESIGNATION:	Conservation Area, 10 LBs	NEW ENTRY?:	No
CONDITION:	Poor	TREND:	Deteriorating
VULNERABILITY:	Low	CONTACT:	Jon Ackroyd (LPA) 01274 433952
SITE NAME:	Great Horton		
DESIGNATION:	Conservation Area, 43 LBs, part in RPG grade II	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	Deteriorating
VULNERABILITY:	Low	CONTACT:	Jon Ackroyd (LPA) 01274 433952
SITE NAME:	Heaton Estates		
DESIGNATION:	Conservation Area, 8 LBs	NEW ENTRY?:	No
CONDITION:	Poor	TREND:	Deteriorating
VULNERABILITY:	Low	CONTACT:	Jon Ackroyd (LPA) 01274 433952
SITE NAME:	Idle and The Green		
DESIGNATION:	Conservation Area, 36 LBs	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	Deteriorating
VULNERABILITY:	Low	CONTACT:	Jon Ackroyd (LPA) 01274 433952
SITE NAME:	Little Horton Lane, Bradford, Trident		
DESIGNATION:	Conservation Area, 60 LBs	NEW ENTRY?:	No
CONDITION:	Poor	TREND:	Deteriorating
VULNERABILITY:	Low	CONTACT:	Jon Ackroyd (LPA) 01274 433952
SITE NAME:	North Park Road		
DESIGNATION:	Conservation Area, 13 LBs, part in RPG grade II	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	Deteriorating
VULNERABILITY:	Low	CONTACT:	Jon Ackroyd (LPA) 01274 433952
SITE NAME:	Southfield Square, Manningham, Bradford		
DESIGNATION:	Conservation Area, 6 LBs	NEW ENTRY?:	No
CONDITION:	Poor	TREND:	Deteriorating
VULNERABILITY:	Low	CONTACT:	Jon Ackroyd (LPA) 01274 433952
SITE NAME:	St Paul		
DESIGNATION:	Conservation Area, 18 LBs, part in RPG grade II	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	Deteriorating
VULNERABILITY:	Low	CONTACT:	Jon Ackroyd (LPA) 01274 433952
SITE NAME:	The Goitside, Bradford		
DESIGNATION:	Conservation Area, 5 LBs	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	Deteriorating
VULNERABILITY:	Low	CONTACT:	Jon Ackroyd (LPA) 01274 433952
SITE NAME:	Thornton		
DESIGNATION:	Conservation Area, 52 LBs	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	Deteriorating
VULNERABILITY:	Low	CONTACT:	Jon Ackroyd (LPA) 01274 433952

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.
- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

BRADFORD / KIRKLEES / LEEDS



© Battlefields Trust

SITE NAME:	Battle of Adwalton Moor, Drighlington
DESIGNATION:	Registered Battlefield, LB grade II
CONDITION:	Generally satisfactory but with significant localised problems
VULNERABILITY:	High
TREND:	Stable
PRIORITY CATEGORY:	D (D)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	1000000

The 1643 battle during the English Civil War on moorland outside Bradford in which some 14,000 men fought, gave control of the north of England to the Royalists. The battlefield faces various development pressures. Historic England is advising Local Planning Authorities on managing these issues through their respective Local Plans.

Contact: Keith Emerick 01904 601988

CALDERDALE



© Historic England

SITE NAME:	Former boiler house and attached chimney to north of Old Lane Mill, Old Lane
DESIGNATION:	Listed Building grade II*
CONDITION:	Very bad
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	1272533

Boiler house and integral chimney of 1827 to 1828, built to serve Old Lane Mill which is the oldest and largest surviving example of a multi-storey, steam-powered, iron-framed textile mill in Halifax. Not in use and in poor repair.

Contact: Nicky Brown 01904 601985



© Historic England

SITE NAME:	Old Lane Mill, Old Lane, Rawson's Mill, Old Lane
DESIGNATION:	Listed Building grade II*
CONDITION:	Poor
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	1244144

Worsted mill of 1825 to 1828, the oldest and largest surviving example of a multi-storey, steam-powered, iron-framed textile mill in Halifax. Unoccupied and in poor repair. This site has been subject to heritage crime. Planning and Listed building consent have been applied for for conversion of the mill to residential apartments.

Contact: Nicky Brown 01904 601985



© Historic England

SITE NAME:	Ovenden Hall, Ovenden Road
DESIGNATION:	Listed Building grade II*
CONDITION:	Poor
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Commercial company
LIST ENTRY NUMBER:	1242456

Completed 1662 for Joseph Fourness, a wealthy agent engaged in the buying and selling of cloth in London. It has an imposing south front of higher quality masonry, originally with three gables; the west wing was added in the late C19. A service wing was added in the C18 and has recently been converted to self-contained dwellings. The roof to the hall is in poor condition with attendant decay. The building has been subject to heritage crime. Historic England is working with the owners to cost repairs to the building and explore opportunities for reuse.

Contact: Richard Butterfield 01904 601995

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.
- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

	<p>SITE NAME: Scout Hall, Lee Lane, Halifax</p> <p>DESIGNATION: Listed Building grade II*</p> <p>CONDITION: Fair</p> <p>OCCUPANCY: Occupied/in use</p> <p>PRIORITY CATEGORY: F (F)</p> <p>OWNER TYPE: Private</p> <p>LIST ENTRY NUMBER: 1203783</p>	<p>Late C17 house. The interior has been converted and is occupied as a dwelling. The external stone work repairs are not yet complete.</p> <p>Contact: Bryan Davies 01904 601867</p>
	<p>SITE NAME: Former lock-up, 121, Keighley Road, Illingworth, Halifax</p> <p>DESIGNATION: Listed Building grade II*</p> <p>CONDITION: Very bad</p> <p>OCCUPANCY: Vacant/not in use</p> <p>PRIORITY CATEGORY: B (B)</p> <p>OWNER TYPE: Local authority</p> <p>LIST ENTRY NUMBER: 1314017</p>	<p>Dating to 1823 the lock-up is a small two-storey building with coursed sandstone walls and stone slate roof. The roof covering and drainage is in very poor condition. North Halifax Historic Buildings Preservation Trust hopes to acquire the building by asset transfer from the Local Authority. A condition survey and options appraisal has been completed with grant from the Architectural Heritage Fund and a schedule of repair has been developed with grant from Historic England. A working party, organised by the Society for the Protection of Ancient Buildings, has carried out some holding repairs.</p> <p>Contact: Nicky Brown 01904 601985</p>
	<p>SITE NAME: Double aisled barn to north west of Kirklees Priory Gatehouse, Kirklees Park, Brighouse</p> <p>DESIGNATION: Listed Building grade I, RPG grade II</p> <p>CONDITION: Fair</p> <p>OCCUPANCY: Part occupied/part in use</p> <p>PRIORITY CATEGORY: C (C)</p> <p>OWNER TYPE: Private</p> <p>LIST ENTRY NUMBER: 1133848</p>	<p>Aisled barn. One of the farm buildings of the former Priory, with a C15 timber frame, later stone-clad. The north east corner of stables and the north threshing porch are unstable. The roof of the stables is in poor condition, although some maintenance has been carried out. Repair and reuse is under discussion.</p> <p>Contact: Giles Proctor 01904 601981</p>
	<p>SITE NAME: Home Farm Building No. 6, Kirklees Park, Brighouse</p> <p>DESIGNATION: Listed Building grade II*, RPG grade II</p> <p>CONDITION: Very bad</p> <p>OCCUPANCY: Vacant/not in use</p> <p>PRIORITY CATEGORY: C (C)</p> <p>OWNER TYPE: Private</p> <p>LIST ENTRY NUMBER: 1133805</p>	<p>Early C17 cowhouse and a two cell house, possibly originally a slaughter house. The east gable wall and the roof have partially collapsed. The fallen material has been cleared and the building has been made safe.</p> <p>Contact: Giles Proctor 01904 601981</p>
	<p>SITE NAME: L-shaped aisled barn, Kirklees Park, Brighouse</p> <p>DESIGNATION: Listed Building grade II*, RPG grade II</p> <p>CONDITION: Fair</p> <p>OCCUPANCY: Vacant/not in use</p> <p>PRIORITY CATEGORY: C (C)</p> <p>OWNER TYPE: Private</p> <p>LIST ENTRY NUMBER: 1133808</p>	<p>Aisled barn, early C16, encased in stone during the early to mid-C17. An area of roof is missing to the north and there is some timber decay to the frame. Some maintenance has been undertaken.</p> <p>Contact: Giles Proctor 01904 601981</p>

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.
- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site



© Historic England

SITE NAME:	Malthouse, Kirklees Park, Brighouse
DESIGNATION:	Listed Building grade I, RPG grade II
CONDITION:	Fair
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	1133809

Malthouse, late C17, which forms part of a farm complex. The building is in a stable condition, but disused.

Contact: Giles Proctor 01904 601981



© Historic England

SITE NAME:	Broad Bottom Old Hall, Mytholmroyd, Hebden Royd
DESIGNATION:	Listed Building grade II*
CONDITION:	Poor
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	D (D)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	1279330

A rare and important example of an aisled timber-framed open hall dating to 1464 and encased in stone in late C16. Watertight but vacant for some years and vulnerable to decay without a sustaining use. Old Hall was probably built for the Draper family, who were cloth merchants. The estate is typical of the post-medieval economy of the Calder valley combining small-scale farming with textile production. Tree ring dating and a historical and architectural survey have been completed. Historic England grant-aided Project Development is complete.

Contact: Nicky Brown 01904 601985



© Historic England

SITE NAME:	Barn to north west of Greenwood Lee, Widdop Road, Heptonstall
DESIGNATION:	Listed Building grade II*
CONDITION:	Very bad
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	F (C)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	1265719

Late C16 aisled barn. Major failure of roof structure and loss of roof covering. The east end gable wall has Listed Building Consent to rebuild and work is on site to repair and restore the building.

Contact: Nicky Brown 01904 601985



© Historic England

SITE NAME:	Wainsgate Baptist Church, Wainsgate Lane, Hebden Bridge, Wadsworth
DESIGNATION:	Listed Building grade II*
CONDITION:	Poor
OCCUPANCY:	Part occupied/part in use
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Charity (heritage)
LIST ENTRY NUMBER:	1227399

Former chapel with attached Sunday school and minister's house dating from 1859. The chapel is now wind and water tight following grant-aided repairs but the interior remains in very poor condition following prolonged and extensive water ingress and this is limiting the use of the building.

Contact: Nicky Brown 01904 601985



© Historic England

SITE NAME:	Church of St Peter, Town Gate, Halifax
DESIGNATION:	Listed Place of Worship grade I
CONDITION:	Poor
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1313775

Church of 1763 to 1766 in the Classical style, based on the design for the Church of the Holy Trinity, Leeds. The building incorporates a nave with massive composite columns and horseshoe gallery, north organ chamber and vestry, apsidal sanctuary and three-stage west tower. The finely decorated interior is particularly noteworthy and includes Royal Arms dated 1766 flanked by four cartouches with coats of arms by Guiseppe Cortese, the Ten Commandments and relief figures of Moses and Jesus. Water ingress is causing damage to the finishes and decorations.

Contact: Bryan Davies 01904 601867


PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.
- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

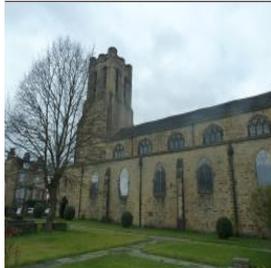

© Historic England

SITE NAME:	Church of St Paul, Queen's Road, King Cross
DESIGNATION:	Listed Place of Worship grade II*
CONDITION:	Poor
PRIORITY CATEGORY:	D (D)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1258113

Large parish church of 1911 to 1912 in the free-Perpendicular style by Sir Charles Nicholson. The church comprises a three-stage west tower; nave with aisles and porches; chancel with chapel, vestries and an organ chamber with a south west bellcote turret. Masonry is in poor condition, particularly to the tower which suffers extensive water ingress. The tower and nave roofs are also defective. A scheme for repair has been approved and fundraising is ongoing.

Contact: Bryan Davies 01904 601867



© Historic England

SITE NAME:	Christ Church, Church Lane, Mount Pellon
DESIGNATION:	Listed Place of Worship grade II
CONDITION:	Fair
PRIORITY CATEGORY:	D (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1313998

Large Gothic Revival Commissioners' Church built in 1853 to 1854. Some roofs in poor condition. A National Lottery Heritage Fund Grants for Places of Worship Repair grant was accepted in 2018 and repairs have been carried out to the south arcade and the roofs, masonry and rainwater goods of the tower and Lady Chapel. A further phase of roof repair is planned.

Contact: Bryan Davies 01904 601867



© Historic England

SITE NAME:	Church of St James, Church Lane, Hebden Royd
DESIGNATION:	Listed Place of Worship grade II
CONDITION:	Fair
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1229139

Early C19 Gothic church, with additions by Richard Norman Shaw. The north slope of the roof was re-covered in 2016 with the support of a National Lottery Heritage Fund Grant for Places of Worship. A further NLHF grant for the re-covering of the south roof slope has been withdrawn, although some urgent repairs have been carried out.

Contact: Giles Proctor 01904 601981



© Historic England

SITE NAME:	Church of St Michael and All Angels, Burnley Road, Todmorden
DESIGNATION:	Listed Place of Worship grade II
CONDITION:	Fair
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1133755

A church by Charles Hodgson Fowler, built in 1902, with embattled west tower and octagonal spire. It is constructed from hammer-dressed stone with ashlar dressings. The vestry roof has recently been repaired. Some further work is needed to the south aisle roof and the tower.

Contact: Giles Proctor 01904 601981

SITE NAME:	Castle Hill univallate defended settlement, Kirklees Park		
DESIGNATION:	Scheduled Monument, LB grade II, RPG grade II	LIST ENTRY NUMBER:	1005806
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985

SITE NAME:	Mill gas plant, Shaw Lodge Mills		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1005783
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Collapse	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
C Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
 Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

SITE NAME:	Ventilation chimney and furnace house 260 metres south of Park Farm		
DESIGNATION:	Scheduled Monument, part in RPG grade II	LIST ENTRY NUMBER:	1017655
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Collapse	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985

SITE NAME:	Cairnfield on Ringstone Edge Moor, 240 metres south west of Clay House, Ripponden		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1018560
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985

SITE NAME:	Ring cairn known as the Ring of Stones on Ringstone Edge Moor, 800 metres south of Upper Gosling Royd, Ripponden		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1018559
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Unknown
PRINCIPAL VULNERABILITY:	Arable clipping	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985

SITE NAME:	Akroydon		
DESIGNATION:	Conservation Area, 27 LBs	NEW ENTRY?:	No
CONDITION:	Poor	TREND:	Deteriorating
VULNERABILITY:	Medium	CONTACT:	Kate Peach (LPA) 01422 392265

SITE NAME:	Elland		
DESIGNATION:	Conservation Area, 20 LBs	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	Improving
VULNERABILITY:	Low	CONTACT:	Kate Peach (LPA) 01422 392265

KIRKLEES



© Historic England

SITE NAME:	Former Huddersfield Infirmary
DESIGNATION:	Listed Building grade II*, CA
CONDITION:	Poor
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Commercial company
LIST ENTRY NUMBER:	1228645

Huddersfield's first infirmary was opened in 1831 to designs by architect John Oates. It was built in response to concerns about industrial accidents and funded by public donations. Originally set in landscaped gardens, its grand entrance was modelled on a Greek temple. Through later additions, its accommodation grew from 20 beds to 85 by 1885. It was last in use as a college. The roof is leaking significantly causing damage to the roof structure, walls and interior. The building has been subject to heritage crime. Its reuse forms part of a major mixed use development proposal, Trinity West.

Contact: Bryan Davies 01904 601867



© Historic England

SITE NAME:	New House Hall, Newhouse Road
DESIGNATION:	Listed Building grade II*
CONDITION:	Fair
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	F (F)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	1279156

Built by Thomas Brooke in c1550, the hall range and solar wing were altered in C17 by later generations of the Brooke family and the east wing was rebuilt in 1865 and refronted in 1903. The oldest part of the hall was extensively damaged by a fire in April 2017. A new owner is undertaking repairs to the house, although a temporary roof was still in place in April 2023.

Contact: Giles Proctor 01904 601981

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.
- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site



© Historic England

SITE NAME: Boiler house, engine house, rope race, water tower and powerhouse at Westwood Mills, Lowestwood Lane, Linthwaite, Huddersfield

DESIGNATION: Listed Building grade II*, CA

CONDITION: Very bad

OCCUPANCY: Vacant/not in use

PRIORITY CATEGORY: B (B)

OWNER TYPE: Commercial company

LIST ENTRY NUMBER: 1271263

Early C19 boiler and engine houses, rope race with water tower and powerhouse to former mill. Other buildings on the site include the former scribbling, carding and fulling mill, office, warehouse and workshops. An application was submitted in 2020 for conversion of the mill to residential use.

Contact: Richard Butterfield 01904 601995



© Historic England

SITE NAME: Mill Dam at Westwood Mills, Lowestwood Lane, Linthwaite, Huddersfield

DESIGNATION: Listed Building grade II*, CA

CONDITION: Poor

OCCUPANCY: Vacant/not in use

PRIORITY CATEGORY: B (B)

OWNER TYPE: Commercial company

LIST ENTRY NUMBER: 1271264

Early C19 dam to mill pond with retaining wall and sluice gates at north to water wheel and at south to overflow. Other buildings on the site include the former scribbling, carding and fulling mill, office, warehouse and workshops. An application was submitted in 2020 for conversion of the mill to residential use with associated landscaping.

Contact: Richard Butterfield 01904 601995



© Historic England

SITE NAME: North Range at Westwood Mills, Lowestwood Lane, Linthwaite, Huddersfield

DESIGNATION: Listed Building grade II*, CA

CONDITION: Very bad

OCCUPANCY: Vacant/not in use

PRIORITY CATEGORY: B (B)

OWNER TYPE: Commercial company

LIST ENTRY NUMBER: 1216965

Warehouse and workshop range to early C19 mill complex. Buildings at the site include former scribbling, carding and fulling mill, office, warehouse, workshops, boiler and engine house. The roof and internal floor structure to the north range has collapsed. An application was submitted in 2020 for conversion of the mill complex to residential use.

Contact: Richard Butterfield 01904 601995



© Historic England

SITE NAME: Offices and workshop ranges at Westwood Mills, Lowestwood Lane, Linthwaite, Huddersfield

DESIGNATION: Listed Building grade II*, CA

CONDITION: Very bad

OCCUPANCY: Vacant/not in use

PRIORITY CATEGORY: B (B)

OWNER TYPE: Commercial company

LIST ENTRY NUMBER: 1217132

Early C19 office and workshop range to mill. Other buildings on the site include the former scribbling, carding and fulling mill, warehouse, boiler and engine houses. The roof structure has collapsed, along with sections of external masonry. An application was submitted in 2020 for conversion of the mill to residential use.

Contact: Richard Butterfield 01904 601995



© Historic England

SITE NAME: West Block at Westwood Mills, Lowestwood Lane, Linthwaite, Huddersfield

DESIGNATION: Listed Building grade II*, CA

CONDITION: Very bad

OCCUPANCY: Vacant/not in use

PRIORITY CATEGORY: B (B)

OWNER TYPE: Commercial company

LIST ENTRY NUMBER: 1216966

Early C19 scribbling, carding and fulling mill. Other buildings on the site include an office, warehouse, workshops, as well as engine and boiler houses. The roof and internal structure of the west block have collapsed, as have sections of external wall masonry. An application was submitted in 2020 for conversion of the mill to residential use.

Contact: Richard Butterfield 01904 601995

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
C Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
 Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site




© Historic England

SITE NAME:	Hopton Congregational Church, Calder Road, Mirfield
DESIGNATION:	Listed Building grade II*
CONDITION:	Fair
OCCUPANCY:	Part occupied/part in use
PRIORITY CATEGORY:	F (F)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	I134675

Former church with attached school buildings to rear, dated 1829. Largely unaltered and retaining box pews in the body of the church and original windows throughout. Water penetration has resulted in patches of timber decay and a failing roof truss. Planning Permission granted for enabling development subject to a Section 106 agreement over phasing of repair work to the church. Some repairs to roof already carried out. New owners have carried out repairs to windows and pews.

Contact: Bryan Davies 01904 601867

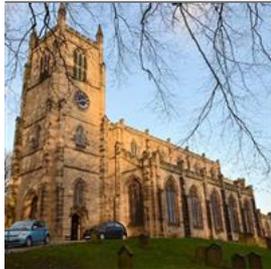

© Historic England

SITE NAME:	Christ Church, Church Lane, Batley and Liversedge
DESIGNATION:	Listed Place of Worship grade II
CONDITION:	Poor
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	I313710

Church of 1812 to 1816 by Thomas Taylor of Leeds. Gothic in style with west tower. Roofs are in poor repair. Repairs to tower completed with funding from National Lottery Heritage Fund and Historic England's former Repair Grant for Places of Worship scheme. A further phase of work to repair the north elevation is required.

Contact: Bryan Davies 01904 601867



© Historic England

SITE NAME:	Church of St Stephen, Lidget Street, Huddersfield
DESIGNATION:	Listed Place of Worship grade II
CONDITION:	Fair
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	I134994

Church of 1829 by John Oates of Halifax in Gothic style. Rainwater goods and drainage in poor condition. Repair works to the tower and south porch were carried out in 2015 with funding from the National Lottery Heritage Fund's former Grants for Places of Worship scheme. A further phase of repair is required to return the church to good condition.

Contact: Bryan Davies 01904 601867



© Historic England

SITE NAME:	Church of St Thomas, Manchester Road, Huddersfield
DESIGNATION:	Listed Place of Worship grade II*
CONDITION:	Fair
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	I134950

Church of 1857 to 1859 by Sir George Gilbert Scott. North and south roof slopes have now been successfully repaired with two phases of funding from the National Lottery Heritage Fund and Historic England. However, a further phase of repair is needed to return the tower to good condition. The congregation is planning to replace the failed heating system.

Contact: Bryan Davies 01904 601867



© Historic England

SITE NAME:	Church of St John, St John's Road, Huddersfield
DESIGNATION:	Listed Place of Worship grade II*, CA
CONDITION:	Fair
PRIORITY CATEGORY:	D (D)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	I217625

Victorian church by William Butterfield with tower and spire. Works to stabilise and repair the east end of the church and repair the roofs were carried out with grant-aid from the National Lottery Heritage Fund and Historic England. A Heritage Stimulus Fund grant, administered by Historic England, has recently supported repairs to the tower. A further phase of work to repair the west window is required.

Contact: Bryan Davies 01904 601867

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.
- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site



© Historic England

SITE NAME:	Church of St Mark, St Marks Road, Huddersfield
DESIGNATION:	Listed Place of Worship grade II
CONDITION:	Poor
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1217677

Parish church of 1877 to 1882 in the Decorated style with south west tower added in 1914. Roofs, rainwater goods and masonry are generally in poor condition, although repairs were undertaken in 2021 to the roof of the Lady Chapel.

Contact: Bryan Davies 01904 601867




© Historic England

SITE NAME:	Church of the Holy Trinity, Trinity Street, Huddersfield
DESIGNATION:	Listed Place of Worship grade II*, CA
CONDITION:	Fair
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1223128

Gothic style parish church of 1816 to 1819 by Leeds architect Thomas Taylor, built to serve the growing population housed in the middle class villas and terraces of the surrounding area. Roof defects are causing localised deterioration of internal finishes and decorations. Repairs to the south nave and south aisle roofs completed in 2017 with a grant from the National Lottery Heritage Fund's former Grants for Places of Worship scheme. A further phase of work is required to repair the remaining roofs. Some repairs have recently been undertaken to the tower.

Contact: Bryan Davies 01904 601867

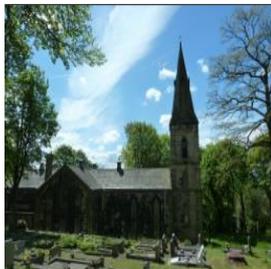

© Historic England

SITE NAME:	Christ Church, Woodhouse Hill, Huddersfield
DESIGNATION:	Listed Place of Worship grade II
CONDITION:	Poor
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1225622

Gothic Revival parish church of 1823 to 1824 by Leeds architect Thomas Taylor, built to accommodate the growing population of industrial Huddersfield. Widespread defects affecting weathering details, rainwater goods, masonry and windows. Structural movement in evidence to organ chamber, tower and spire. Repairs to the tower and spire and general masonry have been completed in 2018 with a National Lottery Heritage Fund Grant for Places of Worship. A further phase of work to repair the organ chamber is required.

Contact: Bryan Davies 01904 601867



© Historic England

SITE NAME:	Church of Emmanuel, Huddersfield Road, Kirkburton
DESIGNATION:	Listed Place of Worship grade II
CONDITION:	Poor
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1135365

Gothic Revival church dating to 1868 with arched, braced hammerbeam roof. Repair works to the nave and chancel ridges were carried out in 2016 with funding from the National Lottery Heritage Fund's former Grants for Places of Worship scheme. Issues with the tower masonry have also been identified and a future phase of repair is required to return the tower to good condition.

Contact: Bryan Davies 01904 601867



© Historic England

SITE NAME:	Church of St Thomas, Marsh Hall Lane, Kirkburton
DESIGNATION:	Listed Place of Worship grade II, CA
CONDITION:	Poor
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1135375

Gothic Revival church by James Mallinson and William Swinden Barber consecrated in 1870. The church comprises five-bay nave and two-bay chancel with organ chamber and vestry on north side and three-stage tower with spire on south side. The east window is in poor condition, held in place with temporary supports; roofs, rainwater goods and masonry also poor.

Contact: Bryan Davies 01904 601867

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.
- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

SITE NAME:	Emley Day Holes, 200 metres east of Churchill Farm, Denby Dale		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1017656
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985

SITE NAME:	Medieval ironstone pits south of Bentley Grange, Denby Dale		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1005786
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985

SITE NAME:	Crosland Lower Hall moated site, Meltham		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1013896
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Development requiring planning permission	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985

SITE NAME:	Birkby, Huddersfield		
DESIGNATION:	Conservation Area, 33 LBs	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	Deteriorating
VULNERABILITY:	High	CONTACT:	Sue Brooks (LPA) 01484 221000

SITE NAME:	Dewsbury		
DESIGNATION:	Conservation Area, 42 LBs	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	Improving
VULNERABILITY:	Medium	CONTACT:	Sue Brooks (LPA) 01484 221000

SITE NAME:	Huddersfield, Huddersfield		
DESIGNATION:	Conservation Area, 214 LBs	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	Improving
VULNERABILITY:	Medium	CONTACT:	Sue Brooks (LPA) 01484 221000

SITE NAME:	Station Road - Batley, Batley		
DESIGNATION:	Conservation Area, 19 LBs	NEW ENTRY?:	Yes
CONDITION:	Very bad	TREND:	Deteriorating
VULNERABILITY:	High	CONTACT:	Sue Brooks (LPA) 01484 221000

LEEDS



© Historic England

SITE NAME:	Calverley Old Hall, 14-24, Woodhall Road
DESIGNATION:	Listed Building grade I, CA
CONDITION:	Poor
OCCUPANCY:	Part occupied/part in use
PRIORITY CATEGORY:	F (F)
OWNER TYPE:	Charity (heritage)
LIST ENTRY NUMBER:	1265966

Medieval manor house with C15 Great Hall, solar wing and chapel, also later extensions and alterations. The unoccupied buildings are generally in poor condition and the timber-framed solar wing was of particular concern. A design team has worked up proposals for repair and conversion as holiday lets for the Landmark Trust. Listed Building Consent has been granted. Culture Recovery Fund and National Lottery Heritage Fund grants have been awarded. Work has started on site with the roof being the first item to be repaired reducing the risk of damage to the building.

Contact: Bryan Davies 01904 601867

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.
- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site



© Historic England

SITE NAME:	Little Temple, Temple Newsam Park
DESIGNATION:	Listed Building grade II*, RPG grade II
CONDITION:	Poor
OCCUPANCY:	N/A
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Local authority
LIST ENTRY NUMBER:	1255949

A garden eye-catcher and viewpoint built in the 1760s and probably designed by Lancelot 'Capability' Brown. Of sandstone and rendered brick under a stone-slate roof. A hybrid design, mixing classical temple form with gothic detailing. The temple is in poor condition, although a management plan commissioned for the landscape might help to secure the future of the temple. Recent scrub clearance and removal of self-set trees has made it more prominent in the landscape.

Contact: Giles Proctor 01904 601981



© Historic England

SITE NAME:	Rothwell Castle, Church Street (off)
DESIGNATION:	Scheduled Monument, CA
CONDITION:	Poor
OCCUPANCY:	N/A
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	1005792

Ruined chapel to medieval manor complex. C14. Masonry needs to be consolidated. The site is part of an active Local Heritage Initiative scheme to investigate its surroundings.

Contact: Nicky Brown 01904 601985



SITE NAME:	Stank Hall quasi-manorial site, Dewsbury Road
DESIGNATION:	Scheduled Monument and Listed Building grade II*, part in CA
CONDITION:	Very bad
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	A (A)
OWNER TYPE:	Local authority
LIST ENTRY NUMBER:	1002985 and 1375339

Remains of a major yeoman farm of sub-manorial type, with surviving barn of C15 of eight bays. Southern-most bays rebuilt in stone mid-C17. Roof slates missing. Temporary roof now put in place.

Contact: Nicky Brown 01904 601985



© Historic England

SITE NAME:	Temple Works gate lodge, Marshall Street
DESIGNATION:	Listed Building grade II*, CA
CONDITION:	Poor
OCCUPANCY:	N/A
PRIORITY CATEGORY:	F (D)
OWNER TYPE:	Commercial company
LIST ENTRY NUMBER:	1375166

Small derelict gate lodge to the flax mill of 1836 to 1840. Designed with advice from Joseph Bonomi, in the Egyptian style. The walls are largely stable, but it lacks a roof and the cornice has been damaged by rusting cramps. The lodge has been cleared of fallen material and the cornice stones have been supported as part of a scheme of repair. It is intended that the British Library will occupy the site.

Contact: Giles Proctor 01904 601981



© Historic England

SITE NAME:	Thorpe Hall, Middleton Lane
DESIGNATION:	Listed Building grade II*
CONDITION:	Very bad
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	A (A)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	1135039

Former farmhouse, 1735. Unitary Development Plan proposes employment land use allocation (offices). Some windows broken and gutters failed. Ceiling collapsed in one room. Roof holed.

Contact: Nicky Brown 01904 601985

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.
- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site



© Historic England

SITE NAME:	Temple Mill, Marshall Street, Holbeck
DESIGNATION:	Listed Building grade I, CA
CONDITION:	Very bad
OCCUPANCY:	Part occupied/part in use
PRIORITY CATEGORY:	F (F)
OWNER TYPE:	Commercial company
LIST ENTRY NUMBER:	1375162

One of the great monuments of the Industrial Revolution, built for James Garth Marshall. Designed by James Coombe and built between 1836 and 40, Joseph Bonomi advised on the design of the Egyptian facade. It fronts a brick-vaulted spinning mill with circular roof lights. Failure of a tie bar has caused the collapse of two front bays. Repairs to the Counting House are being undertaken with Historic England grant. Proposals for the full repair of the buildings are under development. It is intended that the building will be used by the British Library.

Contact: Giles Proctor 01904 601981



© Historic England

SITE NAME:	Gazebo north of Clumpcliffe Farmhouse, Methley Lane, Methley
DESIGNATION:	Listed Building grade II*
CONDITION:	Very bad
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	B (B)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	1135669

Hunting lodge dated 1708 on rainwater heads. Total collapse of the front elevation. Temporary cover on the flanking roofs has failed. Discussions are underway with new owners regarding future use of the buildings.

Contact: Nicky Brown 01904 601985



© Historic England Archive

SITE NAME:	St Mary's Convent Church (Mount Saint Mary), Church Road, Richmond Hill
DESIGNATION:	Listed Building grade II*
CONDITION:	Poor
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	D (D)
OWNER TYPE:	Commercial company
LIST ENTRY NUMBER:	1255558

Former Roman Catholic Church, 1852, by Joseph Hansom. Chancel and transepts by EW Pugin, 1866. Gothic style. Presbytery roof slates are partly missing, the windows are boarded and broken and the interior of the church has been stripped. Surveyed following concern by the Council for public safety. Holding works have been undertaken. Housing development has received consent.

Contact: Nicky Brown 01904 601985



© Historic England Archive

SITE NAME:	Memorial to Queen Victoria, Woodhouse Lane, Woodhouse Moor
DESIGNATION:	Listed Building grade II*, CA
CONDITION:	Poor
OCCUPANCY:	N/A
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Local authority
LIST ENTRY NUMBER:	1255642

1903 by Sir George Frampton, formerly located in front of the Town Hall. Portland stone base flanked by bronzes of 'Peace' and 'Industry', supporting an enthroned bronze statue of Queen Victoria. The figure of Industry is severely damaged and now in store. The remaining bronzes are corroding. A local group is hoping to support the first phase of repair.

Contact: Nicky Brown 01904 601985



© Historic England

SITE NAME:	Bramham Biggin, Bramham cum Oglethorpe
DESIGNATION:	Listed Building grade II*
CONDITION:	Poor
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	1135632

C17 manor house with alterations in 1750-56 by James Paine. Built of magnesian limestone ashlar under a stone slate roof. The house has been vacant for some years and is in poor condition. Potential for reuse has been discussed.

Contact: Giles Proctor 01904 601981

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.
- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site



© Historic England

SITE NAME:	Church of St John the Evangelist, Leeds Road
DESIGNATION:	Listed Place of Worship grade II*, RPG grade II, CA
CONDITION:	Poor
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1135676

Landmark church of 1829 with soaring spire in the Early English style designed by Rickman and Hutchinson. Damage to nave and chancel roofs caused extensive internal damage to historic fabric and finishes. Aisle roofs also in poor condition. A first phase of work to repair high-level roofs was completed in 2017 with funding from National Lottery Heritage Fund's former Grants for Places of Worship scheme. Further phases of repair are required to return the church to good condition.

Contact: Bryan Davies 01904 601867



© Historic England

SITE NAME:	Church of St Wilfrid, Selby Road
DESIGNATION:	Listed Place of Worship grade II*
CONDITION:	Fair
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1256092

Modern 1930s Expressionist church by Randall Wells. The roofs were renewed with funding from National Lottery Heritage Fund and Historic England's former Repair Grants for Places of Worship scheme, but the timber tower and spire are in poor condition and are allowing water to penetrate the fabric of the church. There are further problems with the detailing of some of the rainwater outlets. Historic England has advised on repairs.

Contact: Giles Proctor 01904 601981




© Diocese of Leeds

SITE NAME:	Church of St Agnes, Stoney Rock Lane
DESIGNATION:	Listed Place of Worship grade II
CONDITION:	Poor
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1255970

1886-7 by Kelly & Birchall. Nave and chancel under an unbroken roof, with aisles, of rock-faced sandstone with a Westmorland slate roof. The reredos is of Burmantofts Faience, as is a monument to James Holroyd, the founder of the pottery. Both have sadly been painted over. The church is in poor condition, the slates slipping and with extensive water ingress against the gable walls. As a result, the interior is cold and damp and there are areas of falling plaster. The heating system has failed.

Contact: Giles Proctor 01904 601981

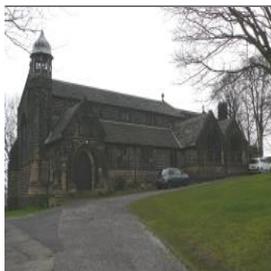

© Historic England

SITE NAME:	Church of St Andrew, Haw Lane, Yeadon and Guiseley
DESIGNATION:	Listed Place of Worship grade II, CA
CONDITION:	Poor
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1313171

Church by Thomas and Francis Healey dating to 1890 to 1891 in the Arts and Crafts Perpendicular style. Distinctive octagonal bell turret with wooden traceried bellcote and ogival cap. Chancel and vestry roofs, bellcote, rainwater goods and glazing repaired with grant offered under National Lottery Heritage Fund and Historic England's former Repair Grants for Places of Worship scheme. A further phase of work is required to repair the nave, south aisle and transept roofs.

Contact: Bryan Davies 01904 601867

SITE NAME:	Cairn west of Craven Hall Hill	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER: 1010355
CONDITION:	Generally unsatisfactory with major localised problems	TREND: Declining
PRINCIPAL VULNERABILITY:	Digging	NEW ENTRY?: No
OWNER TYPE:	Private	CONTACT: Nicky Brown 01904 601985

SITE NAME:	Medieval farmstead in Ireland Wood, 150 metres north east of Cookridge Hospital	
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER: 1018553
CONDITION:	Generally unsatisfactory with major localised problems	TREND: Declining
PRINCIPAL VULNERABILITY:	Vehicle damage/erosion - extensive	NEW ENTRY?: No
OWNER TYPE:	Charity (non-heritage)	CONTACT: Nicky Brown 01904 601985

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
C Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
 Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

SITE NAME:	Stone hut circle settlement in Clayton Wood on the south west side of Iveson Drive		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1018814
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Visitor erosion - extensive	NEW ENTRY?:	No
OWNER TYPE:	Local authority	CONTACT:	Nicky Brown 01904 601985

SITE NAME:	Stone hut circle settlement in Iveson Wood		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1018815
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Visitor erosion - extensive	NEW ENTRY?:	No
OWNER TYPE:	Local authority	CONTACT:	Nicky Brown 01904 601985

SITE NAME:	Howley Hall: a 16th century country house and gardens, Morley		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1016323
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985



© Historic England

SITE NAME:	Oulton Hall
DESIGNATION:	Registered Park and Garden grade II, 2 LBs, part in CA
CONDITION:	Generally satisfactory but with significant localised problems
VULNERABILITY:	Medium
TREND:	Stable
NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners
LIST ENTRY NUMBER:	1000413

Park and pleasure grounds laid out in 1809 to 1810 in part to designs by Humphry Repton, with mid-C19 additions by WA Nesfield. Chequered C20 history and now split as a hotel and golf course. The De Vere hotel group restored the main building. The garden layout survives in part but the golf course and new development predominate.

Contact: Giles Proctor 01904 601981



© Historic England

SITE NAME:	High Royds Hospital, Aireborough, Menston
DESIGNATION:	Registered Park and Garden grade II, LB grade II
CONDITION:	Extensive significant problems
VULNERABILITY:	High
TREND:	Declining
NEW ENTRY?:	No
OWNER TYPE:	Mixed, multiple owners
LIST ENTRY NUMBER:	1001469

The grounds of an echelon-style psychiatric hospital, opened in 1888, including airing courts, sports grounds, woodland and parkland. The hospital is under conversion to residential use including extensive new build within the grounds. The historic landscape is now significantly compromised and peripheral areas neglected.

Contact: Bryan Davies 01904 601867

SITE NAME:	Buslingthorpe, Leeds		
DESIGNATION:	Conservation Area, 4 LBs	NEW ENTRY?:	No
CONDITION:	Poor	TREND:	Deteriorating
VULNERABILITY:	High	CONTACT:	Phil Ward (LPA) 0113 37 87625

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.
- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

SITE NAME:	Headingley Hill, Hyde Park and Woodhouse Moor, Leeds		
DESIGNATION:	Conservation Area, 82 LBs	NEW ENTRY?:	No
CONDITION:	Poor	TREND:	Deteriorating
VULNERABILITY:	Low	CONTACT:	Phil Ward (LPA) 0113 37 87625

SITE NAME:	Holbeck, Leeds		
DESIGNATION:	Conservation Area, 21 LBs	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	No significant change
VULNERABILITY:	Medium	CONTACT:	Phil Ward (LPA) 0113 37 87625

SITE NAME:	Stank Hall, Leeds		
DESIGNATION:	Conservation Area, 3 LBs, part in SM	NEW ENTRY?:	No
CONDITION:	Very bad	TREND:	Deteriorating
VULNERABILITY:	Low	CONTACT:	Phil Ward (LPA) 0113 37 87625

SITE NAME:	The Grand Quarter		
DESIGNATION:	Conservation Area, 7 LBs	NEW ENTRY?:	No
CONDITION:	Poor	TREND:	No significant change
VULNERABILITY:	High	CONTACT:	Phil Ward (LPA) 0113 37 87625

LEEDS / NORTH YORKSHIRE COUNCIL (UA)

SITE NAME:	Linear earthwork, part of the Aberford Dyke system, extending 770 metres east from Humphrey Dale Cottage, Stutton with Hazlewood / Aberford		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1016953
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985

SITE NAME:	Settlement site revealed by aerial photography near Moat House, Wighill / Walton		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1003801
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985

WAKEFIELD



SITE NAME:	Lupset Hall, Horbury Road
DESIGNATION:	Listed Building grade II*
CONDITION:	Very bad
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	1258152

Small country house, built 1716. Well composed elevations to west, south and east, of brick with stone dressings. Modern extensions to the north. The surrounding parkland became a municipal golf course in the C20, and the hall was the clubhouse until 2013. The condition of the building is very poor, with many of the windows smashed and damage to the roof. The interiors are deteriorating. There are plans to convert the building into flats.

Contact: Giles Proctor 01904 601981

© Historic England

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.
- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site




© Historic England

SITE NAME:	Crown Court House, Wood Street
DESIGNATION:	Listed Building grade II*, CA
CONDITION:	Fair
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	D (F)
OWNER TYPE:	Local authority
LIST ENTRY NUMBER:	1258996

Built in 1810 in the neo-Greek style with extensions of 1849 to 1850. Two storeys, sandstone ashlar with banded rustication to all walls. Four columned Doric portico and one-storey side wings. The building has been bought by Wakefield Council and repairs to the shell of the building are complete. The interior remains in poor repair. It is proposed to use the building as a cultural hub, with a mix of leisure, food and drink, workspace and community uses.

Contact: Giles Proctor 01904 601981

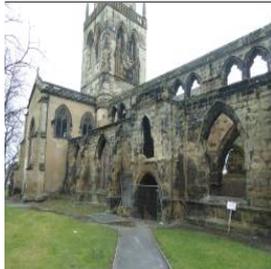


© Historic England

SITE NAME:	Church of All Saints, South Baileygate
DESIGNATION:	Listed Place of Worship grade II*, CA
CONDITION:	Very bad
OCCUPANCY:	N/A
PRIORITY CATEGORY:	A (A)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1313269

This entry refers only to the ruinous portion of the church as the main worship space is in good condition. This C14 and C15 century church was severely damaged under siege during the Civil War. The ruined aisled nave is in very poor condition with signs warning of the danger of falling masonry.

Contact: Nicky Brown 01904 601985

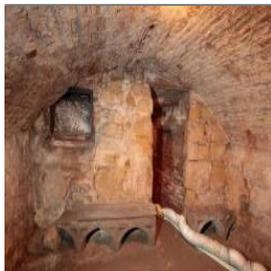

© Historic England

SITE NAME:	The Hermitage, Southgate, Pontefract
DESIGNATION:	Listed Building grade I
CONDITION:	Poor
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	F (F)
OWNER TYPE:	Health authority
LIST ENTRY NUMBER:	1135427

The Hermitage consists of two below ground chambers hewn out of sandstone. The deeper chamber dates from 1386 and consists of a short corridor which leads to a spiral stair which descends to a well. The second chamber, known as the Oratory, is later and consists of a spiral stair which leads to a cell with altar and fireplace. At risk due to flooding. Following completion of a Hydrological Survey a solution to flooding has been identified and negotiations with the owner are progressing.

Contact: Nicky Brown 01904 601985



© Historic England

SITE NAME:	Bridge and medieval gateway at Walton Hall, Walton
DESIGNATION:	Scheduled Monument, 2 LBs
CONDITION:	Poor
OCCUPANCY:	N/A
PRIORITY CATEGORY:	C (New entry)
OWNER TYPE:	Commercial company
LIST ENTRY NUMBER:	1005791

Water gate, said to be medieval. Roughly-dressed well-coursed masonry largely overgrown by ivy. Central segmental archway with inner recess for doors leads to flight of 7 stone steps. Flanking turrets, from one of which it is said Oliver Cromwell fired the first swivel-cannon gun in England. The whole is surmounted by large carved wooden crucifix. The arch is in poor condition and a heavy growth of ivy conceals much of the structure from view. The bridge, which forms part of the Scheduling, is not at risk.

Contact: Giles Proctor 01904 601981



© Historic England

SITE NAME:	Dame Mary Bolle's water tower including water wheel housing and overflow channel, Heath Common, Warmfield cum Heath
DESIGNATION:	Listed Building grade II*
CONDITION:	Poor
OCCUPANCY:	Vacant/not in use
PRIORITY CATEGORY:	C (C)
OWNER TYPE:	Private
LIST ENTRY NUMBER:	1200499

Dating to C17, this five-stage, square water tower was originally associated with the now demolished Heath Old Hall. Some high-level repairs were carried out in 1980s but low-level masonry and interior are in poor condition.

Contact: Nicky Brown 01904 601985

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
B Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
C Slow decay; no solution agreed.

- D** Slow decay; solution agreed but not yet implemented.
E Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).

- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
 Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site



© Historic England

SITE NAME:	Church of St John, Jackson Lane, Darrington	Rock-faced magnesian limestone church dating to 1878 in C12 northern French style to designs of Sir Arthur Blomfield. Roofs, masonry and windows are in poor condition.
DESIGNATION:	Listed Place of Worship grade II, CA	
CONDITION:	Poor	
PRIORITY CATEGORY:	C (C)	
OWNER TYPE:	Religious organisation	
LIST ENTRY NUMBER:	1135502	Contact: Bryan Davies 01904 601867

SITE NAME:	Earthwork west of Ferrybridge, Knottingley		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1005789
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Arable ploughing	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985

SITE NAME:	Newland Preceptory, Normanton / Newland with Woodhouse Moor		
DESIGNATION:	Scheduled Monument, 2 LBs	LIST ENTRY NUMBER:	1012153
CONDITION:	Extensive significant problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Scrub/tree growth	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985

SITE NAME:	Sharlston Common coal and ironstone workings, Sharlston		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1018399
CONDITION:	Generally satisfactory but with significant localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Vehicle damage/erosion - moderate	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985

SITE NAME:	Site of post-medieval tannery, Felkirk, South Hiendley		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1005775
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Vandalism	NEW ENTRY?:	No
OWNER TYPE:	Private	CONTACT:	Nicky Brown 01904 601985

SITE NAME:	Prehistoric enclosed settlement known as South Kirkby Camp, South Kirkby and Moorthorpe		
DESIGNATION:	Scheduled Monument	LIST ENTRY NUMBER:	1018818
CONDITION:	Generally unsatisfactory with major localised problems	TREND:	Declining
PRINCIPAL VULNERABILITY:	Plant growth	NEW ENTRY?:	No
OWNER TYPE:	Local authority	CONTACT:	Nicky Brown 01904 601985

SITE NAME:	Whitwood		
DESIGNATION:	Conservation Area, 3 LBs	NEW ENTRY?:	No
CONDITION:	Poor	TREND:	Deteriorating
VULNERABILITY:	Medium	CONTACT:	Wakefield Council Planning Department (LPA) 03458 506506

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.
- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

YORK (UA)



© Historic England

SITE NAME:	Kexby Old Bridge, Old Bridge Street, Catton / Kexby
DESIGNATION:	Listed Building grade II*, SM
CONDITION:	Poor
OCCUPANCY:	N/A
PRIORITY CATEGORY:	D (F)
OWNER TYPE:	Local authority, multiple owners
LIST ENTRY NUMBER:	1316288

Bridge, built in 1650 for Sir Roger Tresuer, with later additions and alterations. Ashlar and red brick. Three rounded triple-chamfered arches, with pointed cutwaters with sloped tops between. The bridge was damaged by flooding in December 2015 and requires extensive structural repairs. Steel bracing has been introduced to support the damaged arch and a scheme for full repair is planned.

Contact: Giles Proctor 01904 601981



© Historic England

SITE NAME:	Church of St Thomas, Lowther Street, York
DESIGNATION:	Listed Place of Worship grade II
CONDITION:	Fair
PRIORITY CATEGORY:	F (D)
OWNER TYPE:	Religious organisation
LIST ENTRY NUMBER:	1257401

Victorian church with severe erosion to the stonework of the transept gables and also at low level. Recent repairs have been carried out to the west gable and nave walls. Further repairs are planned.

Contact: Giles Proctor 01904 601981

PRIORITY CATEGORIES

- A** Immediate risk of further rapid deterioration or loss of fabric; no solution agreed.
- B** Immediate risk of further rapid deterioration or loss of fabric; solution agreed but not yet implemented.
- C** Slow decay; no solution agreed.
- D** Slow decay; solution agreed but not yet implemented.
- E** Under repair or in fair to good repair, but no user identified; or under threat of vacancy with no obvious new user (applicable only to buildings capable of beneficial use).
- F** Repair scheme in progress and (where applicable) end use or user identified; or functionally redundant buildings with new use agreed but not yet implemented.

NOTE
Last year's priority category is shown in brackets (otherwise, New Entry is noted).

ABBREVIATIONS

CA	Conservation Area
LB	Listed Building
LPA	Local Planning Authority
NP	National Park
RPG	Registered Park and Garden
SM	Scheduled Monument
UA	Unitary Authority
WHS	World Heritage Site

This document is one in a series of regional registers produced as part of Historic England's national **Heritage at Risk** programme.

The registers for other regions and previous **Heritage at Risk** publications can be found at historicengland.org.uk/advice/heritage-at-risk/registers-and-publications/

More information about Historic England's **Heritage at Risk** programme can be found at historicengland.org.uk/advice/heritage-at-risk/

Heritage at Risk

Published November 2023

4th Floor, Cannon Bridge House

25 Dowgate Hill

London EC4R 2YA

© Copyright Historic England 2023

Product code: HE0083



Historic England

**North East & Yorkshire
Register 2023**